


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Passfield Park School (5563)
Region : South Western Sydney
State Electorate : Macquarie Fields
Local Government Area : Campbelltown

Initial Survey : Noel Arnold & Associates : 16 - May - 2008
Reviewed By : AECOM : 26 - May - 2015

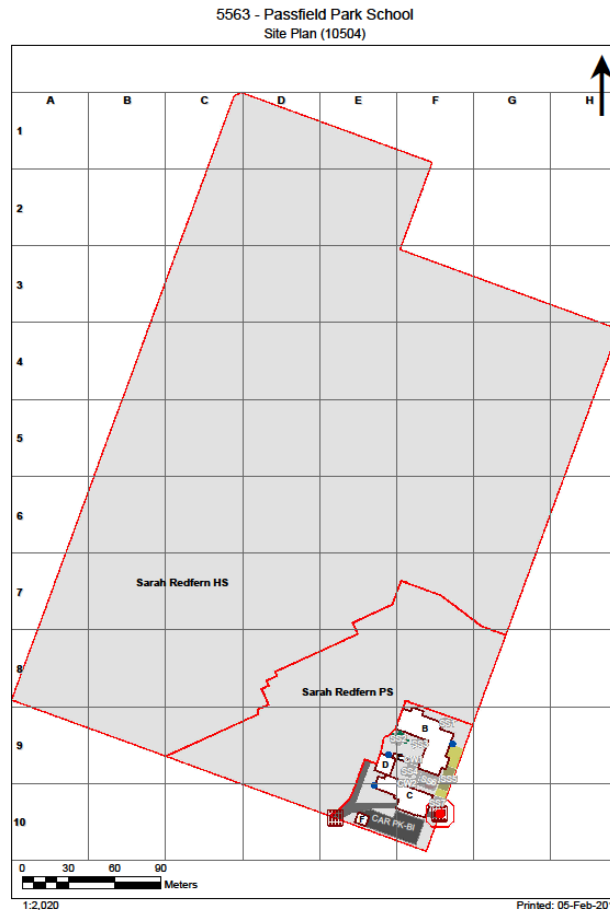

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Support Unit/Administration - 1981 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00B - R0001 - Staff Toilet**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5563/B00D/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5563/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00B - R0002 - Staff Toilet

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5563/B00D/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5563/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00B - R0003 - Duplicating Workroom

Floor Coverings Res/Textile	Vinyl Tiles					
	5563/B00C/R0006/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00B - R0004 - Principal

No Asbestos

B00B - R0005 - Clerical Office

No Asbestos

B00B - R0006 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	5563/B00C/R0006/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00B - R0007 - Staff Room

No Asbestos

B00B - R0008 - Staff Kitchen

Floor Coverings Res/Textile	Vinyl Tiles					
	5563/B00C/R0006/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00B - R0009 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	5563/B00C/R0006/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00B - R0010 - General Storeroom

No Asbestos

B00B - R0011 - Plant

Floor Coverings Res/Textile	Vinyl Tiles					
	5563/B00C/R0006/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00B - R0012 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles					
	5563/B00C/R0006/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00B - R0013 - External Movement

No Asbestos

B00B - R0014 - Outdoor Learning Area

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
B00B - R0015 - External Movement						
No Asbestos						
B00B - R0016 - Staff Room Annexe						
No Asbestos						
B00B - R0017 - Home Base - E						
No Asbestos						
B00B - R0018 - Practical Activities - E						
Floor Coverings Res/Textile	Vinyl Tiles					
	5563/B00C/R0006/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00B - R0019 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles					
	5563/B00C/R0006/Floor Coverings Res/Textile/S2					No Asbestos Detected
B00B - R0020 - Toilet - E						
No Asbestos						
B00B - R0021 - Distribution Board						
						Note: No inspection of live electrical installation.
No Asbestos						
B00B - R0022 - Home Base - E						
No Asbestos						
B00B - R0023 - Staff Room Annexe						
No Asbestos						
B00B - R0024 - Plant						
No Asbestos						
B00B - R0025 - Movement						
No Asbestos						
B00B - R0026 - Entry Vestibule						
No Asbestos						
B00B - R0027 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5563/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
B00B - R0028 - Movement						
No Asbestos						
B00B - R0029 - Interview						
No Asbestos						
B00B - R0030 - Distribution Board						
						Note: No inspection of live electrical installation.
No Asbestos						
B00B - R0031 - Deputy Principal						
No Asbestos						
B00B - R0032 - Stairs						
No Asbestos						
B00B - R0033 - Disabled Shower/Toilet						
Recently Modified Space	Requires Inspection					
B00B - R0034 - Toilets-Unisex						
Recently Modified Space	Requires Inspection					
B00B - R1001 - Staff Toilet						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	5563/B00D/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)
B00B - R1002 - Staff Toilet						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5563/B00D/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
B00B - R1003 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles					
5563/B00C/R0006/Floor Coverings Res/Textile/S2					No Asbestos Detected	
B00B - R1004 - Clerical Office/Workroom						
No Asbestos						
B00B - R1005 - Teachers Aide Special Ed						
No Asbestos						
B00B - R1006 - Interview						
No Asbestos						
B00B - R1007 - Home Base - M						
No Asbestos						
B00B - R1008 - Practical Activities - M - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles					
5563/B00C/R0006/Floor Coverings Res/Textile/S2					No Asbestos Detected	
B00B - R1009 - Withdrawal - M						
No Asbestos						
B00B - R1010 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles					
5563/B00C/R0006/Floor Coverings Res/Textile/S2					No Asbestos Detected	
B00B - R1011 - Plant						
No Asbestos						
B00B - R1012 - Home Base - M						
No Asbestos						
B00B - R1013 - Staff Room Annexe						
No Asbestos						
B00B - R1014 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	126m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5563/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00B - R1015 - General Storeroom						
No Asbestos						
B00B - R1016 - Home Base - S						
No Asbestos						
B00B - R1017 - Practical Activities - S - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles					
5563/B00C/R0006/Floor Coverings Res/Textile/S2					No Asbestos Detected	
B00B - R1018 - Home Base Store - S						
Floor Coverings Res/Textile	Vinyl Tiles					
5563/B00C/R0006/Floor Coverings Res/Textile/S2					No Asbestos Detected	
B00B - R1019 - Cleaning Distributed Store						
Floor Coverings Res/Textile	Vinyl Tiles					
5563/B00C/R0006/Floor Coverings Res/Textile/S2					No Asbestos Detected	
B00B - R1020 - Home Base - S						
No Asbestos						
B00B - R1021 - Teachers Aide Special Ed						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1024 - Distribution Board				Note: No inspection of live electrical installation.		
No Asbestos						
B00B - R1026 - Stairs						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5563/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	
B00B - R1027 - Home Base						
No Asbestos						
B00B - R1028 - Movement						
No Asbestos						
B00B - R1029 - Disabled Toilet						
Recently Modified Space	Requires Inspection					
B00B - R1030 - Disabled Toilet						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Technological & Applied Studies - 1981 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00C - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	125m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5563/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00C - R0002 - Covered Vehicle Area/Porte Cochere

Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5563/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00C - R0003 - General Storeroom

No Asbestos

B00C - R0004 - Materials Technology L.S.

No Asbestos

B00C - R0005 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00C - R0009 - Practical Activities - M - 1hb

No Asbestos

B00C - R0010 - Other

No Asbestos

B00C - R0011 - Laundry - S

Wall Linings Internal	Flat AC Sheeting				
5563/B00C/R0011/Wall Linings Internal/S4					No Asbestos Detected

B00C - R0012 - Toilet - M

No Asbestos

B00C - R0013 - Other

No Asbestos

B00C - R0014 - Movement

No Asbestos

B00C - R0015 - Covered Vehicle Area/Porte Cochere

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1981 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B00D - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5563/B00C/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)	

B00D - R0002 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5563/B00D/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	

B00D - R0003 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5563/B00D/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	

B00D - R0004 - Disabled Toilet

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5563/B00D/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	

B00D - R0005 - Disabled Toilet

Partition Walls (Cubicles)	Compressed AC Sheet	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
5563/B00D/R0002/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	

B00D - R0006 - General Storeroom

No Asbestos

B00D - R0007 - Cleaning Supplies

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Building Services - 1981 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00E - R0001 - Cleaning Supplies

No Asbestos

B00E - R1001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-----	------	--------------------	---------	--------------------

5563/B00C/R0001/Ceiling Structures/Linings/S1

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Other - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Other

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017