


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Plattsburg Public School (7308)
Region : Hunter/Central Coast
State Electorate : Wallsend
Local Government Area : Newcastle

Initial Survey : Noel Arnold & Associates : 29 - Apr - 2008
Reviewed By : AECOM : 25 - Jun - 2015

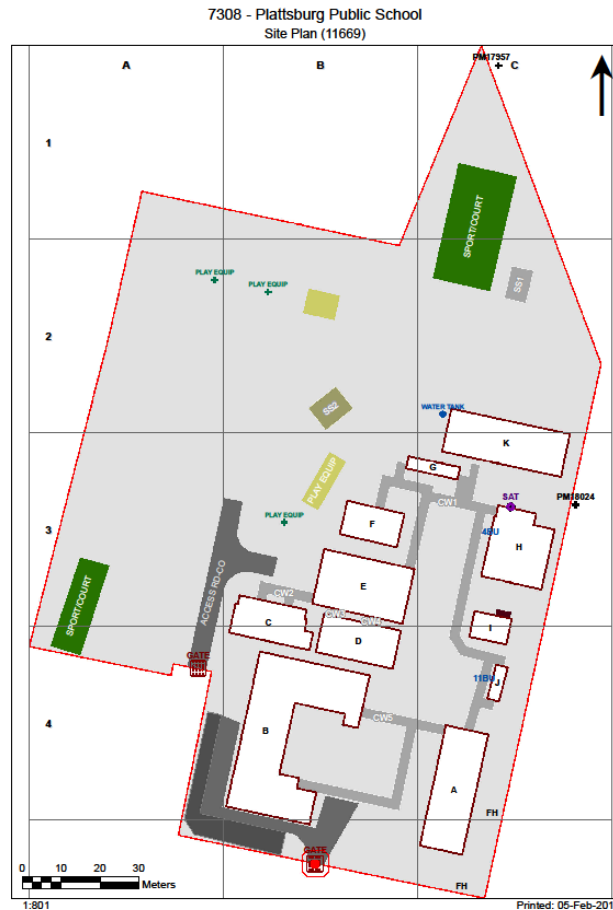

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Staff Facilities - 1995 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00A - R0001 - Movement

No Asbestos

B00A - R0002 - Entry Vestibule

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0003 - Clerical Office

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0004 - Sick Bay

No Asbestos

B00A - R0005 - Sick Bay - Shower/Toilet

No Asbestos

B00A - R0006 - Interview

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0007 - Staff Room Annexe

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0008 - Staff Room Annexe

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0009 - Movement

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0010 - Staff Room Annexe

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0011 - Staff Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0012 - Cleaning Distributed Store

No Asbestos

B00A - R0013 - Staff Toilet

No Asbestos

B00A - R0014 - Staff Toilet

No Asbestos

B00A - R0015 - Staff Toilet

No Asbestos

B00A - R0016 - Security Store

No Asbestos

B00A - R0017 - Principal

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0018 - Duplicating Workroom

No Asbestos

B00A - R0019 - Main Switch Board

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - Communal Facilities/General Learning - 1884 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00B/R0002/Wall Linings Internal/S6				Chrysotile (white asbestos)	
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible no manhole located.					
Underfloor Voids	Non Accessible Area - Area inaccessible no void hatch located.					

Interior

B00B - R0001 - Home Base

No Asbestos

B00B - R0002 - Movement

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00B/R0002/Wall Linings Internal/S6				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00B/R0002/Wall Linings Internal/S6				Chrysotile (white asbestos)	

B00B - R0003 - Withdrawal Space - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	10.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00B/R0002/Wall Linings Internal/S6				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00B/R0002/Wall Linings Internal/S6				Chrysotile (white asbestos)	

B00B - R0004 - Movement

No Asbestos

B00B - R0005 - Movement

No Asbestos

B00B - R0008 - Movement

No Asbestos

B00B - R0010 - Home Base

No Asbestos

B00B - R0011 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00F/R0003/Ceiling Structures/Linings/S2				Chrysotile (white asbestos)	

B00B - R0012 - Staff Room Annexe

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00B/R0002/Wall Linings Internal/S6				Chrysotile (white asbestos)	
Window panel used to replace bbroken window	Flat AC Sheeting 7308/B00B/R0012/Window panel used to replace bbroken window/S7				No Asbestos Detected	

B00B - R0013 - Home Base

No Asbestos

B00B - R0014 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00B/R0002/Wall Linings Internal/S6				Chrysotile (white asbestos)	

B00B - R0015 - Movement

No Asbestos

B00B - R0016 - Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00B - R0017 - Movement

No Asbestos

B00B - R0018 - Raised Platform

No Asbestos

B00B - R0019 - Communal Space

No Asbestos

B00B - R0020 - Home Base/Practical Activities

No Asbestos

B00B - R0021 - Home Base/Practical Activities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1955 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00C/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	Non Accessible Area - Area inaccessible no manhole located.					
Underfloor Voids	No Asbestos Found					

Interior

B00C - R0001 - Garden Store

No Asbestos

B00C - R0002 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00C/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00C - R0003 - Home Base

No Asbestos

B00C - R0004 - Home Base

No Asbestos

B00C - R0005 - General Storeroom

No Asbestos

B00C - R0006 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1912 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00C/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	Non Accessible Area - Area inaccessible no manhole located.					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Withdrawal Space - 1hb

No Asbestos

B00D - R0002 - General Storeroom

No Asbestos

B00D - R0005 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00C/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00D - R0006 - Home Base

Wall Linings Internal	Flat AC Sheeting	75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00C/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00C/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00D - R0007 - Home Base

Wall Linings Internal	Flat AC Sheeting	75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00C/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00C/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

B00D - R0008 - Disabled Toilet

No Asbestos

B00D - R0009 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities/Administration - 2007 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	Non Accessible Area - Area inaccessible no manhole located.
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible no void hatch found.

Interior

B00E - R0001 - Movement

No Asbestos

B00E - R0002 - Canteen

No Asbestos

B00E - R0003 - Canteen Office/Store

No Asbestos

B00E - R0004 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0005 - Sports Store

No Asbestos

B00E - R0006 - Kiln Room

No Asbestos

B00E - R0007 - Disabled Toilet

No Asbestos

B00E - R0008 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1912 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00C/R0002/Ceiling Structures/Linings/S8			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	Non Accessible Area - Height Restriction Area inaccessible manhole is located in FR0004.					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting					
	7308/B00F/Underfloor Voids - Packing to Floor Joists/S11			No Asbestos Detected		

Interior

B00F - R0001 - General Storeroom

No Asbestos

B00F - R0002 - General Storeroom

No Asbestos

B00F - R0003 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00F/R0003/Ceiling Structures/Linings/S2			Chrysotile (white asbestos)		

B00F - R0004 - Home Base

Wall Linings Internal	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00F/R0004/Wall Linings Internal/S3			Chrysotile (white asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1955 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00B/R0002/Wall Linings Internal/S6					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible no void hatcch found.					

Interior

B00G - R0001 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00B/R0002/Wall Linings Internal/S6					Chrysotile (white asbestos)

B00G - R0002 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00B/R0002/Wall Linings Internal/S6					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Library/General Learning - 1928 - Brick/Block (Brick/Block)

Exterior

Gable Verge Lining	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00H/R0002/Ceiling Structures/Linings/S9			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	Non Accessible Area - Height Restriction manhole located in HR1003.					
Underfloor Voids	AC Fragments/Debris	3m2	East	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	7308/B00H/R0002/Ceiling Structures/Linings/S9			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

Interior

B00H - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00H/R0002/Ceiling Structures/Linings/S9			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00H - R0002 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	7308/B00H/R0002/Floor Coverings Res/Textile/S1					
Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00H/R0002/Ceiling Structures/Linings/S9			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00H - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00H/R0002/Ceiling Structures/Linings/S9			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00H - R0004 - Staff Toilet

No Asbestos

B00H - R0005 - Home Base

Chalk Board	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00H/R0005/Chalk Board/S10			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00H - R0006 - Practical Activities - 1hb

No Asbestos

B00H - R0007 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	55m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00H/R0002/Ceiling Structures/Linings/S9			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00H - R0008 - Movement

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	7308/B00H/R0002/Floor Coverings Res/Textile/S1					
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00H/R0002/Ceiling Structures/Linings/S9			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00H - R0009 - Special Programs Room

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B00H/R0002/Ceiling Structures/Linings/S9			Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

B00H - R0010 - Personal Effects Storage

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7308/B00C/R0002/Ceiling Structures/Linings/S8				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00H - R0011 - Stairs						
No Asbestos						
B00H - R1001 - Reading Area						
Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7308/B00H/R0002/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00H - R1002 - Library Office/Workroom						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7308/B00H/R0002/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00H - R1003 - Library Office/Workroom						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7308/B00H/R0002/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00H - R1004 - K.L.A. Store						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7308/B00H/R0002/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00H - R1005 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	3.66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7308/B00H/R0002/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00H - R1006 - Reading Area						
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7308/B00H/R0002/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00H - R1007 - Special Programs Room						
Ceiling Structures/Linings	Flat AC Sheeting	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7308/B00H/R0002/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00H - R1008 - Security Store						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
7308/B00H/R0002/Floor Coverings Res/Textile/S1						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7308/B00H/R0002/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00H - R1009 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7308/B00H/R0002/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		
B00H - R1010 - Movement						
No Asbestos						
B00H - R1011 - Movement						
No Asbestos						
B00H - R1012 - Stairs						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	12.52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
7308/B00H/R0002/Ceiling Structures/Linings/S9				Chrysotile (white asbestos) , Crocidolite (blue asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Other-Community Use - 1940 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B001/R0001/Wall Linings Internal/S5					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior

B001 - R0001 - Other-Community Use

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	7308/B001/R0001/Floor Coverings Res/Textile/S4					
Wall Linings Internal	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B001/R0001/Wall Linings Internal/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B001/R0001/Wall Linings Internal/S5					Chrysotile (white asbestos)

B001 - R0002 - Other-Community Use

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	7308/B001/R0001/Floor Coverings Res/Textile/S4					
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B001/R0001/Wall Linings Internal/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B001/R0001/Wall Linings Internal/S5					Chrysotile (white asbestos)

B001 - R0003 - Other-Community Use

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	7308/B001/R0001/Floor Coverings Res/Textile/S4					
Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B001/R0001/Wall Linings Internal/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B001/R0001/Wall Linings Internal/S5					Chrysotile (white asbestos)

B001 - R0004 - Other-Community Use

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1955 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B001/R0001/Wall Linings Internal/S5					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible no manhole located.					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior

B00J - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B001/R0001/Wall Linings Internal/S5					Chrysotile (white asbestos)

B00J - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	7308/B001/R0001/Wall Linings Internal/S5					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00K - Library - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

No Asbestos

Interior

B00K - R0001 - External Movement

No Asbestos

B00K - R0002 - Special Programs Room

No Asbestos

B00K - R0003 - Special Programs Store

No Asbestos

B00K - R0004 - General Storeroom

No Asbestos

B00K - R0005 - Toilet - Lobby

No Asbestos

B00K - R0006 - Staff Toilet

No Asbestos

B00K - R0007 - Cleaning Distributed Store

No Asbestos

B00K - R0008 - Main Switch Board

No Asbestos

B00K - R0009 - Reading Area

No Asbestos

B00K - R0010 - K.L.A. Store

No Asbestos

B00K - R0011 - Communications Room

No Asbestos

B00K - R0012 - Library Office/Workroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

7308_ASB_221112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017