


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Paddington Public School (7432)
Region : Sydney
State Electorate : Sydney
Local Government Area : Sydney

Initial Survey : Noel Arnold & Associates : 10 - Mar - 2008
Reviewed By : AECOM : 26 - May - 2015

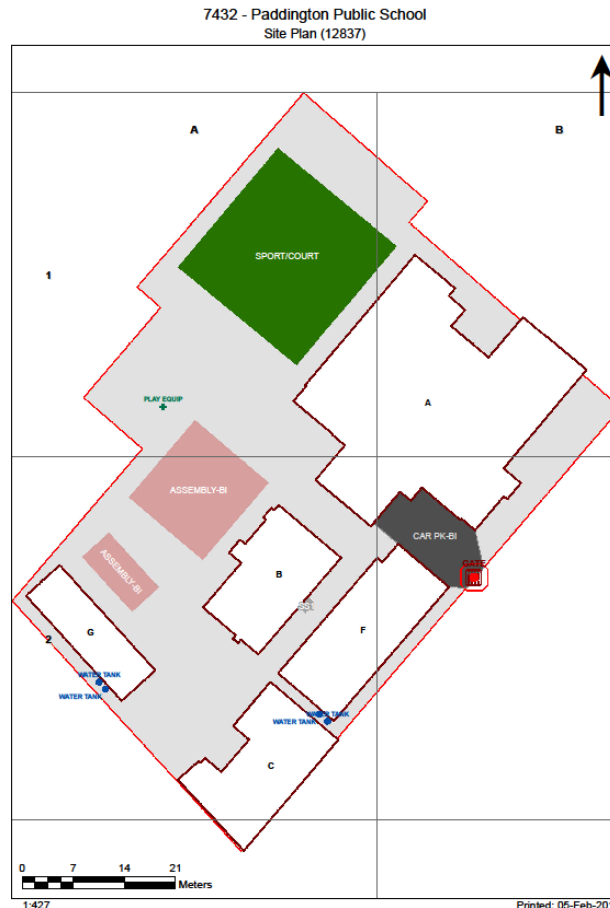

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1869 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 7432/B00A/Eaves Linings/S7					No Asbestos Detected
Gable Ends	Flat AC Sheeting 7432/B00A/Eaves Linings/S7					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00A - R0001 - Deputy Principal

No Asbestos

B00A - R0002 - Movement

No Asbestos

B00A - R0003 - Movement

No Asbestos

B00A - R0004 - Home Base

No Asbestos

B00A - R0005 - Practical Activities - 1hb

No Asbestos

B00A - R0006 - Movement

No Asbestos

B00A - R0007 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 7432/B00B/R0007/Floor Coverings Res/Textile/S2	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	--------------	--------------------	---------	--

B00A - R0008 - Staff Room Annexe

No Asbestos

B00A - R0009 - Cleaning Distributed Store

No Asbestos

B00A - R0010 - Duplicating Workroom

No Asbestos

B00A - R0011 - Staff Room Annexe

No Asbestos

B00A - R0012 - Movement

No Asbestos

B00A - R0013 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting 7432/B00A/R1007/Ceiling Structures/Linings/S5	2m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting 7432/B00A/R1009/Wall Linings Internal/S3	5m2	North facing, West facing	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0014 - Principal

No Asbestos

B00A - R0015 - Movement

No Asbestos

B00A - R0016 - Sick Bay

No Asbestos

B00A - R0017 - Clerical Office

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0018 - Entry Vestibule						
No Asbestos						
B00A - R0019 - Movement						
No Asbestos						
B00A - R0020 - Staff Toilet						
No Asbestos						
B00A - R0021 - Staff Toilet						
No Asbestos						
B00A - R0022 - Staff Room						
No Asbestos						
B00A - R0023 - Movement						
No Asbestos						
B00A - R0024 - Home Base						
No Asbestos						
B00A - R0025 - Movement						
No Asbestos						
B00A - R0026 - General Storeroom						
No Asbestos						
B00A - R0027 - Practical Activities - 1hb						
No Asbestos						
B00A - R0028 - Home Base						
No Asbestos						
B00A - R0029 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7432/B00B/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
B00A - R1001 - Home Base						
No Asbestos						
B00A - R1002 - Practical Activities - 1hb						
No Asbestos						
B00A - R1003 - Staff Room Annexe						
No Asbestos						
B00A - R1004 - Practical Activities - 1hb						
No Asbestos						
B00A - R1005 - Home Base						
No Asbestos						
B00A - R1006 - Movement						
No Asbestos						
B00A - R1007 - Distribution Board						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
7432/B00A/R1007/Ceiling Structures/Linings/S5					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	5m2	North facing, East facing	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
7432/B00A/R1009/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R1008 - Movement						
No Asbestos						
B00A - R1009 - Movement						
Wall Linings Internal	Flat AC Sheeting	2m2	North facing, South facing	Some Damage / Unsealed (3)	Medium (2)	Low Priority (2-3)
7432/B00A/R1009/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	6m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
7432/B00A/R1009/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

- B00A - R1010 - Reading Area**
No Asbestos
- B00A - R1011 - Seminar/Study**
No Asbestos
- B00A - R1012 - Kiln Room**
No Asbestos
- B00A - R1013 - Home Base**
No Asbestos
- B00A - R1014 - Practical Activities - 1hb**
No Asbestos
- B00A - R1015 - Movement**
No Asbestos
- B00A - R1016 - Movement**
No Asbestos
- B00A - R1017 - Cleaning Distributed Store**
No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1907 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible - due to storage.

Interior

B00B - R0001 - Home Base

No Asbestos

B00B - R0002 - Movement

No Asbestos

B00B - R0003 - Home Base

No Asbestos

B00B - R0004 - Main Switch Board

No Asbestos

B00B - R0005 - Cleaning Distributed Store

No Asbestos

B00B - R0006 - Movement

No Asbestos

B00B - R0007 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7432/B00B/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00B - R0008 - Toilets - Boys/Girls

Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
7432/B00B/R0007/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	

B00B - R1001 - Home Base

No Asbestos

B00B - R1002 - Practical Activities - 1hb

No Asbestos

B00B - R1003 - Home Base

No Asbestos

B00B - R1004 - Movement

No Asbestos

B00B - R1005 - Practical Activities - 1hb

No Asbestos

B00B - R1006 - Toilets - Boys/Girls

No Asbestos

B00B - R1007 - Withdrawal Space - 1hb

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Multi Purpose Facilities - 1922 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Non Accessible Area - Area inaccessible - due to storage.

Interior

B00C - R0001 - Communal Space

No Asbestos

B00C - R0002 - Raised Platform

No Asbestos

B00C - R0003 - Movement

No Asbestos

B00C - R0004 - General Storeroom

No Asbestos

B00C - R0005 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	4m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
7432/B00C/R0005/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	

B00C - R0006 - Sports Store

Floor Coverings Res/Textile	Resinous Membrane					
7432/B00C/R0006/Floor Coverings Res/Textile/S8					No Asbestos Detected	

B00C - R0007 - Movement

No Asbestos

B00C - R0008 - Movement

No Asbestos

B00C - R0009 - Movement

No Asbestos

B00C - R0010 - General Storeroom

No Asbestos

B00C - R1001 - Home Base

No Asbestos

B00C - R1002 - Practical Activities - 1hb

No Asbestos

B00C - R1003 - Home Base

No Asbestos

B00C - R1004 - Withdrawal Space - 2hb

No Asbestos

B00C - R1005 - Movement

No Asbestos

B00C - R1006 - Movement

No Asbestos

B00C - R1007 - Movement

No Asbestos

B00C - R2001 - Home Base

No Asbestos

B00C - R2002 - Practical Activities - 1hb

No Asbestos

B00C - R2003 - Home Base

No Asbestos

B00C - R2004 - Darkroom Space

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00C - R2005 - Movement

No Asbestos

B00C - R2006 - Movement

No Asbestos

B00C - R2007 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Home Base

No Asbestos

B00F - R0002 - Home Base Store

No Asbestos

B00F - R0003 - Practical Activities - 1hb

No Asbestos

B00F - R0004 - Withdrawal Space - 2hb

No Asbestos

B00F - R0005 - Home Base

No Asbestos

B00F - R0006 - Home Base Store

No Asbestos

B00F - R0007 - Practical Activities - 1hb

No Asbestos

B00F - R0008 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00G - R0001 - Toilets - Boys/Disabled Cubicle**

No Asbestos

B00G - R0002 - Cleaning Distributed Store

No Asbestos

B00G - R0003 - Garden Store

No Asbestos

B00G - R0004 - General Assistant/Bulk Store

No Asbestos

B00G - R0005 - Sports Store

No Asbestos

B00G - R0006 - Toilets - Girls/Disabled Cubicle

No Asbestos

B00G - R0007 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017