


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Punchbowl Boys High School (8184)
Region : South Western Sydney
State Electorate : Lakemba
Local Government Area : Bankstown

Initial Survey : Noel Arnold & Associates : 04 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 26 - Feb - 2015

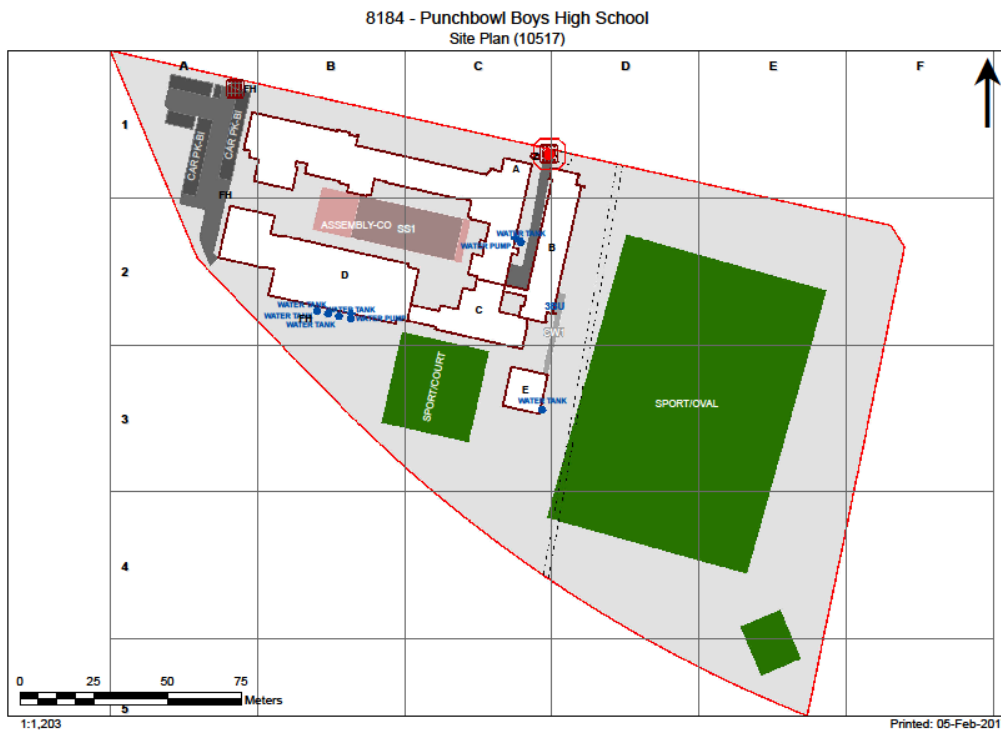

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1950 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids	Fibre Cement sheeting Debris	<1m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	8184/B00A/Underfloor Voids/S15					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	368m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00A/Eaves Linings/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					

Interior

B00A - R0002 - General Storeroom (7.76 m2)

No Asbestos

B00A - R0003 - General Storeroom (3.16 m2)

No Asbestos

B00A - R0004 - General Storeroom (2.71 m2)

No Asbestos

B00A - R0005 - General Storeroom (2.8 m2)

No Asbestos

B00A - R0006 - External Movement (1.89 m2)

No Asbestos

B00A - R0007 - External Movement (1.87 m2)

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00A/R0007/Ceiling Structures/Linings/S23					Chrysotile (white asbestos) , Amosite (brown asbestos)

Moulded Edging Strip	Flat AC Sheeting	2m	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00A/R0007/Moulded Edging Strip/S24					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0008 - General Storeroom (56.67 m2)

No Asbestos

B00A - R0009 - Plant (11.68 m2)

No Asbestos

B00A - R0010 - General Storeroom (3.44 m2)

No Asbestos

B00A - R0011 - Cleaning Supplies Store (19.3 m2)

No Asbestos

B00A - R0012 - Toilets-Boys (119.94 m2)

No Asbestos

B00A - R0013 - Stairs (7.7 m2)

No Asbestos

B00A - R1001 - Chair Store (2.94 m2)

No Asbestos

B00A - R1002 - General Storeroom (11.09 m2)

No Asbestos

B00A - R1003 - General Learning Space (49.19 m2)

Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00A/R1021/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00A - R1004 - General Learning Space (49.26 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R1021/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00A - R1005 - General Learning Space (49.4 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R1021/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00A - R1006 - General Learning Space (49.33 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R1021/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00A - R1009 - Public Reception (39.59 m2)						
No Asbestos						
B00A - R1010 - Administration - Executive (12.53 m2)						
No Asbestos						
B00A - R1011 - Deputy Principal Office (16.96 m2)						
No Asbestos						
B00A - R1012 - Principal Office (18.19 m2)						
No Asbestos						
B00A - R1013 - Staff - Toilet (3.19 m2)						
No Asbestos						
B00A - R1014 - Staff - Toilet (4.69 m2)						
No Asbestos						
B00A - R1015 - Deputy Principal Office (11.34 m2)						
No Asbestos						
B00A - R1016 - Deputy Principal Office (12.58 m2)						
No Asbestos						
B00A - R1017 - Resources Store (7.72 m2)						
No Asbestos						
B00A - R1018 - Interview/Meeting (52.52 m2)						
No Asbestos						
B00A - R1019 - General Storeroom (15.88 m2)						
No Asbestos						
B00A - R1020 - Laboratory L.S. (89.3 m2)						
No Asbestos						
B00A - R1021 - Staff Kitchen (17.7 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R1021/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00A - R1022 - General Storeroom (5.39 m2)						
No Asbestos						
B00A - R1023 - Cleaning Store - Distributed (0.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R1023/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	
B00A - R1024 - Cleaning Store - Distributed (0.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R1023/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	
B00A - R1025 - Distribution Board Cupboard (0.85 m2)						
No Asbestos						
B00A - R1026 - Leading Teacher (8.49 m2)						
No Asbestos						

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00A - R1027 - General Storeroom (3.02 m2)						
No Asbestos						
B00A - R1029 - Movement (10.74 m2)						
No Asbestos						
B00A - R1031 - Movement (11.32 m2)						
No Asbestos						
B00A - R1036 - Cleaning Store - Distributed (0.58 m2)						
No Asbestos						
B00A - R1037 - Distribution Board Cupboard (0.47 m2)						Note: No inspection of live electrical installation.
No Asbestos						
B00A - R1038 - Staff - Toilet (7.92 m2)						
No Asbestos						
B00A - R1039 - Staff - Toilet (5.78 m2)						
No Asbestos						
B00A - R1040 - Staff Kitchen (9.07 m2)						
No Asbestos						
B00A - R1041 - General Storeroom (1.87 m2)						
No Asbestos						
B00A - R1042 - Sport Equipment Store (8.95 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R1042/Ceiling Structures/Linings/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00A - R1043 - General Storeroom (1 m2)						
No Asbestos						
B00A - R1044 - Chair Store (18.19 m2)						
No Asbestos						
B00A - R1046 - Control Room (0.88 m2)						
No Asbestos						
B00A - R1047 - Stage (64.89 m2)						
No Asbestos						
B00A - R1048 - Distribution Board Cupboard (0.86 m2)						Note: No inspection of live electrical installation.
No Asbestos						
B00A - R1050 - General Storeroom (2.1 m2)						
No Asbestos						
B00A - R1054 - Fitness Laboratory (14.01 m2)						
No Asbestos						
B00A - R1057 - External Movement (2.77 m2)						
No Asbestos						
B00A - R1058 - Movement (55.11 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R1021/Floor Coverings Res/Textile/S6				Chrysotile (white asbestos)		
B00A - R1059 - External Movement (7.76 m2)						
No Asbestos						
B00A - R1060 - External Movement (5.49 m2)						
No Asbestos						
B00A - R1061 - Stairs (2.05 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R1062 - Stairs (2.06 m2)						
No Asbestos						
B00A - R1065 - Stairs (9.53 m2)						
No Asbestos						
B00A - R1066 - Stairs (7.34 m2)						
No Asbestos						
B00A - R1067 - Stairs (13.52 m2)						
No Asbestos						
B00A - R1068 - Handwashing Facilities (1.06 m2)						
No Asbestos						
B00A - R1069 - Commonroom (40.1 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8184/B00A/R1071/Floor Coverings Res/Textile/S75	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8184/B00A/R1071/Floor Coverings Res/Textile/S75	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8184/B00A/R1071/Floor Coverings Res/Textile/S75	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1070 - Staff Kitchen (8.73 m2)						
No Asbestos						
B00A - R1071 - Administration - Clerical (43.26 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8184/B00A/R1071/Floor Coverings Res/Textile/S75	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8184/B00A/R1071/Floor Coverings Res/Textile/S75	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8184/B00A/R1071/Floor Coverings Res/Textile/S75	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1072 - Student Waiting (5.51 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8184/B00A/R1071/Floor Coverings Res/Textile/S75	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8184/B00A/R1071/Floor Coverings Res/Textile/S75	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8184/B00A/R1071/Floor Coverings Res/Textile/S75	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8184/B00A/R1071/Floor Coverings Res/Textile/S75	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00A - R1073 - External Movement (5.52 m2)						
No Asbestos						
B00A - R1074 - External Movement (5.65 m2)						
No Asbestos						
B00A - R1075 - External Movement (8.76 m2)						
No Asbestos						
B00A - R1076 - Movement (166.67 m2)						
No Asbestos						
B00A - R1077 - Fitness Laboratory (58.87 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
B00A - R1078 - Fitness Laboratory (7.38 m2)						
No Asbestos						
B00A - R1079 - Toilets-Boys (1.31 m2)						
No Asbestos						
B00A - R1080 - Fitness Laboratory (7.42 m2)						
No Asbestos						
B00A - R1081 - Toilets-Boys (1.34 m2)						
No Asbestos						
B00A - R1082 - Movement (25.75 m2)						
No Asbestos						
B00A - R1083 - Multi-Purpose Space (274.3 m2)						
No Asbestos						
B00A - R1084 - Movement (5.32 m2)						
No Asbestos						
B00A - R2001 - General Learning Space (49.27 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R2010/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R2002 - General Learning Space (49.21 m2)						
No Asbestos						
B00A - R2003 - General Learning Space (49.14 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R2010/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R2004 - General Learning Space (49.28 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R2010/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R2005 - Computer Learning Space (49.11 m2)						
No Asbestos						
B00A - R2006 - Computer Learning Space (49.17 m2)						
No Asbestos						
B00A - R2007 - Printing/Photocopying (19.59 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R2010/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R2008 - Resources Store (15.18 m2)						
No Asbestos						
B00A - R2009 - Staff Study (36.24 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R2010/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R2010 - Interview/Office - Type 1 (21.85 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R2010/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R2011 - Staff - Toilet (8.91 m2)						
No Asbestos						
B00A - R2012 - Staff - Toilet (4.3 m2)						
No Asbestos						
B00A - R2013 - Cleaning Store - Distributed (1.95 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R2014 - Movement (2.16 m2)						
No Asbestos						
B00A - R2015 - General Learning Space (52.64 m2)						
No Asbestos						
B00A - R2016 - Laboratory L.S. (89.57 m2)						
No Asbestos						
B00A - R2017 - General Storeroom (15.74 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R2017/Floor Coverings Res/Textile/S10					Chrysotile (white asbestos)	
B00A - R2018 - Seminar (18.02 m2)						
No Asbestos						
B00A - R2019 - Staff Study (8.52 m2)						
No Asbestos						
B00A - R2020 - Distribution Board Cupboard (0.83 m2)						
				Note: No inspection of live electrical installation.		
Pipe	Fibre Cement Pipe	2m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R2020/Pipe/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R2021 - Dark Room (10.33 m2)						
No Asbestos						
B00A - R2022 - Movement (11.62 m2)						
No Asbestos						
B00A - R2024 - Movement (11.02 m2)						
No Asbestos						
B00A - R2025 - Stairs (12.21 m2)						
No Asbestos						
B00A - R2026 - Stairs (12.34 m2)						
No Asbestos						
B00A - R2027 - Handwashing Facilities (1.05 m2)						
No Asbestos						
B00A - R2028 - Handwashing Facilities (1.07 m2)						
No Asbestos						
B00A - R2029 - Movement (190.88 m2)						
No Asbestos						
B00A - R3001 - Interview/Office - Type 1 (10.91 m2)						
No Asbestos						
B00A - R3002 - Resources Store (10.2 m2)						
No Asbestos						
B00A - R3004 - Resources Store (13.58 m2)						
No Asbestos						
B00A - R3005 - Seminar (31.81 m2)						
No Asbestos						
B00A - R3006 - Careers Advisers Office (16.67 m2)						
No Asbestos						
B00A - R3007 - General Learning Space (49.41 m2)						
No Asbestos						
B00A - R3008 - General Learning Space (49.49 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R2010/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
B00A - R3009 - General Learning Space (49.27 m2)						
No Asbestos						
B00A - R3010 - Staff Study (49.26 m2)						
No Asbestos						
B00A - R3013 - Audio Visual Workroom (19.85 m2)						
No Asbestos						
B00A - R3014 - Cleaning Store - Distributed (1.41 m2)						
No Asbestos						
B00A - R3015 - Seminar (24.19 m2)						
No Asbestos						
B00A - R3016 - Staff - Toilet (9.1 m2)						
No Asbestos						
B00A - R3017 - Librarian (11.12 m2)						
No Asbestos						
B00A - R3020 - Distribution Board Cupboard (0.77 m2)						
				Note: No inspection of live electrical installation.		
Pipe	Fibre Cement Pipe	3m	East	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00A/R2020/Pipe/S9					Chrysotile (white asbestos) , Amosite (brown asbestos)	
B00A - R3021 - Movement (10.69 m2)						
No Asbestos						
B00A - R3022 - Movement (107.66 m2)						
No Asbestos						
B00A - R3023 - Movement (10.8 m2)						
No Asbestos						
B00A - R3024 - Stairs (12.35 m2)						
No Asbestos						
B00A - R3025 - Stairs (12.54 m2)						
No Asbestos						
B00A - R3026 - Library Administration (43.08 m2)						
No Asbestos						
B00A - R3027 - Tea Room (6.72 m2)						
No Asbestos						
B00A - R3028 - Seminar (32.19 m2)						
No Asbestos						
B00A - R3029 - Seminar (29.42 m2)						
No Asbestos						
B00A - R3030 - Main Area (281.18 m2)						
No Asbestos						
B00A - R3031 - Store (9.94 m2)						
No Asbestos						
B00A - R3032 - Movement (6.97 m2)						
No Asbestos						
B00A - R3033 - Staff Study (28.02 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
8184/B00A/R3033/Floor Coverings Res/Textile/S74					No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)		8184/B00A/R3033/Floor Coverings Res/Textile/S70			No Asbestos Detected
-----------------------------	---	--	---	--	--	-----------------------------

B00A - R3034 - Tea Room (3.06 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Physical Education/Music/Art - 1963 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	>1m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	8184/B00B/Underfloor Voids - Packing to Floor Joists/S18			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Eaves Linings	Flat AC Sheeting	120m2	East and West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/Eaves Linings/S16			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Infill panels under windows (all levels)	Flat AC Sheeting	120m2	North and South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/Infill panels under windows (all levels)/S17			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					

Interior

B00B - R0001 - General Assistants (104.77 m2)

No Asbestos

B00B - R0002 - Sport Equipment Store (33.15 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/R0002/Partition Walls (Cubicles)/S11			Chrysotile (white asbestos)		

B00B - R0004 - Movement (34.97 m2)

No Asbestos

B00B - R0005 - Staff - Toilet (1.5 m2)

No Asbestos

B00B - R0006 - General Assistants (14.04 m2)

No Asbestos

B00B - R0007 - Main Switchroom (8.68 m2)

No Asbestos

B00B - R0008 - Other-Community Use (9.1 m2)

No Asbestos

B00B - R0009 - Sport Equipment Store (5.8 m2)

No Asbestos

B00B - R0010 - Movement (5.99 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3			Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00B - R0011 - External Movement (3.45 m2)

No Asbestos

B00B - R0012 - Stairs (11.55 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3			Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00B - R0013 - Staff Study (49.3 m2)

No Asbestos

B00B - R0014 - Sport Equipment Store (13.92 m2)

No Asbestos

B00B - R0015 - External Movement (16.42 m2)

No Asbestos

B00B - R1001 - Music Store (8.91 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Decorative Coating	Vermiculite 8184/B00B/R1001/Decorative Coating/S26					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1002 - Cleaning Store - Distributed (3.35 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1003 - General Learning Space (66.33 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Window Sill	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00B - R1004 - General Storeroom (8.95 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8184/B00B/R1004/Floor Coverings Res/Textile/S28	9m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Decorative Coating	Vermiculite 8184/B00B/R1004/Decorative Coating/S27					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1005 - Laboratory L.S. (85.85 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Window Sill	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Fume Cupboard	No Asbestos Found					
Fume Cupboard	No Asbestos Found					
Fume Cupboard	No Asbestos Found					
B00B - R1006 - Staff Study (39.14 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Window Sill	Compressed AC Sheet	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Fume Cupboard	No Asbestos Found					
Fume Cupboard	No Asbestos Found					
Fume Cupboard	No Asbestos Found					
Fume Cupboard	No Asbestos Found					
Fume Cupboard	No Asbestos Found					
Fume Cupboard	No Asbestos Found					
B00B - R1007 - Laboratory L.S. (85.66 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Window Sill	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Fume Cupboard	No Asbestos Found					
Fume Cupboard	No Asbestos Found					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Fume Cupboard	No Asbestos Found					
B00B - R1008 - General Storeroom (18.71 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/R1011/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
B00B - R1009 - Staff - Toilet (6.97 m2)						
Decorative Coating	Vermiculite					Limited Samples Taken
	8184/B00B/R1009/Decorative Coating/S29					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00B - R1010 - Movement (109.37 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Window Sill	Compressed AC Sheet	5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/R1010/Window Sill/S4					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	50m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/R1011/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
B00B - R1011 - Movement (15.45 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/R1011/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
B00B - R1012 - Stairs (17.46 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00B - R1013 - Stairs (7.33 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00B - R1014 - External Movement (3.43 m2)						
No Asbestos						
B00B - R2002 - Resources Store (10.11 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00B - R2004 - Art Learning Space (59.59 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00B - R2005 - Resources Store (5.85 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					
B00B - R2006 - Cleaning Store - Distributed (6.45 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3					
	<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R2007 - Seminar (25.81 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Thermacon Heater	Encapsulated Insulation material within unit <i>Assumed Asbestos</i>	2Unit	South	Minimal Damage (2)	Medium (2)	Medium Priority (4-5) <i>Assumed Asbestos</i>
B00B - R2008 - Independent Learning Space (25.17 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R2010 - General Learning Space (52.8 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Window Sill	Compressed AC Sheet 8184/B00B/R1010/Window Sill/S4	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00B - R2011 - Movement (109.05 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Window Sill	Compressed AC Sheet 8184/B00B/R1010/Window Sill/S4	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Floor Coverings Res/Textile	Vinyl Tiles 8184/B00B/R1011/Floor Coverings Res/Textile/S5	111m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00B - R2012 - Movement (13.54 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8184/B00B/R1011/Floor Coverings Res/Textile/S5	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
B00B - R2013 - Stairs (17.57 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R2014 - Stairs (16.68 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R2015 - Art Learning Space (62.92 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R2015/Ceiling Structures/Linings/S72					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Ceiling Structures/Linings	Vermiculite 8184/B00B/R2015/Ceiling Structures/Linings/S76					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R2016 - Kiln Space (11.6 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R2015/Ceiling Structures/Linings/S76					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8184/B00B/R2015/Ceiling Structures/Linings/S76					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R2017 - Staff Study (50.1 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8184/B00B/R2017/Floor Coverings Res/Textile/S69	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8184/B00B/R2015/Ceiling Structures/Linings/S76					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Ceiling Structures/Linings	Vermiculite 8184/B00B/R2015/Ceiling Structures/Linings/S76					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R2018 - Tea Room (2.32 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R2015/Ceiling Structures/Linings/S76					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Ceiling Structures/Linings	Vermiculite 8184/B00B/R2015/Ceiling Structures/Linings/S76					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R3001 - Music Learning Space (66.34 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8184/B00B/R1011/Floor Coverings Res/Textile/S5	25m2	Room Centre	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Window Sill	Compressed AC Sheet 8184/B00B/R1010/Window Sill/S4	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R3002 - Music Store (9.21 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8184/B00B/R1011/Floor Coverings Res/Textile/S5	10m2	Room Centre	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Window Sill	Compressed AC Sheet 8184/B00B/R1010/Window Sill/S4	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R3003 - Music Learning Space (59.15 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8184/B00B/R1011/Floor Coverings Res/Textile/S5	50m2	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Window Sill	Compressed AC Sheet 8184/B00B/R1010/Window Sill/S4	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R3004 - Cleaning Store - Distributed (2.92 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00B/R0010/Ceiling Structures/Linings/S3					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Window Sill	Compressed AC Sheet	NA	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/R1010/Window Sill/S4					Chrysotile (white asbestos)
B00B - R3005 - General Learning Space (52.51 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/R1011/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Window Sill	Compressed AC Sheet	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/R1010/Window Sill/S4					Chrysotile (white asbestos)
B00B - R3006 - General Learning Space (52.5 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/R1011/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Window Sill	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/R1010/Window Sill/S4					Chrysotile (white asbestos)
B00B - R3007 - Staff Study (52.43 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Window Sill	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/R1010/Window Sill/S4					Chrysotile (white asbestos)
B00B - R3008 - General Storeroom (14.26 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/R1011/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Thermacon Heater	Encapsulated Insulation material within unit	2Unit	Variable positions	Friable Asbestos (5)	Medium (2)	High Priority (6-8)
	Assumed Asbestos					Assumed Asbestos
B00B - R3009 - Staff - Toilet (4.73 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Incinerette	Encapsulated Insulation material within unit	1Unit	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					Assumed Asbestos
B00B - R3010 - Movement (109.52 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00B/R0010/Ceiling Structures/Linings/S3					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Window Sill	Compressed AC Sheet	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/R1010/Window Sill/S4					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	112m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00B/R1011/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - R3011 - Movement (13.51 m2)

Ceiling Structures/Linings Vermiculite
 8184/B00B/R0010/Ceiling Structures/Linings/S3 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R3012 - Stairs (16.97 m2)

Ceiling Structures/Linings Vermiculite
 8184/B00B/R0010/Ceiling Structures/Linings/S3 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R3013 - Stairs (16.84 m2)

Ceiling Structures/Linings Vermiculite
 8184/B00B/R0010/Ceiling Structures/Linings/S3 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities/Science Learning/General Learning - 1968 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	5m2	North and South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00C/Eaves Linings/S19					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00C - R0001 - Cleaning Store - Distributed (5.09 m2)

Ceiling Structures/Linings	Vermiculite					
	8184/B00C/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0002 - Cleaning Supplies Store (10.76 m2)

Ceiling Structures/Linings	Vermiculite					
	8184/B00C/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0003 - Movement (9.32 m2)

Ceiling Structures/Linings	Vermiculite					
	8184/B00C/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0004 - Sport Equipment Store (14.73 m2)

Floor Coverings Res/Textile	Vinyl Tiles	7m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00C/R1008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)

B00C - R0005 - Sport Equipment Store (18.87 m2)

No Asbestos

B00C - R0006 - Student Canteen (52.48 m2)

Ceiling Structures/Linings	Vermiculite					
	8184/B00C/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0007 - Office/Store (4.75 m2)

No Asbestos

B00C - R0008 - Staff - Toilet (3.48 m2)

Ceiling Structures/Linings	Vermiculite					
	8184/B00C/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00C/R0008/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)

B00C - R0009 - Covered Area (262.45 m2)

No Asbestos

B00C - R0010 - Stairs (0.39 m2)

Ceiling Structures/Linings	Vermiculite					
	8184/B00C/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R0011 - External Movement (20.25 m2)

Recently Modified Space Requires Inspection

B00C - R0012 - External Movement (35.56 m2)

Recently Modified Space Requires Inspection

B00C - R1001 - Laboratory L.S. (89.22 m2)

Ceiling Structures/Linings	Vermiculite					
	8184/B00C/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R1004 - Laboratory L.S. (88.98 m2)						
Ceiling Structures/Linings	Vermiculite					
	8184/B00C/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1005 - Resources Store (25.25 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00C/R1008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00C - R1006 - Chemical Store (24.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00C/R1008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00C - R1007 - Distribution Board Cupboard (0.39 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00C - R1008 - Movement (78.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	8184/B00C/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00C/R1008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00C - R1009 - Movement (11.17 m2)						
Ceiling Structures/Linings	Vermiculite					
	8184/B00C/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00C/R1008/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)
B00C - R1010 - Stairs (16.14 m2)						
Ceiling Structures/Linings	Vermiculite					
	8184/B00C/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R1011 - Preparation - Science (38.42 m2)						
Recently Modified Space	Requires Inspection					
B00C - R2001 - General Learning Space (55.43 m2)						
Ceiling Structures/Linings	Vermiculite					
	8184/B00C/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	Variable positions	Friable Asbestos (5)	Medium (2)	High Priority (6-8)
						Assumed Asbestos
B00C - R2002 - General Learning Space (52.8 m2)						
Ceiling Structures/Linings	Vermiculite					
	8184/B00C/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R2003 - General Learning Space (52.72 m2)						
Ceiling Structures/Linings	Vermiculite					
	8184/B00C/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R2004 - General Learning Space (55.58 m2)						
Ceiling Structures/Linings	Vermiculite					
	8184/B00C/R0003/Ceiling Structures/Linings/S1					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos	2Unit	Variable positions	Friable Asbestos (5)	Medium (2)	High Priority (6-8) Assumed Asbestos
B00C - R2005 - Archive Store (17.53 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00C/R0003/Ceiling Structures/Linings/S1 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					Limited Samples Taken
Thermacon Heater	Encapsulated Insulation material within unit Assumed Asbestos	2Unit	Variable positions	Friable Asbestos (5)	Medium (2)	High Priority (6-8) Assumed Asbestos
B00C - R2006 - Archive Store (7.41 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00C/R0003/Ceiling Structures/Linings/S1 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					Limited Samples Taken
B00C - R2007 - Distribution Board Cupboard (0.34 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00C - R2008 - Resources Store (24.65 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00C/R0003/Ceiling Structures/Linings/S1 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					Limited Samples Taken
B00C - R2009 - Movement (91.55 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00C/R0003/Ceiling Structures/Linings/S1 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					Limited Samples Taken
Floor Coverings Res/Textile	Vinyl Tiles 8184/B00C/R1008/Floor Coverings Res/Textile/S2 Chrysotile (white asbestos)	12m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
B00C - R2010 - Stairs (16.59 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00C/R0003/Ceiling Structures/Linings/S1 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					Limited Samples Taken
B00C - R3001 - General Storeroom (8.51 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00C/R0003/Ceiling Structures/Linings/S1 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					Limited Samples Taken
B00C - R3002 - Office/Store (16.31 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00C/R0003/Ceiling Structures/Linings/S1 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					Limited Samples Taken
B00C - R3003 - General Learning Space (66.05 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00C/R0003/Ceiling Structures/Linings/S1 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					Limited Samples Taken
B00C - R3004 - Seminar (13.15 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00C/R0003/Ceiling Structures/Linings/S1 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					Limited Samples Taken
B00C - R3005 - General Storeroom (13.15 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00C/R0003/Ceiling Structures/Linings/S1 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					Limited Samples Taken
B00C - R3006 - General Learning Space (66.03 m2)						
Ceiling Structures/Linings	Vermiculite 8184/B00C/R0003/Ceiling Structures/Linings/S1 Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					Limited Samples Taken

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - R3007 - General Storeroom (14.31 m2)

Ceiling Structures/Linings Vermiculite
 8184/B00C/R0003/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R3008 - General Storeroom (14.39 m2)

Ceiling Structures/Linings Vermiculite
 8184/B00C/R0003/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R3009 - Distribution Board Cupboard (0.35 m2)

No Asbestos Note: No inspection of live electrical installation.

B00C - R3010 - Movement (58.41 m2)

Ceiling Structures/Linings Vermiculite
 8184/B00C/R0003/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R3011 - Stairs (17.92 m2)

Ceiling Structures/Linings Vermiculite
 8184/B00C/R0003/Ceiling Structures/Linings/S1 **Limited Samples Taken**
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00D - Technological & Applied Studies - 1950 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Poor Condition - Extensive Damage (4)	High (3)	High Priority (6-8)
	8184/B00D/Eaves Linings/S22			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Flat AC Sheeting Debris	1m2	Throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	8184/B00D/Ceiling Voids/S21			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0002 - Materials Store (8.69 m2)

Decorative Coating	Vermiculite					Limited Samples Taken
	8184/B00D/R0002/Decorative Coating/S31					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0003 - Project Store - Type 1 (16.83 m2)

Decorative Coating	Vermiculite					Limited Samples Taken
	8184/B00D/R0003/Decorative Coating/S32					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0004 - Materials Store (15.93 m2)

Decorative Coating	Vermiculite					Limited Samples Taken
	8184/B00D/R0004/Decorative Coating/S33					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0005 - Materials Store (7.6 m2)

Decorative Coating	Vermiculite					Limited Samples Taken
	8184/B00D/R0005/Decorative Coating/S34					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0006 - Metal Technology L.S. (88.45 m2)

Decorative Coating	Vermiculite					Limited Samples Taken
	8184/B00D/R0006/Decorative Coating/S35					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0007 - Welding Area (9.95 m2)

Decorative Coating	Vermiculite					Limited Samples Taken
	8184/B00D/R0007/Decorative Coating/S36					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0008 - Class Tools Storage (9.01 m2)

Decorative Coating	Vermiculite					Limited Samples Taken
	8184/B00D/R0008/Decorative Coating/S37					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0009 - Movement (7.66 m2)

Decorative Coating	Vermiculite					Limited Samples Taken
	8184/B00D/R0009/Decorative Coating/S38					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00D - R0010 - Project Store - Type 1 (38.15 m2)

Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00D/R0010/Ceiling Structures/Linings/S39					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00D - R0011 - External Movement (4.8 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00D/R0011/Ceiling Structures/Linings/S40					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00D - R0012 - Design L.S. (67.85 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0012/Ceiling Structures/Linings/S41				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	12m2	North, East and West Upper walls	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0012/Wall Linings Internal/S42				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0013 - Staff Study (60.74 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0013/Ceiling Structures/Linings/S43				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	20m2	North, East and West Upper portions	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0013/Wall Linings Internal/S44				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0014 - Distribution Board Cupboard (0.41 m2)				Note: No inspection of live electrical installation.		
No Asbestos						
B00D - R0015 - Materials Store (27.8 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0015/Ceiling Structures/Linings/S45				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	4m2	North - Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0015/Wall Linings Internal/S46				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0018 - Design L.S. (77.85 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0018/Ceiling Structures/Linings/S50				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	12m2	North - upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0018/Wall Linings Internal/S51				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0019 - Computer Store (16.14 m2)						
No Asbestos						
B00D - R0020 - Staff - Toilet (5.38 m2)						
No Asbestos						
B00D - R0021 - Cleaning Store - Distributed (1.16 m2)						
No Asbestos						
B00D - R0022 - Class Tools Storage (9.5 m2)						
No Asbestos						
B00D - R0023 - Class Tools Storage (8.28 m2)						
No Asbestos						
B00D - R0024 - Food Technology L.S. (78.24 m2)						
No Asbestos						
B00D - R0025 - Preparation (16.07 m2)						
No Asbestos						
B00D - R0026 - Wood Technology L.S. (100.11 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0026/Ceiling Structures/Linings/S52				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	18m2	South and East - upper portions	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0026/Wall Linings Internal/S53				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0027 - Dust Extraction Space (7.95 m2)						
No Asbestos						
B00D - R0028 - General Learning Space (28.18 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0028/Ceiling Structures/Linings/S54				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	4m2	South and East - upper portions	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0028/Wall Linings Internal/S55				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0032 - Movement (118.06 m2)						
No Asbestos						
B00D - R0033 - External Movement (2.01 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0033/Ceiling Structures/Linings/S58				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0034 - Wood Technology L.S. (126.25 m2)						
Wall Linings Internal	Flat AC Sheeting	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0034/Wall Linings Internal/S68				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	127m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0034/Wall Linings Internal/S68				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0035 - Metal Technology L.S. (94.36 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0034/Wall Linings Internal/S68				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	30m2	South, East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0034/Wall Linings Internal/S68				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0036 - Metal Technology Bay (24.69 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0034/Wall Linings Internal/S68				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	10m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0034/Wall Linings Internal/S68				Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00D - R0037 - Welding Area (9.11 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8184/B00D/R0034/Wall Linings Internal/S68				Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	4m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00D/R0034/Wall Linings Internal/S68					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - R0038 - Wood Technology L.S. (79.14 m2)						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00D/R0038/Ceiling Structures/Linings/S77					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00D/R0038/Ceiling Structures/Linings/S77					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8184/B00D/R0038/Ceiling Structures/Linings/S77					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - R0039 - Handwashing Facilities (1.64 m2)						
Recently Modified Space	Requires Inspection					
B00D - Room+1 - Added Room						
Decorative Coating	Vermiculite					Limited Samples Taken
	8184/B00D/Room+1/Decorative Coating/S59					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00D - Room+2 - Added Room						
Ceiling Structures/Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00D/Room+2/Ceiling Structures/Linings/S60					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout - upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00D/Room+2/Wall Linings Internal/S61					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - Room+3 - Added Room						
Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00D/Room+3/Ceiling Structures/Linings/S62					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	East - upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00D/Room+3/Wall Linings Internal/S63					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - Room+4 - Added Room						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00D/Room+4/Ceiling Structures/Linings/S64					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	6m2	East - upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00D/Room+4/Wall Linings Internal/S65					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00D - Room+5 - Added Room						
Ceiling Structures/Linings	Flat AC Sheeting	140m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00D/Room+5/Ceiling Structures/Linings/S66					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout - upper portions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8184/B00D/Room+5/Wall Linings Internal/S67					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Language Centre - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00E - R0001 - General Learning Space (92 m2)

No Asbestos

B00E - R0002 - Seminar (18.82 m2)

No Asbestos

B00E - R0003 - Resources Space (10.08 m2)

No Asbestos

B00E - R0004 - Resources Store (9.04 m2)

No Asbestos

B00E - R0005 - External Movement (28.54 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Z - Building Services - 2012 - Brick/Block (Brick/Block)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00Z - R0001 - Plant (2.39 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+1 - Added Building

Exterior

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017