


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Pittwater High School (8379)
Region : Northern Sydney
State Electorate : Pittwater
Local Government Area : Pittwater

Initial Survey : Noel Arnold & Associates : 10 - Mar - 2008
Reviewed By : Greencap-NAA : 13 - Aug - 2014

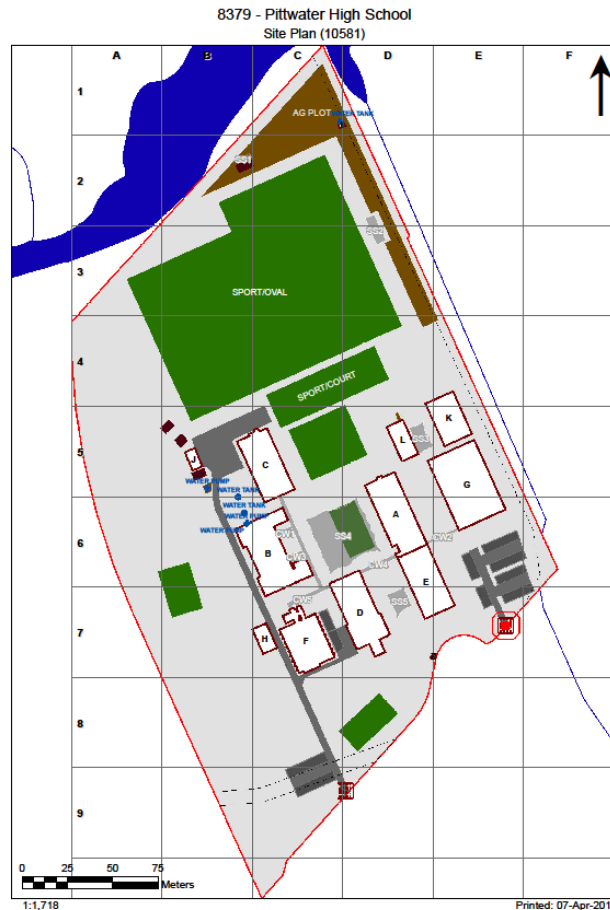

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Science Learning - 1950 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Height restriction - Height restriction -

Interior

B00A - R0002 - Food Technology L.S. (95 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00E/R0016/Ceiling Structures/Linings/S22				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0003 - Pantry (4.46 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00D/R0027/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0004 - Laundry (6.28 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00D/R0027/Ceiling Structures/Linings/S3				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0005 - Preparation - Materials (18.14 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00E/R0016/Ceiling Structures/Linings/S22				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0006 - Resources Store (11.71 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00E/R0016/Ceiling Structures/Linings/S22				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0007 - Food Technology L.S. (102.7 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00E/R0016/Ceiling Structures/Linings/S22				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0009 - Distribution Board Cupboard (0.83 m2)

					Note: No inspection of live electrical installation.	
No Asbestos						

B00A - R0010 - Cleaning Store - Distributed (3.62 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00A - R0011 - Chemical Store (19.09 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00E/R0016/Ceiling Structures/Linings/S22				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0013 - Laboratory L.S. (87.98 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00E/R0016/Ceiling Structures/Linings/S22				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Electrical Backing Board	No Asbestos Found					
--------------------------	-------------------	--	--	--	--	--

B00A - R0014 - Preparation - Science (38.86 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00E/R0016/Ceiling Structures/Linings/S22				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00A - R0015 - Laboratory L.S. (85.91 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	8379/B00E/R0016/Ceiling Structures/Linings/S22				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0016 - Movement (118.31 m2)						
Ceiling Structures/Linings	Vermiculite	8379/B00E/R0016/Ceiling Structures/Linings/S22				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0017 - Archive Store (9.63 m2)						
No Asbestos						
B00A - R0018 - Main Switchroom (3.56 m2)						
No Asbestos						
B00A - R0019 - External Movement (5.94 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8379/B00E/R0017/Ceiling Structures/Linings/S23					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
B00A - R0020 - External Movement (16.07 m2)						
No Asbestos						
B00A - R0021 - Stairs (4.68 m2)						
No Asbestos						
B00A - R0022 - Stairs (4.71 m2)						
No Asbestos						
B00A - R0023 - Tea Room (4.82 m2)						
No Asbestos						
B00A - R0024 - Staff Study (16.29 m2)						
No Asbestos						
B00A - R0025 - Tea Room (5.23 m2)						
Ceiling Structures/Linings	Vermiculite	8379/B00E/R0016/Ceiling Structures/Linings/S22				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0026 - Staff Study (22.45 m2)						
Ceiling Structures/Linings	Vermiculite	8379/B00E/R0016/Ceiling Structures/Linings/S22				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0027 - Cleaning Store - Distributed (5.18 m2)						
No Asbestos						
B00A - R0028 - General Storeroom (4.32 m2)						
No Asbestos						
B00A - R0029 - External Movement (33.12 m2)						
No Asbestos						
B00A - R1001 - Computer Store (3.67 m2)						
No Asbestos						
B00A - R1002 - General Learning Space (52.85 m2)						
No Asbestos						
B00A - R1003 - Resources Store (6.42 m2)						
No Asbestos						
B00A - R1007 - Cleaning Store - Distributed (2.97 m2)						
No Asbestos						
B00A - R1010 - Staff - Toilet (6.43 m2)						
No Asbestos						
B00A - R1011 - General Learning Space (52.27 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R1012 - General Learning Space (52.56 m2)

No Asbestos

B00A - R1013 - General Learning Space (52.63 m2)

No Asbestos

B00A - R1014 - General Learning Space (52.78 m2)

No Asbestos

B00A - R1016 - Movement (141.6 m2)

No Asbestos

B00A - R1017 - Movement (7.25 m2)

No Asbestos

B00A - R1018 - Movement (14.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

Assumed Asbestos - Hight restriction

B00A - R1019 - General Learning Space (59.56 m2)

No Asbestos

B00A - R1020 - Resources Store (18.86 m2)

No Asbestos

B00A - R1021 - Materials Learning Space - Type 1 (38.76 m2)

No Asbestos

B00A - R1022 - Materials Learning Space - Type 1 (52.74 m2)

No Asbestos

B00A - R1023 - Resources Store (12.78 m2)

No Asbestos

B00A - R1024 - Tea Room (4.67 m2)

No Asbestos

B00A - R1025 - Staff Study (37.49 m2)

No Asbestos

B00A - R1026 - Stairs (12.27 m2)

No Asbestos

B00A - R1027 - Stairs (4.01 m2)

No Asbestos

B00A - R1028 - External Movement (32.72 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - Pupil Facilities/Physical Education - 1950 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00B - R0002 - Change (26.32 m2)

No Asbestos

B00B - R0003 - Shower (15.15 m2)

No Asbestos

B00B - R0004 - Sport Equipment Store (6.6 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8379/B00D/R0027/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00B - R0005 - Sport Equipment Store (2.97 m2)

No Asbestos

B00B - R0006 - Staff - Toilet (1.84 m2)

No Asbestos

B00B - R0007 - Uniform Shop (18.06 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8379/B00B/R0021/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00B - R0008 - Pantry (9.58 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8379/B00B/R0021/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00B - R0009 - Student Canteen (49.3 m2)

Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8379/B00B/R0021/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Live

B00B - R0010 - Staff - Toilet (5.02 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8379/B00B/R0021/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00B - R0011 - Uniform Shop (11.09 m2)

No Asbestos

B00B - R0012 - Multi-Purpose Space (321.33 m2)

No Asbestos

B00B - R0013 - Sport Equipment Store (18.01 m2)

Wall Linings Internal	Flat AC Sheeting					
	8379/B00B/R0013/Wall Linings Internal/S2					No Asbestos Detected

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8379/B00B/R0021/Ceiling Structures/Linings/S10					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)

B00B - R0014 - Sport Equipment Store (12.49 m2)

No Asbestos

B00B - R0016 - Change (26.44 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R0017 - Shower (14.99 m2)						
No Asbestos						
B00B - R0019 - General Storeroom (11.04 m2)						
No Asbestos						
B00B - R0020 - Cleaning Supplies Store (8.95 m2)						
No Asbestos						
B00B - R0021 - External Movement (7.05 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8379/B00B/R0021/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00B - R0022 - External Movement (7.18 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8379/B00B/R0021/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00B - R0023 - External Movement (19.53 m2)						
No Asbestos						
B00B - R0024 - External Movement (19.45 m2)						
No Asbestos						
B00B - R0025 - Toilets-Disabled (9.96 m2)						
No Asbestos						
B00B - R0026 - External Movement (7.84 m2)						
No Asbestos						
B00B - R0027 - Toilets-Boys (95.81 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8379/B00B/R0021/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet					
8379/B00B/R0027/Partition Walls (Cubicles)/S11				No Asbestos Detected		
B00B - R0028 - General Storeroom (11.05 m2)						
No Asbestos						
B00B - R0029 - Toilets-Girls (95.1 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8379/B00B/R0021/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
B00B - R0030 - Cleaning Store - Distributed (11.57 m2)						
No Asbestos						
B00B - R0031 - Sport Equipment Store (6.91 m2)						
No Asbestos						
B00B - R0032 - Sport Equipment Store (2.85 m2)						
No Asbestos						
B00B - Room+1 - Added Room						
Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Live - Location west of BR0026						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Technological & Applied Studies/Art - 1950 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	150m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Height restriction - Height restriction -

Interior**B00C - R0002 - Music Learning Space (65.01 m2)**

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8379/B00C/R0026/Ceiling Structures/Linings/S15					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0003 - Music Store (5.84 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8379/B00C/R0026/Ceiling Structures/Linings/S15					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0004 - Resources Store (3.09 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8379/B00C/R0026/Ceiling Structures/Linings/S15					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0005 - Art Learning Space (66.16 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8379/B00C/R0026/Ceiling Structures/Linings/S15					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0006 - Resources Store (2.86 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8379/B00C/R0026/Ceiling Structures/Linings/S15					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0007 - Craft Store (1.86 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8379/B00C/R0026/Ceiling Structures/Linings/S15					

B00C - R0008 - Staff - Toilet (8.02 m2)

No Asbestos

B00C - R0009 - General Storeroom (4.6 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8379/B00C/R0026/Ceiling Structures/Linings/S15					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8379/B00C/R0009/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	8379/B00C/R0009/Floor Coverings Res/Textile/S25					

B00C - R0010 - Multi Media Workshop (52.71 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8379/B00C/R0026/Ceiling Structures/Linings/S15					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0011 - Resources Store (6.3 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8379/B00C/R0026/Ceiling Structures/Linings/S15					
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00C - R0012 - Distribution Board Cupboard (1.06 m2)

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings	Vermiculite 8379/B00C/R0026/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Live
--------------------------	----------------	-------	------	--------------------	---------	--

B00C - R0013 - Art Learning Space (59.04 m2)

Ceiling Structures/Linings	Vermiculite 8379/B00C/R0026/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

Floor Coverings Res/Textile	Vinyl Tiles 8379/B00C/R0013/Floor Coverings Res/Textile/S18					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

Floor Coverings Res/Textile	Vinyl Tiles 8379/B00C/R0013/Floor Coverings Res/Textile/S19					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00C - R0014 - Resources Store (5.1 m2)

Floor Coverings Res/Textile	Vinyl Tiles 8379/B00C/R0014/Floor Coverings Res/Textile/S17					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00C - R0015 - Art Learning Space (52.78 m2)

Ceiling Structures/Linings	Vermiculite 8379/B00C/R0026/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B00C - R0016 - Kiln Space (21.54 m2)

Ceiling Structures/Linings	Vermiculite 8379/B00C/R0026/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B00C - R0017 - Resources Store (10.41 m2)

Ceiling Structures/Linings	Vermiculite 8379/B00C/R0026/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

Floor Coverings Res/Textile	Vinyl Tiles 8379/B00C/R0013/Floor Coverings Res/Textile/S18					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00C - R0018 - Staff Study (26.35 m2)

Ceiling Structures/Linings	Vermiculite 8379/B00C/R0026/Ceiling Structures/Linings/S15					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
----------------------------	---	--	--	--	--	--

B00C - R0019 - Resources Store (10.61 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0021 - External Movement (5.97 m2)

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) 8379/B00C/R0021/Ceiling Structures/Linings/S20 Chrysotile (white asbestos)
----------------------------	------------------	-----	--------------	--------------------	---------	--

B00C - R0022 - Materials Store (3.53 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0023 - External Movement (2.57 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0024 - Stairs (4.77 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0025 - Stairs (4.69 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0026 - Practice/Seminar (25.73 m2)

No Asbestos						
-------------	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8379/B00C/R0026/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0027 - Music Learning Space (66.87 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00C/R0026/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00C - R0028 - General Storeroom (4.76 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8379/B00C/R0009/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8379/B00C/R0009/Floor Coverings Res/Textile/S25					No Asbestos Detected
B00C - R0029 - Movement (104.75 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00C/R0026/Ceiling Structures/Linings/S15					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	35m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8379/B00C/R0009/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	8379/B00C/R0009/Floor Coverings Res/Textile/S25					No Asbestos Detected
B00C - R1001 - Metal Technology L.S. (65.99 m2)						
No Asbestos						
B00C - R1002 - Welding Area (26.65 m2)						
Partition	Flat AC Sheeting	15m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8379/B00C/R1002/Partition/S14					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00C - R1003 - Class Tools Storage (19.13 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8379/B00C/R1014/Floor Coverings Res/Textile/S13					No Asbestos Detected
B00C - R1004 - Dust Extraction Space (3.83 m2)						
No Asbestos						
B00C - R1005 - Wood Technology L.S. (79.24 m2)						
No Asbestos						
B00C - R1006 - Resources Store (15.12 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
	8379/B00C/R1014/Floor Coverings Res/Textile/S13					No Asbestos Detected
B00C - R1007 - Staff Study (26.03 m2)						
No Asbestos						
B00C - R1008 - Staff - Toilet (6.26 m2)						
No Asbestos						
B00C - R1009 - Music Store (3.71 m2)						
No Asbestos						
B00C - R1010 - Design/Technology L.S. (65.01 m2)						
Desk Lining	Flat AC Sheeting					
	8379/B00C/R1010/Desk Lining/S12					No Asbestos Detected
B00C - R1011 - Resources Store (11.49 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - R1012 - Distribution Board Cupboard (0.89 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	2Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Live

B00C - R1013 - General Learning Space (58 m2)

No Asbestos

B00C - R1014 - Materials Store (18.98 m2)

Floor Coverings Res/Textile	Vinyl Sheet				
8379/B00C/R1014/Floor Coverings Res/Textile/S13					No Asbestos Detected

B00C - R1015 - Wood Technology L.S. (79.24 m2)

No Asbestos

B00C - R1016 - Materials Store (6.3 m2)

No Asbestos

B00C - R1017 - Cleaning Store - Distributed (3.71 m2)

No Asbestos

B00C - R1018 - Movement (103.25 m2)

Floor Coverings Res/Textile	Vinyl Tiles				
8379/B00D/R0027/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00C - R1019 - Stairs (4.01 m2)

No Asbestos

B00C - R1020 - Stairs (3.9 m2)

No Asbestos

B00C - R1021 - Movement (6.88 m2)

No Asbestos

B00C - R1022 - Movement (7.1 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration/General Learning - 1950 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	150m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - High restriction						
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Secure Storeroom (9 m2)

No Asbestos

B00D - R0002 - General Learning Space (52.71 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00D/R0027/Ceiling Structures/Linings/S3				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0003 - Resources Store (6.35 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00D/R0027/Ceiling Structures/Linings/S3				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0004 - General Learning Space (39.04 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00D/R0027/Ceiling Structures/Linings/S3				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0005 - Staff Study (25.77 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00D/R0027/Ceiling Structures/Linings/S3				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0006 - Interview/Office - Type 1 (15.65 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00D/R0027/Ceiling Structures/Linings/S3				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0007 - Deputy Principal Office (9.62 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00D/R0027/Ceiling Structures/Linings/S3				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0009 - Clinic (12.12 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00D/R0027/Ceiling Structures/Linings/S3				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0010 - Administration - Clerical (12.15 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00D/R0027/Ceiling Structures/Linings/S3				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0011 - Deputy Principal Office (16.45 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00D/R0027/Ceiling Structures/Linings/S3				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0013 - Public Entry (27.74 m2)

Ceiling Structures/Linings	Vermiculite	8379/B00D/R0027/Ceiling Structures/Linings/S3				Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						

B00D - R0017 - Principal Office (20.62 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0018 - Archive Store (4.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0019 - Staff - Toilet (3.51 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0020 - Cleaning Store - Distributed (1.57 m2)						
No Asbestos						
B00D - R0021 - Distribution Board Cupboard (1 m2)						
Note: No inspection of live electrical installation.						
Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Live						
B00D - R0022 - Careers Advisers Office (25.59 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0023 - Printing/Photocopying (52.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0026 - Resources Store (3.56 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0027 - Movement (71.45 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8379/B00D/R0027/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00D - R0029 - External Movement (2.5 m2)						
No Asbestos						
B00D - R0030 - External Movement (43.47 m2)						
No Asbestos						
B00D - R0031 - External Movement (38.82 m2)						
No Asbestos						
B00D - R0032 - External Movement (33.37 m2)						
No Asbestos						
B00D - R0034 - Stairs (5 m2)						
No Asbestos						
B00D - R0035 - Stairs (7.18 m2)						
No Asbestos						
B00D - R0036 - General Learning Space (75.37 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0037 - Toilet - Lobby (5.24 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0038 - Staff - Toilet (4.45 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0039 - Toilet - Lobby (3.16 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0040 - Staff - Toilet (4.49 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					No Asbestos Detected
B00D - R0041 - External Movement (7.16 m2)						
No Asbestos						
B00D - R0042 - Public Reception (17.51 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0043 - Movement (3.58 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0044 - Student Reception (16.18 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R0045 - Administration - Clerical (53.44 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00D/R0027/Ceiling Structures/Linings/S3					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00D - R1001 - Staff - Toilet (3.69 m2)						
No Asbestos						
B00D - R1003 - Staff - Toilet (6.35 m2)						
No Asbestos						
B00D - R1005 - Seminar (14.36 m2)						
No Asbestos						
B00D - R1006 - General Storeroom (11.89 m2)						
No Asbestos						
B00D - R1007 - Resources Store (11.82 m2)						
No Asbestos						
B00D - R1008 - General Learning Space (52.71 m2)						
No Asbestos						
B00D - R1009 - General Learning Space (52.63 m2)						
No Asbestos						
B00D - R1010 - General Learning Space (65.76 m2)						
No Asbestos						
B00D - R1011 - Resources Store (9.27 m2)						
Electrical Backing Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
<i>Assumed Asbestos - Live</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00D - R1012 - Cleaning Store - Distributed (3.04 m2)						
No Asbestos						
B00D - R1013 - General Learning Space (52.34 m2)						
No Asbestos						
B00D - R1014 - Resources Store (6.17 m2)						
No Asbestos						
B00D - R1015 - General Learning Space (66.03 m2)						
No Asbestos						
B00D - R1016 - Resources Store (6.16 m2)						
No Asbestos						
B00D - R1017 - Movement (122.34 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8379/B00D/R0027/Floor Coverings Res/Textile/S4					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting	15m2	South East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Hight restriction						
B00D - R1018 - Commonroom (92.54 m2)						
No Asbestos						
B00D - R1019 - Interview/Office - Type 1 (25.88 m2)						
No Asbestos						
B00D - R1021 - Stairs (10.45 m2)						
No Asbestos						
B00D - R1022 - Tea Room (7.09 m2)						
No Asbestos						
B00D - R1023 - Staff Study (18.97 m2)						
No Asbestos						
B00D - R1024 - Movement (6.97 m2)						
No Asbestos						
B00D - R1025 - Stairs (4.07 m2)						
No Asbestos						
B00D - R1026 - External Movement (42.29 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Science Learning - 1950 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	------------	--------------------	---------	--------------------

Assumed Asbestos - Height restriction - Height restriction-

Ceiling Voids	No Asbestos Found
---------------	-------------------

Underfloor Voids	No Asbestos Found
------------------	-------------------

Interior**B00E - R0001 - Resources Store (11.95 m2)**

No Asbestos

B00E - R0002 - Distribution Board Cupboard (0.48 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Vermiculite 8379/B00E/R0016/Ceiling Structures/Linings/S22	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Electrical Backing Board	No Asbestos Found
--------------------------	-------------------

B00E - R0003 - Laboratory L.S. (92.22 m2)

Ceiling Structures/Linings	Vermiculite 8379/B00E/R0016/Ceiling Structures/Linings/S22	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00E - R0006 - Laboratory L.S. (93.15 m2)

Ceiling Structures/Linings	Vermiculite 8379/B00E/R0016/Ceiling Structures/Linings/S22	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00E - R0007 - Resources Store (5.19 m2)

No Asbestos

B00E - R0008 - Cleaning Store - Distributed (3.46 m2)

No Asbestos

B00E - R0009 - Staff - Toilet (6.35 m2)

Ceiling Structures/Linings	Vermiculite 8379/B00E/R0016/Ceiling Structures/Linings/S22	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

B00E - R0012 - Special Learning Space (38.93 m2)

Ceiling Structures/Linings	Vermiculite 8379/B00E/R0016/Ceiling Structures/Linings/S22	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8379/B00E/R0014/Floor Coverings Res/Textile/S24	No Asbestos Detected
-----------------------------	--	----------------------

B00E - R0013 - General Learning Space (52.34 m2)

Ceiling Structures/Linings	Vermiculite 8379/B00E/R0016/Ceiling Structures/Linings/S22	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8379/B00E/R0014/Floor Coverings Res/Textile/S24	No Asbestos Detected
-----------------------------	--	----------------------

B00E - R0014 - General Learning Space (52.34 m2)

Ceiling Structures/Linings	Vermiculite 8379/B00E/R0016/Ceiling Structures/Linings/S22	Limited Samples Taken
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works		

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8379/B00E/R0014/Floor Coverings Res/Textile/S24	No Asbestos Detected
-----------------------------	--	----------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00E - R0015 - General Learning Space (52.34 m2)						
Ceiling Structures/Linings	Vermiculite 8379/B00E/R0016/Ceiling Structures/Linings/S22					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8379/B00E/R0014/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00E - R0016 - Movement (101.88 m2)						
Ceiling Structures/Linings	Vermiculite 8379/B00E/R0016/Ceiling Structures/Linings/S22					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0017 - External Movement (6.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3) 8379/B00E/R0017/Ceiling Structures/Linings/S23 <i>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</i>
B00E - R0019 - Stairs (4.72 m2)						
No Asbestos						
B00E - R0020 - Special Learning Space (36.37 m2)						
Ceiling Structures/Linings	Vermiculite 8379/B00E/R0016/Ceiling Structures/Linings/S22					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8379/B00E/R0014/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00E - R0021 - Tea Room (2.38 m2)						
Ceiling Structures/Linings	Vermiculite 8379/B00E/R0016/Ceiling Structures/Linings/S22					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00E - R0022 - Preparation - Science (39.09 m2)						
Electrical Backing Board	No Asbestos Found					
B00E - R0023 - Tea Room (4.97 m2)						
No Asbestos						
B00E - R0024 - Staff Study (20.77 m2)						
No Asbestos						
B00E - R1001 - Distribution Board Cupboard (0.23 m2)						
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3) Note: No inspection of live electrical installation. <i>Assumed Asbestos - Live</i>
B00E - R1002 - General Learning Space (52.18 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8379/B00E/R1012/Floor Coverings Res/Textile/S21	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Floor Coverings Res/Textile	Adhesive 8379/B00E/R1012/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00E - R1003 - General Learning Space (52.2 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8379/B00E/R1012/Floor Coverings Res/Textile/S21	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Floor Coverings Res/Textile	Adhesive 8379/B00E/R1012/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00E - R1004 - General Learning Space (52.34 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8379/B00E/R1012/Floor Coverings Res/Textile/S21	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8379/B00E/R1012/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00E - R1005 - General Learning Space (52.49 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8379/B00E/R1012/Floor Coverings Res/Textile/S21	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8379/B00E/R1012/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00E - R1009 - General Learning Space (52.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8379/B00E/R1012/Floor Coverings Res/Textile/S21	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8379/B00E/R1012/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00E - R1010 - General Learning Space (52.2 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8379/B00E/R1012/Floor Coverings Res/Textile/S21	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8379/B00E/R1012/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00E - R1011 - General Learning Space (52.42 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8379/B00E/R1012/Floor Coverings Res/Textile/S21	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8379/B00E/R1012/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00E - R1012 - General Learning Space (52.41 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8379/B00E/R1012/Floor Coverings Res/Textile/S21	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8379/B00E/R1012/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00E - R1013 - General Learning Space (52.63 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8379/B00E/R1012/Floor Coverings Res/Textile/S21	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 8379/B00E/R1012/Floor Coverings Res/Textile/S26					No Asbestos Detected
B00E - R1015 - Movement (102.5 m2)						
No Asbestos						
B00E - R1016 - Stairs (11.5 m2)						
No Asbestos						
B00E - R1017 - Staff Study (33.41 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 8379/B00E/R1012/Floor Coverings Res/Textile/S21	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings Res/Textile	Adhesive		8379/B00E/R1012/Floor Coverings Res/Textile/S26			No Asbestos Detected
-----------------------------	----------	--	---	--	--	----------------------

B00E - R1018 - Tea Room (3.85 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Science Learning/Library - 1973 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00F - M1001 - General Storeroom (19.31 m2)**

Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00F - M1002 - Plant (1.09 m2)

Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00F - M1003 - Office/Store (19.69 m2)

Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00F - M1004 - Computer Learning Space (141.87 m2)

Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00F - M1005 - Movement (4.96 m2)

No Asbestos

B00F - M1006 - Stairs (0.67 m2)

Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00F - M1007 - Stairs (0.99 m2)

Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00F - R0001 - General Learning Space (66.46 m2)

Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00F - R0002 - Computer Learning Space (72.49 m2)

Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

B00F - R0003 - Laboratory L.S. (91.2 m2)

Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	91m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8379/B00F/R0005/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)

B00F - R0004 - Apparatus Storage (12.55 m2)

Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8379/B00F/R0005/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0005 - Laboratory L.S. (91.1 m2)						
Ceiling Structures/Linings	Vermiculite 8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8379/B00F/R0005/Floor Coverings Res/Textile/S7	91m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00F - R0006 - Distribution Board Cupboard (0.44 m2) Note: No inspection of live electrical installation.						
Floor Coverings Res/Textile	Vinyl Tiles 8379/B00F/R0005/Floor Coverings Res/Textile/S7	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Electrical Backing Board	Resinous Board	2Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Live
B00F - R0007 - Preparation - Science (46.66 m2)						
Ceiling Structures/Linings	Vermiculite 8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8379/B00F/R0005/Floor Coverings Res/Textile/S7	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Electrical Backing Board	No Asbestos Found					
B00F - R0008 - Laboratory L.S. (90.91 m2)						
Ceiling Structures/Linings	Vermiculite 8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8379/B00F/R0005/Floor Coverings Res/Textile/S7	92m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00F - R0009 - Movement (40.02 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8379/B00F/R0005/Floor Coverings Res/Textile/S7	46m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00F - R0010 - Garden Store Room (7.75 m2)						
No Asbestos						
B00F - R0011 - Plant (16.44 m2)						
No Asbestos						
B00F - R0012 - Lift (2.11 m2)						
No Asbestos						
B00F - R0013 - Movement (5.48 m2)						
No Asbestos						
B00F - R0014 - External Movement (29.95 m2)						
No Asbestos						
B00F - R0015 - Stairs (7.69 m2)						
No Asbestos						
B00F - R0016 - Plant (1.9 m2)						
No Asbestos						
B00F - R1001 - External Movement (2.37 m2)						
No Asbestos						
B00F - R1002 - Main Entry (20.25 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00F - R1003 - Staff - Toilet (3.23 m2)						
No Asbestos						
B00F - R1004 - Main Area (362.43 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1005 - Senior Study (25.88 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1006 - Distribution Board Cupboard (0.52 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Electric Off Peak Heater	Resinous Board	2Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Live						
B00F - R1007 - Cleaning Store - Distributed (1.91 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1008 - Study Space (11.77 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1009 - Distribution Board Cupboard (0.57 m2)						
Note: No inspection of live electrical installation.						
Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Electrical Backing Board	Resinous Board	2Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Live						
B00F - R1010 - Seminar (23.13 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1011 - Audio Visual Workroom (29.39 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1012 - Librarian (10.51 m2)						
No Asbestos						
B00F - R1013 - Library Administration (19.95 m2)						
No Asbestos						
B00F - R1014 - Secure Storeroom (7.38 m2)						
Ceiling Structures/Linings	Vermiculite					
	8379/B00F/M1004/Ceiling Structures/Linings/S8					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8379/B00F/R0005/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
B00F - R1015 - Staff - Toilet (3.23 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R1016 - Movement (4.96 m2)						
No Asbestos						
B00F - R1017 - Movement (5.48 m2)						
No Asbestos						
B00F - R1018 - External Movement (24.98 m2)						
No Asbestos						
B00F - R1020 - External Stairs (16.31 m2)						
No Asbestos						
B00F - R1021 - Stairs (3.11 m2)						
Ceiling Structures/Linings	Vermiculite		8379/B00F/M1004/Ceiling Structures/Linings/S8			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1022 - Stairs (2.69 m2)						
Ceiling Structures/Linings	Vermiculite		8379/B00F/M1004/Ceiling Structures/Linings/S8			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00F - R1023 - External Movement (5.21 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Multi Purpose Facilities - 1988 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior**B00G - M0001 - General Storeroom (6.2 m2)**

No Asbestos

B00G - M0002 - General Storeroom (4.26 m2)

No Asbestos

B00G - M0003 - Control Room (1.36 m2)

No Asbestos

B00G - R0002 - Change (30.75 m2)

Wall Linings Internal	Flat AC Sheeting 8379/B00G/R0013/Wall Linings Internal/S9	No Asbestos Detected
-----------------------	--	-----------------------------

B00G - R0004 - Distribution Board Cupboard (3.27 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00G - R0005 - Toilets-Disabled (4.26 m2)

Wall Linings Internal	Flat AC Sheeting 8379/B00G/R0013/Wall Linings Internal/S9	No Asbestos Detected
-----------------------	--	-----------------------------

B00G - R0006 - Chair Store (52.23 m2)

No Asbestos

B00G - R0007 - Multi-Purpose Space (521.47 m2)

No Asbestos

B00G - R0008 - Sport Equipment Store (21.24 m2)

No Asbestos

B00G - R0009 - Music Store (12.42 m2)

Wall Linings Internal	Flat AC Sheeting 8379/B00G/R0013/Wall Linings Internal/S9	No Asbestos Detected
-----------------------	--	-----------------------------

B00G - R0010 - Staff Shower (6 m2)

Wall Linings Internal	Flat AC Sheeting 8379/B00G/R0013/Wall Linings Internal/S9	No Asbestos Detected
-----------------------	--	-----------------------------

B00G - R0011 - Staff Kitchen (15.4 m2)

Wall Linings Internal	Flat AC Sheeting 8379/B00G/R0013/Wall Linings Internal/S9	No Asbestos Detected
-----------------------	--	-----------------------------

B00G - R0012 - Cleaning Store - Distributed (3.44 m2)

No Asbestos

B00G - R0014 - Change (30.85 m2)

Wall Linings Internal	Flat AC Sheeting 8379/B00G/R0013/Wall Linings Internal/S9	No Asbestos Detected
-----------------------	--	-----------------------------

B00G - R0015 - Movement (44.73 m2)

No Asbestos

B00G - R0016 - Stage (68.67 m2)

No Asbestos

B00G - R0017 - External Movement (264.15 m2)

No Asbestos

B00G - R0018 - Toilet - Lobby (3.09 m2)

No Asbestos

B00G - R0019 - Toilets-Girls (18.5 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R0020 - Toilet - Lobby (3.04 m2)						
No Asbestos						
B00G - R0021 - Toilets-Boys (18.48 m2)						
No Asbestos						
B00G - R0022 - Movement (16.55 m2)						
No Asbestos						
B00G - R0023 - General Storeroom (5.72 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning/Performance Learning - 1950 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - Performance Workshop (47.04 m2)

No Asbestos

B00H - R0002 - General Learning Space (47.04 m2)

No Asbestos

B00H - R0003 - External Movement (26.6 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Agricultural Science - 2000 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Flat Roof No Asbestos Found

Interior

B001 - R0001 - Garden Store Room (5.99 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Building Services/Mechanical Services - 2000 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00J - R0001 - Garden Store Room (57.37 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Movement Complex/Staff Facilities - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00K - R0001 - Multi-Purpose Space (215.55 m2)

No Asbestos

B00K - R0002 - Performance Store (39.65 m2)

No Asbestos

B00K - R0003 - Control Room (11.9 m2)

No Asbestos

B00K - R0004 - Staff Study (27.08 m2)

No Asbestos

B00K - R0005 - Sport Equipment Store (6.35 m2)

No Asbestos

B00K - R0006 - Toilets-Unisex (5.12 m2)

No Asbestos

B00K - R0007 - Distribution Board Cupboard (0.63 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00K - R0008 - External Movement (95.67 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Technological & Applied Studies - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00L - R0001 - Food Technology L.S. (110.76 m2)

No Asbestos

B00L - R0002 - Class Tools Storage (15 m2)

No Asbestos

B00L - R0003 - Preparation - Materials (17.55 m2)

No Asbestos

B00L - R0004 - Pantry (8.18 m2)

No Asbestos

B00L - R0005 - Distribution Board Cupboard (1.27 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00L - R0006 - External Movement (31.7 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Z - Building Services - 1962 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00Z - R0001 - Plant (3.04 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

8379_ASB_150514_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017