


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Pennant Hills High School (8438)  
**Region :** Northern Sydney  
**State Electorate :** Hornsby  
**Local Government Area :** Hornsby

**Initial Survey :** Noel Arnold & Associates : 03 - Mar - 2008  
**Reviewed By :** Greencap-NAA : 13 - Aug - 2014

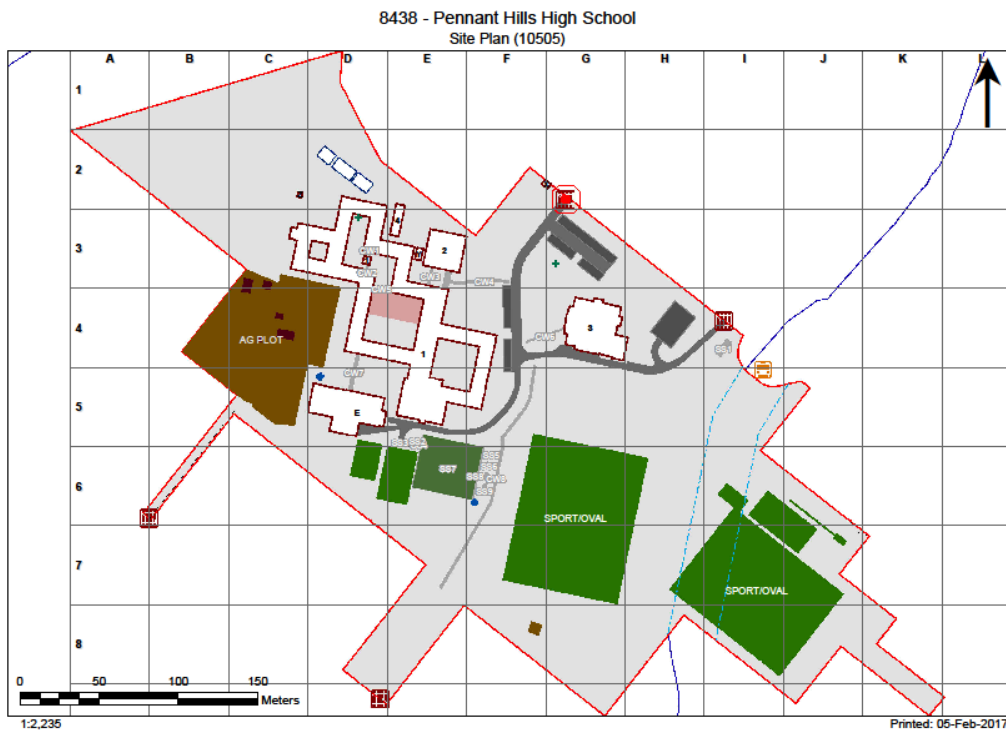

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Administration/General Learning - 1966 - Brick/Veneer (Brick/Veneer)****Exterior**

Wall Cladding	Compressed AC Sheet 8438/B001/R2161/Wall Linings Internal/S5					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 8438/B001/R2059/Ceiling Structures/Linings/S4					No Asbestos Detected
External sill panels under cantilever windows	Compressed AC Sheet 8438/B001/External sill panels under cantilever windows/S14					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

**Interior****B001 - R0001 - General Learning Space (51.65 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8438/B001/R1039/Floor Coverings Res/Textile/S12					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B001 - R0002 - Cleaning Store - Distributed (2.46 m2)**

EDB cupboard wall lining	Flat AC Sheeting	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8438/B001/R2197/EDB cupboard wall lining/S17					Chrysotile (white asbestos)

**B001 - R0003 - Resources Store (12.19 m2)**

No Asbestos

**B001 - R0004 - Movement (12.36 m2)**

No Asbestos

**B001 - R0005 - General Learning Space (51.65 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8438/B001/R1039/Floor Coverings Res/Textile/S12					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B001 - R0006 - Design L.S. (65.26 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8438/B001/R1039/Floor Coverings Res/Textile/S12					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B001 - R0007 - Resources Store (5.54 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8438/B001/R1039/Floor Coverings Res/Textile/S12					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B001 - R0008 - Resources Store (5.55 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8438/B001/R1039/Floor Coverings Res/Textile/S12					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B001 - R0009 - General Learning Space (51.65 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8438/B001/R1039/Floor Coverings Res/Textile/S12					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B001 - R0011 - Leading Teacher (12.47 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 8438/B001/R1039/Floor Coverings Res/Textile/S12					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

**B001 - R0016 - Distribution Board Cupboard (0.53 m2)**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8438/B001/R2015/Wall Linings Internal/S7					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Electrical Mounting Board	Resinous Board	1Unit	Concealed	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						
<b>B001 - R0017 - External Movement (105.27 m2)</b>						
No Asbestos						
<b>B001 - R0018 - External Stairs (6.64 m2)</b>						
No Asbestos						
<b>B001 - R0019 - General Learning Space (64.8 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8438/B001/R1039/Floor Coverings Res/Textile/S12					<b>No Asbestos Detected</b>
<b>B001 - R0020 - Staff Study (23.44 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8438/B001/R1039/Floor Coverings Res/Textile/S12					<b>No Asbestos Detected</b>
<b>B001 - R0021 - Tea Room (1.85 m2)</b>						
No Asbestos						
<b>B001 - R0022 - Garden Store Room (34.82 m2)</b>						
No Asbestos						
<b>B001 - R1001 - Staff - Toilet (2.48 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8438/B001/R3046/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Electrical Cupboard Doors	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8438/B001/R2015/Wall Linings Internal/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Electrical Mounting Board	Resinous Board	1Unit	Concealed	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						
Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8438/B001/R2015/Wall Linings Internal/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B001 - R1003 - Laundry (15.55 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8438/B001/R1003/Floor Coverings Res/Textile/S11					<b>Chrysotile (white asbestos)</b>
<b>B001 - R1005 - Resources Store (8.78 m2)</b>						
No Asbestos						
<b>B001 - R1006 - Resources Store (16.1 m2)</b>						
No Asbestos						
<b>B001 - R1010 - Food Technology L.S. (64.81 m2)</b>						
No Asbestos						
<b>B001 - R1011 - Cleaning Store - Distributed (3.78 m2)</b>						
EDB cupboard wall lining	Flat AC Sheeting	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8438/B001/R2197/EDB cupboard wall lining/S17					<b>Chrysotile (white asbestos)</b>
<b>B001 - R1012 - General Storeroom (12.25 m2)</b>						
No Asbestos						
<b>B001 - R1013 - Toilets-Girls (51.72 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R3046/Partition Walls (Cubicles)/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Service duct roof	Flat AC Sheeting					<b>No Asbestos Detected</b>
8438/B001/R3043/Service duct roof/S13						
<b>B001 - R1014 - General Storeroom (5.87 m2)</b>						
No Asbestos						
<b>B001 - R1015 - Performance Workshop (130.13 m2)</b>						
No Asbestos						
<b>B001 - R1016 - General Storeroom (22.82 m2)</b>						
No Asbestos						
<b>B001 - R1017 - Resources Store (12.17 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8438/B001/R1039/Floor Coverings Res/Textile/S12		<b>No Asbestos Detected</b>				
<b>B001 - R1019 - General Learning Space (51.72 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8438/B001/R1039/Floor Coverings Res/Textile/S12		<b>No Asbestos Detected</b>				
<b>B001 - R1020 - Resources Store (5.97 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8438/B001/R1039/Floor Coverings Res/Textile/S12		<b>No Asbestos Detected</b>				
<b>B001 - R1021 - Resources Store (6 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8438/B001/R1039/Floor Coverings Res/Textile/S12		<b>No Asbestos Detected</b>				
<b>B001 - R1022 - General Learning Space (51.72 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8438/B001/R1039/Floor Coverings Res/Textile/S12		<b>No Asbestos Detected</b>				
<b>B001 - R1023 - Staff - Toilet (4.57 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R3046/Partition Walls (Cubicles)/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B001 - R1024 - Distribution Board Cupboard (0.51 m2)</b>						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	5m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7		<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>				
Electrical Mounting Board	Resinous Board	1Unit	Concealed	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						
Door Backing	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7		<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>				
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7		<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>				
<b>B001 - R1025 - Preparation - Science (27.73 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8438/B001/R1039/Floor Coverings Res/Textile/S12		<b>No Asbestos Detected</b>				

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B001 - R1026 - Resources Store (9.56 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8438/B001/R1039/Floor Coverings Res/Textile/S12					<b>No Asbestos Detected</b>
<b>B001 - R1027 - Laboratory L.S. (91.14 m2)</b>						
Fume Cupboard	Flat AC Sheeting	1Unit	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8438/B001/R2004/Fume Cupboard/S8					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Fume cupboard exhaust pipe	Bitu-flue pipe	1Unit(s)	Above ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Area inaccessible</b>					
<b>B001 - R1028 - General Learning Space (51.65 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8438/B001/R1039/Floor Coverings Res/Textile/S12					<b>No Asbestos Detected</b>
<b>B001 - R1029 - General Learning Space (51.58 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8438/B001/R1039/Floor Coverings Res/Textile/S12					<b>No Asbestos Detected</b>
<b>B001 - R1030 - Resources Store (12.35 m2)</b>						
No Asbestos						
<b>B001 - R1031 - Cleaning Store - Distributed (2.41 m2)</b>						
No Asbestos						
<b>B001 - R1032 - General Learning Space (51.86 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8438/B001/R1039/Floor Coverings Res/Textile/S12					<b>No Asbestos Detected</b>
<b>B001 - R1033 - General Storeroom (12.08 m2)</b>						
No Asbestos						
<b>B001 - R1034 - General Storeroom (25.36 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8438/B001/R1035/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>
<b>B001 - R1035 - General Assistants (25.36 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8438/B001/R1035/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>
<b>B001 - R1038 - Laboratory L.S. (87.06 m2)</b>						
Fume Cupboard	Flat AC Sheeting	1Unit	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8438/B001/R2004/Fume Cupboard/S8					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Fume cupboard exhaust pipe	Bitu-flue pipe	1Unit(s)	Above ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Area inaccessible</b>					
<b>B001 - R1039 - Preparation - Science (25.54 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8438/B001/R1039/Floor Coverings Res/Textile/S12					<b>No Asbestos Detected</b>
<b>B001 - R1040 - Resources Store (6.18 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8438/B001/R1039/Floor Coverings Res/Textile/S12					<b>No Asbestos Detected</b>
<b>B001 - R1041 - Laboratory L.S. (87.1 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Fume Cupboard	Flat AC Sheeting	1Unit	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2004/Fume Cupboard/S8				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Fume cupboard exhaust pipe	Bitu-flue pipe	1Unit(s)	Above ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Area inaccessible</b>						
<b>B001 - R1044 - Distribution Board Cupboard (0.64 m2)</b>				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B001 - R1045 - External Stairs (5.01 m2)</b>						
No Asbestos						
<b>B001 - R1046 - External Stairs (2.68 m2)</b>						
No Asbestos						
<b>B001 - R1047 - General Storeroom (5.34 m2)</b>						
No Asbestos						
<b>B001 - R1048 - External Movement (155.41 m2)</b>						
EDB cupboard wall lining	Flat AC Sheeting	3m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2197/EDB cupboard wall lining/S17				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R1049 - General Storeroom (5.34 m2)</b>						
No Asbestos						
<b>B001 - R1050 - External Stairs (3.47 m2)</b>						
No Asbestos						
<b>B001 - R1051 - External Stairs (6.74 m2)</b>						
No Asbestos						
<b>B001 - R1052 - Distribution Board Cupboard (0.53 m2)</b>				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Electrical Mounting Board	Resinous Board	1Unit	Concealed	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						
Door Backing	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B001 - R1053 - External Movement (7.77 m2)</b>						
No Asbestos						
<b>B001 - R1054 - Movement (5.38 m2)</b>						
No Asbestos						
<b>B001 - R1055 - Lift (2.1 m2)</b>						
No Asbestos						
<b>B001 - R1056 - Plant (1.09 m2)</b>						
Lift Motor Brakes	Bonded Linings	2Unit(s)	Motor Compartment	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Sealed unit</b>						
<b>B001 - R1057 - Distribution Board Cupboard (0.57 m2)</b>				Note: No inspection of live electrical installation.		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B001 - R1058 - Handwashing Facilities (0.2 m2)</b>						
No Asbestos						
<b>B001 - R1059 - Performance Workshop (70.6 m2)</b>						
No Asbestos						
<b>B001 - R1060 - Tea Room (6.02 m2)</b>						
No Asbestos						
<b>B001 - R1061 - Food Technology L.S. (75.08 m2)</b>						
No Asbestos						
<b>B001 - R1062 - Preparation - Materials (25.46 m2)</b>						
No Asbestos						
<b>B001 - R1063 - Handwashing Facilities (0.19 m2)</b>						
No Asbestos						
<b>B001 - R1064 - Staff Study (22.96 m2)</b>						
No Asbestos						
<b>B001 - R1065 - Tea Room (2.25 m2)</b>						
No Asbestos						
<b>B001 - R1066 - Staff Study (50.18 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R1067 - Tea Room (1.22 m2)</b>						
No Asbestos						
<b>B001 - R1068 - Staff Study (23.11 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R1069 - Tea Room (2.14 m2)</b>						
No Asbestos						
<b>B001 - R1070 - External Movement (234.33 m2)</b>						
No Asbestos						
<b>B001 - R2001 - Laboratory L.S. (84.62 m2)</b>						
Fume Cupboard	Flat AC Sheeting	1Unit	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2004/Fume Cupboard/S8					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Fume cupboard exhaust pipe	Bitu-flue pipe	1Unit(s)	Above ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Area inaccessible</b>						
<b>B001 - R2002 - Preparation - Science (28.69 m2)</b>						
No Asbestos						
<b>B001 - R2003 - Resources Store (9.17 m2)</b>						
No Asbestos						
<b>B001 - R2004 - Laboratory L.S. (84.52 m2)</b>						
Fume Cupboard	Flat AC Sheeting	1Unit	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2004/Fume Cupboard/S8					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Fume cupboard exhaust pipe	Bitu-flue pipe	1Unit(s)	Above ceiling	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Area inaccessible</b>						
<b>B001 - R2005 - Staff - Toilet (3.66 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B001 - R2006 - Plant (0.67 m2)</b>						
Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B001 - R2011 - Toilets-Boys (35.61 m2)</b>						
Service duct roof	Flat AC Sheeting					
8438/B001/R3043/Service duct roof/S13				<b>No Asbestos Detected</b>		
<b>B001 - R2012 - Main Switchroom (11.69 m2)</b>						
Electrical Mounting Board	Resinous Board	1Unit	Concealed	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						
<b>B001 - R2014 - General Learning Space (51.58 m2)</b>						
No Asbestos						
<b>B001 - R2015 - Distribution Board Cupboard (0.63 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B001 - R2048 - External Movement (24.92 m2)</b>						
Wall lining panels	Compressed AC Sheet					
8438/B001/R2161/Wall Linings Internal/S5				<b>No Asbestos Detected</b>		
<b>B001 - R2049 - Covered Area (421.4 m2)</b>						
No Asbestos						
<b>B001 - R2051 - Sport Equipment Store (5.77 m2)</b>						
No Asbestos						
<b>B001 - R2052 - Student Canteen (56.6 m2)</b>						
No Asbestos						
<b>B001 - R2053 - Pantry (2.25 m2)</b>						
No Asbestos						
<b>B001 - R2054 - Staff - Toilet (3.3 m2)</b>						
No Asbestos						
<b>B001 - R2055 - Distribution Board Cupboard (0.8 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Electrical Mounting Board	Resinous Board	1Unit	Concealed	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						
<b>B001 - R2056 - General Storeroom (8.78 m2)</b>						
No Asbestos						
<b>B001 - R2057 - General Storeroom (7.7 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
8438/B001/R2059/Ceiling Structures/Linings/S4				<b>No Asbestos Detected</b>		
<b>B001 - R2058 - Movement (22.32 m2)</b>						
No Asbestos						
<b>B001 - R2060 - Sport Equipment Store (18.65 m2)</b>						
No Asbestos						
<b>B001 - R2061 - Sport Equipment Store (1.84 m2)</b>						
No Asbestos						
<b>B001 - R2062 - Cleaning Supplies Store (6 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
8438/B001/R2059/Ceiling Structures/Linings/S4				<b>No Asbestos Detected</b>		
<b>B001 - R2063 - General Storeroom (6 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
No Asbestos						
<b>B001 - R2065 - Staff - Toilet (5.88 m2)</b>						
No Asbestos						
<b>B001 - R2070 - Distribution Board Cupboard (0.64 m2)</b>				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B001 - R2071 - Computer Learning Space (51.65 m2)</b>						
No Asbestos						
<b>B001 - R2073 - General Learning Space (51.29 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R2074 - General Learning Space (51.79 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R2075 - General Learning Space (51.15 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R2076 - General Learning Space (51.86 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R2078 - General Learning Space (52.15 m2)</b>						
No Asbestos						
<b>B001 - R2079 - Distribution Board Cupboard (0.59 m2)</b>				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B001 - R2080 - Cleaning Store - Distributed (3.76 m2)</b>						
No Asbestos						
<b>B001 - R2085 - Cleaning Store - Distributed (3.76 m2)</b>						
EDB cupboard wall lining	Flat AC Sheeting	2m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2197/EDB cupboard wall lining/S17				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R2086 - Distribution Board Cupboard (0.61 m2)</b>				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B001 - R2087 - Chemical Store (25.43 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R2088 - Computer Store (12.57 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R2089 - Staff Study (12.61 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
<b>B001 - R2091 - Staff Study (9.19 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R2093 - Careers Advisers Office (12.47 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R2098 - Music Learning Space (51.43 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R2099 - Staff - Toilet (4.63 m2)</b>						
No Asbestos						
<b>B001 - R2100 - Distribution Board Cupboard (0.48 m2)</b>						
				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Door Backing	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Electrical Mounting Board	Resinous Board	1Unit	Concealed	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Assumed Asbestos - Electrical Hazard</b>		
Ceiling Structures/Linings	Fibre Cement Pipe	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B001 - R2101 - Music Learning Space (51.43 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8438/B001/R2101/Ceiling Structures/Linings/S9				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B001 - R2102 - Resources Store (11.41 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R2104 - Music Learning Space (51.58 m2)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
8438/B001/R2101/Ceiling Structures/Linings/S9				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B001 - R2105 - Resources Store (8.84 m2)</b>						
No Asbestos						
<b>B001 - R2107 - General Learning Space (51.72 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
8438/B001/R2109/Floor Coverings Res/Textile/S18						
<b>B001 - R2108 - Resources Store (12.12 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R2109 - General Learning Space (51.57 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
8438/B001/R2109/Floor Coverings Res/Textile/S18						
<b>B001 - R2110 - Distribution Board Cupboard (0.56 m2)</b>						
				Note: No inspection of live electrical installation.		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Electrical Mounting Board	Resinous Board	1Unit	Concealed	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						
Door Backing	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B001 - R2111 - Staff - Toilet (2.35 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R3046/Partition Walls (Cubicles)/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B001 - R2112 - General Learning Space (51.43 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8438/B001/R2109/Floor Coverings Res/Textile/S18				<b>No Asbestos Detected</b>		
<b>B001 - R2116 - External Stairs (4.67 m2)</b>						
No Asbestos						
<b>B001 - R2117 - Materials Technology L.S. (64.81 m2)</b>						
No Asbestos						
<b>B001 - R2118 - Staff Study (64.98 m2)</b>						
No Asbestos						
<b>B001 - R2119 - General Learning Space (51.5 m2)</b>						
No Asbestos						
<b>B001 - R2120 - External Stairs (6.68 m2)</b>						
Wall Linings Internal	Compressed AC Sheet					
8438/B001/R2120/Wall Linings Internal/S16				<b>No Asbestos Detected</b>		
Ceiling Structures/Linings	Flat AC Sheeting					
8438/B001/R2059/Ceiling Structures/Linings/S4				<b>No Asbestos Detected</b>		
<b>B001 - R2121 - Cleaning Store - Distributed (3.74 m2)</b>						
No Asbestos						
<b>B001 - R2122 - External Movement (38.12 m2)</b>						
Wall Linings Internal	Compressed AC Sheet					
8438/B001/R2122/Wall Linings Internal/S6				<b>No Asbestos Detected</b>		
Ceiling Structures/Linings	Flat AC Sheeting					
8438/B001/R2059/Ceiling Structures/Linings/S4				<b>No Asbestos Detected</b>		
<b>B001 - R2123 - External Movement (98.7 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
8438/B001/R2059/Ceiling Structures/Linings/S4				<b>No Asbestos Detected</b>		
<b>B001 - R2124 - Preparation/Printing (38.57 m2)</b>						
No Asbestos						
<b>B001 - R2125 - Clinic - Girls (12.54 m2)</b>						
No Asbestos						
<b>B001 - R2126 - Clinic - Boys (12.61 m2)</b>						
No Asbestos						
<b>B001 - R2127 - Cleaning Store - Distributed (2.37 m2)</b>						
No Asbestos						
<b>B001 - R2128 - Movement (24.9 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
	<b>B001 - R2129 - Access Student Shower/Toilet/Change (4.54 m2)</b>					
	No Asbestos					
	<b>B001 - R2130 - Staff - Toilet (3.51 m2)</b>					
	No Asbestos					
	<b>B001 - R2131 - Ancillary Staff (12.47 m2)</b>					
	No Asbestos					
	<b>B001 - R2132 - Leading Teacher (11.72 m2)</b>					
	No Asbestos					
	<b>B001 - R2133 - Office/Store (11.69 m2)</b>					
	No Asbestos					
	<b>B001 - R2134 - Student Reception (24.14 m2)</b>					
	No Asbestos					
	<b>B001 - R2135 - Office/Store (12.79 m2)</b>					
	No Asbestos					
	<b>B001 - R2136 - General Storeroom (13 m2)</b>					
	No Asbestos					
	<b>B001 - R2137 - Administration - Clerical (110.13 m2)</b>					
	No Asbestos					
	<b>B001 - R2138 - Principal Office (18.54 m2)</b>					
	No Asbestos					
	<b>B001 - R2139 - Public Reception (35.28 m2)</b>					
	No Asbestos					
	<b>B001 - R2140 - Distribution Board Cupboard (0.66 m2)</b>					Note: No inspection of live electrical installation.
	No Asbestos					
	<b>B001 - R2141 - Interview/Meeting (19 m2)</b>					
	No Asbestos					
	<b>B001 - R2142 - Staff - Toilet (3.35 m2)</b>					
	No Asbestos					
	<b>B001 - R2143 - Staff - Toilet (3.35 m2)</b>					
	No Asbestos					
	<b>B001 - R2144 - Deputy Principal Office (12.47 m2)</b>					
	No Asbestos					
	<b>B001 - R2145 - Deputy Principal Office (12.54 m2)</b>					
	No Asbestos					
	<b>B001 - R2146 - System Administrators Office (25.39 m2)</b>					
	No Asbestos					
	<b>B001 - R2147 - Special Learning Space (58.34 m2)</b>					
	No Asbestos					
	<b>B001 - R2148 - Special Learning Space (58.26 m2)</b>					
	No Asbestos					
	<b>B001 - R2149 - Access Student Shower/Toilet/Change (21.03 m2)</b>					
	No Asbestos					
	<b>B001 - R2150 - Special Learning Space (20.88 m2)</b>					
	No Asbestos					
	<b>B001 - R2151 - Laundry (8.26 m2)</b>					
	No Asbestos					
	<b>B001 - R2152 - Computer Learning Space (64.68 m2)</b>					
	No Asbestos					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B001 - R2153 - Computer Learning Space (64.14 m2)</b>						
No Asbestos						
<b>B001 - R2154 - Distribution Board Cupboard (0.29 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B001 - R2155 - Stairs (3.81 m2)</b>						
No Asbestos						
<b>B001 - R2156 - Sport Equipment Store (15.08 m2)</b>						
No Asbestos						
<b>B001 - R2157 - External Movement (3.37 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8438/B001/R2059/Ceiling Structures/Linings/S4					<b>No Asbestos Detected</b>
<b>B001 - R2158 - General Storeroom (14.8 m2)</b>						
No Asbestos						
<b>B001 - R2159 - Stairs (3.82 m2)</b>						
No Asbestos						
<b>B001 - R2160 - External Movement (21.69 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8438/B001/R2059/Ceiling Structures/Linings/S4					<b>No Asbestos Detected</b>
<b>B001 - R2161 - External Movement (415.18 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8438/B001/R2059/Ceiling Structures/Linings/S4					<b>No Asbestos Detected</b>
Wall Linings Internal	Compressed AC Sheet					
	8438/B001/R2059/Ceiling Structures/Linings/S4					<b>No Asbestos Detected</b>
<b>B001 - R2162 - External Movement (51.58 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8438/B001/R2059/Ceiling Structures/Linings/S4					<b>No Asbestos Detected</b>
Wall Linings Internal	Compressed AC Sheet					
	8438/B001/R2122/Wall Linings Internal/S6					<b>No Asbestos Detected</b>
<b>B001 - R2163 - Resources Store (25.46 m2)</b>						
No Asbestos						
<b>B001 - R2164 - Cleaning Store - Distributed (3.76 m2)</b>						
No Asbestos						
<b>B001 - R2165 - External Stairs (6.64 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8438/B001/R2059/Ceiling Structures/Linings/S4					<b>No Asbestos Detected</b>
<b>B001 - R2166 - Other-Vacant (5.71 m2)</b>						
No Asbestos						
<b>B001 - R2167 - External Stairs (2.8 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8438/B001/R2059/Ceiling Structures/Linings/S4					<b>No Asbestos Detected</b>
<b>B001 - R2168 - External Stairs (2.18 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	8438/B001/R2059/Ceiling Structures/Linings/S4					<b>No Asbestos Detected</b>
<b>B001 - R2169 - Other-Vacant (6.16 m2)</b>						
No Asbestos						
<b>B001 - R2170 - External Stairs (4.42 m2)</b>						
No Asbestos						
<b>B001 - R2171 - External Stairs (4.45 m2)</b>						
No Asbestos						
<b>B001 - R2172 - External Movement (10.29 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B001 - R2173 - Movement (5.38 m2)</b>						
No Asbestos						
<b>B001 - R2175 - Staff Study (28.19 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R2176 - Staff Study (9.39 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R2178 - Handwashing Facilities (0.17 m2)</b>						
No Asbestos						
<b>B001 - R2179 - Staff Study (22.9 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R2180 - Tea Room (2.17 m2)</b>						
No Asbestos						
<b>B001 - R2181 - Music Store (5.78 m2)</b>						
No Asbestos						
<b>B001 - R2182 - Music Store (6.2 m2)</b>						
No Asbestos						
<b>B001 - R2183 - Handwashing Facilities (0.26 m2)</b>						
No Asbestos						
<b>B001 - R2184 - Practice/Seminar (12.43 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R2185 - Practice/Seminar (12.5 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R2186 - General Learning Space (51.65 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R2187 - General Learning Space (51.65 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R2188 - General Learning Space (51.79 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R2189 - Interview/Office - Type 1 (15.45 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R2190 - Handwashing Facilities (0.2 m2)</b>						
No Asbestos						
<b>B001 - R2191 - Plant (0.08 m2)</b>						
No Asbestos						
<b>B001 - R2192 - Tea Room (3.49 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result
No Asbestos						
<b>B001 - R2193 - Staff Study (20.94 m2)</b>						
No Asbestos						
<b>B001 - R2194 - Plant (0.1 m2)</b>						
No Asbestos						
<b>B001 - R2195 - External Movement (11.86 m2)</b>						
No Asbestos						
<b>B001 - R2196 - Handwashing Facilities (0.18 m2)</b>						
No Asbestos						
<b>B001 - R2197 - External Movement (581.39 m2)</b>						
EDB cupboard wall lining	Flat AC Sheeting	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2197/EDB cupboard wall lining/S17						<b>Chrysotile (white asbestos)</b>
<b>B001 - R2198 - General Storeroom (7.8 m2)</b>						
No Asbestos						
<b>B001 - R2199 - General Storeroom (5.93 m2)</b>						
No Asbestos						
<b>B001 - R2200 - Plant (0.1 m2)</b>						
No Asbestos						
<b>B001 - R2201 - Laboratory L.S. (89.22 m2)</b>						
No Asbestos						
<b>B001 - R2202 - Preparation (25.04 m2)</b>						
No Asbestos						
<b>B001 - R2203 - Laboratory L.S. (89.36 m2)</b>						
No Asbestos						
<b>B001 - R3008 - Staff - Toilet (3.69 m2)</b>						
No Asbestos						
<b>B001 - R3009 - Distribution Board Cupboard (0.66 m2)</b>						
						Note: No inspection of live electrical installation.
Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B001 - R3017 - Staff - Toilet (3.64 m2)</b>						
Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B001 - R3018 - Distribution Board Cupboard (0.62 m2)</b>						
						Note: No inspection of live electrical installation.
No Asbestos						
<b>B001 - R3025 - Staff Kitchen (16.43 m2)</b>						
No Asbestos						
<b>B001 - R3026 - Resources Store (8.48 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10						<b>Chrysotile (white asbestos)</b>
<b>B001 - R3028 - General Learning Space (51.72 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10						<b>Chrysotile (white asbestos)</b>
<b>B001 - R3029 - Staff - Toilet (3.57 m2)</b>						
No Asbestos						
<b>B001 - R3030 - Other-Vacant (0.63 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B001 - R3031 - Staff Study (25.43 m2)</b>						
No Asbestos						
<b>B001 - R3033 - General Learning Space (64.88 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R3035 - General Learning Space (51.65 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R3036 - Resources Store (12.23 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R3037 - Interview/Office - Type 1 (10.45 m2)</b>						
No Asbestos						
<b>B001 - R3038 - Staff - Toilet (3.6 m2)</b>						
No Asbestos						
<b>B001 - R3039 - Other-Vacant (0.63 m2)</b>						
Wall Linings Internal	Flat AC Sheeting	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2015/Wall Linings Internal/S7					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B001 - R3040 - General Learning Space (52.51 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B001 - R3042 - Cleaning Store - Distributed (5.88 m2)</b>						
No Asbestos						
<b>B001 - R3043 - Toilets-Boys (38.41 m2)</b>						
Service duct roof	Flat AC Sheeting					<b>No Asbestos Detected</b>
8438/B001/R3043/Service duct roof/S13						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R3046/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B001 - R3044 - Change (38.56 m2)</b>						
No Asbestos						
<b>B001 - R3045 - Movement (13.7 m2)</b>						
No Asbestos						
<b>B001 - R3046 - Archive Store (5.88 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R3046/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Service duct roof	Flat AC Sheeting					<b>No Asbestos Detected</b>
8438/B001/R3043/Service duct roof/S13						
<b>B001 - R3047 - Toilets-Girls (38.43 m2)</b>						
Service duct roof	Flat AC Sheeting					<b>No Asbestos Detected</b>
8438/B001/R3043/Service duct roof/S13						
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R3046/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
<b>B001 - R3048 - Change (38.56 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R3046/Partition Walls (Cubicles)/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B001 - R3049 - Movement (13.68 m2)</b>						
No Asbestos						
<b>B001 - R3050 - Interview/Office - Type 1 (14.6 m2)</b>						
No Asbestos						
<b>B001 - R3051 - External Stairs (4.54 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
8438/B001/R2059/Ceiling Structures/Linings/S4				<b>No Asbestos Detected</b>		
<b>B001 - R3052 - General Learning Space (57.9 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R3053 - General Learning Space (57.83 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R3056 - External Stairs (4.59 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
8438/B001/R2059/Ceiling Structures/Linings/S4				<b>No Asbestos Detected</b>		
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R3057 - General Learning Space (64.95 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R3058 - Staff Study (25.25 m2)</b>						
No Asbestos						
<b>B001 - R3059 - General Learning Space (58.34 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R3060 - General Learning Space (58.26 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R3061 - External Stairs (4.62 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
8438/B001/R2059/Ceiling Structures/Linings/S4				<b>No Asbestos Detected</b>		
<b>B001 - R3062 - Staff Study (104.01 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	104m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10				<b>Chrysotile (white asbestos)</b>		
<b>B001 - R3063 - External Stairs (4.63 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
8438/B001/R2059/Ceiling Structures/Linings/S4				<b>No Asbestos Detected</b>		
<b>B001 - R3064 - Stairs (4.62 m2)</b>						
No Asbestos						
<b>B001 - R3065 - Stairs (4.65 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
---------	----------------------	--------	--------------------	--------------------	-------------	------------------

Sample No

Test Result

**B001 - R3066 - External Movement (10.14 m2)**

No Asbestos

**B001 - R3067 - Movement (5.38 m2)**

No Asbestos

**B001 - R3069 - Commonroom (117.41 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	122m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	

**B001 - R3070 - Resources Store (12.23 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	

**B001 - R3071 - Independent Learning Space (25.5 m2)**

No Asbestos

**B001 - R3072 - Handwashing Facilities (0.2 m2)**

No Asbestos

**B001 - R3073 - General Learning Space (35.46 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	

**B001 - R3074 - Handwashing Facilities (0.18 m2)**

No Asbestos

**B001 - R3075 - Handwashing Facilities (0.19 m2)**

No Asbestos

**B001 - R3076 - External Movement (10.96 m2)**

No Asbestos

**B001 - R3077 - General Storeroom (8.48 m2)**

No Asbestos

**B001 - R3078 - Resources Store (23.11 m2)**

No Asbestos

**B001 - R3079 - Handwashing Facilities (0.2 m2)**

No Asbestos

**B001 - R3080 - Staff Study (56.76 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8438/B001/R2088/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	

**B001 - R3081 - Tea Room (1.17 m2)**

No Asbestos

**B001 - R3082 - External Movement (297.13 m2)**

No Asbestos

**B001 - R3083 - External Movement (2.54 m2)**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B002 - Library - 1991 - Brick/Steel Frame (Brick/Steel Frame)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B002 - R0001 - Seminar (11.8 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0002 - Library Administration (12.01 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0003 - Librarian (12.01 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0004 - Library Administration (35.92 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0005 - Audio Visual Workroom (24.79 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0006 - Staff - Toilet (4.08 m2)**

No Asbestos

**B002 - R0007 - Cleaning Store - Distributed (1.71 m2)**

No Asbestos

**B002 - R0008 - Distribution Board Cupboard (0.54 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B002 - R0009 - Main Entry (14.79 m2)**

No Asbestos

**B002 - R0011 - Seminar (12.18 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0012 - Main Area (374.44 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R0013 - Stairs (7.06 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R9001 - Office/Store (25.29 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R9002 - Archive Store (13.37 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R9003 - Senior Study (130.34 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B002 - R9004 - Stairs (0.86 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B003 - Multi Purpose Facilities - 1990 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B003 - M0001 - Movement (136.82 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B003 - M0005 - Stairs (5.2 m2)**

No Asbestos

**B003 - M0006 - Stairs (5.77 m2)**

No Asbestos

**B003 - M1001 - Performance Store (5.84 m2)**

No Asbestos

**B003 - R0001 - Movement (3.91 m2)**

No Asbestos

**B003 - R0002 - Chair Store (27.58 m2)**

No Asbestos

**B003 - R0003 - Cleaning Store - Distributed (2.12 m2)**

No Asbestos

**B003 - R0004 - Access Staff Shower/Toilet (4.22 m2)**

No Asbestos

**B003 - R0005 - Movement (24.08 m2)**

Electrical Mounting Board	Packing	8438/B003/R0005/Electrical Mounting Board/S15	<b>No Asbestos Detected</b>
---------------------------	---------	---	-----------------------------

**B003 - R0006 - Distribution Board Cupboard (1.24 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B003 - R0009 - Staff Kitchen (12.45 m2)**

No Asbestos

**B003 - R0010 - Uniform Shop (18.57 m2)**

No Asbestos

**B003 - R0011 - Multi-Purpose Space (477.13 m2)**

No Asbestos

**B003 - R0013 - Sport Equipment Store (12.77 m2)**

No Asbestos

**B003 - R0014 - Movement (6.15 m2)**

No Asbestos

**B003 - R0017 - Movement (6.03 m2)**

No Asbestos

**B003 - R0018 - Sport Equipment Store (7.16 m2)**

No Asbestos

**B003 - R0019 - General Storeroom (5.63 m2)**

No Asbestos

**B003 - R0020 - External Movement (12.1 m2)**

No Asbestos

**B003 - R0021 - External Movement (10.95 m2)**

No Asbestos

**B003 - R0024 - External Movement (46.2 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result
						No Asbestos
						<b>B003 - R0025 - Stairs (0.76 m2)</b>
						No Asbestos
						<b>B003 - R0027 - Stairs (5.95 m2)</b>
						No Asbestos
						<b>B003 - R0032 - External Movement (3.31 m2)</b>
						No Asbestos
						<b>B003 - R0033 - Toilet - Lobby (1.44 m2)</b>
						No Asbestos
						<b>B003 - R0034 - Change (30.32 m2)</b>
						No Asbestos
						<b>B003 - R0035 - External Movement (18.46 m2)</b>
						No Asbestos
						<b>B003 - R0036 - Toilet - Lobby (4.28 m2)</b>
						No Asbestos
						<b>B003 - R0037 - Toilets-Boys (12.31 m2)</b>
						No Asbestos
						<b>B003 - R0038 - Toilet - Lobby (6.26 m2)</b>
						No Asbestos
						<b>B003 - R0039 - Toilets-Girls (18.54 m2)</b>
						No Asbestos
						<b>B003 - R0040 - Movement (1.66 m2)</b>
						No Asbestos
						<b>B003 - R0041 - Stairs (5.04 m2)</b>
						No Asbestos
						<b>B003 - R0042 - Toilet - Lobby (1.42 m2)</b>
						No Asbestos
						<b>B003 - R0043 - Change (30.34 m2)</b>
						No Asbestos
						<b>B003 - R0044 - External Movement (46.18 m2)</b>
						No Asbestos
						<b>B003 - R0045 - Stage (90.36 m2)</b>
						No Asbestos
						<b>B003 - R0046 - Control Room (1.53 m2)</b>
						No Asbestos
						<b>B003 - R0047 - Music Learning Space (63.44 m2)</b>
						No Asbestos
						<b>B003 - R0048 - Performance Store (12.23 m2)</b>
						No Asbestos
						<b>B003 - R0049 - Sport Equipment Store (12.39 m2)</b>
						No Asbestos
						<b>B003 - R0050 - Movement (5.1 m2)</b>
						No Asbestos
						<b>B003 - R1001 - Stairs (2.88 m2)</b>
						No Asbestos
						<b>B003 - R1002 - Performance Store (28.47 m2)</b>
						No Asbestos
						<b>B003 - R1003 - Performance Store (19.5 m2)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B003 - R1004 - Plant (1.72 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B004 - Storage - 2002 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B004 - R0001 - General Storeroom (61.95 m2)**

No Asbestos

**B004 - R0002 - General Storeroom (40.76 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### B00E - Technological & Applied Studies/Art - 2004 - Brick/Veneer (Brick/Veneer)

#### Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

#### Interior

##### B00E - R0001 - Design L.S. (59.24 m2)

No Asbestos

##### B00E - R0002 - Design L.S. (59.32 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

##### B00E - R0003 - Distribution Board Cupboard (1.26 m2)

Note: No inspection of live electrical installation.

No Asbestos

##### B00E - R0004 - Staff - Toilet (5.76 m2)

No Asbestos

##### B00E - R0005 - Cleaning Store - Distributed (3.45 m2)

No Asbestos

##### B00E - R0006 - Movement (27.37 m2)

No Asbestos

##### B00E - R0007 - Wood Technology L.S. (119.87 m2)

No Asbestos

##### B00E - R0008 - Materials Store (41.02 m2)

No Asbestos

##### B00E - R0009 - Dust Extraction Space (24.85 m2)

No Asbestos

##### B00E - R0010 - Wood Technology L.S. (119.55 m2)

No Asbestos

##### B00E - R0011 - Materials Store (29.03 m2)

No Asbestos

##### B00E - R0012 - Metal Technology L.S. (119.86 m2)

No Asbestos

##### B00E - R0013 - Materials Store (42.72 m2)

No Asbestos

##### B00E - R0015 - External Movement (127.84 m2)

No Asbestos

##### B00E - R0016 - Stairs (9.44 m2)

No Asbestos

##### B00E - R0017 - Wood Technology Bay (84.53 m2)

No Asbestos

##### B00E - R0018 - Welding Area (12.51 m2)

No Asbestos

##### B00E - R0019 - Materials Store (20.09 m2)

No Asbestos

##### B00E - R0020 - General Storeroom (1.82 m2)

No Asbestos

##### B00E - R0021 - External Movement (27.9 m2)

No Asbestos

##### B00E - R0022 - Stairs (10.58 m2)

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00E - R1001 - Movement (44.25 m2)</b>						
No Asbestos						
<b>B00E - R1002 - Cleaning Store - Distributed (5.83 m2)</b>						
No Asbestos						
<b>B00E - R1003 - Kiln Space (10.2 m2)</b>						
No Asbestos						
<b>B00E - R1005 - Workshop (98.45 m2)</b>						
No Asbestos						
<b>B00E - R1006 - Resources Store (23.74 m2)</b>						
No Asbestos						
<b>B00E - R1007 - General Storeroom (19.02 m2)</b>						
No Asbestos						
<b>B00E - R1008 - Art Learning Space (58.93 m2)</b>						
No Asbestos						
<b>B00E - R1009 - Computer Learning Space (59.16 m2)</b>						
Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found						
<b>B00E - R1010 - Pottery Store (15.55 m2)</b>						
No Asbestos						
<b>B00E - R1011 - Workshop (101.02 m2)</b>						
No Asbestos						
<b>B00E - R1012 - Resources Store (23.94 m2)</b>						
No Asbestos						
<b>B00E - R1013 - Resources Store (19.15 m2)</b>						
No Asbestos						
<b>B00E - R1014 - Art Learning Space (59.01 m2)</b>						
No Asbestos						
<b>B00E - R1015 - Art Learning Space (59.24 m2)</b>						
No Asbestos						
<b>B00E - R1016 - External Movement (114.52 m2)</b>						
No Asbestos						
<b>B00E - R1017 - Stairs (20.24 m2)</b>						
No Asbestos						
<b>B00E - R1018 - Stairs (20.2 m2)</b>						
No Asbestos						
<b>B00E - R1019 - Distribution Board Cupboard (1.26 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00E - R1020 - Darkroom Space (2.39 m2)</b>						
No Asbestos						
<b>B00E - R1021 - Dark Room (24.45 m2)</b>						
No Asbestos						
<b>B00E - R9001 - Movement (3.32 m2)</b>						
No Asbestos						
<b>B00E - R9002 - Stairs (6.86 m2)</b>						
No Asbestos						
<b>B00E - R9003 - Other-Vacant (15.87 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00X - Building Services - 2000 - Concrete (Concrete)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00X - R0001 - Plant (14.25 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00Y - Storage - 2000 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00Y - R0001 - Machine Storage (25.96 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00Z - Storage - 2000 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids            No Asbestos Found

Underfloor Voids        No Asbestos Found

**Interior**

**B00Z - R0001 - Garden Store Room (7.6 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

**OS 710 - D10928 - Home Science/Pantry/Laundry : Placement Date - 30/06/1995**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		14.4 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2

#### R2 - Food Technology L.S.

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		73 m2

#### R3 - Laundry

Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2
---------	---------------	------------------	--	------

**OS 720 - D10940 - Science Laboratory/Prep Room : Placement Date - 30/06/1995**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		17.28 m2

### Interior

#### R1 - Laboratory L.S.

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		90 m2

#### R2 - Preparation

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		19 m2

**OS 601 - D11466 - Learning Unit - Standard/Withdrawal : Placement Date - 15/06/2001**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2

#### R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		55 m2

#### R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2
---------	---------------	------------------	--	-------

**OS 601 - D11804 - Learning Unit - Standard/Withdrawal : Placement Date - 25/02/1999**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 601 - D14961 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995</b>						
<b>Exterior</b>						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017