


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Peel High School (8525)
Region : New England
State Electorate : Tamworth
Local Government Area : Tamworth

Initial Survey : Noel Arnold & Associates : 25 - Mar - 2008
Reviewed By : Greencap-NAA : 07 - May - 2015

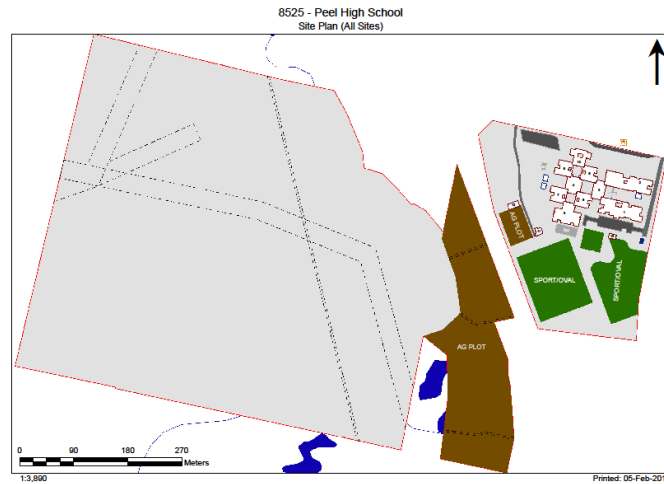

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Art/Technological & Applied Studies - 1978 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B001 - R0001 - Design L.S. (63.9 m2)**

No Asbestos

B001 - R0002 - Movement (8.87 m2)

No Asbestos

B001 - R0003 - Materials Technology L.S. (80.11 m2)

Ceiling Structures/Linings	Flat AC Sheeting	81m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B001 - R0004 - Materials Technology L.S. (104.39 m2)

Ceiling Structures/Linings	Flat AC Sheeting	105m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B001 - R0005 - Materials Store (32.76 m2)

Ceiling Structures/Linings	Flat AC Sheeting	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B001 - R0006 - Staff Study (24.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B001 - R0011 - Materials Technology L.S. (65.07 m2)

Ceiling Structures/Linings	Flat AC Sheeting	66m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B001 - R0012 - Distribution Board Cupboard (0.91 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

Electrical Mounting Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0012/Electrical Mounting Board/S9				Chrysotile (white asbestos)	

B001 - R0013 - Resource/Project Store (15.98 m2)

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B001 - R0014 - Seminar/Technology Space (24.56 m2)

No Asbestos

B001 - R0015 - Design L.S. (63.9 m2)

No Asbestos

B001 - R0016 - Workshop (49.35 m2)

No Asbestos

B001 - R0017 - Kiln Space (8.89 m2)

No Asbestos

B001 - R0018 - Art Learning Space (62.74 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B001 - R0019 - Staff Study (14.76 m2)						
Window beading	Caulking					
	8525/B001/R0019/Window beading/S11					No Asbestos Detected
B001 - R0020 - Bulk Store (20.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0026/Wall Linings Internal/S10					Chrysotile (white asbestos)
B001 - R0021 - Art Learning Space (65.07 m2)						
No Asbestos						
B001 - R0022 - Movement (9.36 m2)						
No Asbestos						
B001 - R0023 - Toilets-Boys (22.92 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	23m2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B011/R0005/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)
B001 - R0024 - Computer Learning Space (64.35 m2)						
No Asbestos						
B001 - R0025 - Senior Study (31.19 m2)						
No Asbestos						
B001 - R0026 - Cleaning Store - Distributed (4.92 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	50m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0026/Wall Linings Internal/S10					Chrysotile (white asbestos)
B001 - R0027 - Movement (73.43 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	74m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	8525/B002/R0032/Floor Coverings Res/Textile/S7					No Asbestos Detected
B001 - R0028 - Art Learning Space (63.4 m2)						
No Asbestos						
B001 - R0029 - Distribution Board Cupboard (0.45 m2)						
Electrical Mounting Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Live.					
Electrical Backing Board	Resinous Board	2Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0012/Electrical Mounting Board/S9					Chrysotile (white asbestos)
B001 - R0030 - Movement (164.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	165m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
B001 - R0031 - External Movement (8.07 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B001 - R0032 - Toilets-Disabled (13.89 m2)

No Asbestos

B001 - R0033 - Outdoor Workshop (98.01 m2)

No Asbestos Found

B001 - R0034 - Metal Technology Bay (165.68 m2)

Ceiling Structures/Linings	Flat AC Sheeting	166m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B001 - R0035 - Movement (144.09 m2)

No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B002 - Science/Technological & Applied Studies - 1978 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting 8525/B004/Gable Verge Lining/S12	40m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting 8525/B001/R0030/Ceiling Structures/Linings/S6	100m2	North facing, South facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
All window beading	Caulking 8525/B001/R0019/Window beading/S11	No Asbestos Detected				
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B002 - R0001 - Laboratory L.S. (91.34 m2)**

No Asbestos

B002 - R0002 - Movement (9.12 m2)

No Asbestos

B002 - R0003 - Laboratory L.S. (91.38 m2)

No Asbestos

B002 - R0004 - Preparation (23.5 m2)

No Asbestos

B002 - R0005 - Laboratory L.S. (91.75 m2)

No Asbestos

B002 - R0006 - Preparation (48.6 m2)

No Asbestos

B002 - R0007 - Laboratory L.S. (91.44 m2)

No Asbestos

B002 - R0008 - Distribution Board Cupboard (0.9 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting 8525/B001/R0030/Ceiling Structures/Linings/S6	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	--------------	--------------------	---------	--

Electrical Mounting Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	----------------	-------	-------	--------------------	---------	--------------------

Assumed Asbestos - Live.**B002 - R0009 - Staff Study (36.31 m2)**

No Asbestos

B002 - R0010 - Apparatus Store (26.25 m2)

No Asbestos

B002 - R0012 - Cleaning Store - Distributed (6.26 m2)

No Asbestos

B002 - R0013 - Laboratory L.S. (91.35 m2)

No Asbestos

B002 - R0014 - Preparation (48.6 m2)

No Asbestos

B002 - R0015 - Laboratory L.S. (91.34 m2)

No Asbestos

B002 - R0016 - Preparation (23.4 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B002 - R0017 - Movement (156.94 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	157m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B002 - R0018 - Food Technology L.S. (101.25 m2)						
Window beading	Caulking					
8525/B001/R0019/Window beading/S11					No Asbestos Detected	
B002 - R0019 - Staff Study (14.87 m2)						
No Asbestos						
B002 - R0020 - Senior Study (64.08 m2)						
Window beading	Caulking					
8525/B001/R0019/Window beading/S11					No Asbestos Detected	
B002 - R0021 - General Storeroom (2.75 m2)						
No Asbestos						
B002 - R0022 - Distribution Board Cupboard (0.77 m2)						
				Note: No inspection of live electrical installation.		
Electrical Mounting Board	Resinous Board	1Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0012/Electrical Mounting Board/S9					Assumed Asbestos - Live.	
Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0012/Electrical Mounting Board/S9					Chrysotile (white asbestos)	
B002 - R0024 - General Storeroom (2.83 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8525/B002/R0032/Floor Coverings Res/Textile/S7					No Asbestos Detected	
B002 - R0025 - Resource/Project Store (10.82 m2)						
Window beading	Caulking					
8525/B001/R0019/Window beading/S11					No Asbestos Detected	
B002 - R0026 - Design L.S. (63.07 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8525/B002/R0032/Floor Coverings Res/Textile/S7					No Asbestos Detected	
B002 - R0027 - Toilets-Girls (16.19 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B011/R0005/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	
B002 - R0029 - Food Technology L.S. (101.25 m2)						
Window beading	Caulking					
8525/B001/R0019/Window beading/S11					No Asbestos Detected	
B002 - R0030 - Food/Research Space (16.05 m2)						
Window beading	Caulking					
8525/B001/R0019/Window beading/S11					No Asbestos Detected	
B002 - R0032 - Laundry (16.05 m2)						
No Asbestos						
B002 - R0034 - External Movement (127.65 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	128m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B002 - R0035 - Apparatus Store (15.08 m2)						
No Asbestos						
B002 - R0036 - Chemical Store (30.74 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B002 - R0037 - Store (13.96 m2)

Window beading	Caulking					
	8525/B001/R0019/Window beading/S11					No Asbestos Detected

B002 - R0038 - Movement (89.43 m2)

No Asbestos Found

B002 - R0039 - Student Kitchen (25.64 m2)

Window beading	Caulking					
	8525/B001/R0019/Window beading/S11					No Asbestos Detected

B002 - R0040 - Outdoor Workshop (37.17 m2)

Window beading	Caulking	10m	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8525/B001/R0012/Electrical Mounting Board/S9					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B003 - Music/Tiered Learning - 1978 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
All window beading	Caulking					No Asbestos Detected
	8525/B001/R0019/Window beading/S11					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B003 - R0001 - Distribution Board Cupboard (1.1 m2)** Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Live.

B003 - R0002 - Distribution Board Cupboard (0.6 m2) Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Live.

B003 - R0003 - Movement (19.64 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8525/B003/R0003/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B003 - R0004 - Music Learning Space (89.74 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8525/B003/R0003/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B003 - R0005 - Tiered Learning Area (185.27 m2)

No Asbestos

B003 - R0006 - Control Room (5.07 m2)

Recently Modified Space Requires Inspection

B003 - R0007 - Sport Equipment Store (2.68 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B003 - R0008 - Staff - Toilet (9.33 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B011/R0005/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B003 - R0009 - Staff - Toilet (9.1 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B011/R0005/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B003 - R0010 - Tiered Learning Store (2.57 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B003 - R0011 - Plant (12.42 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
Evaporative cooler & gas heater	Encapsulated Insulation material within unit	2Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - ACM encased within units.						
B003 - R0012 - Toilets-Boys (20.6 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B011/R0005/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B003 - R0013 - General Storeroom (25.88 m2)						
Ceiling Structures/Linings	Vermiculite					
8525/B003/R0003/Ceiling Structures/Linings/S4					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B003 - R0014 - Cleaning Store - Distributed (1.24 m2)						
No Asbestos						
B003 - R0015 - Music Store (8.93 m2)						
Ceiling Structures/Linings	Vermiculite					
8525/B003/R0003/Ceiling Structures/Linings/S4					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B003 - R0016 - Movement (35.98 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B003 - R0017 - Movement (36.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	37m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B003 - R0018 - Movement (64.44 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	65m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B003 - R0019 - Stairs (6.13 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height restricted						
B003 - R1001 - Staff Study (16.69 m2)						
No Asbestos						
B003 - R1002 - Movement (12.51 m2)						
No Asbestos						
B003 - R1003 - Music Store (17.04 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8525/B003/R1003/Floor Coverings Res/Textile/S5					No Asbestos Detected	
B003 - R1004 - Music Learning Space (69.94 m2)						
No Asbestos						
B003 - R1005 - Resources (25.41 m2)						
No Asbestos						
B003 - R1006 - Stairs (7.92 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B004 - Library - 1978 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Compressed AC Sheet	3m	Tiled roof at SE corner of 4R0007	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8525/B004/Gable Verge Lining/S12					Chrysotile (white asbestos)
All window beading	Caulking					No Asbestos Detected
	8525/B001/R0019/Window beading/S11					
Awnings	Flat AC Sheeting	10m2	Southeast corner of building	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

Interior**B004 - M0001 - Seminar (9.93 m2)**

No Asbestos

B004 - M0002 - Main Area (110.45 m2)

Ceiling Structures/Linings	Flat AC Sheeting	110.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B004 - M0003 - General Storeroom (6.71 m2)

No Asbestos

B004 - M0004 - General Storeroom (6.71 m2)

No Asbestos

B004 - M0005 - Staff Study (9.93 m2)

No Asbestos

B004 - M0006 - Staff Study (9.93 m2)

No Asbestos

B004 - M0007 - Plant (60.74 m2)

Ceiling Structures/Linings	Flat AC Sheeting	61m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

Various plant, equipment & ducting.	Gasket & insulation	200m	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-------------------------------------	---------------------	------	------------	--------------------	---------	--------------------

Assumed Asbestos - Live equipment.**B004 - M0008 - Seminar (9.93 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B004 - R0001 - Main Area (259.99 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8525/B003/R0003/Ceiling Structures/Linings/S4					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B004 - R0002 - Distribution Board Cupboard (5.63 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Live.

Electrical Backing Board	Resinous Board	2Unit	North & east	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0012/Electrical Mounting Board/S9					Chrysotile (white asbestos)

B004 - R0003 - Movement (55.84 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	56m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B004 - R0004 - Entry (15.78 m2)						
No Asbestos						
B004 - R0005 - Staff - Toilet (2.97 m2)						
No Asbestos						
B004 - R0006 - Workroom (42.48 m2)						
No Asbestos						
B004 - R0007 - Audio Visual Workroom (45.67 m2)						
No Asbestos						
B004 - R0008 - Librarian (13.7 m2)						
No Asbestos						
B004 - R0009 - Staff - Toilet (3.21 m2)						
No Asbestos						
B004 - R0010 - Movement (55.08 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	56m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B004 - R0011 - Cleaning Store - Distributed (2.36 m2)						
No Asbestos						
B004 - R0012 - Workroom (15.52 m2)						
No Asbestos						
B004 - R0013 - Movement (40.39 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	41m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B005 - Multi Purpose Facilities - 1978 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior**B005 - R0001 - Toilets-Girls (33.46 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B011/R0005/Partition Walls (Cubicles)/S1			Chrysotile (white asbestos)		
Wall Linings Internal	Flat AC Sheeting	100m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0026/Wall Linings Internal/S10			Chrysotile (white asbestos)		

B005 - R0002 - Cleaning Store - Distributed (9.05 m2)

Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B005 - R0003 - Shower/Change (58.72 m2)

Ceiling Structures/Linings	Flat AC Sheeting	59m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	56m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B011/R0005/Partition Walls (Cubicles)/S1			Chrysotile (white asbestos)		
Wall Linings Internal	Flat AC Sheeting	200m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0026/Wall Linings Internal/S10			Chrysotile (white asbestos)		

B005 - R0004 - Sport Equipment Store (23.2 m2)

Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	100m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0026/Wall Linings Internal/S10			Chrysotile (white asbestos)		

B005 - R0005 - Cleaning Supplies Store (15.68 m2)

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	75m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0026/Wall Linings Internal/S10			Chrysotile (white asbestos)		

B005 - R0006 - Garden Store Room (14.63 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	75m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0026/Wall Linings Internal/S10			Chrysotile (white asbestos)		

B005 - R0007 - Chair Store (55 m2)

--	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	55m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	8525/B001/R0019/Window beading/S11					
B005 - R0008 - Shower/Change (58.4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	59m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	100m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0026/Wall Linings Internal/S10			Chrysotile (white asbestos)		
B005 - R0009 - Movement (10.94 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B005 - R0010 - Toilets-Boys (33.78 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	34m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B011/R0005/Partition Walls (Cubicles)/S1			Chrysotile (white asbestos)		
B005 - R0011 - General Storeroom (9.04 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B005 - R0012 - Staff - Toilet (6.55 m2)						
No Asbestos						
B005 - R0013 - Student Canteen (61.19 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	8525/B005/R0012/Floor Coverings Res/Textile/S3					
B005 - R0014 - Multi-Purpose Space (477.56 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	478m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B005 - R0015 - Movement (10.57 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Linings Internal	Flat AC Sheeting	2m2	Above exit door	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	8525/B001/R0026/Wall Linings Internal/S10			Chrysotile (white asbestos)		
B005 - R0017 - Stage (85.84 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	86m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	8525/B005/R0017/Floor Coverings Res/Textile/S13				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive/underlay Vinyl tile.					
	8525/B005/R0017/Floor Coverings Res/Textile/S14				No Asbestos Detected	
Electrical Mounting Board	Resinous Board	1Unit	Northeast	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Equipment live & inaccessible.						
B005 - R0018 - Movement (190.67 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	191m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Electrical Mounting Board	Resinous Board	2Unit	Northeast	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled live.						
Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0012/Electrical Mounting Board/S9				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B006 - General Learning - 1978 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	40m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B004/Gable Verge Lining/S12				Chrysotile (white asbestos)	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
All window beading.	Caulking					
	8525/B001/R0019/Window beading/S11				No Asbestos Detected	

Interior**B006 - R0001 - Toilets-Girls (15.24 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

Partition Walls (Cubicles)	Compressed AC Sheet	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B011/R0005/Partition Walls (Cubicles)/S1				Chrysotile (white asbestos)	

B006 - R0002 - Movement (4.8 m2)

No Asbestos

B006 - R0003 - General Learning Space (51.48 m2)

No Asbestos

B006 - R0004 - General Learning Space (51.13 m2)

No Asbestos

B006 - R0005 - General Learning Space (51.48 m2)

No Asbestos

B006 - R0006 - Movement (4.8 m2)

No Asbestos

B006 - R0007 - Staff Study (31.86 m2)

No Asbestos

B006 - R0008 - Distribution Board Cupboard (0.79 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	2Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	----------------	-------	--------------	--------------------	---------	--------------------

Assumed Asbestos - Electrically live -Not sampled.**B006 - R0009 - Movement (12.47 m2)**

No Asbestos

B006 - R0010 - Resources (33.94 m2)

No Asbestos

B006 - R0011 - Secure Storeroom (3.97 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

Wall Linings Internal	Flat AC Sheeting	40m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0026/Wall Linings Internal/S10				Chrysotile (white asbestos)	

B006 - R0012 - General Learning Space (50.91 m2)

No Asbestos

B006 - R0013 - Study Space (73.06 m2)

Ceiling Structures/Linings	Flat AC Sheeting	74m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B006 - R0014 - Movement (137.76 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	138m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B007 - General Learning - 1978 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
All window beading	Caulking					
	8525/B001/R0019/Window beading/S11					No Asbestos Detected

Interior**B007 - R0001 - Cleaning Store - Distributed (2.34 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B007 - R0002 - Staff Study (24.21 m2)

No Asbestos

B007 - R0003 - Movement (5.03 m2)

No Asbestos

B007 - R0004 - General Learning Space (51.13 m2)

No Asbestos

B007 - R0005 - General Learning Space (50.41 m2)

No Asbestos

B007 - R0006 - General Learning Space (51.13 m2)

No Asbestos

B007 - R0007 - Movement (4.92 m2)

No Asbestos

B007 - R0008 - Toilets-Girls (14.69 m2)

Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8525/B011/R0005/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)

B007 - R0009 - General Learning Space (51.13 m2)

No Asbestos

B007 - R0010 - Secure Storeroom (4 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles					
	8525/B002/R0032/Floor Coverings Res/Textile/S7					No Asbestos Detected

B007 - R0011 - Resources Space (32.31 m2)

No Asbestos

B007 - R0012 - Movement (12.56 m2)

No Asbestos

B007 - R0013 - Distribution Board Cupboard (0.8 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Not sampled - Live.
Electrical Backing Board	Resinous Board	2Unit	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0012/Electrical Mounting Board/S9					Chrysotile (white asbestos)

B007 - R0014 - Staff - Toilet (4.68 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B011/R0005/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	
B007 - R0015 - Study Space (72.54 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	73m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B007 - R0016 - Movement (147.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	148m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B007 - R0017 - Movement (19.94 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B008 - General Learning - 1978 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	20m	West & East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B004/Gable Verge Lining/S12					Chrysotile (white asbestos)
All window beading.	Caulking 8525/B001/R0019/Window beading/S11					No Asbestos Detected

Interior**B008 - R0001 - General Learning Space (50.55 m2)**

No Asbestos

B008 - R0002 - Staff - Toilet (7.82 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B011/R0005/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)

B008 - R0003 - Toilets-Disabled (7.96 m2)

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B008 - R0004 - General Learning Space (51.12 m2)

No Asbestos

B008 - R0005 - Security Store (4.15 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	20m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0026/Wall Linings Internal/S10					Chrysotile (white asbestos)

B008 - R0006 - Resources Space (33.52 m2)

No Asbestos

B008 - R0007 - Movement (12.58 m2)

No Asbestos

B008 - R0008 - Distribution Board Cupboard (0.59 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	2Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Cannot sample - Live.					
Electrical Backing Board	Resinous Board	2Unit	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0012/Electrical Mounting Board/S9					Chrysotile (white asbestos)

B008 - R0009 - Staff - Toilet (4.13 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B011/R0005/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)

B008 - R0010 - Cleaning Store - Distributed (2.26 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B008 - R0011 - Staff Study (23.96 m2)						
No Asbestos						
B008 - R0012 - General Learning Space (50.76 m2)						
No Asbestos						
B008 - R0013 - General Learning Space (50.05 m2)						
No Asbestos						
B008 - R0014 - Movement (4.62 m2)						
No Asbestos						
B008 - R0015 - Study Space (71.63 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	72m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B008 - R0016 - Movement (4.62 m2)						
No Asbestos						
B008 - R0017 - Movement (154.17 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	155m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B008 - R0018 - Movement (19.93 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B009 - General Learning - 1978 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	40m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B004/Gable Verge Lining/S12				Chrysotile (white asbestos)	
Ceiling Voids - Raked Ceiling	No Asbestos Found					
All window beading	Caulking					No Asbestos Detected
	8525/B001/R0019/Window beading/S11					
Underfloor Voids	No Asbestos Found					

Interior**B009 - R0001 - General Learning Space (51.12 m2)**

No Asbestos

B009 - R0002 - Staff Study (32.14 m2)

No Asbestos

B009 - R0003 - Distribution Board Cupboard (0.92 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	21Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Cannot sample - Live					

Electrical Backing Board	Resinous Board	2Unit	East & west	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0012/Electrical Mounting Board/S9				Chrysotile (white asbestos)	

B009 - R0004 - Movement (12.11 m2)

No Asbestos

B009 - R0005 - General Storeroom (34.12 m2)

No Asbestos

B009 - R0006 - Security Store (3.29 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
	8525/B002/R0032/Floor Coverings Res/Textile/S7					No Asbestos Detected

B009 - R0007 - General Learning Space (50.76 m2)

No Asbestos

B009 - R0008 - Toilets-Boys (16.2 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B011/R0005/Partition Walls (Cubicles)/S1				Chrysotile (white asbestos)	

B009 - R0009 - General Learning Space (50.76 m2)

No Asbestos

B009 - R0010 - General Learning Space (50.61 m2)

No Asbestos

B009 - R0011 - Movement (4.7 m2)

No Asbestos

B009 - R0012 - Study Space (73.07 m2)

Ceiling Structures/Linings	Flat AC Sheeting	74m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B009 - R0013 - Movement (4.71 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B009 - R0014 - Movement (19.27 m2)

Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

8525/B001/R0030/Ceiling Structures/Linings/S6

Chrysotile (white asbestos)

B009 - R0015 - Movement (162.82 m2)

Ceiling Structures/Linings	Flat AC Sheeting	163m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-------	--------------	--------------------	---------	--------------------

8525/B001/R0030/Ceiling Structures/Linings/S6

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B010 - Administration - 1978 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	40m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B004/Gable Verge Lining/S12					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B005/R0007/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

Interior**B010 - R0001 - Duplicating Workroom (24.36 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	8525/B003/R1003/Floor Coverings Res/Textile/S5					No Asbestos Detected

B010 - R0002 - General Storeroom (18.55 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8525/B003/R1003/Floor Coverings Res/Textile/S5					No Asbestos Detected

B010 - R0003 - Deputy Principal Office (24.84 m2)

No Asbestos

B010 - R0004 - Cleaning Store - Distributed (3.19 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8525/B003/R1003/Floor Coverings Res/Textile/S5					No Asbestos Detected

B010 - R0005 - Leading Teacher (11.7 m2)

Ceiling Structures/Linings	Vermiculite					
	8525/B010/R0026/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B010 - R0006 - Interview/Office - Type 1 (15.42 m2)

Ceiling Structures/Linings	Vermiculite					
	8525/B010/R0026/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B010 - R0007 - Interview/Office - Type 1 (11.9 m2)

Ceiling Structures/Linings	Vermiculite					
	8525/B010/R0026/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B010 - R0008 - General Storeroom (6.46 m2)

Ceiling Structures/Linings	Vermiculite					
	8525/B010/R0026/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B010 - R0009 - Careers Advisers Office (12.39 m2)

Ceiling Structures/Linings	Vermiculite					
	8525/B010/R0026/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B010 - R0010 - Administration - Clerical (12.07 m2)

Ceiling Structures/Linings	Vermiculite					
	8525/B010/R0026/Ceiling Structures/Linings/S8					Limited Samples Taken
						Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B010 - R0011 - Main Switchroom (25.02 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority	
Sample No					Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)	
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)		
Electrical Mounting Board	Resinous Board	4Unit	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	
Assumed Asbestos - Live.							
Electrical Backing Board	Resinous Board	2Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)	
Assumed Asbestos - Live. Backing boards already labelled.							
B010 - R0012 - Clinic - Boys (12.07 m2)							
Floor Coverings Res/Textile	Vinyl Tiles						
8525/B003/R1003/Floor Coverings Res/Textile/S5					No Asbestos Detected		
B010 - R0013 - Clinic-Toilets (2.42 m2)							
No Asbestos							
B010 - R0014 - Clinic-Toilets (2.64 m2)							
No Asbestos							
B010 - R0015 - Clinic - Girls (13.16 m2)							
Floor Coverings Res/Textile	Vinyl Tiles						
8525/B003/R1003/Floor Coverings Res/Textile/S5					No Asbestos Detected		
B010 - R0016 - Toilets-Girls (7.01 m2)							
No Asbestos							
B010 - R0017 - Toilets-Boys (7.01 m2)							
No Asbestos							
B010 - R0018 - Principal Office (18.03 m2)							
No Asbestos							
B010 - R0019 - Interview/Office - Type 1 (11.21 m2)							
Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)	
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)		
B010 - R0020 - Administration - Clerical (29.51 m2)							
No Asbestos							
B010 - R0021 - Movement (2.58 m2)							
Ceiling Structures/Linings	Vermiculite						
8525/B010/R0026/Ceiling Structures/Linings/S8					Limited Samples Taken		
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works							
Floor Coverings Res/Textile	Vinyl Tiles						
8525/B003/R1003/Floor Coverings Res/Textile/S5					No Asbestos Detected		
B010 - R0022 - Darkroom Space (24.39 m2)							
Ceiling Structures/Linings	Flat AC Sheeting						
8525/B010/R0026/Ceiling Structures/Linings/S8					No Asbestos Detected		
B010 - R0023 - Administration - Clerical (14.43 m2)							
No Asbestos							
B010 - R0024 - Movement (167.38 m2)							
Ceiling Structures/Linings	Flat AC Sheeting						
8525/B010/R0026/Ceiling Structures/Linings/S8					No Asbestos Detected		
B010 - R0025 - Movement (18.12 m2)							
Ceiling Structures/Linings	Flat AC Sheeting	18.12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)		
B010 - R0026 - External Movement (69.97 m2)							

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
8525/B010/R0026/Ceiling Structures/Linings/S8					Limited Samples Taken	
Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works						
B010 - R0028 - Stairs (7.23 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B010 - R1001 - Commonroom (125.46 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
8525/B003/R1003/Floor Coverings Res/Textile/S5					No Asbestos Detected	
B010 - R1002 - Administration - Clerical (13.3 m2)						
No Asbestos						
B010 - R1003 - Cleaning Store - Distributed (4.23 m2)						
No Asbestos						
B010 - R1004 - Ancillary Staff (28.09 m2)						
No Asbestos						
B010 - R1005 - Toilets-Girls (4.48 m2)						
Incinirette	Millboard	1Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard Asbestos encased						
B010 - R1006 - Toilets-Boys (4.48 m2)						
No Asbestos						
B010 - R1007 - Movement (15.86 m2)						
No Asbestos						
B010 - R1008 - Movement (16.4 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B010 - R1009 - Stairs (12.02 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B011 - Agricultural Science - 1978 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	30m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B011 - R0001 - General Storeroom (36.38 m2)**

Non Accessible

B011 - R0002 - Animal Space (8.82 m2)

No Asbestos

B011 - R0003 - Movement (25.81 m2)

No Asbestos

B011 - R0004 - Animal Space (8.6 m2)

No Asbestos

B011 - R0005 - Staff Change (9 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B011/R0005/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8525/B001/R0030/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

B011 - R0006 - Machine Storage (35.28 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B012 - Agricultural Science - 2002 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B012 - R0001 - Machine Storage (173.66 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B013 - Mechanical Services - 2011 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B013 - R0001 - Materials Store - Type 1 (91.76 m2)

No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D13725 - Learning Unit - Standard/Withdrawal : Placement Date - 3/02/2016

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D14137 - Learning Unit - Standard/Withdrawal : Placement Date - 3/02/2016

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

OS 601 - D15140 - Learning Unit - Standard/Withdrawal : Placement Date - 3/02/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - General Learning Space

No Asbestos Found.

R3 - Store

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017