


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Quaama Public School (2917)
Region : Illawarra and South East
State Electorate : Bega
Local Government Area : Bega Valley

Initial Survey : Noel Arnold & Associates : 26 - May - 2008
Register Issue Date : 22 - Mar - 2017

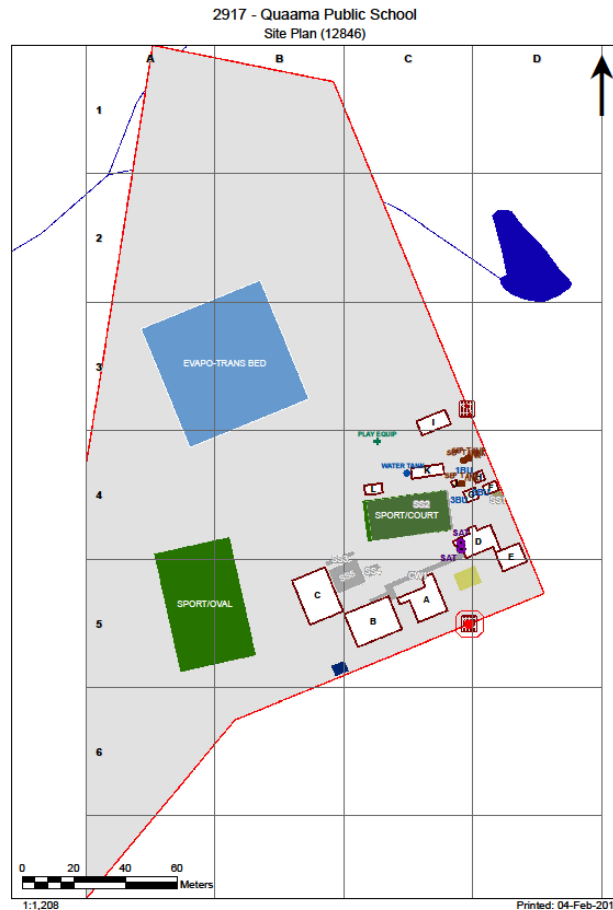

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - Administration/Staff Facilities - 1889 - Timber (Timber)

Exterior

Wall Cladding	Flat AC Sheeting	6m2	Adjacent to Room 0008	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0006/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Eaves Linings	Flat AC Sheeting	25m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0006/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00A - R0001 - Movement

No Asbestos

B00A - R0002 - Duplicating Workroom

No Asbestos

B00A - R0003 - Entry Vestibule

No Asbestos

B00A - R0004 - Staff Room

No Asbestos

B00A - R0005 - Staff Kitchen

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0005/Wall Linings Internal/S1			Chrysotile (white asbestos)		

B00A - R0006 - Uniform Shop

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0006/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0006/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0007 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0006/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0006/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0008 - Movement

Wall Linings Internal	Flat AC Sheeting	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0006/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0006/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0009 - Sick Bay

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0006/Wall Linings Internal/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00A - R0010 - Staff Room Annexe

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00A - R0011 - Clerical Office/Workroom

No Asbestos

B00A - R0012 - Principal

No Asbestos

B00A - R0013 - Clerical Office

No Asbestos

B00A - R0014 - Access Shower/Toilet

Wall Linings Internal	Flat AC Sheeting					
	2917/B00A/R0014/Ceiling Structures/Linings/S3					No Asbestos Detected

Ceiling Structures/Linings	Flat AC Sheeting					
	2917/B00A/R0014/Ceiling Structures/Linings/S3					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1994 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00B - R0001 - Movement

No Asbestos

B00B - R0002 - Personal Effects Storage

No Asbestos

B00B - R0003 - Practical Activities - 1hb

No Asbestos

B00B - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00B - R0005 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00B - R0006 - Movement

No Asbestos

B00B - R0007 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00B - R0008 - Movement

No Asbestos

B00B - R0009 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00B - R0010 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00B - R0011 - Practical Activities - 1hb

No Asbestos

B00B - R0012 - Personal Effects Storage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1994 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00C - R0001 - Movement

No Asbestos

B00C - R0002 - Personal Effects Storage

No Asbestos

B00C - R0003 - Practical Activities - 1hb

No Asbestos

B00C - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0005 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0006 - Movement

No Asbestos

B00C - R0007 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0008 - Movement

No Asbestos

B00C - R0009 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0010 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0011 - Practical Activities - 1hb

No Asbestos

B00C - R0012 - Personal Effects Storage

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library/Pupil Facilities - 1885 - Timber (Timber)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00D - R0002 - Movement

No Asbestos

B00D - R0003 - Library Office/Workroom

No Asbestos

B00D - R0004 - Reading Area

No Asbestos

B00D - R0005 - Canteen Office/Store

No Asbestos

B00D - R0006 - Canteen

No Asbestos

B00D - R0007 - Movement

No Asbestos

B00D - R0008 - Sports Store

Non Accessible

B00D - R0009 - Movement

No Asbestos

B00D - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
2917/B00A/R0006/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00D - R0011 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Special Purpose - 1970 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0006/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00E - R0001 - Movement

Wall Linings Internal	Flat AC Sheeting	8m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0006/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0006/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00E - R0002 - Craft Store

No Asbestos

B00E - R0003 - Special Programs Room

No Asbestos

B00E - R0004 - Craft Store

No Asbestos

B00E - R0005 - Special Programs Room

No Asbestos

B00E - R0006 - Craft Store

Floor Coverings Res/Textile	Vinyl Tiles					
	2917/B00E/R0006/Floor Coverings Res/Textile/S4				No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Shed - 1970 - Timber Shed (Timber Shed)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00F - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1927 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0006/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00G - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0006/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00G - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2917/B00A/R0006/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Shed - 1970 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00H - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Shed - 1997 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00I - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Building Services - 2005 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00J - R0001 - Cleaning Distributed Store

Non Accessible

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Storage - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00K - R0001 - Sports Store

No Asbestos

B00K - R0002 - General Assistant/Bulk Store

No Asbestos

B00K - R0003 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00L - R0001 - Toilets - Boys

No Asbestos

B00L - R0002 - Toilets - Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017