


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Quambone Public School (2919)  
**Region :** Western NSW  
**State Electorate :** Barwon  
**Local Government Area :** Coonamble

**Initial Survey :** Noel Arnold & Associates : 11 - Mar - 2008  
**Reviewed By :** Grencap-NAA : 15 - Jun - 2016

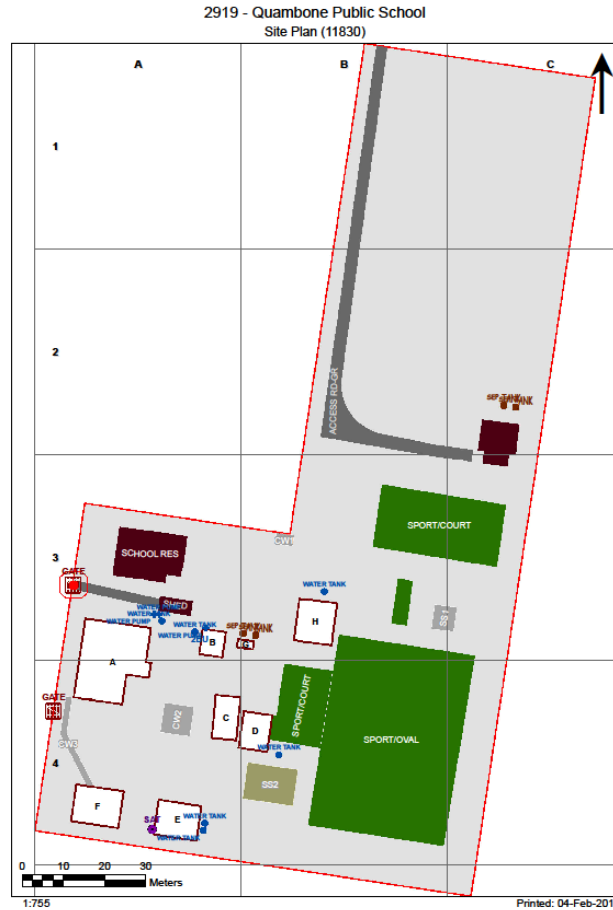

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00A - General Learning/Administration - 1898 - Timber (Timber)**

**Exterior**

|  |  |  |  |  |  |                             |
|--|--|--|--|--|--|-----------------------------|
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found                                |  |  |  |  |                             |
| Pitched Roof - Flat Ceiling                | Non Accessible Area                              |  |  |  |  |                             |
|  | - No manhole & height restricted (4m)            |  |  |  |  |                             |
| Window beading                             | Caulking Material<br>2919/B00A/Window beading/S5 |  |  |  |  | <b>No Asbestos Detected</b> |

**Interior**

**B00A - R0001 - Principal**

No Asbestos

**B00A - R0002 - Clerical Office**

No Asbestos

**B00A - R0003 - Movement**

|   |                |       |      |                    |         |                    |
|---|----------------|-------|------|--------------------|---------|--------------------|
| Electrical Backing Board                        | Resinous Board | 2Unit | West | Good Condition (1) | Low (1) | Low Priority (2-3) |
| <b>Assumed Asbestos - Cannot sample - Live.</b> |                |       |      |                    |         |                    |
| Electrical Mounting Board                       | Resinous Board | 1Unit | West | Good Condition (1) | Low (1) | Low Priority (2-3) |

**Assumed Asbestos - Electrical Hazard**

**B00A - R0004 - General Storeroom**

No Asbestos

**B00A - R0005 - Home Base**

No Asbestos

**B00A - R0006 - Home Base Store**

No Asbestos

**B00A - R0007 - General Storeroom**

No Asbestos

**B00A - R0008 - Covered Outdoor Learning Area**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00B - Pupil Facilities - 1975 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Raked Ceiling      Non Accessible Area  
 - No manhole

Underfloor Voids - Slab on Ground      No Asbestos Found

**Interior**

**B00B - R0001 - Toilets - Girls**

No Asbestos

**B00B - R0002 - Toilets - Boys**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00C - Staff Facilities - 1913 - Timber (Timber)**

**Exterior**

|  |  |  |  |  |  |  |
|--|--|--|--|--|--|--|
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found                                      |  |  |  |  |  |
| Ceiling Voids - Raked Ceiling              | Non Accessible Area<br>- No manhole approx 2.5-3m high |  |  |  |  |  |
| Eaves Linings                              | No Asbestos Found                                      |  |  |  |  |  |

**Interior**

**B00C - R0001 - Movement**

|                            |                  |   |  |  |                             |  |
|----------------------------|------------------|---|--|--|-----------------------------|--|
| Ceiling Structures/Linings | Flat AC Sheeting | 2919/B00C/R0001/Ceiling Structures/Linings/S1 |  |  | <b>No Asbestos Detected</b> |  |
|----------------------------|------------------|---|--|--|-----------------------------|--|

**B00C - R0002 - Staff Room**

|  |                  |   |            |                    |                                    |                    |
|--|------------------|---|------------|--------------------|------------------------------------|--------------------|
| Ceiling Structures/Linings               | Flat AC Sheeting | 2919/B00C/R0001/Ceiling Structures/Linings/S1 |            |                    | <b>No Asbestos Detected</b>        |                    |
| Wall Linings Internal                    | Flat AC Sheeting | 35m2  | Throughout | Good Condition (1) | Low (1)                            | Low Priority (2-3) |
| 2919/B00C/R0002/Wall Linings Internal/S2 |                  |   |            |                    | <b>Chrysotile (white asbestos)</b> |                    |

**B00C - R0003 - Staff Kitchen**

|                            |                  |   |  |  |                             |  |
|----------------------------|------------------|---|--|--|-----------------------------|--|
| Ceiling Structures/Linings | Flat AC Sheeting | 2919/B00C/R0001/Ceiling Structures/Linings/S1 |  |  | <b>No Asbestos Detected</b> |  |
|----------------------------|------------------|---|--|--|-----------------------------|--|

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00D - Administration - 1898 - Metal Shed (Metal Shed)**

**Exterior**

Pitched roof - No ceiling void      No Asbestos Found

Underfloor Voids - Slab on Ground      No Asbestos Found

**Interior**

**B00D - R0001 - General Storeroom**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00E - Library - 1913 - Timber (Timber)**

**Exterior**

|  |  |  |  |  |  |                             |
|--|--|--|--|--|--|-----------------------------|
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found                                |  |  |  |  |                             |
| Pitched Roof - Flat Ceiling                | Non Accessible Area                              |  |  |  |  |                             |
|  | - Height restricted 5m                           |  |  |  |  |                             |
| Window beading                             | Caulking Material<br>2919/B00A/Window beading/S5 |  |  |  |  | <b>No Asbestos Detected</b> |

**Interior**

**B00E - R0001 - Movement**

|                |  |  |  |  |  |                             |
|----------------|--|--|--|--|--|-----------------------------|
| In-fill-panel  | Flat AC Sheeting<br>2919/B00E/R0001/In-fill-panel/S3 |  |  |  |  | <b>No Asbestos Detected</b> |
| Window beading | Caulking Material<br>2919/B00A/Window beading/S5     |  |  |  |  | <b>No Asbestos Detected</b> |

**B00E - R0002 - Reading Area**

|  |   |         |            |                    |         |                    |
|--|---|---------|------------|--------------------|---------|--------------------|
| Floor Coverings Res/Textile                                | Vinyl Tiles (Under Floor Covering/Carpet) | 46.51m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3) |
| <b>Assumed Asbestos - Cannot sample - Excessive damage</b> |   |         |            |                    |         |                    |

**B00E - R0003 - General Storeroom**

No Asbestos

**B00E - R0004 - Library Office/Workroom**

No Asbestos

**B00E - R0005 - Sports Store**

|   |  |       |           |                    |         |                             |
|---|--|-------|-----------|--------------------|---------|-----------------------------|
| Electrical Mounting Board                   | Resinous Board                                   | 1Unit | Southwest | Good Condition (1) | Low (1) | Low Priority (2-3)          |
| <b>Assumed Asbestos - Electrical Hazard</b> |  |       |           |                    |         |                             |
| Window beading                              | Caulking material<br>2919/B00A/Window beading/S5 |       |           |                    |         | <b>No Asbestos Detected</b> |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00F - General Learning - 1913 - Timber (Timber)**

**Exterior**

|  |  |  |  |  |  |                             |
|--|--|--|--|--|--|-----------------------------|
| Pitched roof - Flat ceiling                | Non Accessible Area<br>- No manhole 4m ceiling   |  |  |  |  |                             |
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found                                |  |  |  |  |                             |
| Window beading                             | Caulking Material<br>2919/B00A/Window beading/S5 |  |  |  |  | <b>No Asbestos Detected</b> |

**Interior**

**B00F - FR0005 - Cleaners Room**

|                          |  |     |       |                    |         |                                    |
|--------------------------|--|-----|-------|--------------------|---------|------------------------------------|
| In-fill panel            | Flat AC Sheeting                         | 2m2 | South | Good Condition (1) | Low (1) | Low Priority (2-3)                 |
|                          | 2919/B00F/R0001/Wall Linings Internal/S4 |     |       |                    |         | <b>Chrysotile (white asbestos)</b> |
| Electrical Backing Board | Resinous Board                           | 1m2 | East  | Good Condition (1) | Low (1) | Low Priority (2-3)                 |

**Assumed Asbestos - Cannot sample -Live**

**B00F - R0001 - General Storeroom**

|                       |  |      |            |                    |         |                                    |
|-----------------------|--|------|------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting                         | 15m2 | Throughout | Good Condition (1) | Low (1) | Low Priority (2-3)                 |
|                       | 2919/B00F/R0001/Wall Linings Internal/S4 |      |            |                    |         | <b>Chrysotile (white asbestos)</b> |

**B00F - R0002 - Home Base**

No Asbestos

**B00F - R0003 - Cleaning Distributed Store**

No Asbestos

**B00F - R0004 - Movement**

|                       |  |      |                                   |                    |         |                                    |
|-----------------------|--|------|-----------------------------------|--------------------|---------|------------------------------------|
| Wall Linings Internal | Flat AC Sheeting                         | 10m2 | Western wall - Variable positions | Good Condition (1) | Low (1) | Low Priority (2-3)                 |
|                       | 2919/B00F/R0001/Wall Linings Internal/S4 |      |                                   |                    |         | <b>Chrysotile (white asbestos)</b> |

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00G - Staff Facilities - 2001 - Brick/Veneer (Brick/Veneer)**

**Exterior**

|                                   |                   |
|-----------------------------------|-------------------|
| Ceiling Voids                     | No Asbestos Found |
| Underfloor Voids - Slab on Ground | No Asbestos Found |

**Interior**

**B00G - R0001 - Staff Toilet**

No Asbestos

2017



| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

**B00H - Multi Purpose Facilities - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

|  |                   |
|--|-------------------|
| Ceiling Voids                              | No Asbestos Found |
| Underfloor Voids - Packing to Floor Joists | No Asbestos Found |

**Interior**

**B00H - R0001 - Communal Space**

No Asbestos

**B00H - R0002 - General Storeroom**

No Asbestos

**B00H - R0003 - Practical Activities**

No Asbestos

**B00H - R0004 - External Movement**

No Asbestos

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

| Product   | Material Description | Extent | Location Reference | Material Condition | Risk Status | Control Priority |
|-----------|----------------------|--------|--------------------|--------------------|-------------|------------------|
| Sample No |                      |        |                    |                    | Test Result |                  |

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017