


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Quirindi Public School (3947)  
**Region :** New England  
**State Electorate :** Upper Hunter  
**Local Government Area :** Liverpool Plains

**Initial Survey :** Noel Arnold & Associates : 25 - Mar - 2008  
**Reviewed By :** Grencap-NAA : 07 - May - 2015

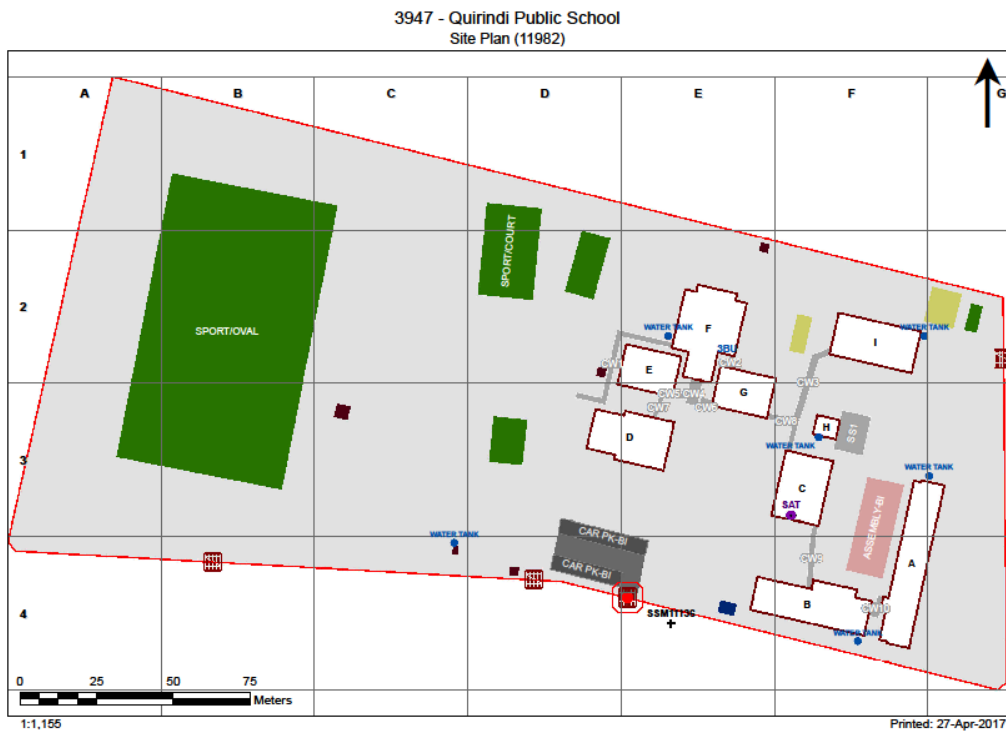

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Support Unit - 1957 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	50m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3947/B00A/R0028/Ceiling Structures/Linings/S8				<b>Chrysotile (white asbestos)</b>	
Underfloor Voids	Packing	3m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3947/B00A/Underfloor Voids/S6				<b>Chrysotile (white asbestos)</b>	
Window frames	Mastic					<b>No Asbestos Detected</b>
	3947/B00A/Window frames/S7					
Ceiling Voids	No Asbestos Found					

**Interior****B00A - R0002 - Home Base (53.59 m2)**

No Asbestos

**B00A - R0003 - Home Base (53.67 m2)**

No Asbestos

**B00A - R0006 - Home Base - M (53.66 m2)**

No Asbestos

**B00A - R0007 - Home Base (53.59 m2)**

No Asbestos

**B00A - R0010 - Home Base (53.73 m2)**

No Asbestos

**B00A - R0013 - Staff Toilet (1.85 m2)**

Wall Linings Internal	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3947/B00A/R0014/Wall Linings Internal/S4				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3947/B00A/R0028/Ceiling Structures/Linings/S8				<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3947/B00A/R0014/Wall Linings Internal/S4				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3947/B00A/R0028/Ceiling Structures/Linings/S8				<b>Chrysotile (white asbestos)</b>	

**B00A - R0016 - Home Base Store (7.06 m2)**

No Asbestos

**B00A - R0017 - Practical Activities - 1hb (12.77 m2)**

No Asbestos

**B00A - R0018 - Home Base Store (4.71 m2)**

No Asbestos

**B00A - R0019 - Home Base Store (4.4 m2)**

No Asbestos

**B00A - R0020 - Withdrawal Space - 1hb (12.7 m2)**

No Asbestos

**B00A - R0021 - Home Base Store (4.38 m2)**

No Asbestos

**B00A - R0022 - Home Base Store (4.38 m2)**

No Asbestos

**B00A - R0023 - Withdrawal Space - 1hb (12.9 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00A - R0024 - General Storeroom (8.71 m2)**

No Asbestos

**B00A - R0025 - Staff Room Annexe (16.77 m2)**

No Asbestos

**B00A - R0026 - Staff Room Annexe (26.36 m2)**

No Asbestos

**B00A - R0027 - Cleaning Distributed Store (3.37 m2)**

Ceiling Structures/Linings Flat AC Sheeting 4m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

3947/B00A/R0028/Ceiling Structures/Linings/S8

**Chrysotile (white asbestos)**

**B00A - R0028 - Practical Activities - 1hb (112.47 m2)**

Ceiling Structures/Linings Flat AC Sheeting 113m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

3947/B00A/R0028/Ceiling Structures/Linings/S8

**Chrysotile (white asbestos)**

**B00A - R0029 - Movement (5.54 m2)**

Ceiling Structures/Linings Flat AC Sheeting 6m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

3947/B00A/R0028/Ceiling Structures/Linings/S8

**Chrysotile (white asbestos)**

**B00A - R9001 - General Storeroom (15.19 m2)**

No Asbestos

**B00A - R9002 - Sports Store (23.92 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning/Pupil Facilities - 1964 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	60m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3947/B00B/R0013/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					

**Interior****B00B - R0001 - Toilets - Boys (29.53 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3947/B00B/R0001/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>

**B00B - R0002 - Toilets - Girls (30.55 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3947/B00B/R0001/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>

**B00B - R0003 - General Storeroom (5.36 m2)**

No Asbestos

**B00B - R0004 - Movement (35.56 m2)**

No Asbestos

**B00B - R0005 - Distribution Board (0.87 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00B - R0006 - Canteen (36.54 m2)**

No Asbestos

**B00B - R0007 - Canteen Office/Store (19.88 m2)**

No Asbestos

**B00B - R0008 - Canteen Office/Store (2.53 m2)**

No Asbestos

**B00B - R0009 - General Storeroom (2.53 m2)**

No Asbestos

**B00B - R0010 - Personal Effects Storage (10.7 m2)**

No Asbestos

**B00B - R0011 - General Storeroom (71.07 m2)**

No Asbestos

**B00B - R0012 - Stairs (4.64 m2)**

No Asbestos

**B00B - R0013 - Movement (33.57 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3947/B00B/R0013/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>

**B00B - R0014 - External Movement (42.71 m2)**

No Asbestos

**B00B - R1001 - Practical Activities - 1hb (43.07 m2)**

Ceiling Structures/Linings	Vermiculite					
	3947/B00B/R1008/Ceiling Structures/Linings/S10					<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00B - R1002 - Practical Activities - 1hb (20.66 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite	3947/B00B/R1008/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1003 - Home Base Store (7.95 m2)</b>						
Ceiling Structures/Linings	Vermiculite	3947/B00B/R1008/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1004 - Withdrawal Space - 1hb (4.77 m2)</b>						
Ceiling Structures/Linings	Vermiculite	3947/B00B/R1008/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1005 - Home Base (57.76 m2)</b>						
Ceiling Structures/Linings	Vermiculite	3947/B00B/R1008/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1006 - Home Base (57.99 m2)</b>						
Ceiling Structures/Linings	Vermiculite	3947/B00B/R1008/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1007 - Withdrawal Space - 1hb (4.76 m2)</b>						
Ceiling Structures/Linings	Vermiculite	3947/B00B/R1008/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1008 - Home Base Store (5.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite	3947/B00B/R1008/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1009 - Movement (1.94 m2)</b>						
Ceiling Structures/Linings	Vermiculite	3947/B00B/R1008/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1010 - Movement (1.82 m2)</b>						
Ceiling Structures/Linings	Vermiculite	3947/B00B/R1008/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1011 - Home Base Store (6.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite	3947/B00B/R1008/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1012 - Withdrawal Space - 1hb (4.73 m2)</b>						
Ceiling Structures/Linings	Vermiculite	3947/B00B/R1008/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1013 - Home Base (56.6 m2)</b>						
Ceiling Structures/Linings	Vermiculite	3947/B00B/R1008/Ceiling Structures/Linings/S10				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00B - R1014 - Stairs (12.38 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Library - 1980 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids - Raked Ceiling  
 Non Accessible Area  
 - Area inaccessible

Underfloor Voids - Slab on Ground  
 Non Accessible Area  
 - Area inaccessible

**Interior**

**B00C - R0001 - Movement (122.93 m2)**

No Asbestos

**B00C - R0002 - Distribution Board (1.48 m2)**

Note: No inspection of live electrical installation.

Wall Linings Internal      Flat AC Sheeting      1m2      North, West      Good Condition (1)      Low (1)      Low Priority (2-3)  
 3947/B00C/R0002/Wall Linings Internal/S3      **Chrysotile (white asbestos)**

**B00C - R0003 - Library Office/Workroom (24.46 m2)**

No Asbestos

**B00C - R0004 - Communications Room (12.82 m2)**

No Asbestos

**B00C - R0005 - Reading Area (154.87 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Administration/Staff Facilities - 1893 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting 3947/B00D/Eaves Linings/S11					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00D - R0001 - Movement (78.02 m2)**

No Asbestos

**B00D - R0002 - Interview (12.59 m2)**

No Asbestos

**B00D - R0003 - Movement (28.98 m2)**

No Asbestos

**B00D - R0004 - Principal (19.97 m2)**

No Asbestos

**B00D - R0005 - Sick Bay (9.25 m2)**

No Asbestos

**B00D - R0008 - Staff Room Annexe (25.41 m2)**

No Asbestos

**B00D - R0009 - Movement (30.4 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3947/B00D/R0009/Ceiling Structures/Linings/S12					No Asbestos Detected
----------------------------	--------------------------------------------------------------------	--	--	--	--	----------------------

**B00D - R0010 - Interview (27.42 m2)**

No Asbestos

**B00D - R0011 - Staff Room Annexe (12.66 m2)**

No Asbestos

**B00D - R0012 - Security Store (10.27 m2)**

No Asbestos

**B00D - R0014 - Duplicating Workroom (30.21 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3947/B00D/R0009/Ceiling Structures/Linings/S12					No Asbestos Detected
----------------------------	--------------------------------------------------------------------	--	--	--	--	----------------------

**B00D - R0015 - Clerical Office (17.33 m2)**

No Asbestos

**B00D - R0016 - Staff Room (22.14 m2)**

No Asbestos Found

**B00D - R0017 - Staff Kitchen (8.2 m2)**

No Asbestos Found

**B00D - R0018 - Staff Toilet (1.92 m2)**

No Asbestos Found

**B00D - R0019 - Toilet - Lobby (3.05 m2)**

No Asbestos Found

**B00D - R0020 - Toilet - Lobby (3.82 m2)**

No Asbestos Found

**B00D - R0021 - Staff Toilet (3.33 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3947/B00D/R0009/Ceiling Structures/Linings/S12					No Asbestos Detected
----------------------------	--------------------------------------------------------------------	--	--	--	--	----------------------

**B00D - R0022 - Staff Toilet (2.01 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Ceiling Structures/Linings Flat AC Sheeting  
 3947/B00D/R0009/Ceiling Structures/Linings/S12

**No Asbestos Detected**

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1964 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Wall Cladding	Flat AC Sheeting 3947/B00E/Wall Cladding/S2					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

**Interior**

**B00E - R0001 - Withdrawal Space - 1hb (5.59 m2)**

No Asbestos

**B00E - R0002 - Home Base Store (5.74 m2)**

No Asbestos

**B00E - R0003 - Practical Activities - 1hb (22.73 m2)**

No Asbestos

**B00E - R0004 - Home Base (55.42 m2)**

No Asbestos

**B00E - R0005 - Movement (42.62 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3947/Build+1/Room+1/Ceiling Structures/Linings/S1					<b>No Asbestos Detected</b>
----------------------------	-----------------------------------------------------------------------	--	--	--	--	-----------------------------

**B00E - R0006 - Home Base (54.15 m2)**

No Asbestos

**B00E - R0007 - Practical Activities - 1hb (21.62 m2)**

No Asbestos

**B00E - R0008 - Distribution Board (0.64 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00E - R0009 - Home Base Store (5.71 m2)**

No Asbestos

**B00E - R0010 - Withdrawal Space - 1hb (5.64 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Communal Facilities/Pupil Facilities - 1957 - Brick/Block (Brick/Block)****Exterior**

Wall Cladding	Flat AC Sheeting 3947/B00E/Wall Cladding/S2					No Asbestos Detected
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

**Interior****B00F - R0001 - Music Store (8.39 m2)**

No Asbestos

**B00F - R0002 - Hall Chair Store (8.94 m2)**

No Asbestos

**B00F - R0003 - General Storeroom (6.63 m2)**

No Asbestos

**B00F - R0004 - Cleaning Distributed Store (3.44 m2)**

No Asbestos

**B00F - R0005 - Toilets - Boys (15.98 m2)**

No Asbestos

**B00F - R0006 - Disabled Toilet (6.06 m2)**

No Asbestos

**B00F - R0007 - Movement (123.96 m2)**

Wall Linings Internal	Flat AC Sheeting 3947/B00E/Wall Cladding/S2					No Asbestos Detected
-----------------------	------------------------------------------------	--	--	--	--	----------------------

**B00F - R0008 - Toilets - Girls (15.67 m2)**

No Asbestos

**B00F - R0009 - Communal Space (139.7 m2)**

No Asbestos

**B00F - R0010 - Plant (0.6 m2)**

No Asbestos

**B00F - R0011 - General Assistant/Bulk Store (14.18 m2)**

No Asbestos

**B00F - R0012 - General Storeroom (13.79 m2)**

No Asbestos

**B00F - R0013 - Distribution Board (0.93 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00F - R0014 - Sports Store (12.46 m2)**

No Asbestos

**B00F - R0015 - Movement (7.24 m2)**

No Asbestos

**B00F - R0016 - Movement (4.66 m2)**

Wall Linings Internal	Flat AC Sheeting 3947/B00E/Wall Cladding/S2					No Asbestos Detected
-----------------------	------------------------------------------------	--	--	--	--	----------------------

**B00F - R0017 - Raised Platform (47.93 m2)**

No Asbestos

**B00F - R0018 - Movement (4.63 m2)**

Wall Linings Internal	Flat AC Sheeting 3947/B00E/Wall Cladding/S2					No Asbestos Detected
-----------------------	------------------------------------------------	--	--	--	--	----------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R0020 - Garden Store (8.31 m2)</b>						
No Asbestos						
<b>B00F - R0021 - Movement (4.95 m2)</b>						
No Asbestos						
<b>B00F - R0022 - Lift (2.16 m2)</b>						
No Asbestos						
<b>B00F - R0023 - Movement (9.34 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
			3947/B00E/Wall Cladding/S2			
Ceiling Structures/Linings	Flat AC Sheeting					<b>No Asbestos Detected</b>
			3947/Build+1/Room+1/Ceiling Structures/Linings/S1			
<b>B00F - R0024 - Plant (0.55 m2)</b>						
No Asbestos Found						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning/Support Unit - 1964 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Wall Cladding	Flat AC Sheeting 3947/B00E/Wall Cladding/S2					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

**Interior**

**B00G - R0001 - Withdrawal Space - 1hb (5.59 m2)**

No Asbestos

**B00G - R0002 - Home Base Store (5.62 m2)**

No Asbestos

**B00G - R0003 - Practical Activities - 1hb (22.5 m2)**

No Asbestos

**B00G - R0004 - Home Base (53.58 m2)**

No Asbestos

**B00G - R0005 - Movement (43.08 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3947/Build+1/Room+1/Ceiling Structures/Linings/S1					<b>No Asbestos Detected</b>
----------------------------	-----------------------------------------------------------------------	--	--	--	--	-----------------------------

**B00G - R0006 - Home Base - M (53.89 m2)**

No Asbestos

**B00G - R0007 - Practical Activities - M - 1hb (21.59 m2)**

No Asbestos

**B00G - R0008 - Distribution Board (0.61 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00G - R0009 - Home Base Store - M (5.78 m2)**

No Asbestos

**B00G - R0010 - Withdrawal - M (5.63 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Pupil Facilities - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

**Interior**

**B00H - R0001 - Canteen (26.9 m2)**

No Asbestos Found

**B00H - R0002 - Canteen Office/Store (8.32 m2)**

No Asbestos Found

**B00H - R0003 - Canteen Covered Area (6.16 m2)**

No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00I - General Learning - 2011 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

**Interior****B00I - R0001 - Sports Store (12.67 m2)**

No Asbestos Found

**B00I - R0002 - General Assistant/Bulk Store (15.72 m2)**

No Asbestos Found

**B00I - R0003 - Garden Store (12.64 m2)**

No Asbestos Found

**B00I - R0004 - Practical Activities - 1hb (18.49 m2)**

No Asbestos Found

**B00I - R0005 - Home Base (61.05 m2)**

No Asbestos Found

**B00I - R0006 - Home Base Store (6.19 m2)**

No Asbestos Found

**B00I - R0007 - Withdrawal Space - 2hb (11.6 m2)**

No Asbestos Found

**B00I - R0008 - Home Base (60.12 m2)**

No Asbestos Found

**B00I - R0009 - Home Base Store (6.19 m2)**

No Asbestos Found

**B00I - R0010 - Practical Activities - 1hb (18.49 m2)**

No Asbestos Found

**B00I - R0011 - Special Programs Room (38.5 m2)**

No Asbestos Found

**B00I - R0012 - Special Programs Store (5.34 m2)**

No Asbestos Found

**B00I - R0013 - Cleaning Distributed Store (4.14 m2)**

No Asbestos Found

**B00I - R0014 - External Movement (76.93 m2)**

No Asbestos Found

**B00I - R0015 - Distribution Board (0.74 m2)**

No Asbestos Found

Note: No inspection of live electrical installation.

**B00I - R9001 - General Storeroom (207.54 m2)**

No Asbestos Found

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017