


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Queanbeyan West Public School (4127)
Region : Illawarra and South East
State Electorate : Monaro
Local Government Area : Queanbeyan

Initial Survey : Noel Arnold & Associates : 07 - May - 2008
Reviewed By : Greencap-NAA : 08 - Jul - 2016

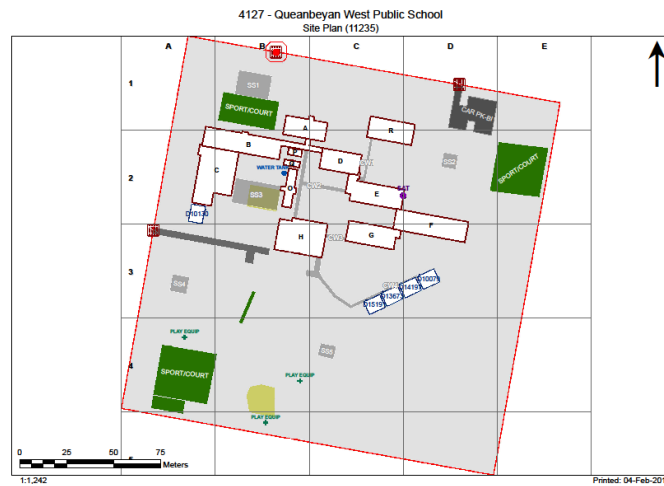

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Staff Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 4127/B00D/Eaves Linings/S30	60m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)
Gable Verge Lining	Flat AC Sheeting 4127/B00A/Gable Verge Lining/S16	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling void	No Asbestos Found					

Interior

B00A - R0002 - Duplicating Workroom

No Asbestos

B00A - R0003 - Clerical Office

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4127/B00A/R0015/Floor Coverings Res/Textile/S17	10.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	--------	------------	--------------------	---------	--

B00A - R0005 - Staff Toilet

No Asbestos

B00A - R0006 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting 4127/B00A/R0005/Ceiling Structures/Linings/S6	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 4127/B00A/R0016/Floor Coverings Res/Textile/S5	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Comms box lid	Resinous Board 4127/B00F/R0011/Comms box lid/S20	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00A - R0007 - Staff Toilet

No Asbestos

B00A - R0008 - Deputy Principal

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4127/B00A/R0015/Floor Coverings Res/Textile/S17	17.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	--------	------------	--------------------	---------	--

B00A - R0009 - Principal

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4127/B00A/R0015/Floor Coverings Res/Textile/S17	16.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	--------	------------	--------------------	---------	--

B00A - R0010 - Staff Room Annexe

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4127/B00A/R0015/Floor Coverings Res/Textile/S17	13.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	--------	------------	--------------------	---------	--

B00A - R0014 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 4127/B00A/R0014/Ceiling Structures/Linings/S7	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	-----	------------	--------------------	---------	--

B00A - R0015 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4127/B00A/R0015/Floor Coverings Res/Textile/S17	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	--	------	------------	--------------------	---------	--

Floor Coverings Res/Textile	Adhesive 4127/B00A/R0015/Floor Coverings Res/Textile/S18					No Asbestos Detected
-----------------------------	---	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0016 - General Assistant/Bulk Store						
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4127/B00A/R0016/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4127/B00A/R0005/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
B00A - R0017 - Clerical Office						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	18.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4127/B00A/R0015/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00A - R0019 - Staff Room						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	54.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4127/B00A/R0015/Floor Coverings Res/Textile/S17					Chrysotile (white asbestos)	
B00A - R0020 - Staff Kitchen						
Floor Coverings Res/Textile	No Asbestos Found					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1975 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00B/Eaves Linings/S26				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/Gable Verge Lining/S16				Chrysotile (white asbestos)	
Ceiling void	No Asbestos Found					
Underfloor debris	AC Fragments/Debris	0.1m2	West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	4127/B00B/Underfloor debris/S27				Chrysotile (white asbestos)	
Window	Putty					No Asbestos Detected
	4127/B00B/Window/S28					

Interior

B00B - R0001 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0016/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	

B00B - R0002 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	87.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0016/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	

Electrical Mounting Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00B/R0002/Electrical Mounting Board/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0003 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0016/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	

B00B - R0004 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Sheet	2.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0016/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	

B00B - R0005 - Home Base

No Asbestos

B00B - R0006 - Home Base

Wall Linings Internal	Flat AC Sheeting	3m2	South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00B/R0006/Wall Linings Internal/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0007 - Sports Store

Floor Coverings Res/Textile	No Asbestos Found					
-----------------------------	-------------------	--	--	--	--	--

B00B - R0008 - General Storeroom

Floor Coverings Res/Textile	No Asbestos Found					
-----------------------------	-------------------	--	--	--	--	--

B00B - R0009 - Home Base

Wall Linings Internal	Flat AC Sheeting	3m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00B/R0006/Wall Linings Internal/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00B - R0010 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	3m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
4127/B00B/R0006/Wall Linings Internal/S8				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00B - R0011 - Craft Store

Floor Coverings Res/Textile No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1959 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0005/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/Gable Verge Lining/S16				Chrysotile (white asbestos)	
Underfloor void	No Asbestos Found					
Ceiling void	No Asbestos Found					
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00B/R0002/Electrical Mounting Board/S25				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Interior**B00C - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0014/Ceiling Structures/Linings/S7				Chrysotile (white asbestos)	

B00C - R0002 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00C/R0008/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	

B00C - R0005 - Main Switch Board

Wall Linings Internal	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00C/R0005/Wall Linings Internal/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00C/R0005/Wall Linings Internal/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00C - R0006 - General Storeroom

No Asbestos

B00C - R0007 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0016/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	

B00C - R0008 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles	56.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00C/R0008/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	

B00C - R0009 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00C/R0008/Floor Coverings Res/Textile/S14				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0016/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	

B00C - R0010 - Toilets - Boys/Girls

No Asbestos

B00C - R0011 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0016/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	

B00C - R0012 - Withdrawal Space - 1hb

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4127/B00A/R0016/Floor Coverings Res/Textile/S5	17.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Bench top	Vinyl Tiles 4127/B00A/R0016/Floor Coverings Res/Textile/S5	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
B00C - R0013 - Staff Toilet						
No Asbestos						
B00C - R0014 - Movement						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4127/B00C/R0008/Floor Coverings Res/Textile/S14	46.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 4127/B00C/R0014/Floor Coverings Res/Textile/S24					No Asbestos Detected
B00C - R0015 - General Storeroom						
No Asbestos						
B00C - R0016 - Covered Outdoor Learning Area						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Support Unit/Intensive English - 1975 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 4127/B00D/Eaves Linings/S30	40m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Gable Verge Lining	Flat AC Sheeting 4127/B00A/Gable Verge Lining/S16	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	
Underfloor void	AC Fragments/Debris 4127/B00D/Underfloor void/S29	0.1m2	North	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
					Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling void	No Asbestos Found					

Interior

B00D - R0001 - General Storeroom

No Asbestos

B00D - R0002 - Special Programs Room

No Asbestos

B00D - R0004 - Withdrawal Space - 1hb

No Asbestos

B00D - R0005 - Special Programs Room

No Asbestos

B00D - R0007 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4127/B00A/R0015/Floor Coverings Res/Textile/S17	18.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					Chrysotile (white asbestos)	

B00D - R0008 - Resource/Toy Space

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Pupil Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00E/Eaves Linings/S21					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/Gable Verge Lining/S16					Chrysotile (white asbestos)
Ceiling void	No Asbestos Found					

Interior

B00E - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00E/R0011/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

B00E - R0002 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0016/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00E - R0003 - Practical Activities - 1hb

Floor Coverings Res/Textile	No Asbestos Found					
-----------------------------	-------------------	--	--	--	--	--

B00E - R0004 - Home Base

Floor Coverings Res/Textile	Adhesive	52.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00F/R0001/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

B00E - R0005 - Home Base

Floor Coverings Res/Textile	Adhesive	53.9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00F/R0001/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)

B00E - R0006 - Practical Activities - 1hb

Floor Coverings Res/Textile	No Asbestos Found					
-----------------------------	-------------------	--	--	--	--	--

B00E - R0007 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0005/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0016/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00E - R0008 - Distribution Board

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0016/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0005/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)
Comms box lid	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00F/R0011/Comms box lid/S20					Chrysotile (white asbestos)

B00E - R0009 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	30m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00E/R0011/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4127/B00E/R0010/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	
B00E - R0010 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
4127/B00E/R0011/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4127/B00E/R0010/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)	
B00E - R0011 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1959 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 4127/B00E/Eaves Linings/S21	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting 4127/B00A/Gable Verge Lining/S16	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior

B00F - R0001 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4127/B00A/R0016/Floor Coverings Res/Textile/S5	82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 4127/B00F/R0001/Floor Coverings Res/Textile/S19	82m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00F - R0002 - Practical Activities - 1hb

Floor Coverings Res/Textile	No Asbestos Found					
-----------------------------	-------------------	--	--	--	--	--

B00F - R0003 - Home Base

Floor Coverings Res/Textile	Adhesive 4127/B00F/R0001/Floor Coverings Res/Textile/S19	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

B00F - R0004 - Home Base

Floor Coverings Res/Textile	Adhesive 4127/B00F/R0001/Floor Coverings Res/Textile/S19	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

B00F - R0005 - Practical Activities - 1hb

Floor Coverings Res/Textile	No Asbestos Found					
-----------------------------	-------------------	--	--	--	--	--

B00F - R0006 - Practical Activities - 1hb

Floor Coverings Res/Textile	No Asbestos Found					
-----------------------------	-------------------	--	--	--	--	--

B00F - R0007 - Home Base

Floor Coverings Res/Textile	Adhesive 4127/B00F/R0001/Floor Coverings Res/Textile/S19	50.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	--------	------------	--------------------	---------	--

B00F - R0008 - Home Base

Floor Coverings Res/Textile	Adhesive 4127/B00F/R0001/Floor Coverings Res/Textile/S19	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

B00F - R0009 - Practical Activities - 1hb

Floor Coverings Res/Textile	No Asbestos Found					
-----------------------------	-------------------	--	--	--	--	--

B00F - R0010 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 4127/B00A/R0016/Floor Coverings Res/Textile/S5	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 4127/B00A/R0005/Ceiling Structures/Linings/S6	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00F - R0011 - Distribution Board

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0016/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0005/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Comms box lid	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00F/R0011/Comms box lid/S20				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00G - General Learning/Pupil Facilities - 1975 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00E/R0011/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/Gable Verge Lining/S16					Chrysotile (white asbestos)
Ceiling void	No Asbestos Found					

Interior**B00G - R0001 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00G/R0003/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

B00G - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00G/R0003/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

B00G - R0003 - Staff Toilet

Incinerator	Encapsulated Insulation material within unit Assumed Asbestos - ITEM inaccessible	1Unit(s)	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00G/R0003/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

B00G - R0004 - Movement

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0016/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00G - R0005 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00E/R0011/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00E/R0010/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)

B00G - R0006 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00E/R0011/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00E/R0010/Partition Walls (Cubicles)/S11					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00G/R0003/Ceiling Structures/Linings/S13					Chrysotile (white asbestos)

B00G - R0007 - Distribution Board

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0016/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/R0005/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Comms box lid	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
4127/B00F/R0011/Comms box lid/S20					Chrysotile (white asbestos)	
B00G - R0008 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4127/B00A/R0005/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4127/B00A/R0016/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00G - R0009 - Practical Activities - 1hb						
Floor Coverings Res/Textile	No Asbestos Found					
B00G - R0010 - Home Base						
Floor Coverings Res/Textile	Adhesive	52.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4127/B00F/R0001/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)	
B00G - R0011 - Home Base						
Floor Coverings Res/Textile	Adhesive	52.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4127/B00F/R0001/Floor Coverings Res/Textile/S19					Chrysotile (white asbestos)	
B00G - R0012 - Practical Activities - 1hb						
Floor Coverings Res/Textile	No Asbestos Found					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities/Communal Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	28m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00E/Eaves Linings/S21				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/Gable Verge Lining/S16				Chrysotile (white asbestos)	
Ceiling void	No Asbestos Found					

Interior

B00H - R0001 - General Assistant/Bulk Store

No Asbestos

B00H - R0002 - Distribution Board

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00E/R0011/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

Electrical Backing Board
Non Accessible Area
- Electrical Hazard

B00H - R0003 - Movement

Floor Coverings Res/Textile
No Asbestos Found

B00H - R0004 - Canteen Office/Store

Floor Coverings Res/Textile
No Asbestos Found

B00H - R0005 - Canteen

Floor Coverings Res/Textile
No Asbestos Found

B00H - R0006 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00E/R0011/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

Floor Coverings Res/Textile
No Asbestos Found

B00H - R0007 - Canteen Office/Store

Floor Coverings Res/Textile
No Asbestos Found

B00H - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00E/R0011/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B00H - R0009 - Toilets - Boys

No Asbestos

B00H - R0010 - Toilets - Girls

No Asbestos

B00H - R0011 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00E/R0011/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B00H - R0012 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00E/R0011/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B00H - R0013 - Communal Space

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No				Test Result	

No Asbestos

B00H - R0015 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Pupil Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	26m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B000/Eaves Linings/S22				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Gable Verge Lining	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00A/Gable Verge Lining/S16				Chrysotile (white asbestos)	
Ceiling void	Fibrous Membrane				No Asbestos Detected	
	4127/B000/Ceiling void/S23					
Underfloor void	No Asbestos Found					

Interior

B000 - R0001 - Staff Toilet

No Asbestos

B000 - R0002 - Toilets - Girls

No Asbestos

B000 - R0003 - Staff Toilet

No Asbestos

B000 - R0004 - Drinking Facilities

No Asbestos

B000 - R0005 - Garden Store

No Asbestos

B000 - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4127/B00E/R0011/Ceiling Structures/Linings/S9				Chrysotile (white asbestos)	

B000 - R0007 - Drinking Facilities

No Asbestos

B000 - R0008 - Toilets - Boys

No Asbestos

B000 - R0009 - Staff Toilet

No Asbestos

B000 - R0010 - Kiln Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Building Services - 1975 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling void	No Asbestos Found

Interior

B00P - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Communal Facilities - 1975 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor void	No Asbestos Found

Interior

B00Q - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - Library/General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

Interior

B00R - R0001 - Reading Area

No Asbestos

B00R - R0002 - Library Office/Workroom

No Asbestos

B00R - R0003 - Communications Room

Floor Coverings Res/Textile	No Asbestos Found
-----------------------------	-------------------

B00R - R0004 - General Storeroom

Floor Coverings Res/Textile	No Asbestos Found
-----------------------------	-------------------

B00R - R0005 - External Movement

No Asbestos

B00R - R0006 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	No Asbestos Found
-----------------------	-------------------

B00R - R0007 - Cleaning Distributed Store

Wall Linings Internal	No Asbestos Found
Floor Coverings Res/Textile	No Asbestos Found

B00R - R0008 - Movement

Wall Linings Internal	No Asbestos Found
-----------------------	-------------------

B00R - R0009 - Staff Toilet

Wall Linings Internal	No Asbestos Found
-----------------------	-------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 603 - D10079 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 12/01/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D10130 - Learning Unit - Standard With P.A.A. : Placement Date - 25/06/2012

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D11579 - Learning Unit - Standard With P.A.A. : Placement Date - 20/06/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D13673 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 602 - D14197 - Learning Unit - Standard With P.A.A. : Placement Date - 24/02/2010

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Learning space/withdrawal/entry						
Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
R2 - Home Base Store						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2
OS 602 - D15191 - Learning Unit - Standard With P.A.A. : Placement Date - 25/10/2012						
Exterior						
Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
Interior						
R1 - Learning space/withdrawal/entry						
Ceiling	Flat AC Sheet	Assumed Asbestos				70 m2
R2 - Home Base Store						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				3 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017