


# Asbestos Register

(Hazardous Materials and Risk Assessment)



**School :** Queanbeyan South Public School (4394)  
**Region :** Illawarra and South East  
**State Electorate :** Monaro  
**Local Government Area :** Queanbeyan

**Initial Survey :** Noel Arnold & Associates : 07 - May - 2008  
**Reviewed By :** Parsons Brinckerhoff : 15 - Feb - 2017

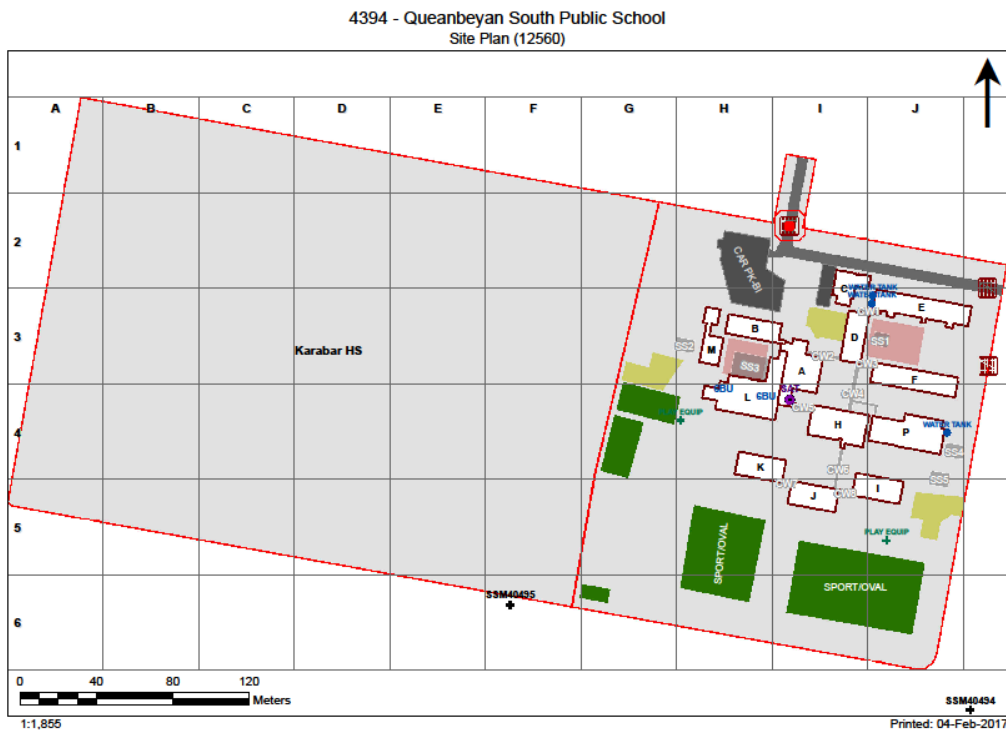

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Library - 1972 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/Eaves Linings/S7				<b>Chrysotile (white asbestos)</b>	
In-fill-panel	Flat AC Sheeting	20m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/In-fill-panel/S8				<b>Chrysotile (white asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/Gable Verge Lining/S4				<b>Chrysotile (white asbestos)</b>	

**Interior**

**B00A - R0001 - Movement (12.26 m2)**

No Asbestos

**B00A - R0002 - Craft Store (46.3 m2)**

Ceiling Structures/Linings	Vermiculite	4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						
In-fill-panel	Flat AC Sheeting	2m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/In-fill-panel/S8				<b>Chrysotile (white asbestos)</b>	

**B00A - R0003 - Clerical Office (23.72 m2)**

Ceiling Structures/Linings	Vermiculite	4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0004 - Deputy Principal (14.27 m2)**

Ceiling Structures/Linings	Vermiculite	4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0005 - Staff Toilet (2.89 m2)**

Ceiling Structures/Linings	Vermiculite	4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00A/R0019/Floor Coverings Res/Textile/S14				<b>Chrysotile (white asbestos)</b>	

**B00A - R0006 - General Storeroom (3.09 m2)**

Ceiling Structures/Linings	Vermiculite	4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Partition Walls (Cubicles)/S2				<b>Chrysotile (white asbestos)</b>	

**B00A - R0007 - Movement (7.63 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00A/R0019/Floor Coverings Res/Textile/S14				<b>Chrysotile (white asbestos)</b>	

Ceiling Structures/Linings	Vermiculite	4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0008 - Cleaning Distributed Store (3.71 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R0009 - Staff Toilet (10.44 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Partition Walls (Cubicles)	Compressed AC Sheet 4394/B00D/R0006/Partition Walls (Cubicles)/S2	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Incinerator	Encapsulated Insulation material within unit <i>Assumed Asbestos - Not sampled due to no access to</i>	1Unit(s)	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<b>B00A - R0010 - Staff Toilet (6.14 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet 4394/B00D/R0006/Partition Walls (Cubicles)/S2	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R0014 - General Storeroom (20.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R0015 - Clerical Office/Workroom (22.81 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R0016 - Staff Toilet (5.23 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R0017 - Staff Room Annexe (13.1 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R0018 - Staff Room Annexe (15.08 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R0019 - General Storeroom (2.97 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4394/B00A/R0019/Floor Coverings Res/Textile/S14	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R0020 - Staff Toilet (3.16 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Partition Walls (Cubicles)	Compressed AC Sheet 4394/B00D/R0006/Partition Walls (Cubicles)/S2	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0021 - Principal (18.57 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0022 - Staff Room Annexe (12.28 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0023 - Distribution Board (0.62 m2)</b>					Note: No inspection of live electrical installation.	
Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)  Assumed Asbestos - Not sampled due to live electrical
<b>B00A - R0024 - Security Store (9.89 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0025 - Movement (26.46 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0026 - Movement (4.5 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4394/B00A/R0029/Ceiling Structures/Linings/S15	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)  Chrysotile (white asbestos)
<b>B00A - R0027 - Stairs (5.51 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0028 - Stairs (3.2 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0029 - Movement (5.27 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4394/B00A/R0029/Ceiling Structures/Linings/S15	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)  Chrysotile (white asbestos)
<b>B00A - R0030 - Staff Room (57.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0031 - Staff Kitchen (7.45 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R0032 - Movement (36.16 m2)</b>						
No Asbestos						
<b>B00A - R0033 - Clerical Office (8.99 m2)</b>						
No Asbestos						
<b>B00A - R0034 - Cleaning Supplies (10.16 m2)</b>						
No Asbestos						
<b>B00A - R0035 - Movement (9.25 m2)</b>						
No Asbestos						
<b>B00A - R0036 - Movement (8.25 m2)</b>						
No Asbestos						
<b>B00A - R1002 - Library Office/Workroom (19.33 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1003 - Library Office/Workroom (5.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1004 - Reading Area (52.9 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1005 - Reading Area (212.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1006 - Seminar/Study (12.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1007 - K.L.A. Store (12.42 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1008 - Toilets - Boys (3.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 4394/B00D/R0006/Partition Walls (Cubicles)/S2	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B00A - R1009 - Cleaning Distributed Store (1.87 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 4394/B00A/R0029/Ceiling Structures/Linings/S15	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B00A - R1010 - Distribution Board (0.55 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Ceiling Structures/Linings	Flat AC Sheeting 4394/B00A/R0029/Ceiling Structures/Linings/S15	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B00A - R1011 - Toilets - Girls (3.29 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Partition Walls (Cubicles)	Compressed AC Sheet 4394/B00D/R0006/Partition Walls (Cubicles)/S2	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
<b>B00A - R1012 - Movement (31.18 m2)</b>						
Ceiling Structures/Linings	Vermiculite 4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00A - R1013 - General Storeroom (6.03 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 4394/B00A/R0019/Floor Coverings Res/Textile/S14	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>
Ceiling Structures/Linings	Flat AC Sheeting 4394/B00A/R0029/Ceiling Structures/Linings/S15	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <i>Chrysotile (white asbestos)</i>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1014 - Stairs (9.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1015 - Stairs (3.4 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1016 - Interview (6.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1017 - Interview (5.93 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1018 - Movement (16.08 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
In-fill-panel	Flat AC Sheeting	3m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/In-fill-panel/S8					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1972 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/Gable Verge Lining/S4				<b>Chrysotile (white asbestos)</b>	
In-fill-panel	Flat AC Sheeting	16m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/In-fill-panel/S8				<b>Chrysotile (white asbestos)</b>	
Eaves Linings	Flat AC Sheeting	30m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/Eaves Linings/S7				<b>Chrysotile (white asbestos)</b>	

**Interior**

**B00B - R0002 - Home Base (58.36 m2)**

No Asbestos

**B00B - R0003 - Home Base Store (4.15 m2)**

No Asbestos

**B00B - R0005 - Home Base Store (4.15 m2)**

No Asbestos

**B00B - R0006 - Home Base (57.25 m2)**

No Asbestos

**B00B - R0007 - Home Base (57.48 m2)**

No Asbestos

**B00B - R0008 - Home Base Store (4.35 m2)**

No Asbestos

**B00B - R0009 - Personal Effects Storage (9.77 m2)**

No Asbestos

**B00B - R0010 - Practical Activities - 2hb (12 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00B/R0010/Floor Coverings Res/Textile/S16				<b>Chrysotile (white asbestos)</b>	

**B00B - R0011 - Movement (6.69 m2)**

No Asbestos

**B00B - R0012 - Movement (47.24 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00A/R0029/Ceiling Structures/Linings/S15				<b>Chrysotile (white asbestos)</b>	
In-fill-panel	Flat AC Sheeting	40m	North, South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/In-fill-panel/S8				<b>Chrysotile (white asbestos)</b>	

**B00B - R0013 - Movement (6.81 m2)**

Ceiling Structures/Linings	Vermiculite	4394/B00A/R0002/Ceiling Structures/Linings/S13			<b>Limited Samples Taken</b>	
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
In-fill-panel	Flat AC Sheeting	6m	North, South, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/In-fill-panel/S8				<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Building Services/General Learning - 1972 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/Gable Verge Lining/S4					<b>Chrysotile (white asbestos)</b>

**Interior**

**B00C - R0001 - General Storeroom (18.57 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>

**B00C - R0002 - Garden Store (18.94 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>

Wall Linings Internal	Flat AC Sheeting	6m2	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4394/B00C/R0002/Wall Linings Internal/S19					<b>Chrysotile (white asbestos)</b>

**B00C - R0003 - General Assistant/Bulk Store (13.14 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>

**B00C - R0004 - Special Programs Room (26.99 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>

**B00C - R0005 - General Storeroom (4.6 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>

**B00C - R0006 - Toilets - Boys/Girls (4.68 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00A/R0019/Floor Coverings Res/Textile/S14					<b>Chrysotile (white asbestos)</b>

**B00C - R0007 - Uniform Shop (9.77 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>

**B00C - R0008 - Movement (22.29 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>

Wall Linings Internal	Flat AC Sheeting	2m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00C/R0002/Wall Linings Internal/S19					<b>Chrysotile (white asbestos)</b>

**B00C - R0009 - Garage/Carport (44.07 m2)**

No Asbestos

**B00C - R0010 - General Assistant/Bulk Store (6.91 m2)**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00D/R0006/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
<b>B00C - R0011 - Movement (5.7 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00D/R0006/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
<b>B00C - R0012 - General Storeroom (28.66 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities/Pre-School Facilities - 1972 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	26m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/Gable Verge Lining/S4				Chrysotile (white asbestos)	

**Interior****B00D - R0006 - Toilets - Boys (36.73 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Partition Walls (Cubicles)/S2				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	

**B00D - R0007 - Staff Toilet (1.24 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	

**B00D - R0008 - Movement (76.23 m2)**

Ceiling Structures/Linings	Flat AC Sheeting				No Asbestos Detected	
	4394/Build+1/Room+1/Ceiling Structures/Linings/S5					

**B00D - R0009 - Home Base - Pre (69.22 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	70m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet				No Asbestos Detected	
	4394/B00D/R0009/Floor Coverings Res/Textile/S6					

**B00D - R0010 - Toilets - Girls (47.94 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Partition Walls (Cubicles)/S2				Chrysotile (white asbestos)	

**B00D - R0011 - General Storeroom - Pre (9.42 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	

**B00D - R0012 - Toilets - Boys/Girls - Pre (7.9 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Partition Walls (Cubicles)/S2				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	

**B00D - R0013 - Disabled Shower/Toilet (11.03 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1972 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/Eaves Linings/S7				<b>Chrysotile (white asbestos)</b>	
In-fill-panel	Flat AC Sheeting	80m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/In-fill-panel/S8				<b>Chrysotile (white asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/Gable Verge Lining/S4				<b>Chrysotile (white asbestos)</b>	

**Interior****B00E - R0001 - Movement (89.47 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos)</b>	
In-fill-panel	Flat AC Sheeting	22m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/In-fill-panel/S8				<b>Chrysotile (white asbestos)</b>	

**B00E - R0002 - Practical Activities - 1hb (12.41 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/R0002/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>	

**B00E - R0003 - Home Base (59.41 m2)**

No Asbestos

**B00E - R0004 - Home Base (59.51 m2)**

No Asbestos

**B00E - R0005 - Practical Activities - 1hb (12.42 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/R0002/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>	

**B00E - R0006 - Home Base (85.58 m2)**

No Asbestos

**B00E - R0007 - Practical Activities - 1hb (11.48 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	4394/B00D/R0009/Floor Coverings Res/Textile/S6				<b>No Asbestos Detected</b>	

**B00E - R0008 - Toilets - Boys/Girls (3.82 m2)**

Wall Linings Internal	Vinyl Tiles	14m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/R0008/Wall Linings Internal/S10				<b>Chrysotile (white asbestos)</b>	
Incinerator	Encapsulated Insulation material within unit	1Unit(s)	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Not sampled due to no access to</b>					

**B00E - R0009 - Distribution Board (2.11 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00E - R0010 - Practical Activities - 1hb (12.36 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/R0002/Floor Coverings Res/Textile/S9				<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority	
Sample No					Test Result		
<b>B00E - R0011 - Home Base (59.66 m2)</b>							
No Asbestos							
<b>B00E - R0012 - Home Base (59.59 m2)</b>							
No Asbestos							
<b>B00E - R0013 - Practical Activities - 1hb (12.41 m2)</b>							
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)	
4394/B00E/R0002/Floor Coverings Res/Textile/S9					<b>Chrysotile (white asbestos)</b>		
<b>B00E - R0014 - Movement (8.19 m2)</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4394/Build+1/Room+1/Ceiling Structures/Linings/S5				<b>No Asbestos Detected</b>	
<b>B00E - R0015 - Movement (4.81 m2)</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4394/Build+1/Room+1/Ceiling Structures/Linings/S5				<b>No Asbestos Detected</b>	
<b>B00E - R0016 - Movement (8.17 m2)</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4394/Build+1/Room+1/Ceiling Structures/Linings/S5				<b>No Asbestos Detected</b>	
<b>B00E - R0017 - Movement (6.8 m2)</b>							
Ceiling Structures/Linings	Flat AC Sheeting	4394/Build+1/Room+1/Ceiling Structures/Linings/S5				<b>No Asbestos Detected</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning - 1972 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/Gable Verge Lining/S4				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	30m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/Eaves Linings/S7				Chrysotile (white asbestos)	
In-fill-panel	Flat AC Sheeting	22m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/In-fill-panel/S8				Chrysotile (white asbestos)	

**Interior**

**B00F - R0001 - Personal Effects Storage (7.6 m2)**

No Asbestos

**B00F - R0002 - Home Base Store (2.52 m2)**

No Asbestos

**B00F - R0003 - Toilets - Boys/Girls (3.78 m2)**

Wall Linings Internal	Vinyl Tiles	6m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/R0008/Wall Linings Internal/S10				Chrysotile (white asbestos)	

**B00F - R0004 - Home Base (87.04 m2)**

No Asbestos

**B00F - R0005 - Home Base (56.84 m2)**

No Asbestos

**B00F - R0006 - Home Base Store (4.14 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/R0002/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)	

**B00F - R0008 - Home Base Store (4.12 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/R0002/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)	

**B00F - R0009 - Home Base (56.84 m2)**

No Asbestos

**B00F - R0010 - Home Base (86.8 m2)**

No Asbestos

**B00F - R0011 - Toilets - Boys/Girls (3.73 m2)**

Wall Linings Internal	Vinyl Tiles	10m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/R0008/Wall Linings Internal/S10				Chrysotile (white asbestos)	

**B00F - R0012 - Home Base Store (2.52 m2)**

No Asbestos

**B00F - R0013 - Personal Effects Storage (7.52 m2)**

No Asbestos

**B00F - R0014 - Movement (80.77 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Ceiling Structures/Linings/S3				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
In-fill-panel	Flat AC Sheeting	20m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00E/In-fill-panel/S8					Chrysotile (white asbestos)	

**B00F - R0015 - Movement (6.51 m2)**

No Asbestos

**B00F - R0016 - Personal Effects Storage (12 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Communal Facilities/Pupil Facilities - 1968 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00D/Gable Verge Lining/S4					Chrysotile (white asbestos)	

**Interior****B00H - M0001 - Movement (15.88 m2)**

No Asbestos

**B00H - M0002 - Movement (3.46 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00I/R0011/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)	

**B00H - M0003 - Other-Vacant (2.9 m2)**

No Asbestos

**B00H - M0004 - Out Of School Hours Care Centre (5.31 m2)**

No Asbestos

**B00H - R0001 - Communal Space (197.06 m2)**

No Asbestos

**B00H - R0002 - Hall Chair Store (5.45 m2)**

No Asbestos

**B00H - R0003 - Movement (2.83 m2)**

No Asbestos

**B00H - R0005 - Toilets - Girls (10.15 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00D/R0006/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	

**B00H - R0006 - Toilets - Boys (12.01 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00D/R0006/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	

**B00H - R0007 - Cleaning Distributed Store (2.49 m2)**

No Asbestos

**B00H - R0008 - Sports Store (13.04 m2)**

Non Accessible

**B00H - R0009 - Main Switch Board (11.14 m2)**

Electrical Backing Board	Resinous Board	1m2	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to live electrical						

**B00H - R0010 - Staff Toilet (4.09 m2)**

Incinerator	Millboard	1Unit(s)	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Not sampled due to no access to						

**B00H - R0011 - Canteen Office/Store (8.32 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00H/R0018/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)	

**B00H - R0012 - Canteen (32.32 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	33m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00H/R0018/Floor Coverings Res/Textile/S11					<b>Chrysotile (white asbestos)</b>	
<b>B00H - R0013 - Movement (2.12 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00H/R0018/Floor Coverings Res/Textile/S11					<b>Chrysotile (white asbestos)</b>	
<b>B00H - R0014 - Canteen Office/Store (4.51 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00H/R0014/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00H - R0016 - Movement (16.9 m2)</b>						
No Asbestos						
<b>B00H - R0017 - Movement (48.85 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
4394/Build+1/Room+1/Ceiling Structures/Linings/S5					<b>No Asbestos Detected</b>	
<b>B00H - R0018 - Movement (71.69 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	72m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
4394/B00H/R0018/Floor Coverings Res/Textile/S11					<b>Chrysotile (white asbestos)</b>	
<b>B00H - R0019 - P.E. Store (2.59 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
4394/B00H/R0018/Floor Coverings Res/Textile/S11					<b>Chrysotile (white asbestos)</b>	

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/Gable Verge Lining/S4					<b>Chrysotile (white asbestos)</b>

**Interior****B001 - R0001 - Practical Activities - 1hb (13.42 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00H/R0014/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>

**B001 - R0002 - Home Base (59.47 m2)**

No Asbestos

**B001 - R0003 - Movement (12.09 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00I/R0011/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>

**B001 - R0004 - Withdrawal Space - 1hb (18.26 m2)**

No Asbestos

**B001 - R0005 - Toilets - Girls (7.49 m2)**

Wall Linings Internal	Flat AC Sheeting	4m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/R0008/Wall Linings Internal/S10					<b>Chrysotile (white asbestos)</b>

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>

**B001 - R0006 - Distribution Board (1.79 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B001 - R0007 - Toilets - Boys (7.07 m2)**

Wall Linings Internal	Flat AC Sheeting	4m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/R0008/Wall Linings Internal/S10					<b>Chrysotile (white asbestos)</b>

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>

**B001 - R0008 - Movement (12.09 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00I/R0011/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>

**B001 - R0009 - Home Base (59.47 m2)**

No Asbestos

**B001 - R0010 - Practical Activities - 1hb (13.43 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00H/R0014/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>

**B001 - R0011 - Movement (62.74 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00I/R0011/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00J - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/Gable Verge Lining/S4					<b>Chrysotile (white asbestos)</b>

**Interior****B00J - R0001 - Practical Activities - 1hb (13.42 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00H/R0014/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>

**B00J - R0002 - Home Base (59.48 m2)**

No Asbestos

**B00J - R0003 - Movement (12.09 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00I/R0011/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>

**B00J - R0004 - Withdrawal Space - 1hb (18.26 m2)**

No Asbestos

**B00J - R0005 - Toilets - Girls (7.52 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4394/B00M/R0002/Wall Linings Internal/S17					

**B00J - R0006 - Distribution Board (1.79 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00J - R0007 - Toilets - Boys (7.2 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4394/B00M/R0002/Wall Linings Internal/S17					

**B00J - R0008 - Movement (12.09 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00I/R0011/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>

**B00J - R0009 - Home Base (59.48 m2)**

No Asbestos

**B00J - R0010 - Practical Activities - 1hb (13.43 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00H/R0014/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>

**B00J - R0013 - Movement (62.52 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00I/R0011/Ceiling Structures/Linings/S20					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00D/Gable Verge Lining/S4					Chrysotile (white asbestos)	

**Interior**

**B00K - R0001 - Practical Activities - 1hb (13.43 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00H/R0014/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	

**B00K - R0002 - Home Base (59.47 m2)**

No Asbestos

**B00K - R0003 - Movement (12.09 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00I/R0011/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)	

**B00K - R0004 - Withdrawal Space - 1hb (18.26 m2)**

No Asbestos

**B00K - R0005 - Toilets - Girls (7.5 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00D/R0006/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	4m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00E/R0008/Wall Linings Internal/S10					Chrysotile (white asbestos)	

**B00K - R0006 - Distribution Board (1.79 m2)**

Note: No inspection of live electrical installation.

Non Accessible

**B00K - R0007 - Toilets - Boys (7.18 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00D/R0006/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	

**B00K - R0008 - Movement (12.1 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00I/R0011/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)	

**B00K - R0009 - Home Base (59.47 m2)**

No Asbestos

**B00K - R0010 - Practical Activities - 1hb (13.43 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00H/R0014/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	

**B00K - R0011 - Movement (62.6 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
4394/B00I/R0011/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00E/Eaves Linings/S7					<b>Chrysotile (white asbestos)</b>
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/Gable Verge Lining/S4					<b>Chrysotile (white asbestos)</b>

**Interior**

**B00L - R0001 - Movement (86.05 m2)**

Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00L - R0002 - Toilets - Girls (29.77 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>
Incinerator	Encapsulated Insulation material within unit	1Unit(s)	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	<b>Assumed Asbestos - Not sampled due to no access to</b>					

Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00L - R0003 - Home Base (65.82 m2)**

Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00L - R0004 - Home Base (65.82 m2)**

Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00L - R0005 - Home Base (62.86 m2)**

Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00L - R0006 - Toilets - Boys (29.71 m2)**

Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00D/R0006/Partition Walls (Cubicles)/S2					<b>Chrysotile (white asbestos)</b>

**B00L - R0007 - General Storeroom (6.97 m2)**

No Asbestos

**B00L - R0008 - Stairs (5.6 m2)**

Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00L - R0009 - Covered Outdoor Learning Area (348.16 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00L - R1002 - Home Base (64.33 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00L - R1003 - Home Base (65.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00L - R1004 - Home Base (63.03 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00L - R1005 - Home Base (61.46 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00L - R1006 - Movement (71.36 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Wall Linings Internal	Flat AC Sheeting	8m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00C/R0002/Wall Linings Internal/S19					Chrysotile (white asbestos)
<b>B00L - R1007 - Stairs (11.21 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00L - R1008 - Home Base Store (7.24 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	4394/B00A/R0002/Ceiling Structures/Linings/S13					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Support Unit/Staff Facilities - 1972 - Timber (Timber)**

**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00M/R0007/Ceiling Structures/Linings/S18			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Underfloor Voids	AC Fragments/Debris	1m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	4394/B00M/Underfloor Voids/S21			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		

**Interior**

**B00M - R0001 - Staff Room (51.89 m2)**

No Asbestos

**B00M - R0002 - Toilets - Boys/Girls (6.38 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	4394/B00M/R0002/Wall Linings Internal/S17					

**B00M - R0003 - Movement (45.94 m2)**

No Asbestos

**B00M - R0004 - No Access (15.65 m2)**

No Asbestos

**B00M - R0005 - Staff Room Annexe (15.65 m2)**

No Asbestos

**B00M - R0006 - Movement (14.53 m2)**

No Asbestos

**B00M - R0007 - Movement (11.82 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	4394/B00M/R0007/Ceiling Structures/Linings/S18			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00M - R0008 - Home Base (47.45 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00P - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00P - R0001 - Communal Space (198.45 m2)**

No Asbestos

**B00P - R0002 - Raised Platform (53.95 m2)**

No Asbestos

**B00P - R0003 - Chair Storeroom (12.67 m2)**

No Asbestos

**B00P - R0004 - Communal/Performance Store (10.34 m2)**

No Asbestos

**B00P - R0005 - P.E. Store (16.48 m2)**

No Asbestos

**B00P - R0006 - Entry Vestibule (2.42 m2)**

No Asbestos

**B00P - R0007 - Toilets - Girls (6.99 m2)**

No Asbestos

**B00P - R0008 - Sound Cupboard (2.04 m2)**

No Asbestos

**B00P - R0009 - Entry Vestibule (3.45 m2)**

No Asbestos

**B00P - R0010 - Toilets - Boys (5.67 m2)**

No Asbestos

**B00P - R0011 - Cleaning Distributed Store (3.46 m2)**

No Asbestos

**B00P - R0012 - General Storeroom (1.59 m2)**

No Asbestos

**B00P - R0013 - Distribution Board (3.29 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00P - R0014 - Access Shower/Toilet (6.89 m2)**

No Asbestos

**B00P - R0015 - Covered Outdoor Learning Area (190.72 m2)**

No Asbestos

**B00P - R0016 - Movement (8.49 m2)**

No Asbestos

**B00P - R0017 - Ramp (11.91 m2)**

No Asbestos

**B00P - R0018 - Movement (18.1 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**There are no asbestos related file attachment(s) for this school.**

2017