


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Quirindi High School (8174)
Region : New England
State Electorate : Upper Hunter
Local Government Area : Liverpool Plains

Initial Survey : Noel Arnold & Associates : 25 - Mar - 2008
Reviewed By : Greencap-NAA : 07 - May - 2015

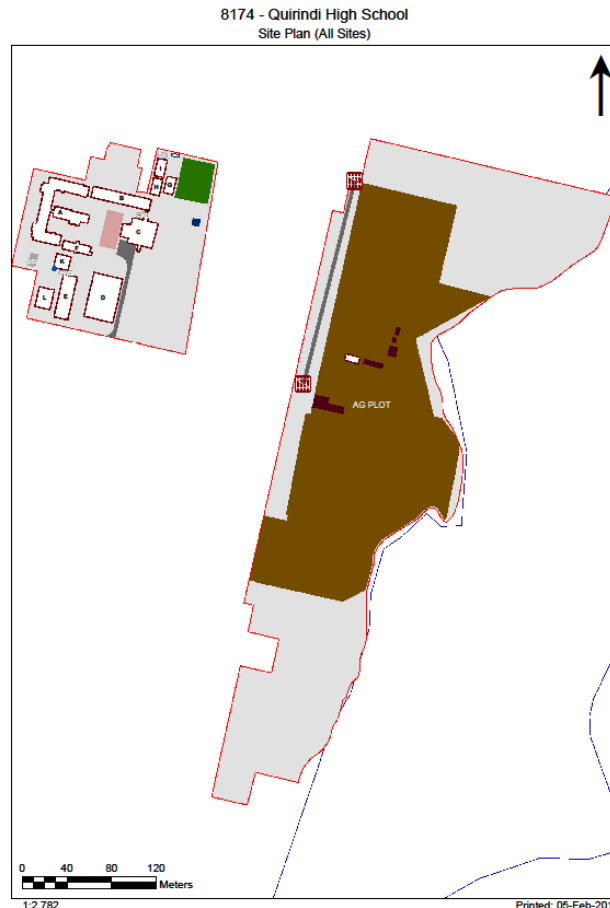

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Various - 1935 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids	AC Fragments/Debris	3m2	Variable positions	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	8174/B00A/Underfloor Voids/S21			Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		
Ceiling Voids	Non Accessible Area - Area inaccessible					

Interior**B00A - R0004 - Movement (6.33 m2)**

No Asbestos

B00A - R0005 - Laundry (3.83 m2)

No Asbestos

B00A - R0006 - Food Technology L.S. (101.71 m2)

No Asbestos

B00A - R0007 - Food/Research Space (19.92 m2)

No Asbestos

B00A - R0008 - Movement (6.41 m2)

No Asbestos

B00A - R0009 - External Movement (2.52 m2)

No Asbestos

B00A - R0010 - Movement (10.72 m2)

No Asbestos

B00A - R0011 - Movement (4.24 m2)

No Asbestos

B00A - R0024 - Movement (1.8 m2)

No Asbestos

B00A - R0025 - Principal Office (19.2 m2)

No Asbestos

B00A - R0026 - General Learning Space (46.87 m2)

No Asbestos

B00A - R0027 - General Learning Space (47.23 m2)

No Asbestos

B00A - R0028 - General Storeroom (6.12 m2)

No Asbestos

B00A - R0030 - Cleaning Store - Distributed (0.98 m2)

No Asbestos

B00A - R0033 - General Learning Space (49.97 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8174/B00A/R0035/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00A - R0034 - Seminar/Technology Space (6.57 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8174/B00A/R0035/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00A - R0035 - Resource/Project Store (5.2 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	8174/B00A/R0035/Floor Coverings Res/Textile/S4					No Asbestos Detected

B00A - R0036 - Design L.S. (52.87 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
8174/B00A/R0035/Floor Coverings Res/Textile/S4					No Asbestos Detected	
B00A - R0038 - Interview/Office - Type 1 (10.35 m2)						
No Asbestos						
B00A - R0039 - Commonroom (89.25 m2)						
No Asbestos						
B00A - R0040 - Movement (10.96 m2)						
No Asbestos						
B00A - R0041 - Staff Change (3.55 m2)						
No Asbestos						
B00A - R0042 - Staff - Toilet (2.4 m2)						
No Asbestos						
B00A - R0043 - Staff - Toilet (2.38 m2)						
No Asbestos						
B00A - R0044 - Staff Change (1.17 m2)						
No Asbestos						
B00A - R0045 - Ancillary Staff (10.38 m2)						
No Asbestos						
B00A - R0046 - External Movement (4.47 m2)						
No Asbestos						
B00A - R0047 - Materials Store (24.65 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8174/B00A/R0047/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)	
B00A - R0048 - Senior Study (44.04 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8174/B00A/R0047/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)	
B00A - R0050 - Toilets-Boys (50.07 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet					
8174/B00A/R0050/Partition Walls (Cubicles)/S3					No Asbestos Detected	
B00A - R0051 - External Movement (2.09 m2)						
No Asbestos						
B00A - R0052 - Design L.S. (80.19 m2)						
No Asbestos						
B00A - R0053 - Design L.S. (4.26 m2)						
No Asbestos						
B00A - R0054 - Staff Study (10.27 m2)						
No Asbestos						
B00A - R0055 - Movement (1.76 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
8174/B00A/R0055/Ceiling Structures/Linings/S8					No Asbestos Detected	
B00A - R0056 - Movement (3.15 m2)						
No Asbestos						
B00A - R0057 - Movement (1.77 m2)						
No Asbestos						
B00A - R0058 - Movement (11.03 m2)						
No Asbestos						
B00A - R0059 - Movement (17.81 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0060 - Clinic-Toilets (1.9 m2)						
No Asbestos						
B00A - R0061 - Clinic - Girls (13.63 m2)						
No Asbestos						
B00A - R0062 - Clinic-Toilets (2.09 m2)						
No Asbestos						
B00A - R0063 - Clinic - Boys (9.61 m2)						
No Asbestos						
B00A - R0064 - Principal Office (22.78 m2)						
No Asbestos						
B00A - R0065 - Staff Study (13.48 m2)						
No Asbestos						
B00A - R0066 - Communications Cupboard (0.27 m2)						
No Asbestos						
B00A - R0067 - Duplicating Workroom (21.79 m2)						
No Asbestos						
B00A - R0068 - Administration - Clerical (36.4 m2)						
No Asbestos						
B00A - R0069 - Staff - Toilet (6.03 m2)						
No Asbestos						
B00A - R0070 - Public Entry (23.83 m2)						
No Asbestos						
B00A - R0071 - Movement (11.22 m2)						
No Asbestos						
B00A - R0072 - Movement (67.14 m2)						
No Asbestos						
B00A - R0073 - Movement (1.71 m2)						
No Asbestos						
B00A - R0074 - External Movement (7.47 m2)						
No Asbestos						
B00A - R0075 - Staff Study (35.08 m2)						
No Asbestos						
B00A - R0076 - Staff Study (11.69 m2)						
Electrical Mounting Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00A - R0077 - General Storeroom (0.34 m2)						
No Asbestos						
B00A - R0078 - Movement (2.99 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8174/B00A/R0047/Ceiling Structures/Linings/S20				Chrysotile (white asbestos)		
B00A - R0079 - Seminar/Technology Space (12 m2)						
No Asbestos						
B00A - R0080 - Pantry (12.92 m2)						
No Asbestos						
B00A - R0081 - Pantry (14.57 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0082 - External Movement (35.42 m2)						
No Asbestos						
B00A - R0083 - Stairs (8.83 m2)						
No Asbestos						
B00A - R0084 - Stairs (8.98 m2)						
No Asbestos						
B00A - R1001 - General Storeroom (5.92 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
		8174/B00A/R0035/Floor Coverings Res/Textile/S4				No Asbestos Detected
B00A - R1002 - General Storeroom (7.15 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
		8174/B00A/R0035/Floor Coverings Res/Textile/S4				No Asbestos Detected
B00A - R1003 - Cleaning Store - Distributed (0.93 m2)						
No Asbestos						
B00A - R1004 - Movement (130.99 m2)						
No Asbestos						
B00A - R1005 - General Learning Space (47.24 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
		8174/B00A/R0035/Floor Coverings Res/Textile/S4				No Asbestos Detected
B00A - R1006 - General Learning Space (47.43 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
		8174/B00A/R0035/Floor Coverings Res/Textile/S4				No Asbestos Detected
B00A - R1007 - General Storeroom (12.98 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
		8174/B00A/R0035/Floor Coverings Res/Textile/S4				No Asbestos Detected
B00A - R1008 - Staff - Toilet (2.94 m2)						
No Asbestos						
B00A - R1009 - Movement (1.32 m2)						
No Asbestos						
B00A - R1010 - Staff - Toilet (1.28 m2)						
No Asbestos						
B00A - R1011 - Staff Study (35.01 m2)						
No Asbestos						
B00A - R1012 - General Learning Space (47.71 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
		8174/B00A/R0035/Floor Coverings Res/Textile/S4				No Asbestos Detected
B00A - R1013 - General Learning Space (47.35 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
		8174/B00A/R0035/Floor Coverings Res/Textile/S4				No Asbestos Detected
B00A - R1014 - Cleaning Store - Distributed (1.31 m2)						
No Asbestos						
B00A - R1015 - General Learning Space (50.49 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
		8174/B00A/R0035/Floor Coverings Res/Textile/S4				No Asbestos Detected
B00A - R1016 - Staff Study (55.12 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8174/B00A/R0035/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R1017 - Computer Learning Space (71.57 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8174/B00A/R0035/Floor Coverings Res/Textile/S4					No Asbestos Detected
B00A - R1018 - Stairs (13.89 m2)						
No Asbestos						
B00A - R1019 - Stairs (13.83 m2)						
No Asbestos						
B00A - R9001 - Toilets-Girls (41.63 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet					
	8174/B00A/R0050/Partition Walls (Cubicles)/S3					No Asbestos Detected
B00A - R9002 - Cleaning Store - Distributed (2.7 m2)						
No Asbestos						
B00A - R9003 - Art Learning Space (68.73 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	8174/B00A/R9003/Floor Coverings Res/Textile/S15					No Asbestos Detected
B00A - R9004 - Resources Store (21.88 m2)						
No Asbestos						
B00A - R9005 - Kiln Space (6.5 m2)						
No Asbestos						
B00A - R9006 - Darkroom Space (11.64 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8174/B00A/R0047/Ceiling Structures/Linings/S20					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - Various - 1969 - Brick/Block (Brick/Block)						
Exterior						
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Interior						
B00B - R0001 - Apparatus Store (26.21 m2)						
Ceiling Structures/Linings	Vermiculite					
	8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0006 - Main Switchroom (8.81 m2)						
No Asbestos						
B00B - R0007 - Cleaning Store - Distributed (3.25 m2)						
Ceiling Structures/Linings	Vermiculite					
	8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0008 - Staff Study (10.07 m2)						
Ceiling Structures/Linings	Vermiculite					
	8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0009 - Movement (11 m2)						
Ceiling Structures/Linings	Vermiculite					
	8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8174/B00B/R0012/Floor Coverings Res/Textile/S19					No Asbestos Detected
B00B - R0010 - Staff - Toilet (1.59 m2)						
Ceiling Structures/Linings	Vermiculite					
	8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0011 - Staff Change (3.11 m2)						
Ceiling Structures/Linings	Vermiculite					
	8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0012 - Staff Study (26.1 m2)						
Ceiling Structures/Linings	Vermiculite					
	8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet					
	8174/B00B/R0012/Floor Coverings Res/Textile/S19					No Asbestos Detected
B00B - R0014 - Movement (100.75 m2)						
Ceiling Structures/Linings	Vermiculite					
	8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R0015 - Movement (22.5 m2)						
No Asbestos						
B00B - R0016 - Stairs (17.57 m2)						
No Asbestos						
B00B - R0017 - Ramp (19.56 m2)						
No Asbestos						
B00B - R0018 - Stairs (4.42 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R0019 - Preparation (38.94 m2)						
No Asbestos						
B00B - R0020 - Laboratory L.S. (92.61 m2)						
No Asbestos						
B00B - R0021 - Laboratory L.S. (92.56 m2)						
No Asbestos						
B00B - R1001 - Cleaning Store - Distributed (3.12 m2)						
Ceiling Structures/Linings	Vermiculite		8174/B00B/R0001/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1002 - General Storeroom (9.64 m2)						
Ceiling Structures/Linings	Vermiculite		8174/B00B/R0001/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1003 - General Learning Space (53.22 m2)						
Ceiling Structures/Linings	Vermiculite		8174/B00B/R0001/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet		8174/B00B/R0012/Floor Coverings Res/Textile/S19			No Asbestos Detected
B00B - R1004 - General Storeroom (6.25 m2)						
Ceiling Structures/Linings	Vermiculite		8174/B00B/R0001/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1005 - Resource/Project Store (6.28 m2)						
Ceiling Structures/Linings	Vermiculite		8174/B00B/R0001/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00B - R1006 - Computer Learning Space (66.54 m2)						
Ceiling Structures/Linings	Vermiculite		8174/B00B/R0001/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet		8174/B00B/R0012/Floor Coverings Res/Textile/S19			No Asbestos Detected
B00B - R1007 - General Storeroom (13.03 m2)						
Ceiling Structures/Linings	Vermiculite		8174/B00B/R0001/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet		8174/B00B/R0012/Floor Coverings Res/Textile/S19			No Asbestos Detected
B00B - R1008 - General Storeroom (12.82 m2)						
Ceiling Structures/Linings	Vermiculite		8174/B00B/R0001/Ceiling Structures/Linings/S18			Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Sheet		8174/B00B/R0012/Floor Coverings Res/Textile/S19			No Asbestos Detected
B00B - R1009 - General Learning Space (53.14 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 8174/B00B/R0012/Floor Coverings Res/Textile/S19					No Asbestos Detected
B00B - R1010 - Staff Study (25.91 m2)						
Ceiling Structures/Linings	Vermiculite 8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 8174/B00B/R0012/Floor Coverings Res/Textile/S19					No Asbestos Detected
B00B - R1011 - Cleaning Store - Distributed (3.06 m2)						
Ceiling Structures/Linings	Vermiculite 8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1012 - General Storeroom (6.25 m2)						
Ceiling Structures/Linings	Vermiculite 8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1013 - General Learning Space (52.92 m2)						
Ceiling Structures/Linings	Vermiculite 8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Sheet 8174/B00B/R0012/Floor Coverings Res/Textile/S19					No Asbestos Detected
B00B - R1014 - Movement (115.13 m2)						
Ceiling Structures/Linings	Vermiculite 8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1015 - Distribution Board Cupboard (0.89 m2) Note: No inspection of live electrical installation.						
Wall Linings Internal	Flat AC Sheeting	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8174/B00B/R1015/Wall Linings Internal/S6					Chrysotile (white asbestos)
Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00B - R1016 - Movement (1.78 m2)						
No Asbestos						
B00B - R1017 - Stairs (16.23 m2)						
Ceiling Structures/Linings	Vermiculite 8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1018 - Stairs (15.22 m2)						
Ceiling Structures/Linings	Vermiculite 8174/B00B/R0001/Ceiling Structures/Linings/S18					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00B - R1019 - Ramp (19.56 m2)						
No Asbestos						
B00B - R9001 - Cleaning Store - Distributed (4.5 m2)						
No Asbestos						
B00B - R9002 - Movement (3.02 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00B - R9003 - Movement (6.14 m2)						
No Asbestos						
B00B - R9004 - Student Drinking Facilities (11.98 m2)						
No Asbestos						
B00B - R9005 - Toilets-Boys (21.91 m2)						
No Asbestos						
B00B - R9006 - Student Drinking Facilities (11.75 m2)						
No Asbestos						
B00B - R9007 - Toilets-Girls (21.84 m2)						
No Asbestos						
B00B - R9011 - Shower/Change (6.59 m2)						
No Asbestos						
B00B - R9014 - Movement (89.58 m2)						
No Asbestos						
B00B - R9015 - Staff - Toilet (3.29 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8174/B00B/R9015/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	8174/B00B/R9015/Floor Coverings Res/Textile/S17				No Asbestos Detected	
B00B - R9016 - General Storeroom (4.96 m2)						
Electrical Backing Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00B - R9017 - Student Canteen (43.5 m2)						
No Asbestos						
B00B - R9018 - Careers Advisers Office (35.04 m2)						
No Asbestos						
B00B - R9019 - General Assistants (43.73 m2)						
No Asbestos						
B00B - R9020 - Cleaning Store - Distributed (23.4 m2)						
No Asbestos						
B00B - R9021 - General Storeroom (71.05 m2)						
No Asbestos						
B00B - R9022 - Maintenance Bulk Store (7.74 m2)						
No Asbestos						
B00B - R9023 - General Learning Space (61.33 m2)						
No Asbestos						
B00B - R9024 - Stairs (11.69 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Science/Library - 1971 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Gable Verge Lining	Flat AC Sheeting	20m	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	8174/B00C/Gable Verge Lining/S25					Chrysotile (white asbestos)

Interior**B00C - R0001 - Movement (523.02 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	North East corner	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8174/B00C/R0001/Ceiling Structures/Linings/S22					Chrysotile (white asbestos)

B00C - R0002 - Covered Area (83.01 m2)

No Asbestos

B00C - R0003 - Stairs (5.8 m2)

No Asbestos

B00C - R0004 - Stairs (16.25 m2)

No Asbestos

B00C - R0006 - Movement (2.43 m2)

No Asbestos

B00C - R0007 - Lift (1.4 m2)

No Asbestos

B00C - R1001 - Staff - Toilet (3.16 m2)

Incinerette	Millboard	1Unit	East	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Electrical Hazard - inaccessible

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8174/B00C/R2004/Partition Walls (Cubicles)/S26					Chrysotile (white asbestos)

B00C - R1002 - Staff - Toilet (3.21 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8174/B00C/R2004/Partition Walls (Cubicles)/S26					Chrysotile (white asbestos)

B00C - R1005 - Movement (3.9 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8174/B00C/R1011/Ceiling Structures/Linings/S24					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00C - R1006 - Chemical Store (23.33 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	8174/B00C/R1011/Ceiling Structures/Linings/S24					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Floor Coverings Res/Textile	Vinyl Tiles	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8174/B00C/R1005/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)

Floor Coverings Res/Textile	Adhesive	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8174/B00C/R1006/Floor Coverings Res/Textile/S23					Chrysotile (white asbestos)

B00C - R1007 - Preparation (51.42 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Vermiculite 8174/B00C/R1011/Ceiling Structures/Linings/S24					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 8174/B00C/R1005/Floor Coverings Res/Textile/S7	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1008 - Distribution Board Cupboard (0.87 m2)				Note: No inspection of live electrical installation.		
Electrical Backing Board	Resinous Board	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
B00C - R1009 - Cleaning Store - Distributed (0.6 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 8174/B00C/R1005/Floor Coverings Res/Textile/S7	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R1010 - Laboratory L.S. (91.35 m2)						
Ceiling Structures/Linings	Vermiculite 8174/B00C/R1011/Ceiling Structures/Linings/S24					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R1011 - Laboratory L.S. (91.17 m2)						
Ceiling Structures/Linings	Vermiculite 8174/B00C/R1011/Ceiling Structures/Linings/S24					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R1012 - Laboratory L.S. (58.84 m2)						
Ceiling Structures/Linings	Vermiculite 8174/B00C/R1011/Ceiling Structures/Linings/S24					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
B00C - R1013 - Movement (159.13 m2)				No Asbestos		
B00C - R1014 - Stairs (16.25 m2)				No Asbestos		
B00C - R1015 - Stairs (8.64 m2)				No Asbestos		
B00C - R1016 - Lift (1.4 m2)				No Asbestos		
B00C - R1017 - Movement (2.77 m2)				No Asbestos		
B00C - R2001 - Staff - Toilet (3.18 m2)						
Incinerette	Millboard	1Unit	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3) Assumed Asbestos - Electrical Hazard
Partition Walls (Cubicles)	Compressed AC Sheet 8174/B00C/R2004/Partition Walls (Cubicles)/S26	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R2003 - Cleaning Store - Distributed (2.68 m2)				No Asbestos		
B00C - R2004 - Staff - Toilet (1.31 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet 8174/B00C/R2004/Partition Walls (Cubicles)/S26	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R2005 - Staff Change (1.91 m2)				No Asbestos		
B00C - R2006 - Distribution Board Cupboard (0.72 m2)				Note: No inspection of live electrical installation.		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Electrical Mounting Board	Resinous Board	3Unit	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

Assumed Asbestos - Electrical Hazard

B00C - R2007 - Audio Visual Workroom (13.07 m2)						
No Asbestos						
B00C - R2008 - Seminar (13.07 m2)						
No Asbestos						
B00C - R2009 - Seminar (13.07 m2)						
No Asbestos						
B00C - R2010 - Main Area (53.44 m2)						
No Asbestos						
B00C - R2011 - Librarian (5.94 m2)						
No Asbestos						
B00C - R2012 - Workroom (8.34 m2)						
No Asbestos						
B00C - R2013 - Workroom (11.37 m2)						
No Asbestos						
B00C - R2014 - External Movement (22.34 m2)						
No Asbestos						
B00C - R2015 - External Movement (4.93 m2)						
No Asbestos						
B00C - R2016 - Main Area (190.64 m2)						
No Asbestos						
B00C - R2017 - Audio Visual Workroom (13.07 m2)						
No Asbestos						
B00C - R2018 - Lift (1.4 m2)						
No Asbestos						
B00C - R2019 - Movement (2.43 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Multi Purpose Facilities - 1974 - Brick/Veneer (Brick/Veneer)**Exterior**

Gable Verge Lining	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------	------------------	------	--------------	--------------------	---------	--------------------

Assumed Asbestos - Height Restriction

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B00D - M0002 - Control Room (6.34 m2)**

No Asbestos

B00D - M0004 - Control Room (6.34 m2)

No Asbestos

B00D - R0001 - Shower/Change (33.14 m2)

No Asbestos

B00D - R0003 - Toilets-Boys (17.86 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8174/B00D/R0003/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	

B00D - R0004 - Main Switchroom (2.9 m2)

No Asbestos

B00D - R0006 - Chair Store (63.8 m2)

No Asbestos

B00D - R0007 - Shower/Change (32.9 m2)

No Asbestos

B00D - R0009 - Toilets-Girls (17.52 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8174/B00D/R0003/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)	

B00D - R0011 - Cleaning Store - Distributed (3.33 m2)

No Asbestos

B00D - R0012 - Student Canteen (15.66 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
8174/B00D/R0012/Floor Coverings Res/Textile/S1					No Asbestos Detected	

B00D - R0013 - Staff Study (8.74 m2)

No Asbestos

B00D - R0014 - Staff Study (8.73 m2)

No Asbestos

B00D - R0015 - Sport Equipment Store (20.75 m2)

No Asbestos

B00D - R0016 - Sport Equipment Store (54.35 m2)

No Asbestos

B00D - R0017 - Multi-Purpose Space (455.17 m2)

No Asbestos

B00D - R0018 - External Movement (218.57 m2)

No Asbestos

B00D - R0019 - Stage (65 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Technological & Applied Studies - 1980 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting 8174/B00E/Eaves Linings/S27					No Asbestos Detected
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior

B00E - R0001 - Wood Technology Bay (34.8 m2)

No Asbestos

B00E - R0002 - Dust Extraction Space (2.84 m2)

No Asbestos

B00E - R0003 - Distribution Board Cupboard (2.84 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00E - R0004 - Materials Technology L.S. (91.1 m2)

No Asbestos

B00E - R0005 - Workshop Area (58.54 m2)

No Asbestos

B00E - R0006 - General Storeroom (3.42 m2)

No Asbestos

B00E - R0007 - Welding Area (12.78 m2)

No Asbestos

B00E - R0008 - Materials Technology L.S. (82.5 m2)

No Asbestos

B00E - R0009 - Metal Technology Bay (34.78 m2)

No Asbestos

B00E - R0012 - Welding Area (4.02 m2)

No Asbestos Found

B00E - R0013 - Welding Area (4 m2)

No Asbestos Found

B00E - R0014 - Welding Area (4.02 m2)

No Asbestos Found

B00E - R0015 - Store (29.2 m2)

No Asbestos Found

B00E - R0016 - External Movement (63.56 m2)

No Asbestos Found

B00E - R0017 - Movement (18.26 m2)

No Asbestos Found

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Art - 1961 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Bulk Store (20.09 m2)

No Asbestos

B00F - R0002 - Art Learning Space (60.49 m2)

No Asbestos

B00F - R0003 - Movement (1.49 m2)

No Asbestos

B00F - R0004 - Workshop (61.12 m2)

No Asbestos

B00F - R0005 - Art Entry/Display (6.32 m2)

No Asbestos

B00F - R0006 - Movement (2.97 m2)

No Asbestos

B00F - R0007 - Resources Space (26.55 m2)

No Asbestos

B00F - R0008 - Resources Store (7.72 m2)

No Asbestos

B00F - R0009 - Covered Area (5.04 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Music - 1913 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction
Underfloor Voids	No Asbestos Found

Interior

B00G - R0002 - General Storeroom (8.65 m2)

No Asbestos

B00G - R0004 - External Movement (19.16 m2)

No Asbestos

B00G - R0005 - Music Store (15.42 m2)

No Asbestos

B00G - R0006 - Music Learning Space (78.35 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1913 - Timber (Timber)**Exterior**

Ceiling Voids	Non Accessible Area - Height Restriction
Underfloor Voids	No Asbestos Found

Interior**B00H - R0001 - General Learning Space (47.06 m2)**

No Asbestos

B00H - R0002 - General Learning Space (47.54 m2)

No Asbestos

B00H - R0003 - External Movement (28.3 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Support Unit - 1913 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------	------------------	------	------------	--------------------	---------	--------------------

Assumed Asbestos - Area inaccessible construction zone

Ceiling Voids	No Asbestos Found					
---------------	-------------------	--	--	--	--	--

Ceiling Voids	Non Accessible Area - Height Restriction					
---------------	---	--	--	--	--	--

Interior

B001 - R0001 - External Movement (28.56 m2)

Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

8174/B001/R0001/Ceiling Structures/Linings/S14 **Chrysotile (white asbestos)**

B001 - R0002 - Music Learning Space (63.18 m2)

Ceiling Structures/Linings	Flat AC Sheeting	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

8174/B001/R0001/Ceiling Structures/Linings/S14 **Chrysotile (white asbestos)**

B001 - R0003 - Music Store (16.39 m2)

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

8174/B001/R0001/Ceiling Structures/Linings/S14 **Chrysotile (white asbestos)**

B001 - R0004 - Staff Study (20.48 m2)

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	------------	--------------------	---------	--------------------

8174/B001/R0001/Ceiling Structures/Linings/S14 **Chrysotile (white asbestos)**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Agricultural Science - 1913 - Steel (Steel)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B00J - R0001 - Class Tools Storage (5.25 m2)**

No Asbestos

B00J - R0002 - Staff Shower (3.38 m2)

No Asbestos

B00J - R0003 - Staff - Toilet (1.39 m2)

No Asbestos

B00J - R0004 - Agriculture Covered Area (24.65 m2)

No Asbestos

B00J - R0005 - Machine Storage (36.83 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning/Computer Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00K - R0001 - Computer Learning Space (91.72 m2)

No Asbestos

B00K - R0002 - Seminar - Type 1 (19.08 m2)

No Asbestos

B00K - R0003 - Resources Store (9.72 m2)

No Asbestos

B00K - R0004 - Computer Store (9 m2)

No Asbestos

B00K - R0005 - External Movement (30.33 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Technological & Applied Studies/General Learning - 2011 - Steel (Steel)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00L - R0001 - Food Technology L.S. (119.93 m2)

No Asbestos Found

B00L - R0002 - Pantry (9.33 m2)

No Asbestos Found

B00L - R0003 - Distribution Board Cupboard (0.64 m2)

Note: No inspection of live electrical installation.

No Asbestos Found

B00L - R0004 - Preparation - Materials (17.75 m2)

No Asbestos Found

B00L - R0005 - Preparation - Materials (16.17 m2)

No Asbestos Found

B00L - R0006 - Covered Outdoor Space (47.94 m2)

No Asbestos Found

B00L - R0007 - Movement (3.95 m2)

No Asbestos Found

B00L - R0008 - Toilets-Unisex (6.22 m2)

No Asbestos Found

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 836 - D12021 - H Cap Shower/Change/Toilet : Placement Date - 29/01/2003

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

Interior

R1 - Disabled Shower/Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	8 m2
End wall panel	Flat AC Sheet	Assumed Asbestos	36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017