


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Queanbeyan High School (8216)  
**Region :** Illawarra and South East  
**State Electorate :** Monaro  
**Local Government Area :** Queanbeyan

**Initial Survey :** Noel Arnold & Associates : 08 - May - 2008  
**Reviewed By :** Grencap-NAA : 27 - Aug - 2014

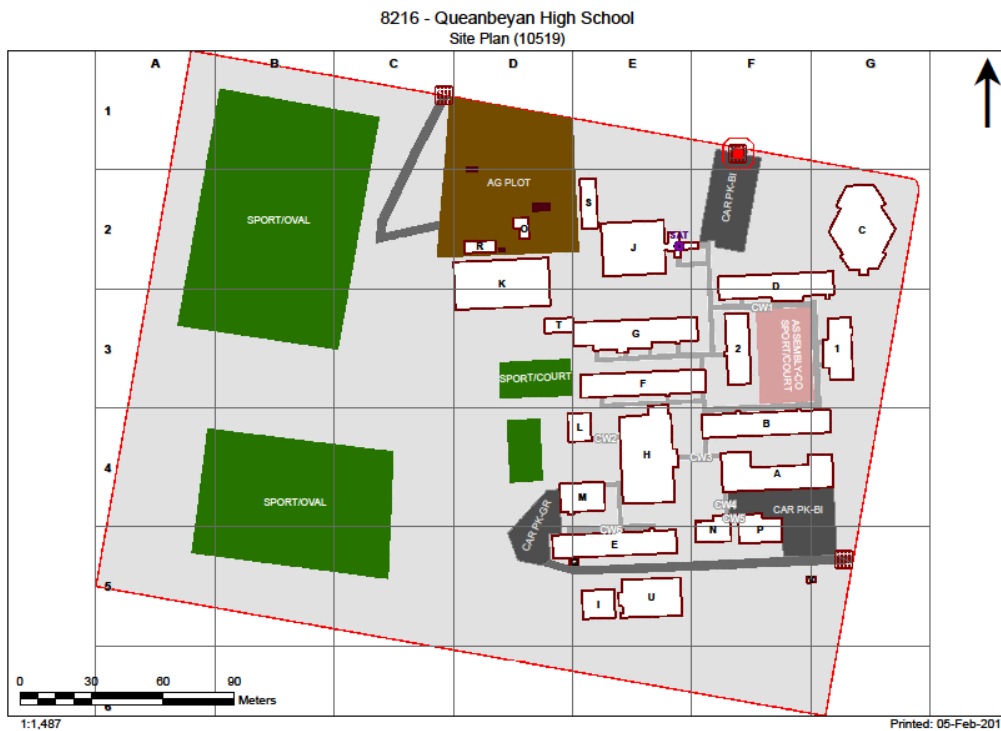

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Administration - 1975 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Gable Ends	Flat AC Sheeting	16m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Gable Verge Lining/S23				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B001 - R0001 - Interview/Office - Type 1 (13.1 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B001/R0002/Floor Coverings Res/Textile/S52				<b>Chrysotile (white asbestos)</b>	

**B001 - R0002 - Clinic - Boys (10.81 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10.81m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B001/R0002/Floor Coverings Res/Textile/S52				<b>Chrysotile (white asbestos)</b>	

**B001 - R0003 - Clinic - Girls (7.57 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B001/R0002/Floor Coverings Res/Textile/S52				<b>Chrysotile (white asbestos)</b>	

**B001 - R0004 - Staff - Toilet (4.25 m2)**

No Asbestos

**B001 - R0005 - General Storeroom (4.27 m2)**

No Asbestos

**B001 - R0006 - Staff - Toilet (4.17 m2)**

No Asbestos

**B001 - R0008 - Teachers Aides (12 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	8216/B001/R0021/Floor Coverings Res/Textile/S51				<b>No Asbestos Detected</b>	

**B001 - R0014 - Main Switchroom (1.14 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	1.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B001/R0014/Ceiling Structures/Linings/S50				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**B001 - R0017 - Staff - Toilet (1.19 m2)**

No Asbestos

**B001 - R0018 - General Storeroom (1.26 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	8216/B001/R0021/Floor Coverings Res/Textile/S51				<b>No Asbestos Detected</b>	

**B001 - R0019 - Principal Office (19.95 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19.95m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B001/R0002/Floor Coverings Res/Textile/S52				<b>Chrysotile (white asbestos)</b>	

**B001 - R0020 - External Movement (3.34 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	3.34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B002/R0016/Ceiling Structures/Linings/S47				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B001 - R0021 - Movement (19.95 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
8216/B001/R0021/Floor Coverings Res/Textile/S51					<b>No Asbestos Detected</b>	

**B001 - R0022 - Staff Kitchen (10.58 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
8216/B001/R0021/Floor Coverings Res/Textile/S51					<b>No Asbestos Detected</b>	

**B001 - R0023 - Deputy Principal Office (20.02 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
8216/B001/R0021/Floor Coverings Res/Textile/S51					<b>No Asbestos Detected</b>	

**B001 - R0024 - Movement (34.61 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
8216/B001/R0021/Floor Coverings Res/Textile/S51					<b>No Asbestos Detected</b>	

**B001 - R0026 - External Movement (27.97 m2)**

No Asbestos						
-------------	--	--	--	--	--	--

**B001 - R0027 - Administration - Clerical (56.13 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
8216/B001/R0021/Floor Coverings Res/Textile/S51					<b>No Asbestos Detected</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B002 - Administration/Staff Facilities - 1975 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Ends	Flat AC Sheeting	16m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Gable Verge Lining/S23			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B002 - R0001 - Commonroom (136.69 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B002/R0007/Floor Coverings Res/Textile/S46					<b>No Asbestos Detected</b>

**B002 - R0005 - Deputy Principal Office (20.79 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B002/R0007/Floor Coverings Res/Textile/S46					<b>No Asbestos Detected</b>

**B002 - R0006 - Leading Teacher (14.61 m2)**

No Asbestos

**B002 - R0007 - Clinic-Waiting (8.41 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B002/R0007/Floor Coverings Res/Textile/S46					<b>No Asbestos Detected</b>

**B002 - R0008 - Staff - Toilet (5.1 m2)**

No Asbestos

**B002 - R0009 - Cleaning Store - Distributed (2.23 m2)**

No Asbestos

**B002 - R0010 - Staff - Toilet (5.1 m2)**

No Asbestos

**B002 - R0012 - Movement (13.19 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B002/R0007/Floor Coverings Res/Textile/S46					<b>No Asbestos Detected</b>

**B002 - R0013 - Movement (8 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B002/R0007/Floor Coverings Res/Textile/S46					<b>No Asbestos Detected</b>

**B002 - R0014 - Administration - Clerical (24.51 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B002/R0007/Floor Coverings Res/Textile/S46					<b>No Asbestos Detected</b>

**B002 - R0015 - Duplicating Workroom (20.2 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B002/R0007/Floor Coverings Res/Textile/S46					<b>No Asbestos Detected</b>

**B002 - R0016 - External Movement (1.77 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	1.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B002/R0016/Ceiling Structures/Linings/S47				Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning - 1964 - Brick/Block (Brick/Block)****Exterior**

In-fill-panel	Compressed AC Sheet	120m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/In-fill-panel/S6			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	No Asbestos Found					

**Interior****B00A - R0001 - Movement (84.65 m2)**

Ceiling Structures/Linings	Vermiculite					
	8216/B00A/R0002/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Floor Coverings Res/Textile	Vinyl Tiles	84.65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>

**B00A - R0002 - Staff - Toilet (6.37 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	3m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

Ceiling Structures/Linings	Vermiculite					
	8216/B00A/R0002/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00A - R0003 - General Learning Space (52.49 m2)**

Ceiling Structures/Linings	Vermiculite					
	8216/B00A/R0002/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Floor Coverings Res/Textile	Vinyl Tiles	52.49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>

**B00A - R0004 - Laboratory L.S. (85.92 m2)**

Ceiling Structures/Linings	Vermiculite					
	8216/B00A/R0002/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					

**B00A - R0005 - Growing/Breeding (7.54 m2)**

Ceiling Structures/Linings	Vermiculite					
	8216/B00A/R0002/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>

**B00A - R0006 - Chemical Store (24.4 m2)**

Ceiling Structures/Linings	Vermiculite					
	8216/B00A/R0002/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b>
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Floor Coverings Res/Textile	Vinyl Tiles	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>

**B00A - R0007 - Distribution Board Cupboard (0.92 m2)**

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R0010 - Computer Learning Space (51.1 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00A/R0002/Floor Coverings Res/Textile/S3	51.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0011 - Staff Study (25.77 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00A/R0002/Floor Coverings Res/Textile/S3	25.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0012 - Duplicating Workroom (4.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00A/R0002/Floor Coverings Res/Textile/S3	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0013 - Cleaning Store - Distributed (5.09 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00A/R0002/Floor Coverings Res/Textile/S3	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0014 - Stairs (11.67 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R0015 - Stairs (18.23 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R0016 - External Movement (68.79 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting 8216/B00A/R0019/Ceiling Structures/Linings/S41	10.59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
<b>B00A - R0017 - Staff Study (11.44 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00A/R0002/Floor Coverings Res/Textile/S3	11.44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
<b>B00A - R0018 - Staff Study (52.03 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5				Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>	
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00A/R0002/Floor Coverings Res/Textile/S3	52.03m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0019 - External Movement (10.56 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	10.56m <sup>2</sup>	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0019/Ceiling Structures/Linings/S41					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
<b>B00A - R1001 - Staff - Toilet (6.84 m<sup>2</sup>)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8216/B00A/R0002/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	7m <sup>2</sup>	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	3m <sup>2</sup>	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
<b>B00A - R1002 - General Learning Space (63.41 m<sup>2</sup>)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8216/B00A/R0002/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	63.41m <sup>2</sup>	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>
<b>B00A - R1003 - General Storeroom (3.06 m<sup>2</sup>)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8216/B00A/R0002/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	4m <sup>2</sup>	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>
<b>B00A - R1004 - Store (9.06 m<sup>2</sup>)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8216/B00A/R0002/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	9.06m <sup>2</sup>	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>
<b>B00A - R1005 - General Learning Space (52.56 m<sup>2</sup>)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8216/B00A/R0002/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	52.56m <sup>2</sup>	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>
<b>B00A - R1006 - Distribution Board Cupboard (0.82 m<sup>2</sup>)</b>						
						Note: No inspection of live electrical installation.
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8216/B00A/R0002/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	1m <sup>2</sup>	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>
<b>B00A - R1007 - General Storeroom (6.68 m<sup>2</sup>)</b>						
Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	8216/B00A/R0002/Ceiling Structures/Linings/S5					<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles	7m <sup>2</sup>	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1008 - General Storeroom (4.59 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00A/R0002/Floor Coverings Res/Textile/S3	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00A - R1009 - General Learning Space (52.7 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00A/R0002/Floor Coverings Res/Textile/S3	52.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00A - R1010 - General Learning Space (52.41 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00A/R0002/Floor Coverings Res/Textile/S3	52.41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00A - R1011 - General Storeroom (4.62 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00A/R0002/Floor Coverings Res/Textile/S3	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00A - R1012 - General Storeroom (4.28 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00A/R0002/Floor Coverings Res/Textile/S3	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00A - R1013 - General Storeroom (3.11 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00A/R0002/Floor Coverings Res/Textile/S3	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00A - R1014 - General Learning Space (52.56 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00A/R0002/Floor Coverings Res/Textile/S3	52.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
<b>B00A - R1015 - Movement (88.45 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00A/R0002/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00A/R0002/Floor Coverings Res/Textile/S3	88.45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1016 - Stairs (17.66 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		8216/B00A/R0002/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R1017 - Stairs (18 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
		8216/B00A/R0002/Ceiling Structures/Linings/S5				Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R9001 - General Assistants (67.62 m2)</b>						
Stored Sheeting	Flat AC Sheeting					
		8216/B00A/R9001/Stored Sheeting/S42				No Asbestos Detected
Entry door infill panel	Flat AC Sheeting					
		8216/B00A/R9001/Entry door infill panel/S43				No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1975 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Gable Ends	Flat AC Sheeting	16m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Gable Verge Lining/S23				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior****B00B - R0001 - General Learning Space (65.95 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B00B/R0009/Floor Coverings Res/Textile/S45				<b>No Asbestos Detected</b>	

**B00B - R0002 - General Storeroom (23.11 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B00B/R0009/Floor Coverings Res/Textile/S45				<b>No Asbestos Detected</b>	

**B00B - R0003 - Staff Study (23.32 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B00B/R0009/Floor Coverings Res/Textile/S45				<b>No Asbestos Detected</b>	

**B00B - R0004 - Staff Study (23.25 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	23.25m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/R0008/Floor Coverings Res/Textile/S1				<b>Chrysotile (white asbestos)</b>	

**B00B - R0005 - Movement (27.2 m2)**

No Asbestos

**B00B - R0006 - General Learning Space (65.58 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B00B/R0009/Floor Coverings Res/Textile/S45				<b>No Asbestos Detected</b>	

**B00B - R0007 - General Learning Space (65.67 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B00B/R0009/Floor Coverings Res/Textile/S45				<b>No Asbestos Detected</b>	

**B00B - R0008 - Teachers Aides (23.18 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/R0008/Floor Coverings Res/Textile/S1				<b>Chrysotile (white asbestos)</b>	

**B00B - R0009 - General Learning Space (47.08 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B00B/R0009/Floor Coverings Res/Textile/S45				<b>No Asbestos Detected</b>	

**B00B - R0010 - General Learning Space (66.4 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B00B/R0009/Floor Coverings Res/Textile/S45				<b>No Asbestos Detected</b>	

**B00B - R0011 - Movement (27.29 m2)**

					<b>No Asbestos Detected</b>	
--	--	--	--	--	-----------------------------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00B - R0012 - External Movement (21.8 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B00B/R0012/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R0013 - External Movement (1.72 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	1.72m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B00B/R0013/Ceiling Structures/Linings/S44				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R0014 - External Movement (1.73 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	1.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B00B/R0013/Ceiling Structures/Linings/S44				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Multi Purpose Facilities/Performing Arts - 1971 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible
Underfloor Voids	No Asbestos Found

**Interior****B00C - M0001 - Control Room (2.98 m2)**

No Asbestos

**B00C - M0002 - Movement (2.82 m2)**

No Asbestos

**B00C - M0003 - Movement (2.97 m2)**

No Asbestos

**B00C - M0004 - Movement (2.82 m2)**

No Asbestos

**B00C - M0005 - Stairs (5.23 m2)**

No Asbestos

**B00C - M0006 - Stairs (5.31 m2)**

No Asbestos

**B00C - R0001 - Stage (95.53 m2)**

No Asbestos

**B00C - R0004 - Multi-Purpose Space (441.55 m2)**

No Asbestos

**B00C - R0005 - Movement (23.03 m2)**

No Asbestos

**B00C - R0006 - Distribution Board Cupboard (0.51 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00C - R0007 - Staff - Toilet (8.48 m2)**

No Asbestos

**B00C - R0008 - Staff - Toilet (6.57 m2)**

No Asbestos

**B00C - R0009 - Multi-Purpose Space (16.54 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
-----------------------------	-------------	------	------------	--------------------	---------	--------------------

8216/B00C/R0009/Floor Coverings Res/Textile/S15

**Chrysotile (white asbestos)****B00C - R0010 - Stairs (1.56 m2)**

No Asbestos

**B00C - R0011 - Movement (6.17 m2)**

No Asbestos

**B00C - R0012 - Movement (6.26 m2)**

No Asbestos

**B00C - R0013 - Stairs (1.56 m2)**

No Asbestos

**B00C - R0014 - External Movement (3.99 m2)**

No Asbestos

**B00C - R0015 - External Movement (3.7 m2)**

No Asbestos

**B00C - R0016 - External Movement (9.06 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00C - R0017 - External Movement (3.69 m2)</b>						
No Asbestos						
<b>B00C - R0018 - External Movement (3.99 m2)</b>						
No Asbestos						
<b>B00C - R9001 - Toilets-Boys (6.27 m2)</b>						
No Asbestos						
<b>B00C - R9002 - Movement (2 m2)</b>						
No Asbestos						
<b>B00C - R9003 - Performing Arts Changeroom (37.36 m2)</b>						
No Asbestos						
<b>B00C - R9004 - Performing Arts Changeroom (11.7 m2)</b>						
No Asbestos						
<b>B00C - R9005 - Performing Arts Changeroom (11.7 m2)</b>						
No Asbestos						
<b>B00C - R9006 - Movement (2.37 m2)</b>						
No Asbestos						
<b>B00C - R9007 - Toilets-Girls (6.22 m2)</b>						
No Asbestos						
<b>B00C - R9008 - Stairs (0.96 m2)</b>						
No Asbestos						
<b>B00C - R9009 - Stairs (0.96 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Technological & Applied Studies - 1958 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Ends	Flat AC Sheeting	16m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Gable Verge Lining/S23			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior**

**B00D - R0001 - Food Technology L.S. (105.94 m2)**

No Asbestos

**B00D - R0002 - Materials Store (16.87 m2)**

No Asbestos

**B00D - R0003 - Staff - Toilet (3.24 m2)**

No Asbestos

**B00D - R0004 - Materials Store (2.29 m2)**

No Asbestos

**B00D - R0005 - Cleaning Store - Distributed (0.69 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8216/B00H/R0023/Wall Linings Internal/S11					
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00D/R0005/Ceiling Structures/Linings/S25			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00D - R0006 - Distribution Board Cupboard (0.78 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00D/R0005/Ceiling Structures/Linings/S25			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8216/B00H/R0023/Wall Linings Internal/S11					

**B00D - R0007 - Laundry (10.57 m2)**

Wall Linings Internal	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00D/R0007/Wall Linings Internal/S49			<b>Chrysotile (white asbestos)</b>		

**B00D - R0008 - Pantry (12.75 m2)**

No Asbestos

**B00D - R0009 - Food Technology L.S. (99.06 m2)**

No Asbestos

**B00D - R0010 - Movement (8.29 m2)**

No Asbestos

**B00D - R0011 - Design L.S. (66.99 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	66.99m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00D/R0015/Floor Coverings Res/Textile/S48			<b>Chrysotile (white asbestos)</b>		

**B00D - R0012 - Materials Store (6.23 m2)**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B00D/R0015/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)	
<b>B00D - R0013 - Materials Store (9.76 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	9.76m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B00D/R0015/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)	
<b>B00D - R0014 - Movement (9.01 m2)</b>						
No Asbestos						
<b>B00D - R0015 - Materials Store (6.31 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6.31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B00D/R0015/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)	
<b>B00D - R0016 - Design L.S. (66.69 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	66.69m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B00D/R0015/Floor Coverings Res/Textile/S48					Chrysotile (white asbestos)	
<b>B00D - R0017 - External Movement (24.75 m2)</b>						
No Asbestos						
<b>B00D - R0018 - External Movement (3.34 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3.34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B002/R0016/Ceiling Structures/Linings/S47					Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00D - R0019 - Movement</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Technological & Applied Studies - 1958 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Gable Ends	Flat AC Sheeting	22m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Gable Verge Lining/S23				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	Air conditioner platform				<b>No Asbestos Detected</b>	
	8216/B00E/Ceiling Voids/S30					
Underfloor Voids	Moulded fibre cement pipe	250m2	Variable positions	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	8216/B00E/Underfloor Voids/S31				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Underfloor Voids	Vinyl Tiles				<b>No Asbestos Detected</b>	
	8216/B00E/Underfloor Voids/S32					

**Interior**

**B00E - R0001 - General Learning Space (49.66 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Floor Coverings Res/Textile/S3				<b>Chrysotile (white asbestos)</b>	

**B00E - R0002 - Movement (9.79 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Floor Coverings Res/Textile/S3				<b>Chrysotile (white asbestos)</b>	

**B00E - R0004 - Staff - Toilet (3.27 m2)**

No Asbestos

**B00E - R0006 - Materials Technology L.S. (82.27 m2)**

No Asbestos

**B00E - R0016 - Materials Store (15.22 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00A/R0002/Floor Coverings Res/Textile/S3				<b>Chrysotile (white asbestos)</b>	

**B00E - R0018 - Materials Store (12.74 m2)**

Wall Linings Internal	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00E/R0025/Wall Linings Internal/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00E - R0019 - Movement (6.52 m2)**

No Asbestos

**B00E - R0020 - Materials Technology L.S. (82.9 m2)**

No Asbestos

**B00E - R0021 - Materials Technology L.S. (144.16 m2)**

No Asbestos

**B00E - R0022 - Materials Store (14.35 m2)**

No Asbestos

**B00E - R0023 - Materials Store (6.96 m2)**

No Asbestos

**B00E - R0025 - Welding Area (13.32 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	3m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B00E/R0025/Wall Linings Internal/S9				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00E - R0026 - Movement (10.57 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	10.57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B00A/R0002/Floor Coverings Res/Textile/S3				<b>Chrysotile (white asbestos)</b>		
<b>B00E - R0027 - Welding Area (8.71 m2)</b>						
No Asbestos						
<b>B00E - R0028 - External Movement (1.66 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1.66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B00E/R0028/Ceiling Structures/Linings/S29				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00E - R0029 - External Movement (1.65 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1.65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B00E/R0028/Ceiling Structures/Linings/S29				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00E - Room+1 - kitchen</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
8216/B00E/Room+1/Floor Coverings Res/Textile/S8				<b>No Asbestos Detected</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning/Computer Learning - 1958 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Gable Ends	Flat AC Sheeting	16m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Gable Verge Lining/S23				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	No Asbestos Found					

**Interior****B00F - R0001 - Laboratory L.S. (100.15 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8216/B00F/R0013/Wall Linings Internal/S12					

**B00F - R0002 - Preparation (24.21 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8216/B00F/R0013/Wall Linings Internal/S12					

**B00F - R0003 - Movement (9.68 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8216/B00F/R0013/Wall Linings Internal/S12					

**B00F - R0004 - Laboratory L.S. (98.6 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8216/B00F/R0013/Wall Linings Internal/S12					

**B00F - R0005 - Cleaning Store - Distributed (4.73 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8216/B00F/R0013/Wall Linings Internal/S12					

**B00F - R0006 - Apparatus Store (9.24 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8216/B00F/R0013/Wall Linings Internal/S12					

**B00F - R0007 - Computer Learning Space (66.19 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8216/B00F/R0013/Wall Linings Internal/S12					

**B00F - R0008 - Movement (12.24 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8216/B00F/R0013/Wall Linings Internal/S12					

**B00F - R0009 - Darkroom Space (14.91 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8216/B00F/R0013/Wall Linings Internal/S12					

**B00F - R0010 - Darkroom Space (17.64 m2)**

No Asbestos

**B00F - R0011 - Computer Store (9.1 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8216/B00F/R0013/Wall Linings Internal/S12					

**B00F - R0012 - Computer Resource (9.08 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8216/B00F/R0013/Wall Linings Internal/S12					

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R0013 - Computer Learning Space (66.1 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
	8216/B00F/R0013/Wall Linings Internal/S12					<b>No Asbestos Detected</b>
<b>B00F - R0014 - External Movement (22.69 m2)</b>						
No Asbestos						
<b>B00F - R0015 - External Movement (1.71 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1.71m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00F/R0015/Ceiling Structures/Linings/S36					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00G - General Learning - 1958 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Gable Ends	Flat AC Sheeting	16m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Gable Verge Lining/S23				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00G - R0001 - Staff Study (19.62 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	19.62m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00G/R0002/Floor Coverings Res/Textile/S37				<b>Chrysotile (white asbestos)</b>	

**B00G - R0002 - General Storeroom (12.96 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00G/R0002/Floor Coverings Res/Textile/S37				<b>Chrysotile (white asbestos)</b>	

**B00G - R0003 - Staff Study (25.77 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	25.77m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00G/R0002/Floor Coverings Res/Textile/S37				<b>Chrysotile (white asbestos)</b>	

**B00G - R0004 - General Learning Space (52.56 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	52.56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00G/R0002/Floor Coverings Res/Textile/S37				<b>Chrysotile (white asbestos)</b>	

**B00G - R0005 - Movement (18.75 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	18.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00G/R0002/Floor Coverings Res/Textile/S37				<b>Chrysotile (white asbestos)</b>	

**B00G - R0006 - General Learning Space (66.65 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	66.65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00G/R0002/Floor Coverings Res/Textile/S37				<b>Chrysotile (white asbestos)</b>	

**B00G - R0007 - General Learning Space (66.46 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	66.46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00G/R0002/Floor Coverings Res/Textile/S37				<b>Chrysotile (white asbestos)</b>	

**B00G - R0012 - Multi-Purpose Space (24.1 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8216/B00G/R0022/Wall Linings Internal/S13					

**B00G - R0013 - General Storeroom (6.2 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00G/R0002/Floor Coverings Res/Textile/S37				<b>Chrysotile (white asbestos)</b>	

**B00G - R0014 - Movement (5.1 m2)**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	8216/B00G/R0022/Wall Linings Internal/S13					

**B00G - R0015 - General Learning Space (65.99 m2)**

--	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00G - R0016 - General Storeroom (6.26 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B00G/R0002/Floor Coverings Res/Textile/S37					Chrysotile (white asbestos)	
<b>B00G - R0018 - External Movement (26.89 m2)</b>						
No Asbestos						
<b>B00G - R0019 - Practical Activity Area (45.71 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	45.71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B00G/R0002/Floor Coverings Res/Textile/S37					Chrysotile (white asbestos)	
<b>B00G - R0020 - Study Space (9.52 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	9.52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B00G/R0002/Floor Coverings Res/Textile/S37					Chrysotile (white asbestos)	
<b>B00G - R0021 - Disabled Toilet (9.45 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
8216/B00G/R0022/Wall Linings Internal/S13					No Asbestos Detected	
<b>B00G - R0022 - Laundry (7.29 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
8216/B00G/R0022/Wall Linings Internal/S13					No Asbestos Detected	
<b>B00G - R0023 - Movement (4.2 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
8216/B00G/R0022/Wall Linings Internal/S13					No Asbestos Detected	
<b>B00G - R0024 - Disabled Toilet (10.37 m2)</b>						
Wall Linings Internal	Flat AC Sheeting					
8216/B00G/R0022/Wall Linings Internal/S13					No Asbestos Detected	
<b>B00G - R0025 - External Movement (31.77 m2)</b>						
No Asbestos						
<b>B00G - R0026 - External Movement (1.81 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1.81m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
8216/B00F/R0015/Ceiling Structures/Linings/S36					Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Pupil Facilities/Technological & Applied Studies - 1958 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	80m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					

**Interior****B00H - R0018 - General Learning Space (48.71 m2)**

No Asbestos

**B00H - R0019 - Student Canteen (53.61 m2)**

No Asbestos

**B00H - R0020 - Movement (3.41 m2)**

No Asbestos

**B00H - R0021 - Staff - Toilet (6.39 m2)**

Wall Linings Internal	Flat AC Sheeting					
	8216/B00H/R0021/Wall Linings Internal/S33					<b>No Asbestos Detected</b>

**B00H - R0022 - Office/Store (14.95 m2)**

No Asbestos

**B00H - R0023 - Cleaning Store - Distributed (2.49 m2)**

Wall Linings Internal	Flat AC Sheeting					
	8216/B00H/R0023/Wall Linings Internal/S11					<b>No Asbestos Detected</b>

**B00H - R0024 - Movement (179.11 m2)**

No Asbestos

**B00H - R0025 - Distribution Board Cupboard (0.38 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00H - R0026 - Student Drinking Facilities (70.47 m2)**

No Asbestos

**B00H - R0027 - External Movement (13.5 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00H - R0028 - General Storeroom (12.07 m2)**

No Asbestos

**B00H - R0029 - Design/Technology L.S. (100.87 m2)**

No Asbestos

**B00H - R0030 - Design/Technology L.S. (49.11 m2)**

No Asbestos

**B00H - R0034 - Other-Vacant (37.79 m2)**

No Asbestos

**B00H - R0035 - External Movement (33.12 m2)**

No Asbestos

**B00H - R0037 - Toilets-Girls (30.62 m2)**

No Asbestos

**B00H - R0038 - Cleaning Store - Distributed (1.58 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

**B00H - R0039 - Movement (7.44 m2)**

No Asbestos

**B00H - R0040 - Toilets-Girls (40.37 m2)**

No Asbestos

**B00H - R0041 - Toilets-Boys (40.27 m2)**

No Asbestos

**B00H - R0042 - Movement (7.52 m2)**

No Asbestos

**B00H - R0043 - Toilets-Boys (31.57 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Building Services - 2003 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00I - R0001 - General Assistants (161.82 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Library/Science Learning - 1970 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

**Interior**

**B00J - M2001 - Plant (39.88 m2)**

Flue	Fibre Cement Pipe	1m	North, East	Minimal Damage (2)	Low (1)	Low Priority (2-3)
8216/B00J/R0010/Flue/S38					<b>Chrysotile (white asbestos)</b>	

**B00J - M2002 - Movement (38.44 m2)**

No Asbestos

**B00J - M2003 - Workroom (67.01 m2)**

No Asbestos

**B00J - M2004 - Seminar (16.17 m2)**

No Asbestos

**B00J - M2005 - Stairs (2.74 m2)**

No Asbestos

**B00J - M2006 - Stairs (2.72 m2)**

No Asbestos

**B00J - R0001 - Art Learning Space (61.63 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	8216/B00J/R0010/Floor Coverings Res/Textile/S16				<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Vermiculite	8216/B00J/R0001/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00J - R0002 - Art Learning Space (63.44 m2)**

Ceiling Structures/Linings	Vermiculite	8216/B00J/R0001/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00J - R0003 - Kiln Space (6.73 m2)**

Ceiling Structures/Linings	Vermiculite	8216/B00J/R0001/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00J - R0004 - Art Learning Space (66.34 m2)**

Ceiling Structures/Linings	Vermiculite	8216/B00J/R0001/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	8216/B00J/R0010/Floor Coverings Res/Textile/S16				<b>No Asbestos Detected</b>

**B00J - R0005 - Resources Store (5.49 m2)**

No Asbestos

**B00J - R0006 - Performance Workspace (62.49 m2)**

Ceiling Structures/Linings	Vermiculite	8216/B00J/R0001/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

**B00J - R0007 - Art Learning Space (57.04 m2)**

Ceiling Structures/Linings	Vermiculite	8216/B00J/R0001/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00J - R0008 - Art Learning Space (69.82 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00J - R0009 - Staff Study (20.29 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00J - R0010 - Resources Store (5.8 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8216/B00J/R0010/Floor Coverings Res/Textile/S16					No Asbestos Detected
Flue	Fibre Cement Pipe	2m	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00J/R0010/Flue/S38					Chrysotile (white asbestos)
<b>B00J - R0011 - Movement (59.38 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8216/B00J/R0010/Floor Coverings Res/Textile/S16					No Asbestos Detected
<b>B00J - R0013 - Plant (11.53 m2)</b>						
Flue	Fibre Cement Pipe	2m	South & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00J/R0010/Flue/S38					Chrysotile (white asbestos)
<b>B00J - R0014 - General Storeroom (4.15 m2)</b>						
No Asbestos						
<b>B00J - R0015 - Stairs (14.52 m2)</b>						
No Asbestos						
<b>B00J - R0016 - Lift (2.1 m2)</b>						
No Asbestos						
<b>B00J - R0017 - External Movement (33.43 m2)</b>						
No Asbestos						
<b>B00J - R1002 - Preparation (12.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00J/R1003/Floor Coverings Res/Textile/S18					Chrysotile (white asbestos)
<b>B00J - R1003 - Apparatus Store (3.18 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00J/R1003/Floor Coverings Res/Textile/S18					Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite					
	8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00J - R1004 - Staff Study (31.28 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles					
	8216/B00J/R0010/Floor Coverings Res/Textile/S16					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00J - R1005 - Laboratory L.S. (90.83 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00J/R1003/Floor Coverings Res/Textile/S18	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00J - R1006 - Distribution Board Cupboard (0.8 m2)</b> <span style="float: right;">Note: No inspection of live electrical installation.</span>						
Electrical Backing Board	Resinous Board 8216/B00J/R2016/Electrical Backing Board/S39	2Unit	East & West	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00J - R1007 - Laboratory L.S. (90.65 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00J/R1003/Floor Coverings Res/Textile/S18	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00J - R1008 - Apparatus Store (31.8 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00J/R1003/Floor Coverings Res/Textile/S18	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00J - R1009 - Chemical Store (3.19 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00J/R1003/Floor Coverings Res/Textile/S18	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00J - R1010 - Movement (12.64 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00J/R1003/Floor Coverings Res/Textile/S18	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00J - R1011 - Laboratory L.S. (90.73 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00J/R1003/Floor Coverings Res/Textile/S18	91m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Vermiculite 8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken <b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>
<b>B00J - R1012 - Movement (58.71 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00J/R1003/Floor Coverings Res/Textile/S18	58.71m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00J - R1014 - Stairs (19.09 m2)</b>						
No Asbestos						
<b>B00J - R1015 - Lift (2.1 m2)</b>						
No Asbestos						
<b>B00J - R1016 - Apparatus Store (18.14 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00J/R1003/Floor Coverings Res/Textile/S18	18.14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)  Chrysotile (white asbestos)
<b>B00J - R1017 - General Learning Space (72.48 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles 8216/B00J/R0010/Floor Coverings Res/Textile/S16					No Asbestos Detected
<b>B00J - R1018 - External Movement (40.62 m2)</b>						
No Asbestos						
<b>B00J - R1019 - Movement (3.28 m2)</b>						
No Asbestos						
<b>B00J - R2001 - General Storeroom (12.25 m2)</b>						
No Asbestos						
<b>B00J - R2002 - Audio Visual Workroom (27.72 m2)</b>						
No Asbestos						
<b>B00J - R2003 - Librarian (11.19 m2)</b>						
No Asbestos						
<b>B00J - R2004 - Workroom (17.74 m2)</b>						
No Asbestos						
<b>B00J - R2005 - Staff - Toilet (3.16 m2)</b>						
No Asbestos						
<b>B00J - R2006 - Staff - Toilet (3.14 m2)</b>						
No Asbestos						
<b>B00J - R2007 - Entry (3.23 m2)</b>						
No Asbestos						
<b>B00J - R2008 - Seminar (70.13 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
<b>B00J - R2009 - Main Area (311 m2)</b>						
Ceiling Structures/Linings	Vermiculite 8216/B00J/R0001/Ceiling Structures/Linings/S17					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
In-fill-panel	Flat AC Sheeting 8216/B00D/R0005/Ceiling Structures/Linings/S25	20m	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)  Chrysotile (white asbestos) , Amosite (brown asbestos)
<b>B00J - R2010 - Seminar (12.68 m2)</b>						
No Asbestos						
<b>B00J - R2011 - Seminar (11.62 m2)</b>						
No Asbestos						
<b>B00J - R2012 - Plant (6.27 m2)</b>						
No Asbestos						
<b>B00J - R2013 - Plant (5.7 m2)</b>						
No Asbestos						
<b>B00J - R2014 - Cleaning Store - Distributed (0.37 m2)</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00J - R2015 - Movement (5.04 m2)**

No Asbestos

**B00J - R2016 - Distribution Board Cupboard (0.46 m2)**

Note: No inspection of live electrical installation.

Electrical Backing Board    Resinous Board    2Unit    East & West    Good Condition (1)    Low (1)    Low Priority (2-3)

8216/B00J/R2016/Electrical Backing Board/S39

**Chrysotile (white asbestos)**

**B00J - R2017 - Seminar (12 m2)**

No Asbestos

**B00J - R2018 - Seminar (11.44 m2)**

No Asbestos

**B00J - R2020 - Stairs (9.55 m2)**

No Asbestos

**B00J - R2021 - Stairs (0.62 m2)**

Ceiling Structures/Linings    Vermiculite

8216/B00J/R0001/Ceiling Structures/Linings/S17

**Limited Samples Taken**

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00J - R2022 - Stairs (0.62 m2)**

Ceiling Structures/Linings    Vermiculite

8216/B00J/R0001/Ceiling Structures/Linings/S17

**Limited Samples Taken**

**Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works**

**B00J - R2023 - Lift (2.1 m2)**

No Asbestos

**B00J - R2024 - External Movement (24.54 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Physical Education - 1991 - Steel (Steel)****Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area

- Area inaccessible

Ceiling Voids      No Asbestos Found

**Interior****B00K - R0001 - Staff Change (29.87 m2)**

Ceiling Structures/Linings      Flat AC Sheeting  
8216/B00K/R0003/Ceiling Structures/Linings/S21      **No Asbestos Detected**

Partition Walls (Cubicles)      Compressed AC Sheet  
8216/B00K/R0003/Partition Walls (Cubicles)/S19      **No Asbestos Detected**

Wall Linings Internal      Flat AC Sheeting  
8216/B00K/R0003/Wall Linings Internal/S20      **No Asbestos Detected**

**B00K - R0002 - Movement (11.36 m2)**

Ceiling Structures/Linings      Flat AC Sheeting  
8216/B00K/R0003/Ceiling Structures/Linings/S21      **No Asbestos Detected**

**B00K - R0003 - Staff Change (31.16 m2)**

Partition Walls (Cubicles)      Compressed AC Sheet  
8216/B00K/R0003/Partition Walls (Cubicles)/S19      **No Asbestos Detected**

Wall Linings Internal      Flat AC Sheeting  
8216/B00K/R0003/Wall Linings Internal/S20      **No Asbestos Detected**

Ceiling Structures/Linings      Flat AC Sheeting  
8216/B00K/R0003/Ceiling Structures/Linings/S21      **No Asbestos Detected**

**B00K - R0004 - Multi-Purpose Space (17.36 m2)**

Ceiling Structures/Linings      Flat AC Sheeting  
8216/B00K/R0003/Ceiling Structures/Linings/S21      **No Asbestos Detected**

Wall Linings Internal      Flat AC Sheeting  
8216/B00K/R0003/Wall Linings Internal/S20      **No Asbestos Detected**

**B00K - R0006 - Gymnasium (621.78 m2)**

No Asbestos

**B00K - R0007 - Sport Equipment Store (11.63 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00L - Pupil Facilities - 1958 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Ends	Flat AC Sheeting	16m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Gable Verge Lining/S23			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible					
Ceiling Voids	No Asbestos Found					

**Interior****B00L - R0001 - Shower/Change (64.87 m2)**

Wall Linings Internal	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00M/R0002/Wall Linings Internal/S10			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Partition Walls (Cubicles)	Compressed AC Sheet	30m2	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00L/R0001/Partition Walls (Cubicles)/S35			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00L - R0002 - Staff Study (9.46 m2)**

Wall Linings Internal	Flat AC Sheeting	6m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00M/R0002/Wall Linings Internal/S10			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00L - R0003 - Sport Equipment Store (8.04 m2)**

Wall Linings Internal	Flat AC Sheeting	6m2	North, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00M/R0002/Wall Linings Internal/S10			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00L - R0004 - External Movement (21.58 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00M - Pupil Facilities - 1958 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Ends	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Eaves Linings/S24			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Verge Lining	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00B/Gable Verge Lining/S23			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					

**Interior**

**B00M - R0001 - Staff - Toilet (8.88 m2)**

Wall Linings Internal	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00M/R0002/Wall Linings Internal/S10			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00M - R0002 - Shower/Change (40.16 m2)**

Wall Linings Internal	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00M/R0002/Wall Linings Internal/S10			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00M - R0003 - Shower/Change (19.61 m2)**

Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8216/B00M/R0002/Wall Linings Internal/S10			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00M - R0004 - No Access (13.81 m2)**

No Asbestos

**B00M - R0005 - General Storeroom (13.81 m2)**

No Asbestos

**B00M - R0006 - General Assistants (23.71 m2)**

No Asbestos

**B00M - R0007 - General Storeroom (40.75 m2)**

No Asbestos

**B00M - R0008 - External Movement (41.97 m2)**

No Asbestos

**B00M - R0009 - Plant (2.69 m2)**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - General Learning - 1964 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	16m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00N/R0001/Ceiling Structures/Linings/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Flat AC Sheeting	150m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	8216/B00N/Underfloor Voids/S34			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior****B00N - R0001 - General Storeroom (6.02 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00N/R0001/Ceiling Structures/Linings/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	16m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00P/R0001/Wall Linings Internal/S7			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00N - R0002 - General Learning Space (44.06 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B00N/R0002/Floor Coverings Res/Textile/S28			<b>No Asbestos Detected</b>		

**B00N - R0003 - General Learning Space (43.93 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	8216/B00N/R0002/Floor Coverings Res/Textile/S28			<b>No Asbestos Detected</b>		

**B00N - R0004 - External Movement (27.8 m2)**

Wall Linings Internal	Flat AC Sheeting	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00P/R0001/Wall Linings Internal/S7			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00N - R0005 - External Movement (14.98 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B000 - Agricultural Science - 2004 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Bench top	Compressed AC Sheet 8216/B000/Bench top/S40					<b>No Asbestos Detected</b>

**Interior**

**B000 - R0001 - General Assistants (17.61 m2)**

No Asbestos

**B000 - R0002 - Covered Area (26.51 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00P - Music - 1964 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	36m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00N/R0001/Ceiling Structures/Linings/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Debris	200m2	Variable positions	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)
	8216/B00P/Underfloor Voids/S27			<b>Chrysotile (white asbestos)</b>		

**Interior****B00P - R0001 - Music Store (10.01 m2)**

Wall Linings Internal	Flat AC Sheeting	14m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00P/R0001/Wall Linings Internal/S7			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00N/R0001/Ceiling Structures/Linings/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00P - R0002 - Music Learning Space (53.88 m2)**

No Asbestos

**B00P - R0003 - Music Learning Space (53.95 m2)**

No Asbestos

**B00P - R0004 - Staff Study (23.05 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00N/R0001/Ceiling Structures/Linings/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00P/R0001/Wall Linings Internal/S7			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00P - R0005 - Resources (4.99 m2)**

No Asbestos

**B00P - R0006 - Movement (25.73 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	25.73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00N/R0001/Ceiling Structures/Linings/S26			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	30m2	North, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00P/R0001/Wall Linings Internal/S7			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00P - R0007 - External Movement (21.22 m2)**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00Q - Mechanical Services - 1964 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00Q - R0001 - Dust Extraction Space (6.41 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00R - Agricultural Science - 2004 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00R/Eaves Linings/S22					<b>Chrysotile (white asbestos)</b>
Gable Ends	Flat AC Sheeting	8m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	8216/B00R/Eaves Linings/S22					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00R - R0001 - General Assistants (60.26 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00S - Railway Carriage - 2004 - Steel (Steel)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00S - R0001 - Railway Carriage (97.47 m2)**

No Asbestos

**B00S - R0002 - Covered Area (40.78 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00T - Pupil Facilities - 2004 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00T - R0001 - Gymnasium (70.2 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### B00U - Technological & Applied Studies - 2008 - Brick/Veneer (Brick/Veneer)

#### Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids	No Asbestos Found

#### Interior

##### B00U - R0001 - Workshop Area (213.2 m2)

No Asbestos

##### B00U - R0002 - Visitors Office (18.79 m2)

No Asbestos

##### B00U - R0003 - Welding Store (4.42 m2)

No Asbestos

##### B00U - R0004 - Welding Store (9.09 m2)

No Asbestos

##### B00U - R0005 - Seminar/Technology Space (39.23 m2)

No Asbestos

##### B00U - R0006 - Welding Area (3.72 m2)

No Asbestos

##### B00U - R0007 - Welding Area (3.54 m2)

No Asbestos

##### B00U - R0008 - Welding Area (3.54 m2)

No Asbestos

##### B00U - R0009 - Welding Area (4.58 m2)

No Asbestos

##### B00U - R0010 - Welding Area (4.58 m2)

No Asbestos

##### B00U - R0011 - Welding Area (3.56 m2)

No Asbestos

##### B00U - R0012 - Welding Area (3.56 m2)

No Asbestos

##### B00U - R0013 - Workshop Area (5.28 m2)

No Asbestos

##### B00U - R0014 - Main Switchroom (1.38 m2)

No Asbestos

##### B00U - R0015 - Plant (4.03 m2)

No Asbestos

##### B00U - R0016 - Plant (3.74 m2)

No Asbestos

##### B00U - R0017 - External Movement (56.25 m2)

No Asbestos

##### B00U - R9001 - Plant (18.01 m2)

No Asbestos

##### B00U - R9002 - Bulk Store (34.39 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00V - Mechanical Services - 2008 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00V - R0001 - Plant (6.07 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017