


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Ulmarra Public School (3303)
Region : North Coast
State Electorate : Clarence
Local Government Area : Clarence Valley

Initial Survey : Noel Arnold & Associates : 26 - May - 2008
Reviewed By : Greencap-NAA : 05 - May - 2016

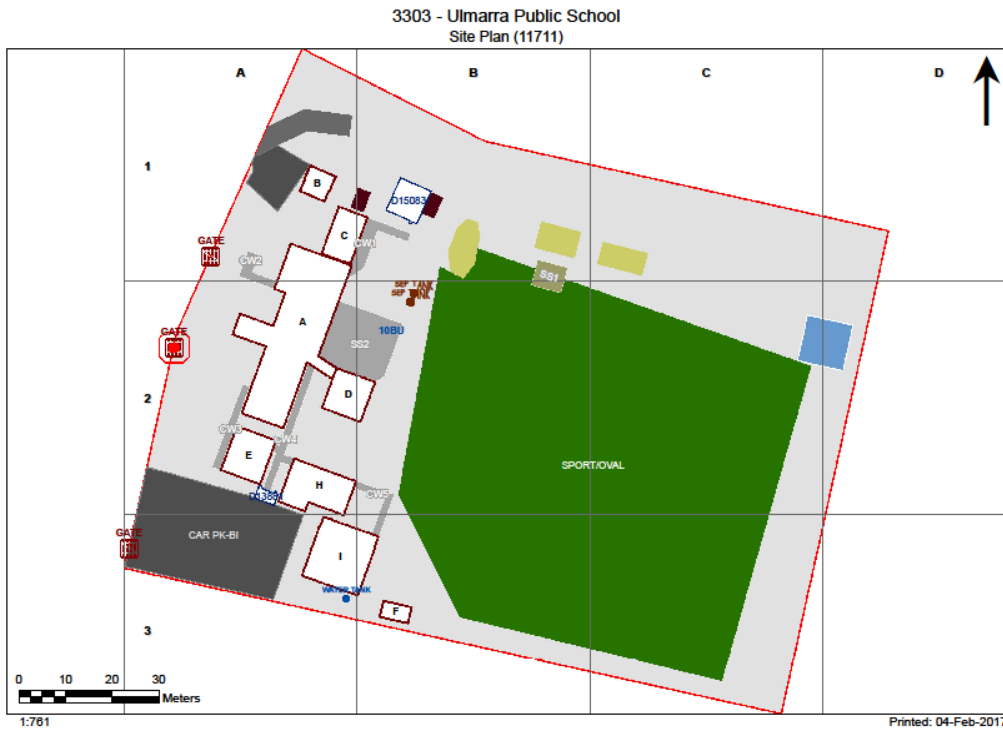

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Library/General Learning - 1941 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 3303/B00A/Eaves Linings/S4	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0001 - Communications Room**

Ceiling Structures/Linings	Flat AC Sheeting 3303/B00A/R0004/Ceiling Structures/Linings/S1					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3303/B00A/R0004/Ceiling Structures/Linings/S1					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3303/B00A/R0001/Floor Coverings Res/Textile/S8	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 3303/B00A/R0001/Floor Coverings Res/Textile/S9	12m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00A - R0002 - General Storeroom

Floor Coverings Res/Textile	Adhesive 3303/B00A/R0001/Floor Coverings Res/Textile/S9	11m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3303/B00A/R0001/Floor Coverings Res/Textile/S8	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00A - R0003 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting 3303/B00A/R0004/Ceiling Structures/Linings/S1					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3303/B00A/R0004/Ceiling Structures/Linings/S1					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 3303/B00A/R0001/Floor Coverings Res/Textile/S9	48m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3303/B00A/R0001/Floor Coverings Res/Textile/S8	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00A - R0004 - Practical Activities - 1hb

Ceiling Structures/Linings	Flat AC Sheeting 3303/B00A/R0004/Ceiling Structures/Linings/S1					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3303/B00A/R0004/Ceiling Structures/Linings/S1					No Asbestos Detected

B00A - R0005 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting 3303/B00A/R0004/Ceiling Structures/Linings/S1					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3303/B00A/R0004/Ceiling Structures/Linings/S1					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 3303/B00A/R0001/Floor Coverings Res/Textile/S9	48m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3303/B00A/R0001/Floor Coverings Res/Textile/S8	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00A - R0006 - General Storeroom

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00A/R0011/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	5m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
	3303/B00A/R0001/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)	
B00A - R0007 - Withdrawal Space - 1hb						
Ceiling Structures/Linings	Flat AC Sheeting					
	3303/B00A/R0004/Ceiling Structures/Linings/S1				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting					
	3303/B00A/R0004/Ceiling Structures/Linings/S1				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive	12m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
	3303/B00A/R0001/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00A/R0001/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)	
B00A - R0008 - Withdrawal Space - 1hb						
Ceiling Structures/Linings	Flat AC Sheeting					
	3303/B00A/R0004/Ceiling Structures/Linings/S1				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting					
	3303/B00A/R0004/Ceiling Structures/Linings/S1				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive	16m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
	3303/B00A/R0001/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00A/R0001/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)	
B00A - R0009 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting					
	3303/B00A/R0004/Ceiling Structures/Linings/S1				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting					
	3303/B00A/R0004/Ceiling Structures/Linings/S1				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive	48m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
	3303/B00A/R0001/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00A/R0001/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)	
B00A - R0010 - Home Base						
Ceiling Structures/Linings	Flat AC Sheeting					
	3303/B00A/R0004/Ceiling Structures/Linings/S1				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting					
	3303/B00A/R0004/Ceiling Structures/Linings/S1				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive	48m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
	3303/B00A/R0001/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00A/R0001/Floor Coverings Res/Textile/S8				Chrysotile (white asbestos)	
B00A - R0011 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00A/R0011/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting					
	3303/B00A/R0004/Ceiling Structures/Linings/S1				No Asbestos Detected	
Wall Linings Internal	Flat AC Sheeting					
	3303/B00A/R0004/Ceiling Structures/Linings/S1				No Asbestos Detected	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive	12m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
3303/B00A/R0001/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00A - R0012 - Resources Store						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3303/B00A/R0011/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	6m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
3303/B00A/R0001/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00A - R0013 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3303/B00A/R0011/Floor Coverings Res/Textile/S2					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	6m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
3303/B00A/R0001/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00A - R0014 - External Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1984 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Wall Cladding	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00B/Wall Cladding/S13			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids	No Asbestos Found					

Interior

B00B - R0001 - Practical Activities - 1hb

No Asbestos

B00B - R0002 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1971 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00A/Eaves Linings/S4					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					

Interior

B00C - R0005 - External Movement

No Asbestos

B00C - R0006 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3303/B00C/R0008/Ceiling Structures/Linings/S7					

B00C - R0007 - Toilets-Unisex

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3303/B00C/R0008/Ceiling Structures/Linings/S7					

B00C - R0008 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3303/B00C/R0008/Ceiling Structures/Linings/S7					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1947 - Timber (Timber)**Exterior**

Ceiling Voids	Non Accessible Area - Area inaccessible 4m height
Underfloor Voids	No Asbestos Found

Interior**B00D - R0001 - Home Base**

Wall Linings Internal	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00D/R0001/Wall Linings Internal/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00D/R0001/Wall Linings Internal/S3				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00D/R0004/Floor Coverings Res/Textile/S10				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	38m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
	3303/B00D/R0004/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	

B00D - R0002 - Practical Activities - 1hb

No Asbestos

B00D - R0003 - Movement

No Asbestos

B00D - R0004 - Withdrawal Space - 1hb

Wall Linings Internal	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00D/R0001/Wall Linings Internal/S3				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00D/R0001/Wall Linings Internal/S3				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	16m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
	3303/B00D/R0004/Floor Coverings Res/Textile/S11				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00D/R0004/Floor Coverings Res/Textile/S10				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1947 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00E/Eaves Linings/S12				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior

B00E - R0004 - Secure Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3303/B00A/R0011/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	6m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
	3303/B00A/R0001/Floor Coverings Res/Textile/S9				Chrysotile (white asbestos)	

B00E - R0005 - Duplicating Workroom

No Asbestos

B00E - R0006 - Principal

No Asbestos

B00E - R0007 - Entry Vestibule

No Asbestos

B00E - R0008 - Clerical Office

No Asbestos

B00E - R0009 - Staff Room

No Asbestos

B00E - R0010 - Sick Bay

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 1987 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00F - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Communal Facilities - 2000 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00H - R0002 - External Movement

No Asbestos

B00H - R0003 - General Storeroom

No Asbestos

B00H - R0004 - Sports Store

No Asbestos

B00H - R0005 - Practical Activities

No Asbestos

B00H - R0006 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00I - R0001 - External Movement

No Asbestos

B00I - R0002 - Reading Area

No Asbestos

B00I - R0003 - Communications Room

No Asbestos

B00I - R0004 - K.L.A. Store

No Asbestos

B00I - R0005 - Library Office/Workroom

No Asbestos

B00I - R0006 - Main Switch Board

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 844 - D13881 - Country Toilet - Reltc - Boys/Girls : Placement Date - 3/11/1997

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

Interior

R1 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

R2 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	9 m2

OS 801 - D15083 - FSU : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	8.64 m2

Interior

R1 - Canteen

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	45 m2

R2 - Covered Area

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017