


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Ungarie Central School (3311)
Region : Riverina
State Electorate : Cootamundra
Local Government Area : Bland

Initial Survey : Noel Arnold & Associates : 07 - May - 2008
Reviewed By : AECOM : 27 - Nov - 2014

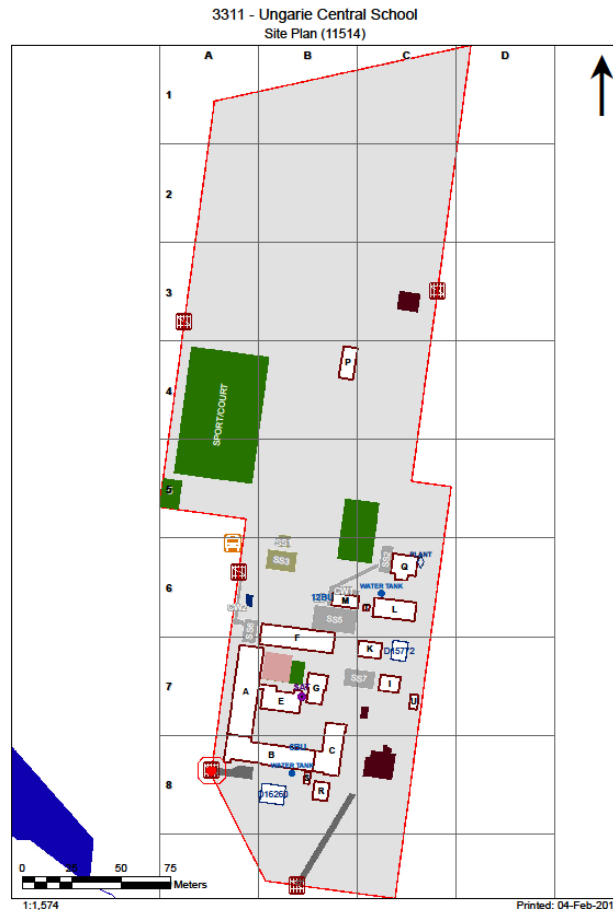

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Library - 1973 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	5m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00A/R0001/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible - Slab on ground and/or no designated access point identified.					

Interior**B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00A/R0001/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	
Window In-fill-panel	Flat AC Sheeting	6m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00B/R0002/Ceiling Structures/Linings/S14				Chrysotile (white asbestos)	

B00A - R0002 - Seminar/Study

No Asbestos

B00A - R0003 - Seminar/Study

No Asbestos

B00A - R0004 - Reading Area

No Asbestos

B00A - R0005 - K.L.A. Store

No Asbestos

B00A - R0006 - Library Office/Workroom

No Asbestos

B00A - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00A/R0001/Ceiling Structures/Linings/S13				Chrysotile (white asbestos)	

B00A - R0009 - General Storeroom

Ceiling Space Access Panel	Flat AC Sheeting	1m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00A/R0009/Ceiling Space Access Panel/S15				Chrysotile (white asbestos)	

B00A - R0012 - Movement

No Asbestos

B00A - R0014 - Staff Toilet

No Asbestos

B00A - R0015 - Cleaning Distributed Store

No Asbestos

B00A - R0016 - Staff Toilet

No Asbestos

B00A - R0017 - Staff Toilet

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	North facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible - access requires					

B00A - R0021 - Food Technology L.S.

No Asbestos

B00A - R0022 - Pantry

No Asbestos

B00A - R0023 - Laundry

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0024 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	82m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

3311/B00A/R0001/Ceiling Structures/Linings/S13

Chrysotile (white asbestos)

Window In-fill-panel	Flat AC Sheeting	6m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------	------------------	-----	-------------	--------------------	---------	--------------------

3311/B00B/R0002/Ceiling Structures/Linings/S14

Chrysotile (white asbestos)

B00A - R0025 - Principal

No Asbestos

B00A - R0026 - Movement

No Asbestos

B00A - R0027 - Clerical Office

No Asbestos

B00A - R0028 - Sick Bay

No Asbestos

B00A - R0029 - Duplicating Workroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning/Pupil Facilities - 1973 - Brick/Block (Brick/Block)

Exterior

Electrical mounting board	Resinous Board	2Unit(s)	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)	
Assumed Asbestos - Electrical Hazard							
Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)	
3311/B00B/Eaves Linings/S16				Chrysotile (white asbestos)			
Underfloor Voids - Slab on Ground	Non Accessible Area - Slab on ground and/or no designated access point identified.						
Ceiling Voids	No Asbestos Found						
Wall Cladding	Flat AC Sheeting	3311/B00B/Wall Cladding/S22				No Asbestos Detected	
Southern eave to BR0015	Flat AC Sheeting	3311/B00B/Southern eave to BR0015/S23				No Asbestos Detected	

Interior

B00B - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	167m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3311/B00B/R0002/Ceiling Structures/Linings/S14				Chrysotile (white asbestos)		
In-fill-panel	Flat AC Sheeting	6m2	Above Canteen Counter	Good Condition (1)	Low (1)	Low Priority (2-3)
3311/B00B/R0002/Ceiling Structures/Linings/S14				Chrysotile (white asbestos)		

B00B - R0003 - Canteen

Ceiling Structures/Linings	Flat AC Sheeting	36m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3311/B00B/R0002/Ceiling Structures/Linings/S14				Chrysotile (white asbestos)		

B00B - R0004 - Canteen Office/Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3311/B00B/R0002/Ceiling Structures/Linings/S14				Chrysotile (white asbestos)		

B00B - R0005 - Staff Toilet

Incinerator	Encapsulated Insulation material within unit	1Unit(s)	East facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Area inaccessible - access requires						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3311/B00B/R0002/Ceiling Structures/Linings/S14				Chrysotile (white asbestos)		

B00B - R0009 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

B00B - R0010 - Materials Technology L.S.

Window frames	Putty	3311/B00B/R0010/Window frames/S17				No Asbestos Detected	
---------------	-------	-----------------------------------	--	--	--	-----------------------------	--

B00B - R0011 - Welding Area

Window frames	Putty	3311/B00B/R0010/Window frames/S17				No Asbestos Detected	
---------------	-------	-----------------------------------	--	--	--	-----------------------------	--

Floor Coverings Res/Textile	Vinyl Tiles	2.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3311/B00B/R0012/Floor Coverings Res/Textile/S19				Chrysotile (white asbestos)		
Bituminous adhesive below vinyl tiles	Adhesive	2.75m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3311/B00B/R0012/Bituminous adhesive below vinyl tiles/S18				Chrysotile (white asbestos)		

B00B - R0012 - Materials Store - Type 1

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Window frames	Putty 3311/B00B/R0010/Window frames/S17				No Asbestos Detected	
Bituminous adhesive below vinyl tiles	Adhesive 3311/B00B/R0012/Bituminous adhesive below vinyl tiles/S18	13.19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Floor Coverings Res/Textile	Vinyl Tiles 3311/B00B/R0012/Floor Coverings Res/Textile/S19	13.19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
Ceiling access hatch	Flat AC Sheeting 3311/B00B/R0002/Ceiling Structures/Linings/S14	1m2	Ceiling access point	Good Condition (1)	Low (1)	Low Priority (2-3)
B00B - R0013 - Movement						
Window frames	Putty 3311/B00B/R0010/Window frames/S17				No Asbestos Detected	
Window infill panel	Flat AC Sheeting 3311/B00B/R0013/Window infill panel/S30	1m2	South side, west end	Good Condition (1)	Low (1)	Low Priority (2-3)
Ceiling Structures/Linings	Flat AC Sheeting 3311/B00B/R0013/Ceiling Structures/Linings/S31	68.97m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00B - R0014 - Movement						
Eave lining	Flat AC Sheeting 3311/B00B/Eaves Linings/S16	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
B00B - R0015 - Plant						
No Asbestos						
B00B - R0016 - General Storeroom						
Window frames	Putty 3311/B00B/R0010/Window frames/S17				No Asbestos Detected	
Ceiling Structures/Linings	Flat AC Sheeting 3311/B00B/R0016/Ceiling Structures/Linings/S20	42.87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00C - Pupil Facilities - 1973 - Brick/Block (Brick/Block)						
Exterior						
Gable Ends	Flat AC Sheeting	2m2	North and south facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00C/Eaves Linings/S29					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	30m2	South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00C/Eaves Linings/S29					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Slab on ground and/or no designated access point identified.					
Ceiling Voids	Flue pipe	1m	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00C/Ceiling Voids/S21					Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior						
B00C - R0001 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	37m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00B/R0013/Ceiling Structures/Linings/S31					Chrysotile (white asbestos)
Window In-fill-panel	Flat AC Sheeting	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00B/R0013/Window infill panel/S30					Chrysotile (white asbestos)
B00C - R0002 - Sports Store						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00C/R0005/Ceiling Structures/Linings/S32					Chrysotile (white asbestos)
B00C - R0003 - Plant						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00C/R0005/Ceiling Structures/Linings/S32					Chrysotile (white asbestos)
B00C - R0004 - Shower/Change						
Ceiling Structures/Linings	Flat AC Sheeting	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00C/R0005/Ceiling Structures/Linings/S32					Chrysotile (white asbestos)
B00C - R0005 - Toilets - Boys						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00C/R0005/Ceiling Structures/Linings/S32					Chrysotile (white asbestos)
B00C - R0006 - Cleaning Supplies						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00C/R0005/Ceiling Structures/Linings/S32					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00C/R0006/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)
B00C - R0007 - Disabled Toilet						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00C/R0005/Ceiling Structures/Linings/S32					Chrysotile (white asbestos)
B00C - R0008 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting	26m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00C/R0005/Ceiling Structures/Linings/S32					Chrysotile (white asbestos)
B00C - R0009 - Shower/Change						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00C/R0009/Partition Walls (Cubicles)/S33					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	32m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3311/B00C/R0005/Ceiling Structures/Linings/S32					Chrysotile (white asbestos)	
B00C - R0010 - General Assistant/Bulk Store						
Ceiling Structures/Linings	Flat AC Sheeting	27m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3311/B00C/R0005/Ceiling Structures/Linings/S32					Chrysotile (white asbestos)	
B00C - R0011 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	42m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3311/B00C/R0005/Ceiling Structures/Linings/S32					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1964 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 3311/B00E/Eaves Linings/S11					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible - crawl space only, entry 0.3 m clearance opening to ~0.6m clearance.					

Interior**B00E - R0001 - Movement**

Wall Linings Internal	Flat AC Sheeting	2m2	East facing, West facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00E/R0001/Wall Linings Internal/S10					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00E - R0002 - Movement

No Asbestos

B00E - R0003 - General Storeroom

No Asbestos

B00E - R0004 - Chemical Store

No Asbestos

B00E - R0005 - Apparatus Store

No Asbestos

B00E - R0006 - Apparatus Store

No Asbestos

B00E - R0007 - Laboratory L.S.

No Asbestos

B00E - R0008 - Staff Study

No Asbestos

B00E - R0009 - General Storeroom

No Asbestos

B00E - R0010 - Movement

No Asbestos

B00E - R0011 - Movement

No Asbestos

B00E - R0012 - Staff Study

No Asbestos

B00E - R0013 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00E/R0013/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1973 - Brick/Block (Brick/Block)**Exterior**

Window In-fill-panel	Flat AC Sheeting	3m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00F/R0001/Window In-fill-panel/S35				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	25m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00F/R0001/Ceiling Structures/Linings/S36				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	Non Accessible Area - Area inaccessible - crawl space only, 0.3m clearance.					

Interior**B00F - R0001 - Movement**

Window In-fill-panel	Flat AC Sheeting	3m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00F/R0001/Window In-fill-panel/S35				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	68m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00F/R0001/Ceiling Structures/Linings/S36				Chrysotile (white asbestos)	

B00F - R0002 - Computer Learning Space

No Asbestos

B00F - R0003 - Computer Resource

No Asbestos

B00F - R0004 - Computer Store

No Asbestos

B00F - R0005 - Home Base Store

No Asbestos

B00F - R0006 - Home Base

No Asbestos

B00F - R0007 - Home Base

No Asbestos

B00F - R0008 - Home Base Store

No Asbestos

B00F - R0009 - Deputy Principal

No Asbestos

B00F - R0010 - Home Base Store

No Asbestos

B00F - R0011 - Home Base

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1950 - Timber (Timber)**Exterior**

Electrical mounting board	Resinous Board	1Unit(s)	North facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
3311/B00G/Underfloor Voids - Packing to Floor Joists/S24					Chrysotile (white asbestos)	
Underfloor Voids	Non Accessible Area - Area inaccessible - generally inaccessible due low clearance 30-40cm.					

Interior**B00G - R0001 - General Learning Space**

No Asbestos

B00G - R0002 - Withdrawal Space - 1hb

Wall Linings Internal	Flat AC Sheeting	2m2	Behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
3311/B00G/R0002/Wall Linings Internal/S37					Chrysotile (white asbestos)	

B00G - R0003 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
3311/B00G/R0003/Floor Coverings Res/Textile/S4					No Asbestos Detected	

B00G - R0004 - Movement

No Asbestos

B00G - R0005 - Staff Room Annexe

No Asbestos

B00G - R0006 - Movement

No Asbestos

B00G - R0007 - Interview

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning - 1975 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00I/Eaves Linings/S38					Chrysotile (white asbestos)
Underfloor Voids	Non Accessible Area - Area inaccessible - crawl space only, 0.2 - 0.3 m clearance.					
Ceiling Voids	Non Accessible Area - Height Restriction (4 m) and access hatch located toward centre of room. Access hatch in IR0003 fixed in place.					

Interior

B00I - R0001 - General Storeroom

No Asbestos

B00I - R0002 - Plant

No Asbestos

B00I - R0003 - General Learning Space - Type 1

Wall Linings Internal	Flat AC Sheeting	2m2	Behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00G/R0002/Wall Linings Internal/S37					Chrysotile (white asbestos)

B00I - R0004 - Practical Activities - 1hb

No Asbestos

B00I - R0005 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - General Learning - 1950 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	4m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction (4m) and angled						

Underfloor Voids	Non Accessible Area - Area inaccessible - crawl space only, clearance 0.2 - 0.3 m.					
------------------	---	--	--	--	--	--

Ceiling Voids	Non Accessible Area - Area inaccessible - fixed ceilings					
---------------	---	--	--	--	--	--

Interior

B00K - R0001 - Movement

Wall Linings Internal	Flat AC Sheeting	3311/B00K/R0001/Wall Linings Internal/S3				No Asbestos Detected
-----------------------	------------------	--	--	--	--	-----------------------------

B00K - R0002 - General Learning Space

No Asbestos

B00K - R0003 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning - 1973 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00L/Eaves Linings/S25					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction (4m) in CR0003.					
Underfloor Voids	AC Fragments/Debris	NA	Throughout	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	3311/B00L/Underfloor Voids/S28					Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior

B00L - R0001 - Home Base Store

Floor Coverings Res/Textile	Vinyl Tiles					
	3311/B00L/R0001/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00L - R0002 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	3311/B00L/R0001/Floor Coverings Res/Textile/S2					No Asbestos Detected

B00L - R0003 - Home Base

No Asbestos

B00L - R0004 - Practical Activities - 1hb

No Asbestos

B00L - R0005 - Toilets - Boys/Girls

Wall Linings Internal	Flat AC Sheeting	30m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3311/B00L/R0005/Wall Linings Internal/S1					Chrysotile (white asbestos)

B00L - R0006 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	37m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00L/R0006/Ceiling Structures/Linings/S26					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Pupil Facilities - 1950 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	4m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/B00M/Eaves Linings/S27				Chrysotile (white asbestos)	
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Slab on ground and/or no designated access point identified.					
Ceiling Voids	Non Accessible Area					
	- Area inaccessible - fixed ceilings, no designated access point.					

Interior

B00M - R0001 - Handwashing Facilities

No Asbestos

B00M - R0002 - Toilets - Boys

No Asbestos

B00M - R0003 - Toilets - Girls

No Asbestos

B00M - R0004 - No Access

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Agricultural Science - 1950 - Steel (Steel)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible - fixed ceilings, no designated access point.
Underfloor Voids - Slab on Ground	Non Accessible Area - Slab on ground and/or no designated access point identified.

Interior

B00P - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	37m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3311/B00P/R0003/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00P - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	8.24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3311/B00P/R0003/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00P - R0003 - Garden Store

Ceiling Structures/Linings	Flat AC Sheeting	43m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3311/B00P/R0003/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00P - R0004 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3311/B00P/R0003/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

B00P - R0005 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3311/B00P/R0003/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Multi Purpose Facilities - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

No Asbestos

Interior

B00Q - R0001 - Communal Space

No Asbestos

B00Q - R0002 - P.E. Store

No Asbestos

B00Q - R0003 - Communications Cupboard

No Asbestos

B00Q - R0004 - Main Switch Board

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - Building Services - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

No Asbestos

Interior

B00R - R0001 - Garage/Carport

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - Administration - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

No Asbestos

Interior

B00S - R0001 - Materials Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00T - Pupil Facilities - 2011 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00T - R0001 - Practical Activities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00U - Building Services - 1970 - Metal Shed (Metal Shed)

Exterior

External areas surrounding building	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	3311/B00U/External areas surrounding building/S38			Chrysotile (white asbestos) , Amosite (brown asbestos)		

Ceiling Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00U - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Build+1 - Drinking shelter

Exterior

Wall Cladding	Flat AC Sheeting	3m2	North facing, South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3311/Build+1/Wall Cladding/S39				Chrysotile (white asbestos) , Amosite (brown asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 521 - D15772 - Staff Study : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Staff Room

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R2 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	6 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	4 m2

R3 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	6 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	4 m2

R4 - Lobby

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2

NS 200 - D16260 - Art Learning Space/Workshop/Bulk Store : Placement Date - 1/08/2012

Exterior

No Asbestos Found.

Interior

R1 - Art Learning Space

No Asbestos Found.

R2 - Workshop

No Asbestos Found.

R3 - Bulk Store

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017