


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Urana Public School (3314)
Region : Riverina
State Electorate : Albury
Local Government Area : Urana

Initial Survey : Noel Arnold & Associates : 11 - Mar - 2008
Reviewed By : Greencap-NAA : 07 - Jul - 2016

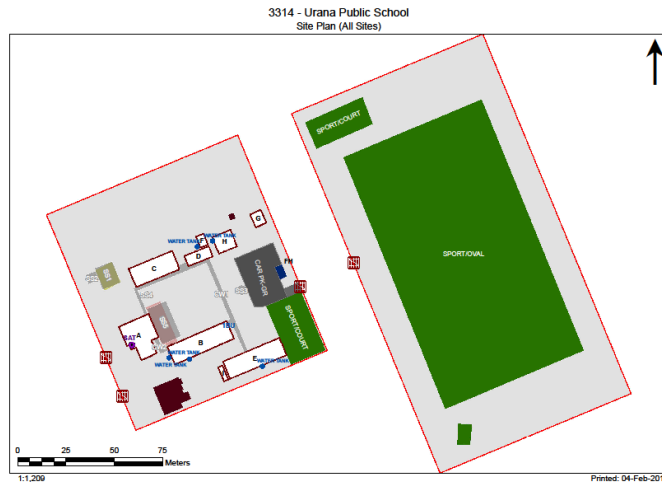

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration - 1892 - Brick/Block (Brick/Block)**Exterior**

Wall Cladding	Flat AC Sheeting	6m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00A/R0001/Wall Linings Internal/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0001 - External Movement**

Wall Linings Internal	Flat AC Sheeting	4m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00A/R0001/Wall Linings Internal/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0002 - Duplicating Workroom

No Asbestos

B00A - R0003 - General Learning Space

No Asbestos

B00A - R0004 - Movement

No Asbestos

B00A - R0005 - Clerical Office

No Asbestos

B00A - R0006 - Sick Bay

No Asbestos

B00A - R0007 - Principal

No Asbestos

B00A - R0008 - Entry Vestibule

No Asbestos

B00A - R0009 - General Storeroom

No Asbestos

B00A - R0010 - General Storeroom

No Asbestos

B00A - R0011 - Staff Room

No Asbestos

B00A - R0012 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	8m2	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00A/R0001/Wall Linings Internal/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0013 - Darkroom Space

Wall Linings Internal	Flat AC Sheeting	8m2	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00A/R0001/Wall Linings Internal/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00A - R0014 - External Movement

Wall Linings Internal	Flat AC Sheeting	3m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00A/R0001/Wall Linings Internal/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
B00B - General Learning - 1966 - Brick/Block (Brick/Block)						
Exterior						
Eaves Linings	Flat AC Sheeting	40m2	North & South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Entry Steps	Compressed AC Sheet					No Asbestos Detected
	3314/B00C/R0006/Partition Walls (Cubicles)/S4					
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	30m	East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/Gable Verge Lining/S15					Chrysotile (white asbestos) , Amosite (brown asbestos)
Interior						
B00B - R0001 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	74m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0001/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	2m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00A/R0001/Wall Linings Internal/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0002 - Chemical Store						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0002/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
B00B - R0003 - Staff Room Annexe						
Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0002/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
B00B - R0004 - Laboratory L.S.						
Floor Coverings Res/Textile	Vinyl Tiles	79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive	79m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0002/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
Fume Cupboard	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0004/Fume Cupboard/S17					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00B - R0005 - General Learning Space						
Floor Coverings Res/Textile	Adhesive	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0002/Floor Coverings Res/Textile/S16					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0002/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)
B00B - R0006 - Distribution Board						
Note: No inspection of live electrical installation.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	4m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3314/B00B/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Electrical Mounting Board	Resinous Board	3Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3314/B00B/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0007 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0002/Floor Coverings Res/Textile/S3			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Adhesive	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0002/Floor Coverings Res/Textile/S16			Chrysotile (white asbestos)		
B00B - R0011 - Pupil Entry						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0001/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00B - R0012 - Home Base						
Floor Coverings Res/Textile	Adhesive	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0002/Floor Coverings Res/Textile/S16			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3314/B00B/R0002/Floor Coverings Res/Textile/S3			Chrysotile (white asbestos)		
B00B - R0015 - General Learning Space						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00C - General Learning - 1965 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 3314/B00B/R0001/Ceiling Structures/Linings/S2	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
In-fill panels around windows	Flat AC Sheeting 3314/B00A/R0001/Wall Linings Internal/S1	14m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting 3314/B00C/Gable Verge Lining/S11					No Asbestos Detected

Interior**B00C - R0001 - Toilets - Boys/Girls**

No Asbestos

B00C - R0002 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles 3314/B00C/R0004/Floor Coverings Res/Textile/S9	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 3314/B00C/R0004/Floor Coverings Res/Textile/S10	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0003 - Personal Effects Storage

No Asbestos

B00C - R0004 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3314/B00C/R0004/Floor Coverings Res/Textile/S9	87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive 3314/B00C/R0004/Floor Coverings Res/Textile/S10	87m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0005 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 3314/B00C/R0009/Ceiling Structures/Linings/S8	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 3314/B00C/R0006/Partition Walls (Cubicles)/S4					No Asbestos Detected
Incinerator	Encapsulated Insulation material within unit Assumed Asbestos - item inaccessible	1Unit(s)	South facing	Friable Asbestos (5)	Low (1)	Low Priority (2-3)

B00C - R0006 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet 3314/B00C/R0006/Partition Walls (Cubicles)/S4					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3314/B00C/R0009/Ceiling Structures/Linings/S8	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00C - R0007 - Sports Store

Ceiling Structures/Linings	Flat AC Sheeting 3314/B00C/R0009/Ceiling Structures/Linings/S8	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	---	------	------------	--------------------	---------	--

B00C - R0008 - Disabled Toilet

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3314/B00C/R0009/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00C - R0009 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3314/B00C/R0009/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
B00C - R0010 - Distribution Board				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3314/B00C/R0009/Ceiling Structures/Linings/S8					Chrysotile (white asbestos)	
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Administration/Building Services - 1965 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00D - R0005 - Home Base

No Asbestos

B00D - R0006 - Special Programs Room

No Asbestos

B00D - R0007 - General Storeroom

No Asbestos

B00D - R0008 - Cleaning Distributed Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00E - Pupil Facilities - 1965 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
In-fill panels around windows	Flat AC Sheeting 3314/B00A/R0001/Wall Linings Internal/S1	35m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting 3314/B00B/R0001/Ceiling Structures/Linings/S2	15m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting 3314/B00E/Gable Verge Lining/S14	30m	East & West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior**B00E - R0001 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting 3314/B00E/R0001/Ceiling Structures/Linings/S13	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	------------	--------------------	---------	--

B00E - R0002 - Welding Area

Hot Metal Workbench	Compressed AC Sheet 3314/B00E/R0003/Hot Metal Workbench/S6					No Asbestos Detected
Floor Coverings	Compressed AC Sheet 3314/B00E/R0003/Hot Metal Workbench/S6					No Asbestos Detected

B00E - R0003 - Materials Technology L.S.

Hot Metal Workbench	Compressed AC Sheet 3314/B00E/R0003/Hot Metal Workbench/S6					No Asbestos Detected
---------------------	---	--	--	--	--	-----------------------------

B00E - R0004 - Design L.S.

Floor Coverings Res/Textile	Adhesive 3314/B00E/R0004/Floor Coverings Res/Textile/S12	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	------	------------	--------------------	---------	--

B00E - R0005 - Food Technology L.S.

Floor Coverings Res/Textile	Vinyl Tiles 3314/B00E/R0005/Floor Coverings Res/Textile/S7					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 3314/B00E/R0004/Floor Coverings Res/Textile/S12	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0006 - Music Store

Floor Coverings Res/Textile	Vinyl Tiles 3314/B00E/R0005/Floor Coverings Res/Textile/S7					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 3314/B00E/R0004/Floor Coverings Res/Textile/S12	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0007 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles 3314/B00E/R0005/Floor Coverings Res/Textile/S7					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive 3314/B00E/R0004/Floor Coverings Res/Textile/S12	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00E - R0008 - Distribution Board

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3314/B00E/R0004/Floor Coverings Res/Textile/S12					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles					
3314/B00E/R0005/Floor Coverings Res/Textile/S7					No Asbestos Detected	
Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 1965 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00F - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Other - 2008 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00G - R0001 - Garage/Carport

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00H - R0001 - Reading Area

No Asbestos

B00H - R0002 - K.L.A. Store

No Asbestos

B00H - R0003 - Practical Activities

No Asbestos

B00H - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - Agricultural Science - 2012 - Greenhouse (Greenhouse)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00I - R0001 - Plant Space

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017