


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Urbenville Public School (3316)  
**Region :** North Coast  
**State Electorate :** Lismore  
**Local Government Area :** Tenterfield

**Initial Survey :** Noel Arnold & Associates : 11 - Jun - 2008  
**Reviewed By :** Parsons Brinckerhoff : 01 - Nov - 2016

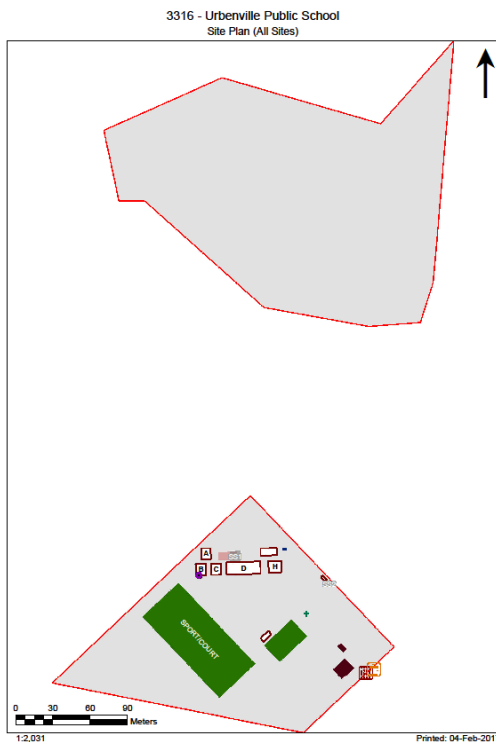

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning - 1910 - Timber (Timber)**

**Exterior**

Underfloor Void	No Asbestos Found
Ceiling Void	Non Accessible Area - No Access - No manhole in building

**Interior**

**B00A - R0001 - Canteen**

No Asbestos

**B00A - R0002 - Special Programs Room**

No Asbestos

**B00A - R0003 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
3316/B00A/R0003/Ceiling Structures/Linings/S10					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Library - 1910 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00B/Eaves Linings/S4					<b>Chrysotile (white asbestos)</b>
Ceiling Void	Non Accessible Area - No Access - No manhole in building					
Underfloor Voids	AC Fragments/Debris	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5)
	3316/B00B/Underfloor Voids/S8					<b>Chrysotile (white asbestos)</b>
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3316/B00B/Underfloor Voids - Packing to Floor Joists/S9					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior**

**B00B - R0001 - K.L.A. Store**

No Asbestos

**B00B - R0002 - Reading Area**

No Asbestos

**B00B - R0003 - Library Office/Workroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning - 1910 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00C/Eaves Linings/S5					<b>Chrysotile (white asbestos)</b>
Underfloor Void	No Asbestos Found					
Ceiling Void	Non Accessible Area - No Access - No manhole in building					

**Interior**

**B00C - R0001 - Practical Activities - 1hb**

No Asbestos

**B00C - R0002 - Home Base**

No Asbestos

**B00C - R0003 - Handwashing Facilities**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1910 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00D/Eaves Linings/S6					<b>Chrysotile (white asbestos)</b>
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

**Interior**

**B00D - R0001 - Clerical Office**

Wall Linings Internal	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00D/R0007/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00D/R0007/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>

**B00D - R0002 - Principal**

Wall Linings Internal	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00D/R0007/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00D/R0007/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>

**B00D - R0003 - Home Base**

Wall Linings Internal	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00D/R0007/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	51m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00D/R0007/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>

**B00D - R0004 - Home Base**

Wall Linings Internal	Flat AC Sheeting	120m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00D/R0007/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	52m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00D/R0007/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>

**B00D - R0005 - Home Base**

Wall Linings Internal	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00D/R0007/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	42m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00D/R0007/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>

**B00D - R0006 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	3316/B00D/R0006/Floor Coverings Res/Textile/S3					
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00D/R0007/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>

**B00D - R0007 - Staff Room**

Wall Linings Internal	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00D/R0007/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00D/R0007/Wall Linings Internal/S2					<b>Chrysotile (white asbestos)</b>

**B00D - R0008 - Movement**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3316/B00D/R0008/Ceiling Structures/Linings/S11					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities - 1946 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00E/Eaves Linings/S7					<b>Chrysotile (white asbestos)</b>
Underfloor Void	No Asbestos Found					
Ceiling Void	No Asbestos Found					
Flue Pipe	Fibre Cement Pipe	4m	North	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3316/B00E/Flue Pipe/S12					<b>Chrysotile (white asbestos)</b>
Flue Pipe	Fibre Cement Pipe	2m	South	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3316/B00E/R0001/Downpipe/S13					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior****B00E - R0001 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00E/R0003/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>
Downpipe	Fibre Cement Pipe	2.5m	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00E/R0001/Downpipe/S13					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00E - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00E/R0003/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**B00E - R0003 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00E/R0003/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**B00E - R0004 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00E/R0003/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**B00E - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00E/R0003/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**B00E - R0006 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00E/R0003/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**B00E - R0007 - Staff Toilet**

No Asbestos

**B00E - R0008 - Staff Toilet**

No Asbestos

**B00E - R0009 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3316/B00E/R0003/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Building Services - 1984 - Timber (Timber)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

**Interior**

**B00F - R0001 - General Assistant/Bulk Store**

No Asbestos

**B00F - R0002 - General Storeroom**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Building Services - 1950 - Timber (Timber)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00G - R0001 - General Storeroom**

No Asbestos

**B00G - R0002 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Multi Purpose Facilities - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00H - R0001 - Communal Space**

No Asbestos

**B00H - R0002 - General Storeroom**

No Asbestos

**B00H - R0003 - Practical Activities**

No Asbestos

**B00H - R0004 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

3316\_ASB\_221112\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017