


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Uralla Central School (3864)
Region : New England
State Electorate : Northern Tablelands
Local Government Area : Uralla

Initial Survey : Noel Arnold & Associates : 20 - May - 2008
Reviewed By : Greencap-NAA : 05 - May - 2016

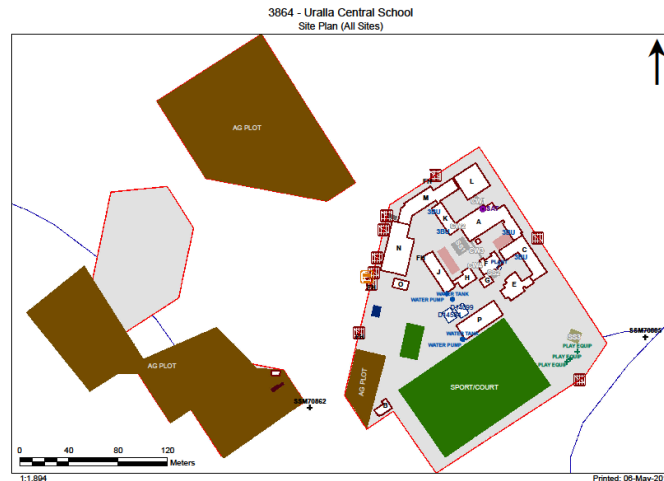

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Staff Facilities - 1912 - Brick/Block (Brick/Block)**Exterior**

No Asbestos

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

Interior**B00A - R0001 - Movement (15.61 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00A/R0001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	

B00A - R0002 - Interview (12.24 m2)

No Asbestos

B00A - R0003 - Interview (15.13 m2)

No Asbestos

B00A - R0004 - Interview (12.13 m2)

No Asbestos

B00A - R0005 - Staff Toilet (2.76 m2)

No Asbestos

B00A - R0006 - Staff Toilet (2.79 m2)

No Asbestos

B00A - R0007 - Communal/Performance Store (12.2 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
3864/B00A/R0014/Floor Coverings Res/Textile/S28					No Asbestos Detected	

B00A - R0008 - Interview (16.05 m2)

No Asbestos

B00A - R0009 - Cleaning Distributed Store (0.79 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
3864/B00A/R0014/Floor Coverings Res/Textile/S28					No Asbestos Detected	

B00A - R0010 - Main Switch Board (7.47 m2)

Electrical Mounting Board	Resinous Board					
3864/B00A/R0010/Electrical Mounting Board/S34					No Asbestos Detected	

B00A - R0011 - General Storeroom (4.89 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
3864/B00A/R0014/Floor Coverings Res/Textile/S28					No Asbestos Detected	

B00A - R0012 - Staff Toilet (4.61 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00A/R0026/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	

B00A - R0013 - Staff Toilet (4.54 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00A/R0026/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	

B00A - R0014 - Security Store (14.26 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
3864/B00A/R0014/Floor Coverings Res/Textile/S28					No Asbestos Detected	

B00A - R0015 - Interview (12.13 m2)

No Asbestos

B00A - R0016 - Movement (26.53 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0017 - Deputy Principal (12.89 m2)						
No Asbestos						
B00A - R0018 - Movement (87.84 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
3864/B00A/R0014/Floor Coverings Res/Textile/S28					No Asbestos Detected	
B00A - R0019 - Staff Kitchen (7.23 m2)						
No Asbestos						
B00A - R0020 - Staff Room (53.47 m2)						
Chalk Board	Resinous Board	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00A/R0020/Chalk Board/S35					Chrysotile (white asbestos)	
B00A - R0021 - Home Base (48.53 m2)						
No Asbestos						
B00A - R0022 - Practical Activities - 1hb (5.09 m2)						
No Asbestos						
B00A - R0023 - Home Base (43.76 m2)						
No Asbestos						
B00A - R0024 - Practical Activities - 1hb (4.96 m2)						
No Asbestos						
B00A - R0025 - Cleaning Distributed Store (0.42 m2)						
No Asbestos						
B00A - R0026 - Toilets - Boys (12.76 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	1m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00A/R0026/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00A/R0028/Wall Linings Internal/S29					Chrysotile (white asbestos)	
B00A - R0027 - Disabled Toilet (2.62 m2)						
Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00A/R0028/Wall Linings Internal/S29					Chrysotile (white asbestos)	
B00A - R0028 - Toilets - Girls (12.67 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00A/R0026/Partition Walls (Cubicles)/S3					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00A/R0028/Wall Linings Internal/S29					Chrysotile (white asbestos)	
B00A - R0029 - Movement (107.24 m2)						
No Asbestos						
B00A - R0030 - Cleaning Supplies (12.79 m2)						
No Asbestos						
B00A - R0031 - General Storeroom (16.93 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
3864/B00A/R0014/Floor Coverings Res/Textile/S28					No Asbestos Detected	
B00A - R0032 - Home Base (43.25 m2)						
Chalk Board	Resinous Board	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00A/R0020/Chalk Board/S35					Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0033 - Practical Activities - 1hb (4.84 m2)						
No Asbestos						
B00A - R0034 - Home Base (48.17 m2)						
No Asbestos						
B00A - R0035 - Practical Activities - 1hb (4.63 m2)						
No Asbestos						
B00A - R0036 - Home Base (48.27 m2)						
No Asbestos						
B00A - R0037 - Practical Activities - 1hb (4.85 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Agricultural Science - 1970 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Wall Cladding	Flat AC Sheeting 3864/B00B/Wall Cladding/S23	6m2	Upper Portion Above Room I	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Interior**B00B - R0001 - Animal Space (7.77 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3864/B00B/R0006/Ceiling Structures/Linings/S44	7.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-------	------------	--------------------	---------	--

B00B - R0002 - Movement (18.88 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3864/B00B/R0006/Ceiling Structures/Linings/S44	18.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	--------	------------	--------------------	---------	--

B00B - R0003 - General Storeroom (8.83 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3864/B00B/R0006/Ceiling Structures/Linings/S44	8.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-------	------------	--------------------	---------	--

B00B - R0004 - Class Tools Storage (33.92 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3864/B00B/R0006/Ceiling Structures/Linings/S44	33.8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	--------	------------	--------------------	---------	--

B00B - R0005 - Movement (2.02 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3864/B00B/R0006/Ceiling Structures/Linings/S44	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	------------	--------------------	---------	--

Electrical Backing Board	Resinous Board 3864/B00B/R0005/Electrical Backing Board/S45					No Asbestos Detected
--------------------------	--	--	--	--	--	-----------------------------

B00B - R0006 - Toilets - Boys/Girls (7.53 m2)

Partition Walls (Cubicles)	Compressed AC Sheet 3864/B00B/R0006/Partition Walls (Cubicles)/S24	4m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 3864/B00B/R0006/Ceiling Structures/Linings/S44	7.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Administration/General Learning - 1940 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3864/B00C/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	
Window	Putty					No Asbestos Detected
	3864/B00C/Window/S49					
Underfloor void	AC Fragments/Debris	0.1m2	South	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3864/B00C/Underfloor void/S51				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Underfloor void	Bricks	3Unit	South	Friable Asbestos (5)	Medium (2)	Medium Priority (4-5)
	3864/B00C/Underfloor void/S52				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling void	Non Accessible Area - Height Restriction 3.2m					

Interior**B00C - R0001 - Movement (118.72 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	60m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3864/B00C/R0001/Ceiling Structures/Linings/S5				Chrysotile (white asbestos)	

B00C - R0002 - Home Base (79.89 m2)

Decorative Coating	Vermiculite					Limited Samples Taken
	3864/B00C/R0004/Decorative Coating/S31					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Chalk Board	Resinous Board					No Asbestos Detected
	3864/B00C/R0002/Chalk Board/S32					

B00C - R0003 - Toilets - Boys/Girls (3.42 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	3m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3864/B00C/R0017/Partition Walls (Cubicles)/S7				Chrysotile (white asbestos)	

B00C - R0004 - Practical Activities - 1hb (8.65 m2)

Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	3864/B00C/R0004/Floor Coverings Res/Textile/S30					

Decorative Coating	Vermiculite					Limited Samples Taken
	3864/B00C/R0004/Decorative Coating/S31					
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00C - R0005 - Principal (16.28 m2)

No Asbestos

B00C - R0006 - Clerical Office (25.82 m2)

No Asbestos

B00C - R0007 - Movement (3.42 m2)

No Asbestos

B00C - R0008 - Distribution Board (1.28 m2)

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	0.3m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3864/B00C/R0008/Wall Linings Internal/S50				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

B00C - R0009 - Staff Toilet (3.64 m2)

No Asbestos

B00C - R0010 - Movement (3.89 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00C/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00C - R0011 - Entry Vestibule (22.61 m2)						
No Asbestos						
B00C - R0012 - Home Base (46.62 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00C/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00C - R0013 - Home Base (47.68 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00C/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00C - R0014 - Practical Activities - 1hb (7.67 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00C/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
3864/B00C/R0004/Floor Coverings Res/Textile/S30					No Asbestos Detected	
B00C - R0015 - Movement (16.7 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00C/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
B00C - R0016 - Practical Activities - 1hb (7.88 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00C/R0001/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Sheet					
3864/B00C/R0004/Floor Coverings Res/Textile/S30					No Asbestos Detected	
B00C - R0017 - Staff Toilet (3.94 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00C/R0017/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)	
B00C - R0018 - Sick Bay (10.77 m2)						
No Asbestos						
B00C - R0019 - Duplicating Workroom (16.34 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
3864/B00C/R0019/Floor Coverings Res/Textile/S6					No Asbestos Detected	
B00C - R0020 - Movement (9.37 m2)						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1981 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling void No Asbestos Found

Interior**B00E - R0001 - Toilets - Boys (12.69 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00E/R0001/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)	

B00E - R0002 - Toilets - Girls (12.59 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00E/R0001/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)	

B00E - R0003 - Home Base (56.18 m2)

No Asbestos

B00E - R0004 - Home Base Store (5.49 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
3864/B00E/R0004/Floor Coverings Res/Textile/S9					No Asbestos Detected	

B00E - R0005 - Withdrawal Space - 1hb (11.85 m2)

No Asbestos

B00E - R0006 - Home Base Store (5.96 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
3864/B00E/R0004/Floor Coverings Res/Textile/S9					No Asbestos Detected	

B00E - R0007 - Home Base (54.31 m2)

No Asbestos

B00E - R0008 - Movement (8.15 m2)

No Asbestos

B00E - R0009 - Practical Activities - 2hb (56.7 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
3864/B00E/R0004/Floor Coverings Res/Textile/S9					No Asbestos Detected	

lino to Practical Activities Bench

Vinyl Sheet						
3864/B00E/R0009/lino to Practical Activities Bench/S10					No Asbestos Detected	

B00E - R0010 - Distribution Board (0.48 m2)

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile	Vinyl Sheet					
3864/B00E/R0004/Floor Coverings Res/Textile/S9					No Asbestos Detected	

B00E - R0011 - Cleaning Distributed Store (1.13 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
3864/B00E/R0004/Floor Coverings Res/Textile/S9					No Asbestos Detected	

B00E - R0012 - Movement (53.99 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Technological & Applied Studies - 1912 - Brick/Block (Brick/Block)**Exterior**

Underfloor void	No Asbestos Found					
Ceiling void	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 3864/B00F/Wall Cladding/S54					No Asbestos Detected

Interior**B00F - R0001 - External Movement (2.44 m2)**

No Asbestos

B00F - R0007 - External Movement (12.39 m2)

No Asbestos

B00F - R0011 - Food/Research Space (34.94 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3864/B00F/R0016/Floor Coverings Res/Textile/S53					No Asbestos Detected
--------------------------------	--	--	--	--	--	----------------------

B00F - R0012 - Kitchen - Type 1 (73.05 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3864/B00F/R0016/Floor Coverings Res/Textile/S53					No Asbestos Detected
--------------------------------	--	--	--	--	--	----------------------

B00F - R0013 - Preparation - Materials (12.24 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3864/B00F/R0016/Floor Coverings Res/Textile/S53					No Asbestos Detected
--------------------------------	--	--	--	--	--	----------------------

B00F - R0014 - Materials Store (10.07 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3864/B00F/R0016/Floor Coverings Res/Textile/S53					No Asbestos Detected
--------------------------------	--	--	--	--	--	----------------------

B00F - R0015 - Laundry (3.53 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3864/B00F/R0016/Floor Coverings Res/Textile/S53					No Asbestos Detected
--------------------------------	--	--	--	--	--	----------------------

B00F - R0016 - Materials Store (10.1 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3864/B00F/R0016/Floor Coverings Res/Textile/S53					No Asbestos Detected
--------------------------------	--	--	--	--	--	----------------------

B00F - R0017 - Movement (4.38 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3864/B00F/R0016/Floor Coverings Res/Textile/S53					No Asbestos Detected
--------------------------------	--	--	--	--	--	----------------------

B00F - R0018 - Movement (1.96 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3864/B00F/R0016/Floor Coverings Res/Textile/S53					No Asbestos Detected
--------------------------------	--	--	--	--	--	----------------------

B00F - R0019 - External Movement (8.79 m2)

Wall Linings Internal	Flat AC Sheeting 3864/B00F/Wall Cladding/S54					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Technological & Applied Studies - 1950 - Timber (Timber)

Exterior

Underfloor void	AC Fragments/Debris	0.1m2	South	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	3864/B00G/Underfloor void/S46					Chrysotile (white asbestos)
Ceiling void	No Asbestos Found					

Interior

B00G - R0001 - Design L.S. (61.23 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	3864/B00G/R0001/Floor Coverings Res/Textile/S48					No Asbestos Detected

B00G - R0002 - External Movement (5.31 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Senior Learning/Staff Facilities - 1981 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 3864/B00H/Eaves Linings/S42					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underflor void	AC Fragments/Debris 3864/B00H/Underflor void/S41					No Asbestos Detected

Interior**B00H - R0001 - Seminar/Study (44.28 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3864/B00H/R0005/Ceiling Structures/Linings/S15	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Chalk Board	Flat AC Sheeting 3864/B00H/R0004/Chalk Board/S17					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3864/B00H/R0004/Wall Linings Internal/S18	80m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00H - R0002 - Sports Store (6.37 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3864/B00H/R0002/Floor Coverings Res/Textile/S43	6.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00H - R0003 - Movement (5.67 m2)

No Asbestos

B00H - R0004 - Staff Room Annexe (44.14 m2)

Chalk Board	Flat AC Sheeting 3864/B00H/R0004/Chalk Board/S17					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3864/B00H/R0004/Wall Linings Internal/S18	60m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 3864/B00H/R0005/Ceiling Structures/Linings/S15	44m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00H - R0005 - Cleaning Distributed Store (1.01 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3864/B00H/R0006/Floor Coverings Res/Textile/S13					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3864/B00H/R0005/Ceiling Structures/Linings/S15	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting 3864/B00H/R0005/Wall Linings Internal/S16					No Asbestos Detected

B00H - R0006 - Movement (46.38 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3864/B00H/R0006/Ceiling Structures/Linings/S12					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet 3864/B00H/R0006/Floor Coverings Res/Textile/S13					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 3864/B00H/R0006/Floor Coverings Res/Textile/S14					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3864/B00H/R0006/Wall Linings Internal/S62					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00J - General Learning/Staff Facilities - 1981 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3864/B00J/Eaves Linings/S56			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Underfloor void	AC Fragments/Debris	0.1m2	South	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3864/B00J/Underfloor void/S55			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting	2m2	North, South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3864/B00J/Gable Verge Lining/S57			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling void	No Asbestos Found					

Interior**B00J - R0001 - Staff Toilet (3.41 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3864/B00J/R0001/Ceiling Structures/Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00J - R0002 - Staff Room Annexe (33.76 m2)

No Asbestos

B00J - R0003 - General Storeroom (1.59 m2)

No Asbestos

B00J - R0004 - Art Learning Space (89.64 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	3864/B00J/R0010/Floor Coverings Res/Textile/S20					No Asbestos Detected

B00J - R0005 - Kiln Room (6.01 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	3864/B00J/R0010/Floor Coverings Res/Textile/S20					No Asbestos Detected

B00J - R0006 - Resources Space (11.28 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	3864/B00J/R0010/Floor Coverings Res/Textile/S20					No Asbestos Detected

B00J - R0007 - General Learning Space (53.32 m2)

Chalk Board	Resinous Board					
	3864/B00J/R0007/Chalk Board/S22					No Asbestos Detected

B00J - R0008 - General Learning Space (53.53 m2)

Chalk Board	Resinous Board					
	3864/B00J/R0007/Chalk Board/S22					No Asbestos Detected

B00J - R0009 - Darkroom Space (7.6 m2)

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3864/B00J/R0009/Floor Coverings Res/Textile/S21					Chrysotile (white asbestos)

B00J - R0010 - Movement (64.32 m2)

Ceiling Structures/Linings	Flat AC Sheeting	65m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3864/B00J/R0001/Ceiling Structures/Linings/S19			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Sheet					
	3864/B00J/R0010/Floor Coverings Res/Textile/S20					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Technological & Applied Studies - 1912 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids	Non Accessible Area - Height Restriction 3.2m					
Underfloor Voids	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	0.1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00K/Eaves Linings/S37					Chrysotile (white asbestos)	

Interior**B00K - R0001 - Movement (44.7 m2)**

No Asbestos

B00K - R0002 - Staff Room Annexe (11.71 m2)

No Asbestos

B00K - R0003 - Distribution Board (0.67 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00K - R0004 - Welding Area (5.3 m2)

No Asbestos

B00K - R0007 - Dust Extraction Space (4.42 m2)

No Asbestos

B00K - R0008 - Materials Store (27.61 m2)

Ceiling Structures/Linings	Flat AC Sheeting	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00K/R0008/Ceiling Structures/Linings/S36					Chrysotile (white asbestos)	

B00K - R0009 - Materials Technology L.S. (118.66 m2)

Ceiling Structures/Linings	Flat AC Sheeting	119m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00K/R0008/Ceiling Structures/Linings/S36					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00L - Library - 1981 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling void	No Asbestos Found

Interior**B00L - R0001 - Movement (98.26 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	99m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00L/R0001/Ceiling Structures/Linings/S58				Chrysotile (white asbestos)		

B00L - R0002 - Computer Learning Space (53.32 m2)

Decorative Coating	Vermiculite	54m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
3864/B00L/R0005/Decorative Coating/S59				Chrysotile (white asbestos)		

B00L - R0003 - Library Office/Workroom (19.91 m2)

Decorative Coating	Vermiculite	20m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
3864/B00L/R0005/Decorative Coating/S59				Chrysotile (white asbestos)		

B00L - R0004 - Movement (29.12 m2)

Decorative Coating	Vermiculite	30m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
3864/B00L/R0005/Decorative Coating/S59				Chrysotile (white asbestos)		

B00L - R0005 - Staff Toilet (3.05 m2)

Decorative Coating	Vermiculite	4m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
3864/B00L/R0005/Decorative Coating/S59				Chrysotile (white asbestos)		

B00L - R0006 - Distribution Board (0.68 m2)

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board	0.1m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00L/R0006/Electrical Mounting Board/S60				Chrysotile (white asbestos)		

Door lining	Flat AC Sheeting	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00L/R0006/Door lining/S61				Chrysotile (white asbestos)		

Ceiling Structures/Linings	Flat AC Sheeting	0.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00L/R0001/Ceiling Structures/Linings/S58				Chrysotile (white asbestos)		

B00L - R0007 - Cleaning Distributed Store (1.57 m2)

Decorative Coating	Vermiculite	2m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
3864/B00L/R0005/Decorative Coating/S59				Chrysotile (white asbestos)		

B00L - R0008 - Staff Toilet (3.67 m2)

Decorative Coating	Vermiculite	4m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
3864/B00L/R0005/Decorative Coating/S59				Chrysotile (white asbestos)		

B00L - R0009 - Seminar/Study (12.95 m2)

Decorative Coating	Vermiculite	13m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
3864/B00L/R0005/Decorative Coating/S59				Chrysotile (white asbestos)		

B00L - R0010 - Seminar/Study (12.99 m2)

Decorative Coating	Vermiculite	13m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
3864/B00L/R0005/Decorative Coating/S59				Chrysotile (white asbestos)		

B00L - R0011 - Seminar/Study (26.3 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Decorative Coating	Vermiculite	27m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
3864/B00L/R0005/Decorative Coating/S59					Chrysotile (white asbestos)	
B00L - R0012 - Reading Area (161.85 m2)						
Decorative Coating	Vermiculite	162m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
3864/B00L/R0005/Decorative Coating/S59					Chrysotile (white asbestos)	
B00L - R0013 - Librarian (5.88 m2)						
Decorative Coating	Vermiculite	6m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
3864/B00L/R0005/Decorative Coating/S59					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Science/General Learning - 1985 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
- Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00M - R0001 - Movement (27.18 m2)

Floor Coverings Res/Textile Vinyl Tiles
3864/B00M/R0006/Floor Coverings Res/Textile/S2 **No Asbestos Detected**

B00M - R0002 - General Learning Space (50.87 m2)

No Asbestos

B00M - R0003 - General Learning Space (51.93 m2)

No Asbestos

B00M - R0004 - No Access (39.47 m2)

No Asbestos

B00M - R0005 - General Assistant/Bulk Store (19.04 m2)

No Asbestos

B00M - R0006 - Movement (58.98 m2)

Floor Coverings Res/Textile Vinyl Tiles
3864/B00M/R0006/Floor Coverings Res/Textile/S2 **No Asbestos Detected**

B00M - R0007 - Movement (2.78 m2)

No Asbestos

B00M - R0008 - Toilets - Girls (12.8 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	------	--------------	--------------------	---------	--------------------

3864/B00M/R0008/Partition Walls (Cubicles)/S1 **Chrysotile (white asbestos)**

B00M - R0009 - Toilets - Boys (12.8 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	1.5m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	---------------------	-------	------	--------------------	---------	--------------------

3864/B00M/R0008/Partition Walls (Cubicles)/S1 **Chrysotile (white asbestos)**

B00M - R0010 - Apparatus Store (22.16 m2)

No Asbestos

B00M - R0011 - Cleaning Distributed Store (1.01 m2)

No Asbestos

B00M - R0012 - Distribution Board (0.71 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00M - R0013 - Staff Room Annexe (32.13 m2)

No Asbestos

B00M - R0014 - Laboratory L.S. (88.29 m2)

Floor Coverings Res/Textile Vinyl Tiles
3864/B00M/R0006/Floor Coverings Res/Textile/S2 **No Asbestos Detected**

Heat-proof Mat Flat AC Sheeting
3864/B00M/R0014/Heat-proof Mat/S38 **No Asbestos Detected**

B00M - R0015 - Preparation (48.95 m2)

Floor Coverings Res/Textile Vinyl Tiles
3864/B00M/R0006/Floor Coverings Res/Textile/S2 **No Asbestos Detected**

B00M - R0016 - Laboratory L.S. (88.17 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	3864/B00M/R0006/Floor Coverings Res/Textile/S2				No Asbestos Detected	
Heat-proof Mat	Flat AC Sheeting					
	3864/B00M/R0014/Heat-proof Mat/S38				No Asbestos Detected	
B00M - R0017 - Distribution Board (0.47 m2)				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles					
	3864/B00M/R0006/Floor Coverings Res/Textile/S2				No Asbestos Detected	
B00M - R0018 - Movement (2.23 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Communal Facilities/Pupil Facilities - 1985 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	10m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Height Restriction 3.2m						
Verandah infill	Compressed AC Sheet 3864/B00N/Verandah infill/S40					No Asbestos Detected
Ceiling void	No Asbestos Found					

Interior**B00N - R0001 - Movement (268.81 m2)**

No Asbestos

B00N - R0002 - Canteen (40.51 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3864/B00N/R0002/Floor Coverings Res/Textile/S26					No Asbestos Detected
Under sink pad	Fibrous Membrane 3864/B00N/R0002/Under sink pad/S39	0.2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00N - R0003 - Canteen Office/Store (5.94 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3864/B00N/R0002/Floor Coverings Res/Textile/S26					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00N - R0004 - Staff Toilet (2.27 m2)

Sanitary incinerator	Encapsulated Insulation material within unit	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed unit						

B00N - R0005 - Canteen Office/Store (4.34 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3864/B00N/R0002/Floor Coverings Res/Textile/S26					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00N - R0006 - Hall Chair Store (12.69 m2)

No Asbestos

B00N - R0007 - Multi-Purpose Space (221.22 m2)

No Asbestos

B00N - R0008 - Cleaning Distributed Store (1.11 m2)

No Asbestos

B00N - R0009 - Distribution Board (1.11 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00N - R0010 - P.E. Store (18.99 m2)

No Asbestos

B00N - R0011 - Raised Platform (50.74 m2)

No Asbestos

B00N - R0012 - Shower/Change (20.88 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00N/R0013/Partition Walls (Cubicles)/S25						Chrysotile (white asbestos)

B00N - R0013 - Toilets - Girls (17.51 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
3864/B00N/R0013/Partition Walls (Cubicles)/S25						Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00N - R0014 - Sports Store (12.95 m2)						
No Asbestos						
B00N - R0015 - Shower/Change (18.98 m2)						
No Asbestos						
B00N - R0016 - Toilets - Boys (16.41 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet					
3864/B00N/R0016/Partition Walls (Cubicles)/S47					No Asbestos Detected	
B00N - R0017 - Garden Store (16.23 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Multi Purpose Facilities - 2007 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B000 - R0001 - Sports Store (20.69 m2)

No Asbestos

B000 - R0002 - Sports Store (20.69 m2)

No Asbestos

B000 - R0003 - Sports Store (20.69 m2)

No Asbestos

B000 - R0004 - Sports Store (19.99 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - General Learning - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible

Interior

B00P - R0001 - Practical Activities - 1hb (19.06 m2)

Floor Coverings Res/Textile	No Asbestos Found
-----------------------------	-------------------

B00P - R0002 - Home Base (60.44 m2)

No Asbestos

B00P - R0003 - Home Base Store (6.2 m2)

No Asbestos

B00P - R0004 - Withdrawal Space - 2hb (11.66 m2)

No Asbestos

B00P - R0005 - Home Base (60.44 m2)

No Asbestos

B00P - R0006 - Practical Activities - 1hb (19.06 m2)

Floor Coverings Res/Textile	No Asbestos Found
-----------------------------	-------------------

B00P - R0007 - Home Base Store (6.2 m2)

No Asbestos

B00P - R0008 - Practical Activities - 1hb (19.06 m2)

Floor Coverings Res/Textile	No Asbestos Found
-----------------------------	-------------------

B00P - R0009 - Home Base (60.44 m2)

No Asbestos

B00P - R0010 - Home Base Store (6.2 m2)

No Asbestos

B00P - R0011 - Withdrawal Space - 2hb (11.66 m2)

No Asbestos

B00P - R0012 - Home Base (60.44 m2)

No Asbestos

B00P - R0013 - Home Base Store (6.2 m2)

No Asbestos

B00P - R0014 - Practical Activities - 1hb (19.06 m2)

Floor Coverings Res/Textile	No Asbestos Found
-----------------------------	-------------------

B00P - R0015 - External Movement (102.75 m2)

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Agricultural Science - 2015 - Metal Shed (Metal Shed)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00Q - R0001 - Animal Space (13.39 m2)

No Asbestos

B00Q - R0002 - Animal Space (12.78 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 601 - D14099 - Learning Unit - Standard/Withdrawal : Placement Date - 18/02/2003

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

OS 601 - D14534 - Learning Unit - Standard/Withdrawal : Placement Date - 11/05/2004

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3864_ASB_010713_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017