


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Umina Beach Public School (3995)  
**Region :** Hunter/Central Coast  
**State Electorate :** Gosford  
**Local Government Area :** Gosford

**Initial Survey :** Noel Arnold & Associates : 21 - Mar - 2008  
**Reviewed By :** Parsons Brinckerhoff : 08 - Jun - 2015

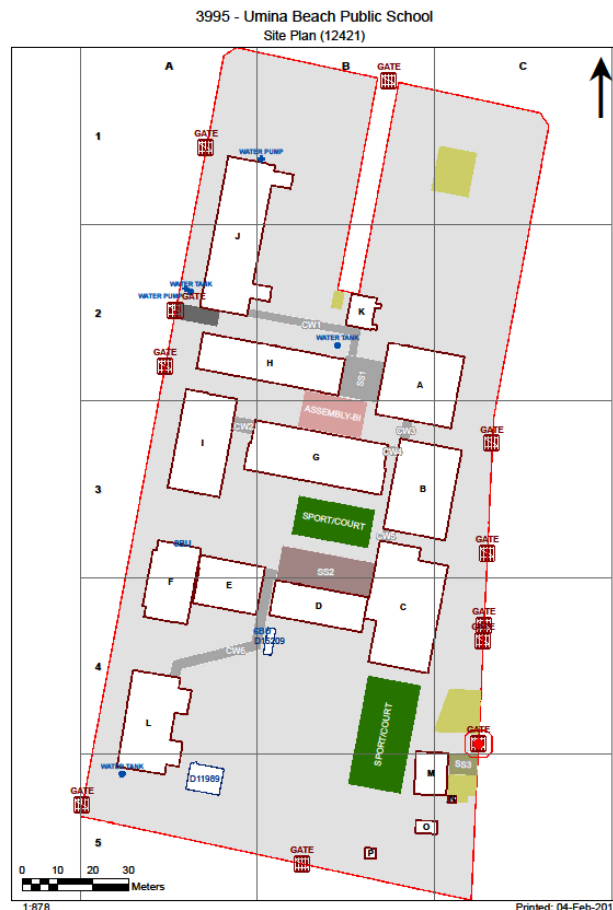

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - General Learning - 1956 - Brick/Block (Brick/Block)</b>						
<b>Exterior</b>						
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
<b>Interior</b>						
<b>B00A - R0001 - Home Base (55.99 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3995/B00A/R0006/Ceiling Structures/Linings/S16				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0002 - Practical Activities - 1hb (22.76 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00A/R0005/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
	3995/B00A/R0006/Ceiling Structures/Linings/S16				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0003 - Home Base (56 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3995/B00A/R0006/Ceiling Structures/Linings/S16				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0004 - Practical Activities - 1hb (22.76 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00A/R0005/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
	3995/B00A/R0006/Ceiling Structures/Linings/S16				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0005 - Practical Activities - 1hb (22.76 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00A/R0005/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
	3995/B00A/R0006/Ceiling Structures/Linings/S16				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0006 - Home Base (55.99 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3995/B00A/R0006/Ceiling Structures/Linings/S16				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0007 - Home Base (55.99 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3995/B00A/R0006/Ceiling Structures/Linings/S16				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0008 - Practical Activities - 1hb (22.76 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	23m2	Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00A/R0005/Floor Coverings Res/Textile/S17				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Vermiculite					
	3995/B00A/R0006/Ceiling Structures/Linings/S16				Limited Samples Taken	
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0009 - External Movement (95.47 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Administration/Staff Facilities - 1957 - Brick/Veneer (Brick/Veneer)****Exterior**

Wall Cladding	Compressed AC Sheet 3995/B00B/R0001/Wall cladding/S18					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00B - R0002 - Duplicating Workroom (27.08 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 3995/B00B/R0014/Floor Coverings Res/Textile/S20					<b>No Asbestos Detected</b>
--------------------------------	--	--	--	--	--	-----------------------------

**B00B - R0004 - Deputy Principal (14.2 m2)**

No Asbestos

**B00B - R0005 - Staff Room Annexe (14.2 m2)**

No Asbestos

**B00B - R0006 - Interview (12.94 m2)**

No Asbestos

**B00B - R0009 - Staff Room Annexe (24.29 m2)**

No Asbestos

**B00B - R0010 - Distribution Board (0.32 m2)**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting 3995/B00B/R0010/Ceiling Structures/Linings/S19					<b>No Asbestos Detected</b>
----------------------------	--	--	--	--	--	-----------------------------

**B00B - R0011 - Cleaning Distributed Store (1.61 m2)**

No Asbestos

**B00B - R0012 - Staff Toilet (2.49 m2)**

No Asbestos

**B00B - R0013 - Staff Toilet (2.49 m2)**

No Asbestos

**B00B - R0014 - Security Store (17.85 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 3995/B00B/R0014/Floor Coverings Res/Textile/S20					<b>No Asbestos Detected</b>
--------------------------------	--	--	--	--	--	-----------------------------

**B00B - R0017 - Sick Bay (9.24 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 3995/B00B/R0014/Floor Coverings Res/Textile/S20					<b>No Asbestos Detected</b>
--------------------------------	--	--	--	--	--	-----------------------------

**B00B - R0019 - Entry Vestibule (12.24 m2)**

No Asbestos

**B00B - R0020 - Movement (27.64 m2)**

No Asbestos

**B00B - R0021 - Staff Room (49.13 m2)**

No Asbestos

**B00B - R0022 - Staff Kitchen (8.94 m2)**

No Asbestos

**B00B - R0024 - Clerical Office/Workroom (25.99 m2)**

No Asbestos

**B00B - R0025 - Principal (21.84 m2)**

No Asbestos

**B00B - R0026 - Movement (20.26 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00B - R0027 - External Movement (133.48 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Communal Facilities/Pupil Facilities - 1985 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00C - R0001 - External Movement (1.69 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	3995/B00C/R0001/Ceiling Structures/Linings/S15					No Asbestos Detected

**B00C - R0002 - Communal Space (243.52 m2)**

In-fill panel above window	Flat AC Sheeting					
	3995/B00C/R0007/In-fill panel above window/S14					No Asbestos Detected

**B00C - R0003 - External Movement (1.69 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	3995/B00C/R0001/Ceiling Structures/Linings/S15					No Asbestos Detected

**B00C - R0005 - P.E. Store (14.22 m2)**

No Asbestos

**B00C - R0006 - Communal/Performance Store (14.22 m2)**

No Asbestos

**B00C - R0007 - Raised Platform (65.23 m2)**

In-fill panel above window	Flat AC Sheeting					
	3995/B00C/R0007/In-fill panel above window/S14					No Asbestos Detected

**B00C - R0008 - External Movement (1.69 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	3995/B00C/R0001/Ceiling Structures/Linings/S15					No Asbestos Detected

**B00C - R0009 - Movement (9.5 m2)**

No Asbestos

**B00C - R0011 - Sports Store (12.27 m2)**

No Asbestos

**B00C - R0012 - Garden Store (8.06 m2)**

No Asbestos

**B00C - R0013 - Cleaning Distributed Store (2.39 m2)**

No Asbestos

**B00C - R0015 - Staff Toilet (2.13 m2)**

No Asbestos

**B00C - R0016 - Canteen Office/Store (8.37 m2)**

No Asbestos

**B00C - R0017 - Canteen Office/Store (3.45 m2)**

No Asbestos

**B00C - R0018 - Canteen (42.29 m2)**

No Asbestos

**B00C - R0019 - Toilets - Boys (10.17 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00C/R0019/Partition Walls (Cubicles)/S21					Chrysotile (white asbestos)

**B00C - R0020 - Distribution Board (1.52 m2)**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting					
	3995/B00C/R0007/In-fill panel above window/S14					No Asbestos Detected

**B00C - R0021 - Toilets - Girls (10.18 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	8m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3995/B00C/R0019/Partition Walls (Cubicles)/S21					Chrysotile (white asbestos)	

**B00C - R0022 - External Movement (136.39 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1985 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	75m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00D/R0012/Ceiling Structures/Linings/S13				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3995/B00H/Underfloor Voids - Packing to Floor Joists/S22				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**Interior****B00D - R0001 - General Storeroom (4.49 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00D/R0012/Ceiling Structures/Linings/S13				<b>Chrysotile (white asbestos)</b>	

**B00D - R0002 - Interview (26.58 m2)**

No Asbestos

**B00D - R0003 - Home Base (53.31 m2)**

No Asbestos

**B00D - R0004 - Home Base Store (2.73 m2)**

No Asbestos

**B00D - R0005 - General Storeroom (10.36 m2)**

No Asbestos

**B00D - R0006 - General Storeroom (10.36 m2)**

No Asbestos

**B00D - R0007 - Home Base Store (2.73 m2)**

No Asbestos

**B00D - R0008 - Home Base (53.31 m2)**

No Asbestos

**B00D - R0010 - Uniform Shop (16.67 m2)**

No Asbestos

**B00D - R0013 - Interview (5.57 m2)**

No Asbestos

**B00D - R0014 - Movement (3.56 m2)**

No Asbestos

**B00D - R0015 - External Movement (8.28 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00D/R0015/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos)</b>	

**B00D - R0016 - Practical Activities - 1hb (18.34 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00D/R0015/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos)</b>	

**B00D - R0017 - External Movement (7.48 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00D/R0015/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos)</b>	

**B00D - R0018 - Practical Activities - 1hb (17.34 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00D/R0015/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos)</b>	

**B00D - R0019 - External Movement (3.56 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3995/B00D/R0015/Ceiling Structures/Linings/S24					<b>Chrysotile (white asbestos)</b>	

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 1956 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00E/Eaves Linings/S12				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00E - R0001 - Home Base (53.31 m2)**

No Asbestos

**B00E - R0002 - Home Base (53.31 m2)**

No Asbestos

**B00E - R0003 - General Assistant/Bulk Store (13.22 m2)**

No Asbestos

**B00E - R0004 - General Assistant/Bulk Store (8.49 m2)**

No Asbestos

**B00E - R0006 - External Movement (68.55 m2)**

No Asbestos

**B00E - R0007 - External Movement (6.98 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00D/R0015/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos)</b>	

**B00E - R0008 - Practical Activities - 1hb (14.59 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00D/R0015/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos)</b>	

**B00E - R0009 - External Movement (3.08 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00D/R0015/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos)</b>	

**B00E - R0010 - Practical Activities - 1hb (15.66 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00D/R0015/Ceiling Structures/Linings/S24				<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning/Pupil Facilities - 1992 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00F - R0001 - Withdrawal Space - 1hb (7.98 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00F - R0002 - Home Base Store (2.92 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00F - R0003 - Distribution Board (0.36 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00F - R0004 - Toilets - Boys (12.12 m2)**

No Asbestos

**B00F - R0005 - Practical Activities - 1hb (18.82 m2)**

No Asbestos

**B00F - R0006 - Home Base (61.47 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00F - R0007 - Home Base (61.47 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00F - R0008 - Practical Activities - 1hb (18.82 m2)**

No Asbestos

**B00F - R0009 - Toilets - Girls (11.11 m2)**

No Asbestos

**B00F - R0010 - Home Base Store (3.42 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00F - R0011 - Withdrawal Space - 1hb (7.98 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00F - R0012 - External Movement (56.64 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 1957 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3995/B00H/Underfloor Voids - Packing to Floor Joists/S22			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		

**Interior**

**B00G - R0001 - Withdrawal Space - 1hb (22.35 m2)**

No Asbestos

**B00G - R0002 - Home Base (53.32 m2)**

No Asbestos

**B00G - R0003 - Home Base (53.32 m2)**

No Asbestos

**B00G - R0004 - General Storeroom (12.64 m2)**

No Asbestos

**B00G - R0005 - Interview (9.43 m2)**

No Asbestos

**B00G - R0006 - Home Base (53.32 m2)**

No Asbestos

**B00G - R0007 - Home Base (53.31 m2)**

No Asbestos

**B00G - R0010 - Craft Store (16.44 m2)**

No Asbestos

**B00G - R0011 - General Storeroom (5.51 m2)**

No Asbestos

**B00G - R0013 - Movement (8.67 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3995/B00D/R0015/Ceiling Structures/Linings/S24			<b>Chrysotile (white asbestos)</b>		

**B00G - R0015 - External Movement (159.2 m2)**

No Asbestos

**B00G - R0016 - External Movement (9.59 m2)**

Recently Modified Space Requires Inspection

**B00G - R0017 - General Storeroom (5.45 m2)**

Recently Modified Space Requires Inspection

**B00G - R0018 - Practical Activities (16.48 m2)**

Recently Modified Space Requires Inspection

**B00G - R0019 - Practical Activities (16.37 m2)**

Recently Modified Space Requires Inspection

**B00G - R0020 - Practical Activities (16.41 m2)**

Recently Modified Space Requires Inspection

**B00G - R0021 - Practical Activities (16.51 m2)**

Recently Modified Space Requires Inspection

**B00G - R0022 - General Storeroom (5.56 m2)**

Recently Modified Space Requires Inspection

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00H - General Learning/Pupil Facilities - 1956 - Brick/Block (Brick/Block)****Exterior**

In-fill panels below windows	Flat AC Sheeting 3995/B00H/R0011/In-fill panels below windows/S5	15m2	North facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting 3995/B00H/Eaves Linings/S7	30m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting 3995/B00H/Underfloor Voids - Packing to Floor Joists/S22	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>

**Interior****B00H - R0001 - Personal Effects Storage (8.19 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 3995/B00H/R0009/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00H - R0002 - Home Base Store (2.55 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 3995/B00H/R0009/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00H - R0003 - Toilets - Boys/Girls (4.05 m2)**

Wall Linings Internal	Flat AC Sheeting 3995/B00H/R0008/Wall Linings Internal/S6	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting 3995/B00H/R0008/Wall Linings Internal/S6	5m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00H - R0004 - Home Base (68.77 m2)**

No Asbestos

**B00H - R0005 - Practical Activities - 1hb (14.22 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 3995/B00H/R0009/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00H - R0006 - Practical Activities - 1hb (14.22 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 3995/B00H/R0009/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00H - R0007 - Home Base (68.75 m2)**

No Asbestos

**B00H - R0008 - Toilets - Boys/Girls (3.73 m2)**

Wall Linings Internal	Flat AC Sheeting 3995/B00H/R0008/Wall Linings Internal/S6	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting 3995/B00H/R0008/Wall Linings Internal/S6	4m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00H - R0009 - Home Base Store (2.9 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 3995/B00H/R0009/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00H - R0010 - Personal Effects Storage (8.21 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 3995/B00H/R0009/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00H - R0012 - Toilets - Boys (30.88 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3995/B00H/R0012/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
3995/B00H/R0012/Partition Walls (Cubicles)/S2						
<b>B00H - R0013 - Drinking Facilities (9.07 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3995/B00H/R0012/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>	
Infill panels above Toilet entrances	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
3995/B00H/R0016/Infill panels above Toilet entrances/S27					<b>Chrysotile (white asbestos)</b>	
<b>B00H - R0014 - Toilets - Girls (30.88 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	31m2	Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3995/B00H/R0012/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>	
Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
3995/B00H/R0012/Partition Walls (Cubicles)/S2						
<b>B00H - R0015 - Sports Store (40.33 m2)</b>						
No Asbestos						
<b>B00H - R0017 - External Movement (77.96 m2)</b>						
Recently Modified Space	Requires Inspection					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Library - 1993 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Flat AC Sheeting 3995/B001/Eaves Linings/S10					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B001 - R0001 - Special Programs Room (44.1 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B001 - R0002 - Security Store (2.42 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B001 - R0003 - Distribution Board (0.48 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B001 - R0004 - External Movement (74.82 m2)**

No Asbestos

**B001 - R0005 - Security Store (12.58 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B001 - R0006 - Library Office/Workroom (26.52 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B001 - R0007 - Reading Area (227.48 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B001 - R0008 - Cleaning Distributed Store (3.07 m2)**

No Asbestos

**B001 - R0009 - Plant (1.7 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - General Learning/Pupil Facilities - 2006 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00J - R0001 - Practical Activities - 1hb (18.54 m2)**

No Asbestos

**B00J - R0002 - Home Base Store (6.09 m2)**

No Asbestos

**B00J - R0003 - Home Base (60.35 m2)**

No Asbestos

**B00J - R0004 - Withdrawal Space - 2hb (11.5 m2)**

No Asbestos

**B00J - R0005 - Practical Activities - 1hb (18.51 m2)**

No Asbestos

**B00J - R0006 - Distribution Board (0.81 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00J - R0007 - Home Base Store (6.08 m2)**

No Asbestos

**B00J - R0008 - Home Base Store (6.08 m2)**

No Asbestos

**B00J - R0009 - Practical Activities - 1hb (18.66 m2)**

No Asbestos

**B00J - R0010 - Home Base (60.09 m2)**

No Asbestos

**B00J - R0011 - Withdrawal Space - 2hb (11.61 m2)**

No Asbestos

**B00J - R0012 - Practical Activities - 1hb (19.31 m2)**

No Asbestos

**B00J - R0013 - Home Base (60.08 m2)**

No Asbestos

**B00J - R0014 - Home Base Store (6.09 m2)**

No Asbestos

**B00J - R0015 - Toilets - Girls (22.88 m2)**

No Asbestos

**B00J - R0016 - Toilets - Boys (17.14 m2)**

No Asbestos

**B00J - R0017 - Kiln Room (4.57 m2)**

No Asbestos

**B00J - R0018 - Staff Toilet (3.33 m2)**

No Asbestos

**B00J - R0019 - Home Base (60.43 m2)**

No Asbestos

**B00J - R0020 - General Storeroom (9.67 m2)**

No Asbestos

**B00J - R0021 - General Storeroom (9.55 m2)**

No Asbestos

**B00J - R0022 - External Stairs (9.18 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
	No Asbestos					
	<b>B00J - R0023 - External Stairs (9.18 m2)</b>					
	No Asbestos					
	<b>B00J - R0024 - External Movement (129.22 m2)</b>					
	No Asbestos					
	<b>B00J - R1001 - Practical Activities - 1hb (19.15 m2)</b>					
	No Asbestos					
	<b>B00J - R1002 - Home Base Store (6.17 m2)</b>					
	No Asbestos					
	<b>B00J - R1003 - Home Base (60.96 m2)</b>					
	No Asbestos					
	<b>B00J - R1004 - Withdrawal Space - 2hb (11.68 m2)</b>					
	No Asbestos					
	<b>B00J - R1005 - Practical Activities - 1hb (18.65 m2)</b>					
	No Asbestos					
	<b>B00J - R1006 - Distribution Board (0.51 m2)</b>				Note: No inspection of live electrical installation.	
	No Asbestos					
	<b>B00J - R1007 - Home Base Store (6.12 m2)</b>					
	No Asbestos					
	<b>B00J - R1008 - Home Base Store (6.14 m2)</b>					
	No Asbestos					
	<b>B00J - R1009 - Practical Activities - 1hb (18.27 m2)</b>					
	No Asbestos					
	<b>B00J - R1010 - Home Base (60.22 m2)</b>					
	No Asbestos					
	<b>B00J - R1011 - Withdrawal Space - 2hb (11.65 m2)</b>					
	No Asbestos					
	<b>B00J - R1012 - Practical Activities - 1hb (19.35 m2)</b>					
	No Asbestos					
	<b>B00J - R1013 - Home Base (60.66 m2)</b>					
	No Asbestos					
	<b>B00J - R1014 - Home Base Store (6.12 m2)</b>					
	No Asbestos					
	<b>B00J - R1015 - K.L.A. Store (44.02 m2)</b>					
	No Asbestos					
	<b>B00J - R1016 - Cleaning Distributed Store (5.79 m2)</b>					
	No Asbestos					
	<b>B00J - R1017 - Home Base (60.86 m2)</b>					
	No Asbestos					
	<b>B00J - R1018 - External Movement (95.33 m2)</b>					
	No Asbestos					
	<b>B00J - R1019 - External Stairs (9.31 m2)</b>					
	No Asbestos					
	<b>B00J - R1020 - External Stairs (9.12 m2)</b>					
	No Asbestos					



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Other - 2006 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting					
	3995/B00K/Underfloor Voids - Packing to Floor Joists/S23					<b>No Asbestos Detected</b>

**Interior**

**B00K - R0001 - Special Programs Room (62.5 m2)**

No Asbestos

**B00K - R0002 - External Movement (1.94 m2)**

No Asbestos

**B00K - R0003 - External Movement (1.94 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00L - General Learning - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00L - R0001 - Practical Activities - 1hb (21.04 m2)**

No Asbestos

**B00L - R0002 - Withdrawal Space - 1hb (9.13 m2)**

No Asbestos

**B00L - R0003 - Home Base Store (5.88 m2)**

No Asbestos

**B00L - R0004 - Home Base (57.89 m2)**

No Asbestos

**B00L - R0005 - Home Base Store (6.14 m2)**

No Asbestos

**B00L - R0006 - Practical Activities - 1hb (18.99 m2)**

No Asbestos

**B00L - R0007 - Home Base (60.56 m2)**

No Asbestos

**B00L - R0008 - Withdrawal Space - 2hb (11.6 m2)**

No Asbestos

**B00L - R0009 - Home Base (60.17 m2)**

No Asbestos

**B00L - R0010 - Practical Activities - 1hb (19 m2)**

No Asbestos

**B00L - R0011 - Home Base Store (6.19 m2)**

No Asbestos

**B00L - R0012 - External Movement (82.31 m2)**

No Asbestos

**B00L - R0013 - Distribution Board (0.48 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00L - R0014 - External Stairs (5.17 m2)**

No Asbestos

**B00L - R0015 - General Storeroom (9.47 m2)**

No Asbestos

**B00L - R0016 - External Stairs (5.3 m2)**

No Asbestos

**B00L - R0017 - General Storeroom (9.4 m2)**

No Asbestos

**B00L - R1001 - Practical Activities - 1hb (20.93 m2)**

No Asbestos

**B00L - R1002 - Withdrawal Space - 1hb (9.2 m2)**

No Asbestos

**B00L - R1003 - Home Base (57.77 m2)**

No Asbestos

**B00L - R1004 - Home Base Store (5.94 m2)**

No Asbestos

**B00L - R1005 - Home Base Store (6.19 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	<b>Sample No</b>					<b>Test Result</b>

No Asbestos

**B00L - R1006 - Practical Activities - 1hb (18.98 m2)**

No Asbestos

**B00L - R1007 - Home Base (60 m2)**

No Asbestos

**B00L - R1008 - Withdrawal Space - 2hb (11.63 m2)**

No Asbestos

**B00L - R1009 - Home Base (60.07 m2)**

No Asbestos

**B00L - R1010 - Home Base Store (6.19 m2)**

No Asbestos

**B00L - R1011 - Practical Activities - 1hb (19.14 m2)**

No Asbestos

**B00L - R1012 - External Movement (74.04 m2)**

No Asbestos

**B00L - R1013 - Distribution Board (0.48 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00L - R1014 - External Stairs (17.53 m2)**

No Asbestos

**B00L - R1015 - External Stairs (17.65 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Other - 2011 - Steel (Steel)**

**Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

**Interior**

**B00M - R0001 - Clerical Office (11.49 m2)**

No Asbestos

**B00M - R0002 - Special Programs Room (58.97 m2)**

No Asbestos

**B00M - R0003 - Clerical Office (11.87 m2)**

No Asbestos

**B00M - R0004 - Toilets-Unisex (1.89 m2)**

No Asbestos

**B00M - R0005 - Toilet - Lobby (3.35 m2)**

No Asbestos

**B00M - R0006 - General Storeroom (11.45 m2)**

No Asbestos

**B00M - R0007 - Kitchen - Pre (4.21 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - Other - 2010 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00N - R0001 - Sports Store (3.91 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B000 - Other - 2010 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B000 - R0001 - Sports Store (20.66 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00P - Other - 2010 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00P - R0001 - Sports Store (8.41 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D11989 - Learning Unit - Standard With P.A.A. : Placement Date - 22/02/2013**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 840 - D15209 - Girls Toilet : Placement Date - 29/03/2001**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	2.88 m2

**Interior**

**R1 - Toilets-Girls**

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	4 m2
End wall panel	Flat AC Sheet	Assumed Asbestos	36 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

3995\_ASB\_281112\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017