


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** West Pennant Hills Public School (2858)  
**Region :** Northern Sydney  
**State Electorate :** Epping  
**Local Government Area :** Hornsby

**Initial Survey :** Noel Arnold & Associates : 17 - Jan - 2008  
**Reviewed By :** Greencap-NAA : 24 - Jun - 2015

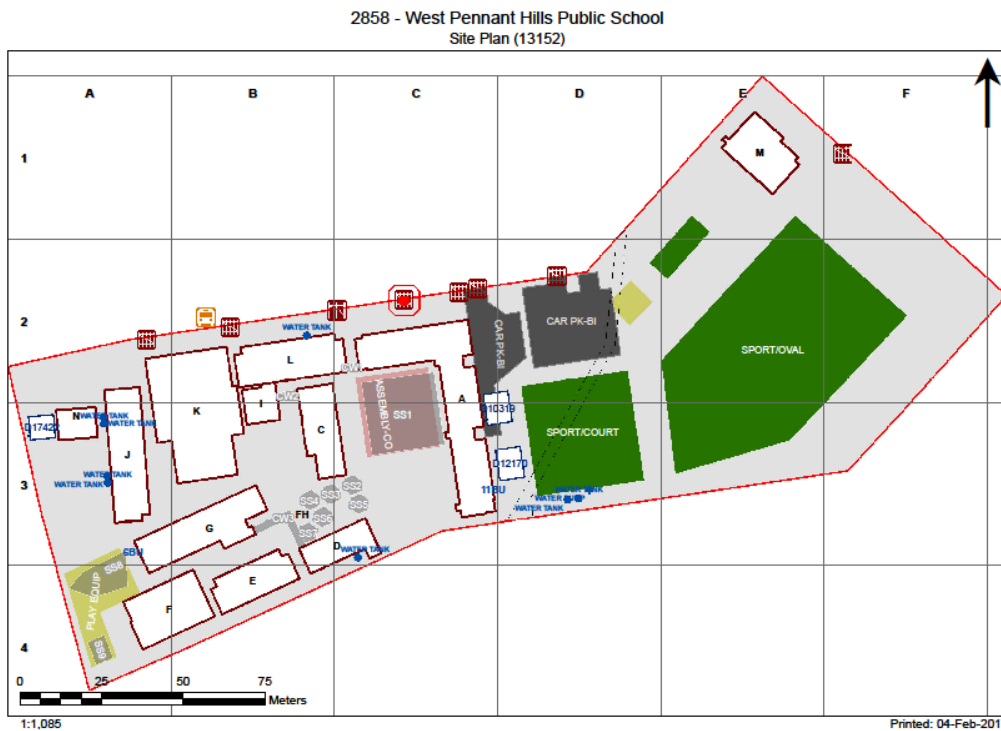

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/General Learning - 1963 - Brick/Block (Brick/Block)****Exterior**

Gable Verge Lining	Flat AC Sheeting 2858/B00D/gable verge strip/S1	60m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Eaves Linings	Flat AC Sheeting 2858/B00A/Eaves Linings/S27	180m2	North facing, South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	
Pebble Dash Wall cladding	Flat AC Sheeting 2858/B00A/Pebble Dash Wall cladding/S18	50m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible - crawl space					
Eaves Linings	Flat AC Sheeting 2858/B00A/Eaves Linings/S27	3m	South	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	

**Interior****B00A - R0001 - Security Store (13.28 m2)**

Floor Coverings Res/Textile	Vinyl Sheet 2858/B00A/R1011/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>
Floor underlay	paper lining 2858/B00A/R0001/Floor underlay/S25					<b>No Asbestos Detected</b>

**B00A - R0002 - Clerical Office (16.01 m2)**

No Asbestos

**B00A - R0003 - Deputy Principal (13.28 m2)**

No Asbestos

**B00A - R0004 - Cleaning Distributed Store (2.23 m2)**

No Asbestos

**B00A - R0006 - Staff Toilet (4.1 m2)**

No Asbestos

**B00A - R0007 - Principal (20.69 m2)**

No Asbestos

**B00A - R0008 - External Movement (9.83 m2)**

No Asbestos

**B00A - R0009 - Home Base (62.52 m2)**

No Asbestos

**B00A - R0010 - Home Base Store (5.4 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00A/R0026/Floor Coverings Res/Textile/S15	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	

**B00A - R0011 - Personal Effects Storage (7.9 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00A/R0026/Floor Coverings Res/Textile/S15	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos)</b>	

**B00A - R0012 - Movement (9.14 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2858/B00A/R0026/Floor Coverings Res/Textile/S15	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0013 - Entry Vestibule (23.06 m2)</b>						
No Asbestos						
<b>B00A - R0014 - General Storeroom (8.33 m2)</b>						
No Asbestos						
<b>B00A - R0015 - Clerical Office (15.27 m2)</b>						
No Asbestos						
<b>B00A - R0016 - Staff Toilet (7.17 m2)</b>						
No Asbestos						
<b>B00A - R0017 - Duplicating Workroom (23.06 m2)</b>						
No Asbestos						
<b>B00A - R0018 - Duplicating Workroom (23.15 m2)</b>						
No Asbestos						
<b>B00A - R0019 - Staff Toilet (5.87 m2)</b>						
No Asbestos						
<b>B00A - R0021 - Movement (27.53 m2)</b>						
No Asbestos						
<b>B00A - R0022 - External Movement (2.1 m2)</b>						
No Asbestos						
<b>B00A - R0023 - General Storeroom (4.16 m2)</b>						
No Asbestos						
<b>B00A - R0024 - External Movement (5.63 m2)</b>						
No Asbestos						
<b>B00A - R0025 - Home Base (56.9 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2858/B00A/R0026/Floor Coverings Res/Textile/S15	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0026 - Personal Effects Storage (5.44 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 2858/B00A/R0026/Floor Coverings Res/Textile/S15	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive to light blue vft 2858/B00A/R0026/Floor Coverings Res/Textile/S19					<b>No Asbestos Detected</b>
<b>B00A - R0027 - Main Switch Board (3.08 m2)</b>						
No Asbestos						
<b>B00A - R0028 - Home Base Store (4.68 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 2858/B00A/R0026/Floor Coverings Res/Textile/S15	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0029 - Home Base (56.9 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2858/B00A/R0026/Floor Coverings Res/Textile/S15	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0030 - Personal Effects Storage (5.44 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles 2858/B00A/R0026/Floor Coverings Res/Textile/S15	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
<b>B00A - R0031 - General Storeroom (3.08 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0032 - Home Base Store (4.68 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00A/R0026/Floor Coverings Res/Textile/S15				<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0033 - Cleaning Supplies (8.53 m2)</b>						
No Asbestos						
<b>B00A - R0034 - External Movement (2.1 m2)</b>						
No Asbestos						
<b>B00A - R0035 - Movement (68.46 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2858/B00A/R0035/Ceiling Structures/Linings/S14				<b>Limited Samples Taken</b>	
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Ceiling Structures/Linings	Vermiculite					
	2858/B00A/R0035/Ceiling Structures/Linings/S17				<b>Limited Samples Taken</b>	
	<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>					
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00A/R0026/Floor Coverings Res/Textile/S15				<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0036 - Movement (34.95 m2)</b>						
No Asbestos						
<b>B00A - R0037 - Canteen (30.26 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	31m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00A/R0037/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive to olive green vft					
	2858/B00A/R0037/Floor Coverings Res/Textile/S20				<b>No Asbestos Detected</b>	
<b>B00A - R0039 - Canteen Office/Store (2.89 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00A/R0037/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0040 - Canteen Office/Store (2.86 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00A/R0037/Floor Coverings Res/Textile/S13				<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0041 - Special Programs Room (109.63 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2858/B00A/R1011/Floor Coverings Res/Textile/S16				<b>No Asbestos Detected</b>	
<b>B00A - R0042 - Home Base Store (2.94 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2858/B00A/R0043/Floor Coverings Res/Textile/S21				<b>No Asbestos Detected</b>	
<b>B00A - R0043 - Movement (10.3 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2858/B00A/R0043/Floor Coverings Res/Textile/S21				<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Adhesivevto cream vft					
	2858/B00A/R0043/Floor Coverings Res/Textile/S22				<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Vinyl Tiles					
	2858/B00A/R0043/Floor Coverings Res/Textile/S23				<b>No Asbestos Detected</b>	
<b>B00A - R0044 - External Movement (2.34 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0045 - Sports Store (19.79 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	2858/B00A/R0045/Ceiling Structures/Linings/S26					<b>No Asbestos Detected</b>
<b>B00A - R0046 - Stairs (1.59 m2)</b>						
No Asbestos						
<b>B00A - R0047 - Stairs (2.01 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2858/B00A/R0035/Ceiling Structures/Linings/S17					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0048 - Stairs (0.88 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	2858/B00A/R0035/Ceiling Structures/Linings/S17					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0049 - Stairs (4.61 m2)</b>						
No Asbestos						
<b>B00A - R0050 - External Movement (21.2 m2)</b>						
No Asbestos						
<b>B00A - R1001 - Personal Effects Storage (5.44 m2)</b>						
Floor Coverings Res/Textile	No Asbestos Found					
Floor Coverings Res/Textile	No Asbestos Found					
Floor Coverings Res/Textile	No Asbestos Found					
<b>B00A - R1002 - General Storeroom (3.06 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00A/R0037/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>
<b>B00A - R1003 - Home Base Store (4.59 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2858/B00A/R1011/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>
<b>B00A - R1004 - Home Base (57.12 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2858/B00A/R1011/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>
<b>B00A - R1005 - Personal Effects Storage (5.35 m2)</b>						
Floor Coverings Res/Textile	No Asbestos Found					
Floor Coverings Res/Textile	No Asbestos Found					
Floor Coverings Res/Textile	No Asbestos Found					
<b>B00A - R1006 - General Storeroom (3.01 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00A/R0037/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>
<b>B00A - R1007 - Home Base Store (4.51 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2858/B00A/R1011/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>
<b>B00A - R1008 - Home Base (57.12 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2858/B00A/R1011/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1009 - Personal Effects Storage (5.44 m2)</b>						
Floor Coverings Res/Textile	No Asbestos Found					
Floor Coverings Res/Textile	No Asbestos Found					
Floor Coverings Res/Textile	No Asbestos Found					
<b>B00A - R1010 - General Storeroom (3.06 m2)</b>						
No Asbestos						
<b>B00A - R1011 - Home Base Store (4.59 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2858/B00A/R1011/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>
<b>B00A - R1012 - Home Base (57.12 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2858/B00A/R1011/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>
<b>B00A - R1013 - Personal Effects Storage (5.44 m2)</b>						
Floor Coverings Res/Textile	No Asbestos Found					
Floor Coverings Res/Textile	No Asbestos Found					
Floor Coverings Res/Textile	No Asbestos Found					
<b>B00A - R1014 - General Storeroom (3.06 m2)</b>						
No Asbestos						
<b>B00A - R1015 - Home Base Store (4.59 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2858/B00A/R1011/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>
<b>B00A - R1016 - Home Base (57.12 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2858/B00A/R1011/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>
<b>B00A - R1017 - Personal Effects Storage (4.14 m2)</b>						
No Asbestos						
<b>B00A - R1018 - Security Store (6.7 m2)</b>						
Floor Coverings Res/Textile	No Asbestos Found					
Floor Coverings Res/Textile	No Asbestos Found					
Floor Coverings Res/Textile	No Asbestos Found					
<b>B00A - R1019 - Home Base Store (5.43 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2858/B00A/R1011/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>
<b>B00A - R1020 - Home Base (62.67 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2858/B00A/R1011/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>
<b>B00A - R1021 - Home Base (57.12 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	2858/B00A/R1011/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R1022 - Personal Effects Storage (8.67 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2858/B00A/R0037/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1023 - Home Base Store (4.59 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
2858/B00A/R1011/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>	
<b>B00A - R1024 - Home Base (57.12 m2)</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
2858/B00A/R1011/Floor Coverings Res/Textile/S16					<b>No Asbestos Detected</b>	
<b>B00A - R1025 - Personal Effects Storage (8.77 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2858/B00A/R0037/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1026 - Home Base Store (4.64 m2)</b>						
No Asbestos						
<b>B00A - R1027 - Movement (183.48 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	180m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
2858/B00A/R0037/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1028 - Movement (20.75 m2)</b>						
No Asbestos						
<b>B00A - R1029 - Stairs (15.29 m2)</b>						
No Asbestos						
<b>B00A - R1030 - Stairs (16.64 m2)</b>						
No Asbestos						
<b>B00A - R1031 - Stairs (17.01 m2)</b>						
No Asbestos						
<b>B00A - R1032 - Stairs (16.21 m2)</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00C - General Learning - 1965 - Brick/Veneer (Brick/Veneer)****Exterior**

Gable Verge Lining	Flat AC Sheeting	18m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00D/gable verge strip/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00C/Eaves Linings/S33				<b>Chrysotile (white asbestos)</b>	

**Interior****B00C - R0001 - Out Of School Hours Care Centre (57.46 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	1m2	section under heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00C/R0005/Floor Coverings Res/Textile/S11				<b>Chrysotile (white asbestos)</b>	

**B00C - R0003 - Movement (3.3 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00C/R0005/Floor Coverings Res/Textile/S11				<b>Chrysotile (white asbestos)</b>	

**B00C - R0004 - Personal Effects Storage (4.71 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00C/R0005/Floor Coverings Res/Textile/S11				<b>Chrysotile (white asbestos)</b>	

**B00C - R0005 - Home Base Store (5.87 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00C/R0005/Floor Coverings Res/Textile/S11				<b>Chrysotile (white asbestos)</b>	

**B00C - R0006 - Home Base (57.38 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00C/R0005/Floor Coverings Res/Textile/S11				<b>Chrysotile (white asbestos)</b>	

**B00C - R0008 - Movement (6.46 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00C/R0005/Floor Coverings Res/Textile/S11				<b>Chrysotile (white asbestos)</b>	

**B00C - R0009 - Personal Effects Storage (9.94 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00C/R0005/Floor Coverings Res/Textile/S11				<b>Chrysotile (white asbestos)</b>	

**B00C - R0011 - Home Base Store (5.29 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00C/R0005/Floor Coverings Res/Textile/S11				<b>Chrysotile (white asbestos)</b>	

**B00C - R0012 - Home Base Store (5.29 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00C/R0005/Floor Coverings Res/Textile/S11				<b>Chrysotile (white asbestos)</b>	

**B00C - R0013 - Staff Room (57.38 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00C/R0005/Floor Coverings Res/Textile/S11				<b>Chrysotile (white asbestos)</b>	

**B00C - R0014 - Out Of School Hours Care Centre (51.66 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00C/R0014/Ceiling Structures/Linings/S31				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Infill panel above doors	Flat AC Sheeting	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
2858/B00C/R0014/Ceiling Structures/Linings/S31				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00D - Pupil Facilities - 1968 - Brick/Block (Brick/Block)****Exterior**

Gable Verge Lining	Flat AC Sheeting	18m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00D/gable verge strip/S1			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	Asbestos dust associated with AC ceilings	1m2	Throughout	Friable Asbestos (5)	Low (1)	Medium Priority (4-5)
	<b>Assumed Asbestos - Height Restriction</b>					
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior****B00D - R0001 - Movement (15.37 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00D/R0002/Ceiling Structures/Linings/S24			<b>Chrysotile (white asbestos)</b>		

**B00D - R0002 - Staff Toilet (2.75 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00D/R0002/Partition Walls (Cubicles)/S3			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00D/R0002/Ceiling Structures/Linings/S24			<b>Chrysotile (white asbestos)</b>		

**B00D - R0003 - Toilets - Girls (49.81 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00D/R0002/Ceiling Structures/Linings/S24			<b>Chrysotile (white asbestos)</b>		

**B00D - R0004 - Toilets - Boys (58.55 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	59m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00D/R0002/Ceiling Structures/Linings/S24			<b>Chrysotile (white asbestos)</b>		

**B00D - R0005 - Drinking Facilities (25.09 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00D/R0002/Ceiling Structures/Linings/S24			<b>Chrysotile (white asbestos)</b>		

**B00D - R0006 - Cleaning Distributed Store (7.69 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00D/R0002/Ceiling Structures/Linings/S24			<b>Chrysotile (white asbestos)</b>		

**B00D - R0007 - Sports Store (7.69 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2858/B00D/R0002/Ceiling Structures/Linings/S24			<b>Chrysotile (white asbestos)</b>		

**B00D - R0008 - Garden Store (11.1 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00E - General Learning - 1965 - Brick/Veneer (Brick/Veneer)****Exterior**

Gable Verge Linings	Flat AC Sheeting 2858/B00D/gable verge strip/S1	18m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Eaves Linings	Flat AC Sheeting 2858/B00F/Eaves Linings/S7	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior****B00E - R0002 - Staff Toilet (3.26 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00E/R0003/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>
--------------------------------	---	--	--	--	--	-----------------------------

**B00E - R0003 - Movement (7.3 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00E/R0003/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>
--------------------------------	---	--	--	--	--	-----------------------------

**B00E - R0004 - Duplicating Workroom (20.89 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2858/B00G/R0001/Floor Coverings Res/Textile/S28					<b>No Asbestos Detected</b>
--------------------------------	---	--	--	--	--	-----------------------------

**B00E - R0005 - Personal Effects Storage (7.56 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00E/R0003/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>
--------------------------------	---	--	--	--	--	-----------------------------

**B00E - R0007 - Home Base Store (2.63 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00E/R0003/Floor Coverings Res/Textile/S9					<b>No Asbestos Detected</b>
--------------------------------	---	--	--	--	--	-----------------------------

**B00E - R0008 - Home Base (56.62 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2858/B00A/R0026/Floor Coverings Res/Textile/S15	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>

**B00E - R0009 - Home Base (56.62 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2858/B00A/R0026/Floor Coverings Res/Textile/S15	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>

**B00E - R0011 - Movement (6.55 m2)**

No Asbestos

**B00E - R0012 - Personal Effects Storage (10.5 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00E/R0014/Floor Coverings Res/Textile/S10					<b>No Asbestos Detected</b>
--------------------------------	--	--	--	--	--	-----------------------------

**B00E - R0013 - Seminar/Study (21.67 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2858/B00A/R0026/Floor Coverings Res/Textile/S15	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>

**B00E - R0014 - General Storeroom (3.26 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	2858/B00E/R0014/Floor Coverings Res/Textile/S10				<b>No Asbestos Detected</b>	
<b>B00E - R0015 - External Movement (51.74 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Entrances - East & west	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00G/R0015/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning - 1965 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Extreme Access Issue - Roof - Flat Roof					
Eaves Linings	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00F/Eaves Linings/S7			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior****B00F - R0002 - Movement (7.46 m2)**

No Asbestos

**B00F - R0003 - Cleaning Distributed Store (5.56 m2)**

Floor Coverings Res/Textile	Vinyl Tiles				
	2858/B00F/R0008/Floor Coverings Res/Textile/S6			<b>No Asbestos Detected</b>	

**B00F - R0004 - Home Base Store (5.61 m2)**

Floor Coverings Res/Textile	Vinyl Tiles				
	2858/B00F/R0008/Floor Coverings Res/Textile/S6			<b>No Asbestos Detected</b>	

**B00F - R0005 - Personal Effects Storage (12.07 m2)**

Floor Coverings Res/Textile	Vinyl Tiles				
	2858/B00F/R0008/Floor Coverings Res/Textile/S6			<b>No Asbestos Detected</b>	

**B00F - R0006 - Home Base (65.28 m2)**

No Asbestos

**B00F - R0007 - Home Base (89.52 m2)**

No Asbestos

**B00F - R0008 - Personal Effects Storage (12.2 m2)**

Floor Coverings Res/Textile	Vinyl Tiles				
	2858/B00F/R0008/Floor Coverings Res/Textile/S6			<b>No Asbestos Detected</b>	

**B00F - R0010 - Movement (9.74 m2)**

Floor Coverings Res/Textile	Vinyl Tiles				
	2858/B00F/R0008/Floor Coverings Res/Textile/S6			<b>No Asbestos Detected</b>	

**B00F - R0011 - Staff Toilet (1.62 m2)**

No Asbestos

**B00F - R0013 - External Movement (150.54 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00G - Administration/General Learning - 1948 - Brick/Block (Brick/Block)****Exterior**

Gable Verge Linings	Flat AC Sheeting 2858/B00D/gable verge strip/S1	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Eaves Linings	Flat AC Sheeting 2858/B00G/R0015/Ceiling Structures/Linings/S4	60m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor voids - Ground panel	Compressed AC Sheet 2858/B00G/Underfloor voids - Ground panel/S31					<b>No Asbestos Detected</b>

**Interior****B00G - R0001 - Home Base (56.91 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2858/B00G/R0001/Floor Coverings Res/Textile/S28					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive 2858/B00G/R0001/Floor Coverings Res/Textile/S29					<b>No Asbestos Detected</b>

**B00G - R0002 - Personal Effects Storage (10.41 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00G/R0014/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00G - R0003 - Deputy Principal (19.45 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00G/R0003/Floor Coverings Res/Textile/S30					<b>No Asbestos Detected</b>
-----------------------------	--	--	--	--	--	-----------------------------

**B00G - R0004 - General Storeroom (0.58 m2)**

No Asbestos

**B00G - R0006 - Movement (13.6 m2)**

No Asbestos

**B00G - R0008 - General Storeroom (2.26 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00G/R0014/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00G - R0009 - Personal Effects Storage (7.91 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00G/R0014/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00G - R0010 - Home Base (57.39 m2)**

No Asbestos

**B00G - R0011 - Home Base (57.7 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 2858/B00G/R0001/Floor Coverings Res/Textile/S28					<b>No Asbestos Detected</b>
-----------------------------	--	--	--	--	--	-----------------------------

**B00G - R0012 - Practical Activities - 1hb (3.98 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00G/R0014/Floor Coverings Res/Textile/S5					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00G - R0013 - Personal Effects Storage (6.54 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	2858/B00G/R0014/Floor Coverings Res/Textile/S5				<b>No Asbestos Detected</b>	
<b>B00G - R0014 - Movement (6.63 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2858/B00G/R0014/Floor Coverings Res/Textile/S5				<b>No Asbestos Detected</b>	
<b>B00G - R0016 - Personal Effects Storage (6.54 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2858/B00G/R0014/Floor Coverings Res/Textile/S5				<b>No Asbestos Detected</b>	
<b>B00G - R0017 - Practical Activities - 1hb (3.98 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	2858/B00G/R0014/Floor Coverings Res/Textile/S5				<b>No Asbestos Detected</b>	
<b>B00G - R0018 - Home Base (57.38 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	2858/B00G/R0001/Floor Coverings Res/Textile/S28				<b>No Asbestos Detected</b>	
<b>B00G - R0019 - External Movement (111.7 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Entrances awnings	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00G/R0015/Ceiling Structures/Linings/S4				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00G - R9001 - General Assistant/Bulk Store (31.69 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	2858/B00G/R9002/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	15m2	South facing, East facing	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	2858/B00G/R9002/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00G - R9002 - General Storeroom (12.69 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	2858/B00G/R9002/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	15m2	North facing, West facing	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	2858/B00G/R9002/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Pupil Facilities - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B001 - R0001 - Canteen (41.3 m2)**

No Asbestos

**B001 - R0002 - Canteen Office/Store (9.98 m2)**

No Asbestos

**B001 - R0003 - External Movement (52.91 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00J - General Learning - 1968 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting 2858/B00D/gable verge strip/S1	18m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Eaves Linings	Flat AC Sheeting 2858/B00F/Eaves Linings/S7	45m2	North facing, South facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior**

**B00J - R0002 - General Storeroom (5.39 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00J/R0002/Floor Coverings Res/Textile/S12	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		

**B00J - R0003 - Movement (6.36 m2)**

No Asbestos

**B00J - R0004 - General Storeroom (0.48 m2)**

No Asbestos

**B00J - R0005 - Cleaning Distributed Store (0.5 m2)**

No Asbestos

**B00J - R0006 - General Storeroom (1.05 m2)**

No Asbestos

**B00J - R0007 - Withdrawal Space - 1hb (13.84 m2)**

No Asbestos

**B00J - R0008 - Home Base (56.54 m2)**

No Asbestos

**B00J - R0010 - Movement (7.1 m2)**

No Asbestos

**B00J - R0011 - Personal Effects Storage (4.23 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00J/R0002/Floor Coverings Res/Textile/S12	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		

**B00J - R0012 - Home Base Store (6.12 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00J/R0002/Floor Coverings Res/Textile/S12	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		

**B00J - R0013 - Home Base Store (6.02 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00J/R0002/Floor Coverings Res/Textile/S12	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		

**B00J - R0014 - Personal Effects Storage (4.16 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 2858/B00J/R0002/Floor Coverings Res/Textile/S12	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		

**B00J - R0015 - Home Base (56.38 m2)**

No Asbestos

**B00J - R0016 - Home Base (56.85 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00J - R0018 - Movement (7.1 m2)</b>						
No Asbestos						
<b>B00J - R0019 - Personal Effects Storage (4.19 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2858/B00J/R0002/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00J - R0020 - Home Base Store (5.98 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2858/B00J/R0002/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00J - R0021 - General Storeroom (6.06 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2858/B00J/R0002/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00J - R0022 - Toilets - Boys/Girls (4.21 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
2858/B00J/R0002/Floor Coverings Res/Textile/S12					<b>Chrysotile (white asbestos)</b>	
<b>B00J - R0023 - Home Base (56.93 m2)</b>						
No Asbestos						
<b>B00J - R0024 - External Movement (95.46 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Entrance awnings	Good Condition (1)	Low (1)	Low Priority (2-3)
2858/B00G/R0015/Ceiling Structures/Linings/S4					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Communal Facilities - 2004 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior****B00K - R0001 - Raised Platform (64.13 m2)**

No Asbestos

**B00K - R0002 - Movement (35.75 m2)**

No Asbestos

**B00K - R0003 - Communal/Performance Store (24.35 m2)**

No Asbestos

**B00K - R0004 - Plant (0.5 m2)**

No Asbestos

**B00K - R0005 - Movement (4.56 m2)**

No Asbestos

**B00K - R0006 - P.E. Store (11.17 m2)**

No Asbestos

**B00K - R0007 - Toilets - Girls (26.41 m2)**

No Asbestos

**B00K - R0008 - Access Shower/Toilet (5.71 m2)**

No Asbestos

**B00K - R0010 - Communal Space (260.49 m2)**

No Asbestos

**B00K - R0011 - Communications Cupboard (1.9 m2)**

No Asbestos

**B00K - R0012 - Toilets - Boys (22.33 m2)**

No Asbestos

**B00K - R0013 - Staff Room (10.83 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00K - R0014 - Cleaning Distributed Store (4.25 m2)**

No Asbestos

**B00K - R0015 - Main Switch Board (1.18 m2)**

No Asbestos

**B00K - R0016 - Movement (5.5 m2)**

No Asbestos

**B00K - R0017 - Hall Chair Store (14.52 m2)**

No Asbestos

**B00K - R0018 - Movement (10.54 m2)**

No Asbestos

**B00K - R0019 - External Movement (135.37 m2)**

No Asbestos

**B00K - R0020 - Covered Outdoor Learning Area (244.18 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Library - 2004 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00L - R0001 - Reading Area (233.44 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00L - R0002 - Library Office/Workroom (24.95 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00L - R0003 - Communications Room (8.9 m2)**

No Asbestos

**B00L - R0004 - Security Store (19.68 m2)**

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

**B00L - R0005 - Distribution Board (1.1 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00L - R0006 - External Movement (84.99 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Other - After School Care - 2014 - Steel (Steel)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

**Interior**

**B00M - R0001 - External Movement (43.62 m2)**

No Asbestos

**B00M - R0002 - Movement (5.76 m2)**

No Asbestos

**B00M - R0003 - Other-After School Care (125.21 m2)**

No Asbestos

**B00M - R0004 - Clerical Office (7.84 m2)**

No Asbestos

**B00M - R0005 - Practical Activities (69.68 m2)**

No Asbestos

**B00M - R0006 - Kitchen - Pre (23.63 m2)**

No Asbestos

**B00M - R0007 - Toilets-Unisex (3.37 m2)**

No Asbestos

**B00M - R0008 - Toilets-Unisex (6.41 m2)**

No Asbestos

**B00M - R0009 - External Movement (2.43 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - Music/General Learning - - Steel (Steel)**

**Exterior**

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

**Interior**

**B00N - R0001 - Other (81.89 m2)**

No Asbestos

**B00N - R0002 - Movement (20.97 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D10319 - Learning Unit - Standard With P.A.A. : Placement Date - 11/06/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 603 - D12170 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 20/01/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 600 - D17422 - Learning Unit - Small : Placement Date - 7/03/2016**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - General Learning Space**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017