


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wakool Burraboi Public School (3336)
Region : Riverina
State Electorate : Murray
Local Government Area : Wakool

Initial Survey : Noel Arnold & Associates : 12 - May - 2008
Reviewed By : Grencap-NAA : 07 - Jul - 2016

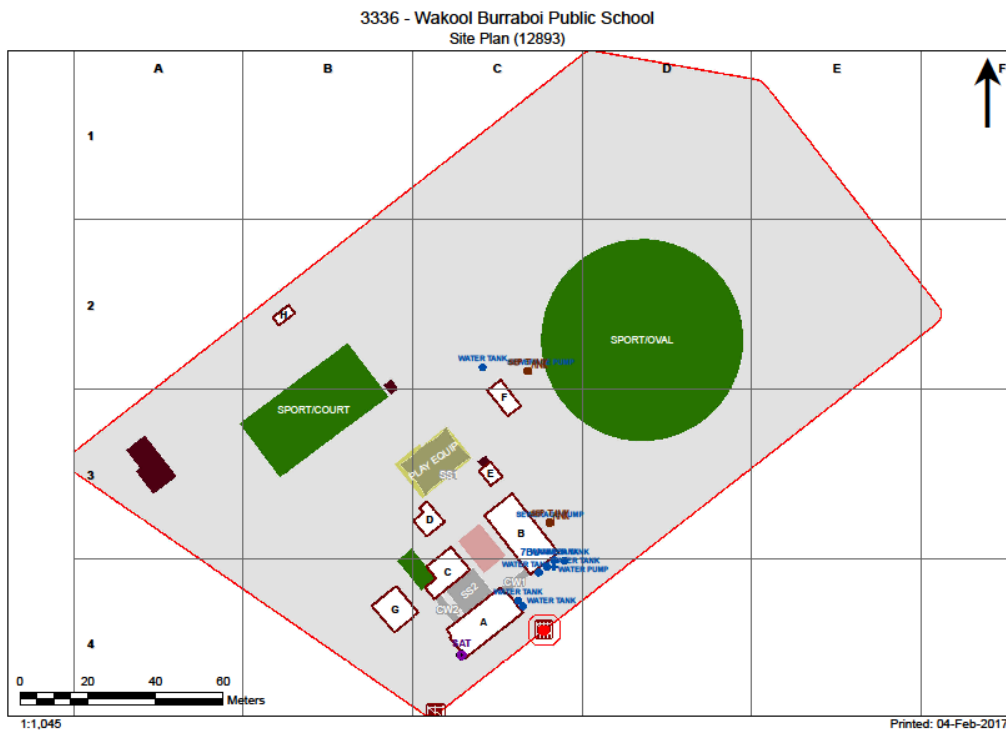

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1960 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3336/B00A/R0007/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0001 - Clerical Office**

No Asbestos

B00A - R0002 - Home Base

Wall Linings Internal	Flat AC Sheeting	2m2	South east corner	Good Condition (1)	Low (1)	Low Priority (2-3)
	3336/B00A/R0007/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B00A - R0003 - Home Base

Wall Linings Internal	Flat AC Sheeting	2m2	South west corner	Good Condition (1)	Low (1)	Low Priority (2-3)
	3336/B00A/R0007/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B00A - R0004 - Home Base Store

No Asbestos

B00A - R0005 - Staff Room Annexe

No Asbestos

B00A - R0006 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3336/B00A/R0007/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

B00A - R0007 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3336/B00A/R0007/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Compressed AC Sheet					
	3336/B00A/R0007/Floor Coverings Res/Textile/S8				No Asbestos Detected	

Wall Linings Internal	Flat AC Sheeting	3m2	East facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3336/B00A/R0007/Ceiling Structures/Linings/S1				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Staff Facilities/General Learning - 1960 - Brick/Block (Brick/Block)**Exterior**

Window In-fill-panel	Flat AC Sheeting	17m2	East facing, West facing	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3336/B00B/Window In-fill-panel/S9				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	10m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3336/B00B/R0005/Wall Linings Internal/S6				Chrysotile (white asbestos)	
Gable verge lining	Flat AC Sheeting	8m2	North facing, South facing	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3336/B00B/R0005/Wall Linings Internal/S6				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3336/B00B/R0001/Floor Coverings Res/Textile/S7				No Asbestos Detected	

B00B - R0002 - Toilets - Boys/Girls

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3336/B00B/R0005/Wall Linings Internal/S6				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3336/B00B/R0005/Wall Linings Internal/S6				Chrysotile (white asbestos)	

B00B - R0003 - Staff Toilet

Floor Coverings Res/Textile	Vinyl Tiles					
	3336/B00B/R0001/Floor Coverings Res/Textile/S7				No Asbestos Detected	

B00B - R0004 - Cleaning Supplies

No Asbestos

B00B - R0005 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	7m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3336/B00B/R0005/Wall Linings Internal/S6				Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3336/B00B/R0005/Wall Linings Internal/S6				Chrysotile (white asbestos)	

B00B - R0006 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	33m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3336/B00B/R0005/Wall Linings Internal/S6				Chrysotile (white asbestos)	

B00B - R0007 - Staff Room

No Asbestos

B00B - R0008 - Personal Effects Storage

No Asbestos

B00B - R0009 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	3336/B00B/R0001/Floor Coverings Res/Textile/S7				No Asbestos Detected	

B00B - R0010 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Library - 1935 - Timber (Timber)

Exterior

Ceiling Voids	Non Accessible Area - Height Restriction 4m height
Underfloor Voids	No Asbestos Found

Interior

B00C - R0001 - Reading Area

No Asbestos

B00C - R0002 - General Storeroom

Wall Linings Internal	Flat AC Sheeting 3336/B00C/R0002/Wall Linings Internal/S3	No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3336/B00C/R0002/Wall Linings Internal/S3	No Asbestos Detected

B00C - R0003 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting 3336/B00C/R0002/Wall Linings Internal/S3	No Asbestos Detected
----------------------------	--	-----------------------------

B00C - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Shed - 1960 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - Movement

No Asbestos

B00D - R0002 - General Storeroom

No Asbestos

B00D - R0003 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Shed - 1955 - Timber Shed (Timber Shed)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00E - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00F - Pupil Facilities - 1960 - Timber (Timber)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 3336/B00F/Eaves Linings/S4	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		
Wall Cladding	Compressed AC Sheet 3336/B00F/Entry dividing walls/S5	8m2	Entry Dividing Walls	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos)		
Ceiling Voids	Non Accessible Area - Area inaccessible					

Interior**B00F - R0001 - Toilets - Boys**

Wall Linings Internal	Flat AC Sheeting 3336/B00F/Eaves Linings/S4	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0002 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 3336/B00F/Eaves Linings/S4	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting 3336/B00F/Eaves Linings/S4	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00F - R0004 - Toilets - Girls

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00G - R0001 - Reading Area

No Asbestos

B00G - R0002 - K.L.A. Store

No Asbestos

B00G - R0003 - Practical Activities

No Asbestos

B00G - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground Non Accessible Area
 - Area inaccessible

Ceiling Voids No Asbestos Found

Interior

B00H - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017