


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Walbundrie Public School (3338)  
**Region :** Riverina  
**State Electorate :** Albury  
**Local Government Area :** Greater Hume

**Initial Survey :** Noel Arnold & Associates : 23 - Feb - 2008  
**Reviewed By :** Greencap-NAA : 07 - Jul - 2016

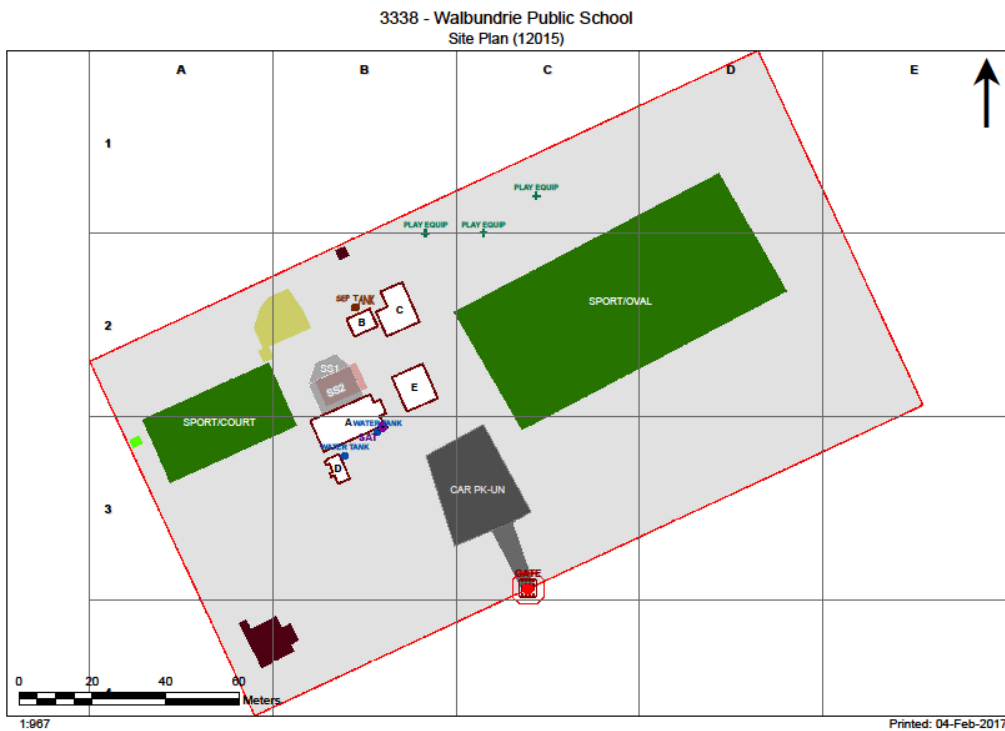

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Administration - 1925 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	10m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3338/B00A/R0006/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Wall Cladding	Flat AC Sheeting	30m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3338/B00A/Wall Cladding/S7				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

**Interior****B00A - R0001 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3338/B00A/R0001/Floor Coverings Res/Textile/S3				<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting				<b>No Asbestos Detected</b>	
	3338/B00A/R0001/Wall Linings Internal/S4					

**B00A - R0004 - Principal**

No Asbestos

**B00A - R0005 - Clerical Office**

No Asbestos

**B00A - R0006 - Staff Room**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3338/B00A/R0006/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting				<b>No Asbestos Detected</b>	
	3338/B00A/R0001/Wall Linings Internal/S4					

**B00A - R0007 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3338/B00A/R0006/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting				<b>No Asbestos Detected</b>	
	3338/B00A/R0001/Wall Linings Internal/S4					

**B00A - R0008 - Reading Area**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3338/B00A/R0006/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting				<b>No Asbestos Detected</b>	
	3338/B00A/R0001/Wall Linings Internal/S4					

**B00A - R0009 - Personal Effects Storage**

Wall Linings Internal	Flat AC Sheeting				<b>No Asbestos Detected</b>	
	3338/B00A/R0001/Wall Linings Internal/S4					
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3338/B00A/R0006/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

Floor panelling	Compressed AC Sheet				<b>No Asbestos Detected</b>	
	3338/B00A/R0009/Floor panelling/S5					

**B00A - R0010 - Movement**

Fascia panels	Flat AC Sheeting				<b>No Asbestos Detected</b>	
	3338/B00A/R0010/Fascia panels/S6					

**B00A - R0011 - Home Base/Practical Activities**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00A - R0012 - Clerical Office/Workroom**

No Asbestos

**B00A - R0013 - Sick Bay**

No Asbestos

**B00A - R0014 - Principal**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3338/B00A/R0001/Floor Coverings Res/Textile/S3					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Pupil Facilities - 1965 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3338/B00B/Eaves Linings/S13					<b>Chrysotile (white asbestos)</b>

**Interior**

**B00B - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3338/B00A/R0006/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00B - R0002 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3338/B00A/R0006/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00B - R0003 - Cleaning Supplies**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3338/B00A/R0006/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00B - R0004 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3338/B00A/R0006/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Special Purpose - 1984 - Timber (Timber)**

**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Wall Cladding	Flat AC Sheeting 3338/B00C/Wall Cladding/S8					<b>No Asbestos Detected</b>
Eaves Linings	Flat AC Sheeting 3338/B00C/Eaves Linings/S9					<b>No Asbestos Detected</b>

**Interior**

**B00C - R0001 - Movement**

No Asbestos

**B00C - R0002 - Special Programs Room**

No Asbestos

**B00C - R0003 - Sports Store**

No Asbestos

**B00C - R0004 - General Assistant/Bulk Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Library - 2000 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	5m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3338/B00D/Eaves Linings/S12					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00D - R0001 - Reading Area**

Wall Linings Internal	Flat AC Sheeting	60m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3338/B00D/R0001/Wall Linings Internal/S10					<b>Chrysotile (white asbestos)</b>
Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3338/B00D/R0001/Ceiling Structures/Linings/S11					<b>Chrysotile (white asbestos)</b>

**B00D - R0002 - Stairs**

No Asbestos

**B00D - R0003 - Stairs**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00E - R0001 - Home Base**

No Asbestos

**B00E - R0002 - Home Base Store**

No Asbestos

**B00E - R0003 - Practical Activities - 1hb**

No Asbestos

**B00E - R0004 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017