


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Walcha Central School (3340)
Region : New England
State Electorate : Tamworth
Local Government Area : Walcha

Initial Survey : Noel Arnold & Associates : 21 - Apr - 2008
Reviewed By : Greencap-NAA : 05 - May - 2016

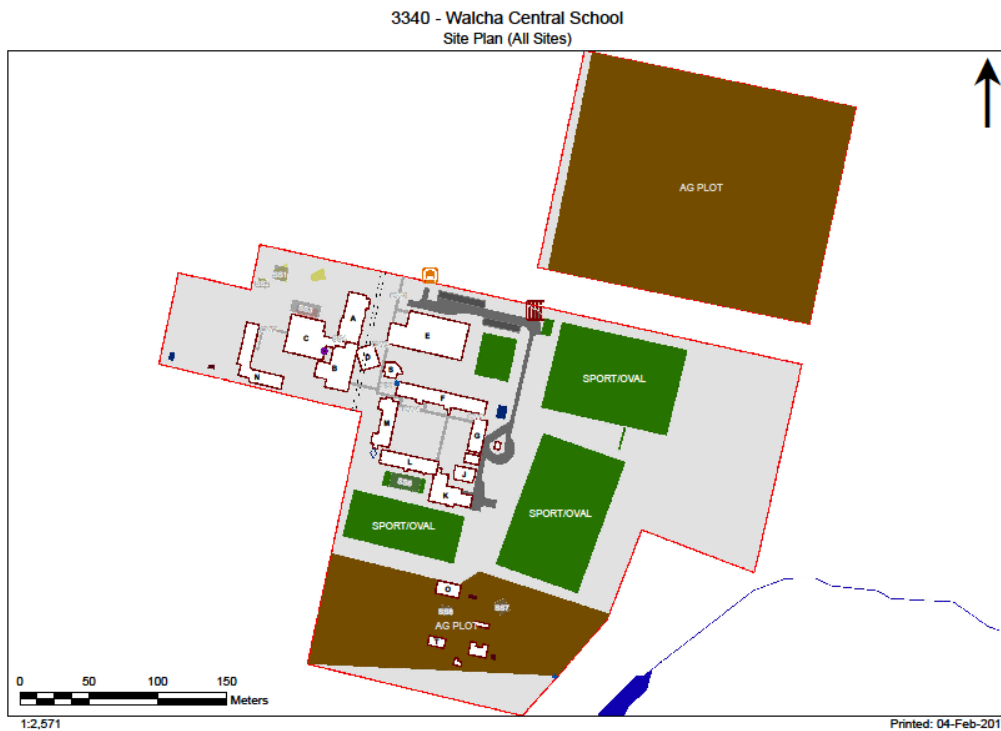

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No						Test Result

B00A - Administration/Staff Facilities - 1991 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 3340/B00A/Wall Cladding/S59					No Asbestos Detected

Interior

B00A - R0001 - Clerical Office (12.96 m2)

No Asbestos

B00A - R0002 - Public Entry (24.6 m2)

No Asbestos

B00A - R0003 - External Movement (20.52 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00A/R0003/Ceiling Structures/Linings/S15					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00A - R0004 - Teachers Aides (14.44 m2)

Undersink pad	Fibrous Membrane	1Unit	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00B/R0009/Undersink pad/S56					Chrysotile (white asbestos)

B00A - R0005 - Shower/Change (2.4 m2)

No Asbestos

B00A - R0006 - Toilets - Boys/Girls (3.95 m2)

No Asbestos

B00A - R0007 - Toilets - Boys/Girls (3.98 m2)

No Asbestos

B00A - R0008 - Community Clinic (14.44 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3340/B00G/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00A - R0009 - Interview (12.98 m2)

No Asbestos

B00A - R0010 - Staff Toilet (5.4 m2)

No Asbestos

B00A - R0011 - Cleaning Distributed Store (2.02 m2)

No Asbestos

B00A - R0012 - Staff Toilet (5.38 m2)

No Asbestos

B00A - R0013 - Staff Room Annexe (12.92 m2)

No Asbestos

B00A - R0014 - Deputy Principal (15.84 m2)

No Asbestos

B00A - R0015 - Pupil Entry (13.33 m2)

No Asbestos

B00A - R0016 - Staff Room Annexe (13.46 m2)

No Asbestos

B00A - R0017 - Staff Room (75.17 m2)

No Asbestos

B00A - R0018 - Staff Room Annexe (20.59 m2)

No Asbestos

B00A - R0019 - Plant (0.39 m2)

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0020 - Distribution Board (0.57 m2)	Note: No inspection of live electrical installation.
--	--

No Asbestos

B00A - R0021 - Security Store (16.67 m2)

No Asbestos

B00A - R0025 - Movement (56.16 m2)

No Asbestos

B00A - R0026 - External Movement (13.75 m2)
--

Ceiling Structures/Linings	Flat AC Sheeting					
		3340/B00A/R0003/Ceiling Structures/Linings/S15				No Asbestos Detected

B00A - R0028 - Principal (24.92 m2)
--

No Asbestos

B00A - R0029 - Clerical Office (50.8 m2)

No Asbestos

B00A - R0030 - Clerical/Printing (23.31 m2)
--

Floor Coverings	Vinyl Sheet					
Res/Textile		3340/B00G/R0003/Floor Coverings Res/Textile/S17				No Asbestos Detected

B00A - R0031 - Interview/Office - Type 1 (14.09 m2)
--

No Asbestos

B00A - R0032 - External Movement (20.22 m2)
--

Ceiling Structures/Linings	Flat AC Sheeting					
		3340/B00A/R0003/Ceiling Structures/Linings/S15				No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library/Building Services - 1991 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00B - R0001 - External Movement (116.21 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00B/R0001/Ceiling Structures/Linings/S58					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting 3340/B00B/R0001/Ceiling Structures/Linings/S58					No Asbestos Detected

B00B - R0002 - Librarian (11.35 m2)

No Asbestos

B00B - R0003 - Reading Area (262.89 m2)

No Asbestos

B00B - R0004 - Cleaning Distributed Store (2.81 m2)

No Asbestos

B00B - R0005 - Distribution Board (0.68 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0006 - Seminar/Study (13.06 m2)

No Asbestos

B00B - R0007 - Seminar/Study (12.58 m2)

No Asbestos

B00B - R0008 - General Assistant/Bulk Store (13.36 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3340/B00G/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00B - R0009 - Cleaning Supplies (16.9 m2)

Undersink pad	Fibrous Membrane	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00B/R0009/Undersink pad/S56					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Sheet 3340/B00G/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected
Adhesive for flooring	Adhesive 3340/B00B/R0009/Adhesive for flooring/S57					No Asbestos Detected

B00B - R0013 - Library Office/Workroom (26.12 m2)

No Asbestos

B00B - R0014 - Librarian (12.89 m2)

No Asbestos

B00B - R0015 - Security Store (23.22 m2)

No Asbestos

B00B - R0016 - Special Programs Room (106.38 m2)

No Asbestos

B00B - R0017 - External Movement (13.89 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00B/R0001/Ceiling Structures/Linings/S58					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Pupil Facilities - 1991 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 3340/B00C/Eaves Linings/S34					No Asbestos Detected

Interior

B00C - R0001 - Movement (182.59 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3340/B00G/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00C - R0002 - Personal Effects Storage (2.9 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0003 - Home Base Store (6.23 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0004 - Withdrawal Space - 1hb (5.93 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0005 - Home Base (60.99 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0006 - External Movement (30.82 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00C/Eaves Linings/S34					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00C - R0007 - Practical Activities - 1hb (18.3 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3340/B00G/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00C - R0008 - Practical Activities - 1hb (18.35 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3340/B00G/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00C - R0009 - Home Base (61.15 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0010 - Withdrawal Space - 1hb (12.74 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0011 - Home Base Store (6.21 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0012 - Personal Effects Storage (6.24 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3340/B00G/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00C - R0013 - Home Base Store (6.21 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0014 - Home Base (61.46 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0015 - Practical Activities - 1hb (18.3 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3340/B00G/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00C - R0016 - Personal Effects Storage (3.02 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00C - R0017 - Home Base Store (6.13 m2)

No Asbestos						
-------------	--	--	--	--	--	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00C - R0018 - Withdrawal Space - 1hb (6.26 m2)						
No Asbestos						
B00C - R0019 - Home Base (61.31 m2)						
No Asbestos						
B00C - R0020 - Practical Activities - 1hb (18.12 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
			3340/B00G/R0003/Floor Coverings Res/Textile/S17			No Asbestos Detected
B00C - R0021 - Practical Activities - 1hb (18.12 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
			3340/B00G/R0003/Floor Coverings Res/Textile/S17			No Asbestos Detected
B00C - R0022 - Home Base (61.07 m2)						
No Asbestos						
B00C - R0023 - Withdrawal Space - 1hb (6.21 m2)						
No Asbestos						
B00C - R0024 - Home Base Store (6.21 m2)						
No Asbestos						
B00C - R0025 - Personal Effects Storage (2.88 m2)						
No Asbestos						
B00C - R0026 - Toilets - Girls (21.26 m2)						
No Asbestos						
B00C - R0027 - Kiln Room (5.94 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					
			3340/B00G/R0003/Floor Coverings Res/Textile/S17			No Asbestos Detected
B00C - R0028 - Toilets - Boys (22.37 m2)						
No Asbestos						
B00C - R0029 - Distribution Board (0.65 m2)						
					Note: No inspection of live electrical installation.	
No Asbestos						
B00C - R0030 - Cleaning Distributed Store (3.43 m2)						
No Asbestos						
B00C - R0031 - External Movement (20.99 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
			3340/B00C/Eaves Linings/S34			No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Tiered Learning/General Learning - 1991 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling void	No Asbestos Found

Interior

B00D - R0001 - General Learning Space (41.66 m2)

No Asbestos

B00D - R0002 - Security Store (20.47 m2)

No Asbestos

B00D - R0003 - Distribution Board (0.61 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0004 - External Movement (2.25 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	3340/B00D/R0004/Ceiling Structures/Linings/S48					No Asbestos Detected

B00D - R0006 - Special Programs Room (79.46 m2)

No Asbestos

B00D - R0007 - Special Programs Store (2.38 m2)

No Asbestos

B00D - R0008 - External Movement (16.2 m2)

Ceiling Structures/Linings	Flat AC Sheeting					
	3340/B00D/R0004/Ceiling Structures/Linings/S48					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Communal Facilities/Pupil Facilities - 1988 - Brick/Block (Brick/Block)

Exterior

Ceiling void	Non Accessible Area - Height Restriction 5m
Underfloor void	No Asbestos Found

Interior

B00E - R0001 - External Movement (15.03 m2)

No Asbestos

B00E - R0002 - Movement (15.23 m2)

No Asbestos

B00E - R0003 - Movement (24.9 m2)

No Asbestos

B00E - R0004 - Raised Platform (98.92 m2)

No Asbestos

B00E - R0005 - Movement (15.41 m2)

No Asbestos

B00E - R0006 - External Movement (194.18 m2)

No Asbestos

B00E - R0007 - Plant (1.59 m2)

No Asbestos

B00E - R0008 - Shower/Change (39.21 m2)

No Asbestos

B00E - R0009 - Movement (10.04 m2)

No Asbestos

B00E - R0010 - Toilets - Boys (18.15 m2)

No Asbestos

B00E - R0011 - Disabled Toilet (5.41 m2)

Incinerette	Encapsulated Insulation material within unit	1Unit	North	Friable Asbestos (5)	Low (1)	High Priority (6-8)
Assumed Asbestos - Sealed unit						

B00E - R0012 - Toilets - Girls (24.88 m2)

Incinerette	Encapsulated Insulation material within unit	1Unit(s)	East, Middle portion	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Sealed unit						

B00E - R0013 - Movement (134.06 m2)

No Asbestos

B00E - R0014 - Staff Kitchen (9.84 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	3340/B00G/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected
Under sink pad	Fibrous Membrane					
	3340/B00E/R0014/Under sink pad/S35					No Asbestos Detected

B00E - R0015 - Canteen Office/Store (7.58 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	3340/B00G/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected

B00E - R0016 - Canteen Office/Store (5.92 m2)

Floor Coverings Res/Textile	Vinyl Sheet					
	3340/B00G/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected

B00E - R0017 - Canteen (34.08 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings Res/Textile	Vinyl Sheet					
	3340/B00G/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected

Undersink pad	Fibrous Membrane					
	3340/B00E/R0014/Under sink pad/S35					No Asbestos Detected

B00E - R0018 - External Movement (12.29 m2)

No Asbestos

B00E - R0019 - Toilets - Boys (16.34 m2)

No Asbestos

B00E - R0020 - Cleaning Distributed Store (2.4 m2)

No Asbestos

B00E - R0021 - Multi-Purpose Space (421.86 m2)

No Asbestos

B00E - R0022 - Hall Chair Store (61.15 m2)

No Asbestos

B00E - R0023 - Movement (11.92 m2)

No Asbestos

B00E - R0024 - Distribution Board (1.79 m2)

No Asbestos Note: No inspection of live electrical installation.

B00E - R0025 - External Movement (13.48 m2)

No Asbestos

B00E - R0026 - Sports Store (22.64 m2)

No Asbestos

B00E - R0027 - Shower/Change (43.55 m2)

No Asbestos

B00E - R0028 - Plant (1.63 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning/Science Learning - 1990 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South, East, West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00F/Eaves Linings/S49				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor void	No Asbestos Found					
Window putty	Putty					No Asbestos Detected
	3340/B00F/Window putty/S60					

Interior**B00F - R0001 - Computer Store (6.19 m2)**

No Asbestos

B00F - R0002 - Cleaning Distributed Store (6.46 m2)

Wall Linings Internal	Flat AC Sheeting	2m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00F/R0011/Wall Linings Internal/S50				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00F - R0003 - Computer Learning Space (67.32 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	3340/B00F/R0009/Floor Coverings Res/Textile/S1					

B00F - R0004 - General Learning Space (53.22 m2)

No Asbestos

B00F - R0005 - Staff Room Annexe (22.44 m2)

Ceiling Structures/Linings	Flat AC Sheeting	0.2m2	Manhole lid	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00F/R0005/Ceiling Structures/Linings/S53				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	3340/B00F/R0009/Floor Coverings Res/Textile/S1					

B00F - R0006 - General Learning Space (54.24 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	3340/B00F/R0009/Floor Coverings Res/Textile/S1					

B00F - R0007 - General Learning Space (52.99 m2)

No Asbestos

B00F - R0008 - General Learning Space (53.43 m2)

No Asbestos

B00F - R0009 - General Learning Space (52.48 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3340/B00F/R0009/Floor Coverings Res/Textile/S1					

B00F - R0010 - Preparation (28.57 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	3340/B00F/R0009/Floor Coverings Res/Textile/S1					

Wall Linings Internal	Flat AC Sheeting	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00F/R0011/Wall Linings Internal/S50				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00F - R0011 - Laboratory L.S. (100.59 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Wall Linings Internal	Flat AC Sheeting	2m2	Northeast	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00F/R0011/Wall Linings Internal/S50			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Electrical Backing Board	Resinous Board	0.1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00F/R0011/Electrical Backing Board/S51			Chrysotile (white asbestos)		
Heat-proof Mat	Flat AC Sheeting	20Unit	Variable positions	Friable Asbestos (5)	Medium (2)	Medium Priority (4-5)
	3340/B00F/R0011/Heat-proof Mat/S52			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles					
	3340/B00F/R0009/Floor Coverings Res/Textile/S1			No Asbestos Detected		
Floor Coverings Res/Textile	Vinyl Sheet					
	3340/B00N/R0010/Floor Coverings Res/Textile/S33			No Asbestos Detected		
B00F - R0012 - Movement (126.21 m2)						
No Asbestos						
B00F - R0013 - External Movement (2.75 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00F/R0014/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R0014 - External Movement (10.19 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00F/R0014/Ceiling Structures/Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
B00F - R9001 - Staff Kitchen (9.37 m2)						
No Asbestos						
B00F - R9002 - Staff Toilet (4.84 m2)						
No Asbestos						
B00F - R9003 - General Storeroom (11.18 m2)						
No Asbestos						
B00F - R9004 - General Storeroom (5.5 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	3340/B00F/R0009/Floor Coverings Res/Textile/S1			No Asbestos Detected		
Ceiling Structures/Linings	Flat AC Sheeting	0.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00F/R9005/Ceiling Structures/Linings/S54			Chrysotile (white asbestos)		
B00F - R9005 - General Learning Space (63.37 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	63m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00F/R9005/Ceiling Structures/Linings/S54			Chrysotile (white asbestos)		
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3340/B00F/R0009/Floor Coverings Res/Textile/S1			No Asbestos Detected		
B00F - R9006 - Senior Seminar (67.46 m2)						
Floor Coverings Res/Textile	Vinyl Tiles					
	3340/B00F/R0009/Floor Coverings Res/Textile/S1			No Asbestos Detected		
B00F - R9007 - General Storeroom (45.51 m2)						
No Asbestos						
B00F - R9008 - General Storeroom (96.98 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Stored item	Compressed AC Sheet	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
3340/B00F/R9008/Stored item/S55					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Art/Building Services - 1970 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Gable Verge Lining	Flat AC Sheeting	30m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00G/Gable Verge Lining/S16				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	100m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00G/R0008/Ceiling Structures/Linings/S11				Chrysotile (white asbestos)	
Ceiling Void	No Asbestos Found					

Interior**B00G - R0001 - Workshop (44.4 m2)**

Kiln	Encapsulated Insulation material within unit	1Unit	West	Friable Asbestos (5)	Low (1)	High Priority (6-8)
	Assumed Asbestos - Area inaccessible					

Skylight lining	Flat AC Sheeting					No Asbestos Detected
	3340/B00G/R0003/Skylight lining/S47					

B00G - R0002 - Distribution Board (0.61 m2)

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	0.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00G/R0008/Ceiling Structures/Linings/S11				Chrysotile (white asbestos)	

B00G - R0003 - Art Learning Space (76.11 m2)

Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	3340/B00G/R0003/Floor Coverings Res/Textile/S17					

Skylight lining	Flat AC Sheeting					No Asbestos Detected
	3340/B00G/R0003/Skylight lining/S47					

B00G - R0004 - Cleaning Distributed Store (3.08 m2)

No Asbestos

B00G - R0005 - Cleaning Supplies (14.84 m2)

Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
	3340/B00G/R0003/Floor Coverings Res/Textile/S17					

B00G - R0006 - Interview (23.49 m2)

No Asbestos

B00G - R0007 - Darkroom Space (5.71 m2)

No Asbestos

B00G - R0008 - External Movement (47.02 m2)

Ceiling Structures/Linings	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00G/R0008/Ceiling Structures/Linings/S11				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pupil Facilities - 1975 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting	30m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00H/Eaves Linings/S18					Chrysotile (white asbestos)

Interior

B00H - R0001 - Toilets - Girls (29.43 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00H/R0003/Partition Walls (Cubicles)/S9					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00H/R0003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)
Incinerette	Encapsulated Insulation material within unit	2Unit(s)	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Area inaccessible					

B00H - R0002 - Drinking Facilities (2.99 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00H/R0003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

B00H - R0003 - Toilets - Boys (29.73 m2)

Partition Walls (Cubicles)	Compressed AC Sheet	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00H/R0003/Partition Walls (Cubicles)/S9					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00H/R0003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Building Services - 1990 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B001 - R0001 - Garden Store (18.17 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Music - 1990 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	5m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00J/Eaves Linings/S45					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor void	No Asbestos Found					

Interior

B00J - R0001 - Music Store (17.81 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3340/B00J/R0001/Ceiling Structures/Linings/S46					

B00J - R0002 - Movement (30.44 m2)

Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00J/R0002/Ceiling Structures/Linings/S8					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00J - R0003 - Music Learning Space (89.58 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Tiered Learning/Mechanical Services - 1990 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Wall Cladding	Flat AC Sheeting 3340/B00K/Wall Cladding/S43					No Asbestos Detected

Interior

B00K - R0001 - Cleaning Distributed Store (7.02 m2)

No Asbestos

B00K - R0006 - Dust Extraction Space (7.05 m2)

No Asbestos

B00K - R0009 - Design L.S. (56.37 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3340/B00G/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00K - R0010 - Distribution Board (0.86 m2)

Note: No inspection of live electrical installation.

No Asbestos

B00K - R0011 - Covered Area (36.05 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00K/R0016/Ceiling Structures/Linings/S44					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

Stored item	Flat AC Sheeting 3340/B00K/Wall Cladding/S43					No Asbestos Detected
-------------	---	--	--	--	--	-----------------------------

B00K - R0012 - Welding Area (7.04 m2)

No Asbestos

B00K - R0013 - Materials Technology L.S. (166.24 m2)

No Asbestos

B00K - R0014 - Materials Store - Type 1 (7.48 m2)

No Asbestos

B00K - R0015 - Project Store - Type 1 (23.3 m2)

No Asbestos


B00K - R0016 - External Movement (44.56 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00K/R0016/Ceiling Structures/Linings/S44					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

Wall Linings Internal	Flat AC Sheeting 3340/B00K/R0016/Ceiling Structures/Linings/S44					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00K - R0017 - Outdoor Learning Space - Type 1 (75.29 m2)

Wall Linings Internal	Flat AC Sheeting 3340/B00K/Wall Cladding/S43					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

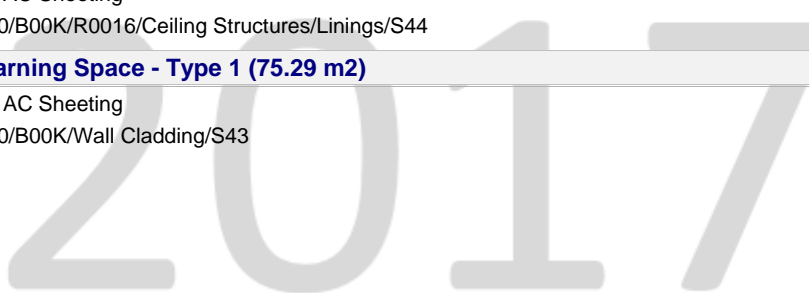

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - General Learning/Tiered Learning - 1959 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting 3340/B00L/Eaves Linings/S23	15m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)
Under floor void	AC Fragments/Debris 3340/B00L/Under floor void/S20	0.1m2	West	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
						Chrysotile (white asbestos)
Ceiling void	No Asbestos Found					

Interior**B00L - R0001 - Staff Room Annexe (22.24 m2)**

Wall Linings Internal	Flat AC Sheeting 3340/B00L/R0001/Wall Linings Internal/S21					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3340/B00L/R0001/Floor Coverings Res/Textile/S22					No Asbestos Detected

B00L - R0002 - External Movement (2.19 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00L/R0011/Ceiling Structures/Linings/S7	3m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00L - R0003 - General Learning Space (52.4 m2)

Wall Linings Internal	Flat AC Sheeting 3340/B00L/R0003/Wall Linings Internal/S19	2m2	Northeast	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00L - R0004 - General Learning Space (53.29 m2)

Wall Linings Internal	Flat AC Sheeting 3340/B00L/R0001/Wall Linings Internal/S21					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00L - R0005 - Design L.S. (45.33 m2)

Wall Linings Internal	Flat AC Sheeting 3340/B00L/R0001/Wall Linings Internal/S21					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00L - R0008 - Movement (44.77 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00L/R0011/Ceiling Structures/Linings/S7	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos) , Amosite (brown asbestos)

B00L - R0009 - External Movement (2.43 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00L/R0014/Ceiling Structures/Linings/S6					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00L - R0010 - External Movement (1.57 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00L/R0014/Ceiling Structures/Linings/S6					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00L - R0011 - Laundry (9.52 m2)

No Asbestos

B00L - R0014 - External Movement (2.13 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00L/R0014/Ceiling Structures/Linings/S6					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00L - R0015 - Movement (14.45 m2)

No Asbestos

B00L - R0016 - Plant (0.97 m2)

No Asbestos

B00L - R0017 - Kitchen - Pre (13.77 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

B00L - R0018 - Food Technology L.S. (84.46 m2)

No Asbestos

B00L - R0019 - Preparation - Materials (22.12 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Science/General Learning - 1959 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting 3340/B00M/Gable Verge Lining/S24	2.6m2	North, South, East, West, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting 3340/B00M/Eaves Linings/S28	40m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling void	Non Accessible Area - Height Restriction 3.2m					
Underfloor void	AC Fragments/Debris 3340/B00M/Underfloor void/S26					No Asbestos Detected

Interior**B00M - R0001 - Laboratory L.S. (94.48 m2)**

No Asbestos

B00M - R0002 - Apparatus Store (10.02 m2)

No Asbestos

B00M - R0003 - Preparation (29.21 m2)

Heat-proof Mat	Flat AC Sheeting 3340/B00M/R0003/Heat-proof Mat/S27					No Asbestos Detected
----------------	--	--	--	--	--	-----------------------------

B00M - R0004 - No Access (26.19 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3340/B00M/R0001/Floor Coverings Res/Textile/S4	26.1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	--------	------------	--------------------	---------	--

B00M - R0005 - Staff Room Annexe (26.49 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3340/B00M/R0001/Floor Coverings Res/Textile/S4	26.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	--------	------------	--------------------	---------	--

B00M - R0006 - General Learning Space (54.02 m2)

No Asbestos

B00M - R0007 - Movement (63.44 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3340/B00M/R0001/Floor Coverings Res/Textile/S4	63.4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	--------	------------	--------------------	---------	--

B00M - R0008 - Staff Toilet (5.29 m2)

Incinerette	Encapsulated Insulation material within unit Assumed Asbestos - Sealed unit	1Unit(s)	North, Middle portion	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
-------------	---	----------	-----------------------	----------------------	---------	--------------------

B00M - R0009 - Staff Toilet (5.19 m2)

No Asbestos

B00M - R0010 - Apparatus Store (20.3 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3340/B00M/R0001/Floor Coverings Res/Textile/S4	20.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	--------	------------	--------------------	---------	--

B00M - R0011 - External Movement (4.88 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00M/R0011/Ceiling Structures/Linings/S3					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00M - R0013 - Stairs (13.56 m2)

No Asbestos

B00M - R9001 - General Storeroom (18.26 m2)

No Asbestos

B00M - R9002 - Main Switch Board (7.36 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Electrical Mounting Board	Resinous Board 3340/B00M/R9002/Electrical Mounting Board/S25					No Asbestos Detected
Ceiling Structures/Linings	Vermiculite 3340/B00M/R9007/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Electrical Mounting Board	Resinous Board	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
B00M - R9003 - Study Space (18.29 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 3340/B00M/R0001/Floor Coverings Res/Textile/S4	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Structures/Linings	Vermiculite 3340/B00M/R9007/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
B00M - R9004 - General Storeroom (6.62 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 3340/B00M/R0001/Floor Coverings Res/Textile/S4	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00M - R9005 - Home Base Store (6.6 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 3340/B00M/R0001/Floor Coverings Res/Textile/S4	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00M - R9006 - Home Base (53.64 m2)						
Ceiling Structures/Linings	Vermiculite 3340/B00M/R9007/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3340/B00M/R0001/Floor Coverings Res/Textile/S4	53.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00M - R9007 - General Learning Space (53.64 m2)						
Ceiling Structures/Linings	Vermiculite 3340/B00M/R9007/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3340/B00M/R0001/Floor Coverings Res/Textile/S4	53.6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00M - R9008 - External Movement (7.78 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 3340/B00M/R0011/Ceiling Structures/Linings/S3					No Asbestos Detected
B00M - R9009 - Movement (49.38 m2)						
Ceiling Structures/Linings	Vermiculite 3340/B00M/R9007/Ceiling Structures/Linings/S5					Limited Samples Taken <i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3340/B00M/R0001/Floor Coverings Res/Textile/S4	49.3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00M - R9010 - Cleaning Distributed Store (5.26 m2)						
No Asbestos						
B00M - R9011 - General Storeroom (1.38 m2)						
No Asbestos						
B00M - R9012 - Stairs (5.73 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 3340/B00M/R0001/Floor Coverings Res/Textile/S4	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - General Learning/Pupil Facilities - 1970 - Timber (Timber)

Exterior

Wall Cladding	Flat AC Sheeting 3340/B00N/Wall Cladding/S12					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 3340/B00N/Eaves Linings/S30					No Asbestos Detected
Underfloor void	AC Fragments/Debris 3340/B00N/Underfloor void/S29					No Asbestos Detected
Ceiling void	No Asbestos Found					

Interior

B00N - R0001 - Home Base (60.9 m2)

No Asbestos

B00N - R0002 - General Storeroom (17.03 m2)

No Asbestos

B00N - R0003 - Practical Activities - 1hb (14.1 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3340/B00N/R0010/Floor Coverings Res/Textile/S33					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00N - R0004 - Home Base Store (5.95 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3340/B00N/R0010/Floor Coverings Res/Textile/S33					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00N - R0005 - Movement (25.52 m2)

No Asbestos

B00N - R0006 - Home Base (60.9 m2)

No Asbestos

B00N - R0007 - Practical Activities - 1hb (14.4 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3340/B00N/R0010/Floor Coverings Res/Textile/S33					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00N - R0008 - Home Base Store (6.09 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3340/B00N/R0010/Floor Coverings Res/Textile/S33					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00N - R0009 - Toilets - Boys (12.08 m2)

Wall Linings Internal	Flat AC Sheeting 3340/B00N/R0011/Wall Linings Internal/S32					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00N - R0010 - General Storeroom (12.92 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3340/B00N/R0010/Floor Coverings Res/Textile/S33					No Asbestos Detected
-----------------------------	--	--	--	--	--	----------------------

B00N - R0011 - Cleaning Distributed Store (3.54 m2)

Wall Linings Internal	Flat AC Sheeting 3340/B00N/R0011/Wall Linings Internal/S32					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Sheet 3340/B00N/R0010/Floor Coverings Res/Textile/S33					No Asbestos Detected

B00N - R0012 - Staff Toilet (2.49 m2)

Wall Linings Internal	Flat AC Sheeting 3340/B00N/R0011/Wall Linings Internal/S32					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

B00N - R0013 - Toilets - Girls (8.98 m2)

Wall Linings Internal	Flat AC Sheeting 3340/B00N/R0011/Wall Linings Internal/S32					No Asbestos Detected
-----------------------	---	--	--	--	--	----------------------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00N - R0014 - External Movement (27.63 m2)						
Floor	Compressed AC Sheet					No Asbestos Detected
		3340/B00N/R0014/Floor/S31				
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
		3340/B00N/Eaves Linings/S30				
B00N - R0015 - Practical Activities - 1hb (14.13 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
		3340/B00N/R0010/Floor Coverings Res/Textile/S33				
B00N - R0016 - Home Base Store (6.05 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
		3340/B00N/R0010/Floor Coverings Res/Textile/S33				
B00N - R0017 - Home Base (60.9 m2)						
No Asbestos						
B00N - R0018 - Practical Activities - 1hb (14.13 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
		3340/B00N/R0010/Floor Coverings Res/Textile/S33				
B00N - R0019 - Home Base Store (5.99 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
		3340/B00N/R0010/Floor Coverings Res/Textile/S33				
B00N - R0020 - Home Base (60.9 m2)						
No Asbestos						
B00N - R0021 - Special Programs Room (17.18 m2)						
No Asbestos						
B00N - R0022 - Movement (25.76 m2)						
Floor Coverings Res/Textile	Vinyl Sheet					No Asbestos Detected
		3340/B00N/R0010/Floor Coverings Res/Textile/S33				
B00N - R0023 - Sports Store (61.79 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B000 - Agricultural Science - 1988 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor void	No Asbestos Found

Interior

B000 - R0001 - Animal Space (87.7 m2)

No Asbestos

B000 - R0002 - Garden Store (69.37 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Agricultural Science - 1990 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00P - R0001 - Garden Store (30.9 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Agricultural Science - 1960 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 3340/B00Q/Eaves Linings/S40	6m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Wall Cladding	Flat AC Sheeting 3340/B00Q/Gable Ends/S41	2.4m2	Throughout, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Gable Ends	Flat AC Sheeting 3340/B00Q/Gable Ends/S41	4m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)

Interior**B00Q - R0001 - Plant Space (9.87 m2)**

No Asbestos

B00Q - R0002 - Shower/Change (7.5 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00Q/R0001/Ceiling Structures/Linings/S13	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet 3340/B00Q/R0002/Partition Walls (Cubicles)/S42	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00Q - R0003 - External Movement (3.86 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00Q/R0001/Ceiling Structures/Linings/S13	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	------------	--------------------	---------	--

B00Q - R0004 - Class Tools Storage (33.89 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00Q/R0001/Ceiling Structures/Linings/S13	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	------------	--------------------	---------	--

B00Q - R0005 - Class Tools Storage (9.56 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00Q/R0001/Ceiling Structures/Linings/S13	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	------------	--------------------	---------	--

B00Q - R0006 - External Movement (19.01 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00Q/R0001/Ceiling Structures/Linings/S13	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	------------	--------------------	---------	--

B00Q - R0007 - Plant Space (8.55 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3340/B00Q/R0001/Ceiling Structures/Linings/S13	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	------------	--------------------	---------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - Agricultural Science - 1990 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00R - R0001 - Animal Space (7.57 m2)

No Asbestos

B00R - R0002 - Animal Space (7.42 m2)

No Asbestos

B00R - R0003 - Animal Space (5.28 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5.2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3340/B00R/R0003/Ceiling Structures/Linings/S38				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	6m2	Upper portion	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3340/B00R/R0003/Wall Linings Internal/S39				Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - Pupil Facilities - 2000 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 3340/B00S/Eaves Linings/S36					No Asbestos Detected

Interior

B00S - R0001 - External Movement (58.05 m2)

No Asbestos

B00S - R0002 - Canteen (30.86 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3340/B00G/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00S - R0003 - Canteen Office/Store (21.57 m2)

Floor Coverings Res/Textile	Vinyl Sheet 3340/B00G/R0003/Floor Coverings Res/Textile/S17					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00T - Other - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00T - R0001 - Machine Storage (80.48 m2)

Stored item	Flat AC Sheeting 3340/B00T/R0001/Stored item/S37	No Asbestos Detected
-------------	---	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017