


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Walgett Community College - Public School (3342)
Region : Western NSW
State Electorate : Barwon
Local Government Area : Walgett

Initial Survey : Noel Arnold & Associates : 13 - May - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Aug - 2016

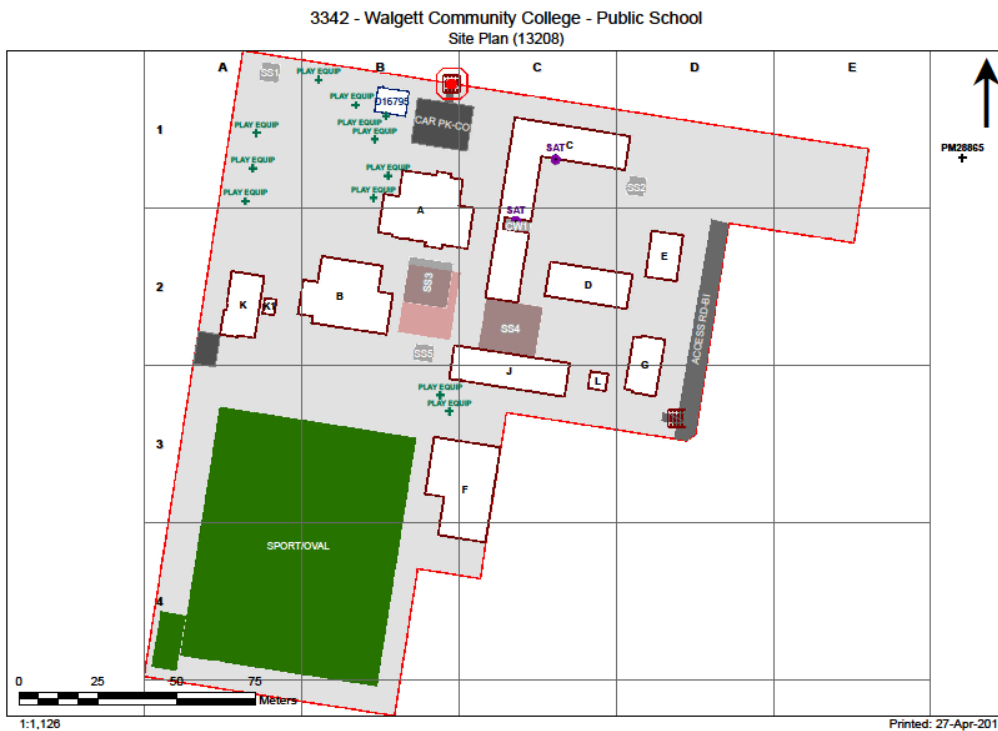

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Library/Administration - 1976 - Brick/Block (Brick/Block)

Exterior

In-fill-panel	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00A/In-fill-panel/S1					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Interview (15.73 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0002 - Staff Toilet (3.25 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0003 - Staff Toilet (10.53 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Incinerette	Encapsulated Insulation material within unit	1Unit(s)	East, Middle portion	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Encapsulated material within unit

B00A - R0004 - Staff Toilet (10.19 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0005 - Distribution Board (1.06 m2)

No Asbestos						Note: No inspection of live electrical installation.
-------------	--	--	--	--	--	--

B00A - R0009 - Movement (5.53 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00A - R0011 - General Storeroom (5.3 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00A - R0012 - Movement (31.35 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00A - R0016 - Security Store (12.65 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3342/B00C/R0018/Floor Coverings Res/Textile/S30					

B00A - R0017 - Interview (15.59 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0018 - Staff Room Annexe (11.83 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00A - R0019 - General Storeroom (1.31 m2)

No Asbestos						
-------------	--	--	--	--	--	--

B00A - R0020 - Staff Toilet (2.43 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00A - R0021 - Principal (15.32 m2)						
Ceiling Structures/Linings	Vermiculite					
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0026 - Movement (4.87 m2)						
No Asbestos						
B00A - R0027 - Movement (29 m2)						
No Asbestos						
B00A - R0028 - General Storeroom (5.41 m2)						
No Asbestos						
B00A - R0029 - Stairs (17.06 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00A/R1001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)
B00A - R0030 - Stairs (15.17 m2)						
No Asbestos						
B00A - R0031 - Entry Vestibule (13.12 m2)						
Ceiling Structures/Linings	Vermiculite					
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0032 - Movement (36.91 m2)						
Ceiling Structures/Linings	Vermiculite					
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0033 - Clerical Office/Workroom (32.67 m2)						
Ceiling Structures/Linings	Vermiculite					
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0034 - Clerical Office (17.87 m2)						
No Asbestos						
B00A - R0035 - Sick Bay (10.49 m2)						
No Asbestos						
B00A - R0036 - Movement (22.5 m2)						
Ceiling Structures/Linings	Vermiculite					
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0037 - Deputy Principal (17.81 m2)						
Ceiling Structures/Linings	Vermiculite					
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0038 - Clerical Office (11.17 m2)						
No Asbestos						
B00A - R0039 - Staff Room (76.44 m2)						
Ceiling Structures/Linings	Vermiculite					
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R0040 - Staff Kitchen (14.13 m2)						
Ceiling Structures/Linings	Vermiculite					
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
B00A - R1001 - Movement (16.68 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
---------	----------------------	--------	--------------------	--------------------	-------------	------------------

Sample No	Test Result
-----------	-------------

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00A/R1001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)		

B00A - R1002 - Distribution Board (1.18 m2) Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00A/R1001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)		

B00A - R1003 - Library Office/Workroom (12.53 m2)

No Asbestos

B00A - R1004 - Resource/Toy Space (11.96 m2)

No Asbestos

B00A - R1005 - Reading Area (123.18 m2)

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Encapsulated material within unit						

B00A - R1006 - Movement (54.93 m2)

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00A/R1001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)		

B00A - R1007 - Movement (16.53 m2)

No Asbestos

B00A - R1008 - Home Base (60.08 m2)

No Asbestos

B00A - R1009 - Practical Activities (13.36 m2)

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00A/R1009/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		

B00A - R1010 - Practical Activities (13.8 m2)

Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00A/R1009/Floor Coverings Res/Textile/S5				Chrysotile (white asbestos)		

B00A - R1011 - Home Base (45.18 m2)

No Asbestos

B00A - R1012 - Staff Room Annexe (3.23 m2)

No Asbestos

B00A - R1013 - Withdrawal - Pre (9.44 m2)


No Asbestos

B00A - R1014 - Stairs (3.04 m2)

No Asbestos

B00A - R1015 - Stairs (3.02 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00A/R1001/Ceiling Structures/Linings/S4				Chrysotile (white asbestos)		

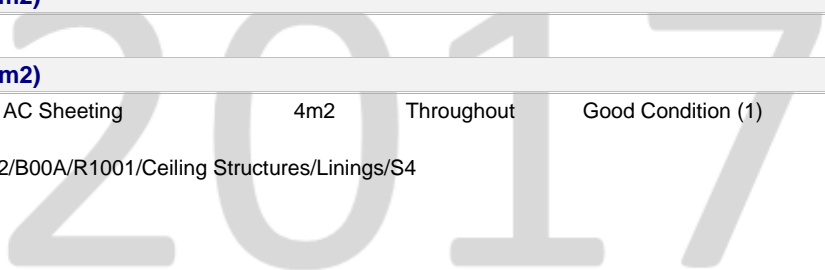

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00B - General Learning - 1976 - Brick/Block (Brick/Block)

Exterior

In-fill-panel	Flat AC Sheeting	48m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00A/In-fill-panel/S1					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00B - R0001 - Home Base (58.83 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0002 - Practical Activities - 1hb (13.69 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0003 - Movement (36.54 m2)

No Asbestos

B00B - R0004 - Sports Store (5.07 m2)

No Asbestos

B00B - R0005 - Practical Activities (13.69 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0006 - Home Base (59.71 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Encapsulated material within unit

B00B - R0007 - Home Base (59.88 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

Thermacon Heater	Encapsulated Insulation material within unit	2Unit	South	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
						Assumed Asbestos - Encapsulated material within unit

B00B - R0008 - Practical Activities (13.2 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0009 - Movement (27.56 m2)

No Asbestos

B00B - R0010 - General Storeroom (5.03 m2)

In-fill-panel	Flat AC Sheeting					No Asbestos Detected
	3342/B00B/R0010/In-fill-panel/S6					

B00B - R0011 - Movement (55.56 m2)

Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
	3342/B00A/R0025/Ceiling Structures/Linings/S2					Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works

B00B - R0012 - Home Base (59.12 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite 3342/B00A/R0025/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Thermacon Heater	Encapsulated Insulation material within unit	1Unit	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3) Assumed Asbestos - Encapsulated material within unit
B00B - R0013 - Practical Activities - 1hb (13.69 m2)						
Ceiling Structures/Linings	Vermiculite 3342/B00A/R0025/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
Floor Coverings Res/Textile	Vinyl Tiles 3342/B00A/R0025/Floor Coverings Res/Textile/S3	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0014 - Distribution Board (0.77 m2)					Note: No inspection of live electrical installation.	
No Asbestos						
B00B - R0015 - Stairs (10.83 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 3342/B00A/R1001/Ceiling Structures/Linings/S4	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R0016 - Stairs (10.83 m2)						
No Asbestos						
B00B - R1001 - Movement (16.36 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 3342/B00A/R1001/Ceiling Structures/Linings/S4	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1002 - Practical Activities - 1hb (24.26 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 3342/B00A/R1009/Floor Coverings Res/Textile/S5	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1003 - Home Base (49.12 m2)						
Thermacon Heater	Encapsulated Insulation material within unit	4Unit	North, South	Friable Asbestos (5)	Low (1)	Low Priority (2-3) Assumed Asbestos - Encapsulated material within units
B00B - R1004 - Home Base (49.01 m2)						
No Asbestos						
B00B - R1005 - Practical Activities (23.58 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 3342/B00A/R1009/Floor Coverings Res/Textile/S5	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1006 - Movement (16.69 m2)						
No Asbestos						
B00B - R1007 - Movement (56.37 m2)						
Ceiling Structures/Linings	Flat AC Sheeting 3342/B00A/R1001/Ceiling Structures/Linings/S4	15m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1008 - Home Base (59.2 m2)						
No Asbestos						
B00B - R1009 - Practical Activities - 1hb (13.12 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 3342/B00A/R1009/Floor Coverings Res/Textile/S5	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00B - R1010 - Distribution Board (0.75 m2)					Note: No inspection of live electrical installation.	
Ceiling Structures/Linings	Flat AC Sheeting 3342/B00B/R1010/Ceiling Structures/Linings/S13	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R1011 - Practical Activities - 1hb (13.02 m2)						
Floor Coverings Res/Textile	Vinyl Tiles	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00A/R1009/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	
B00B - R1012 - Home Base (59.2 m2)						
No Asbestos						
B00B - R1013 - Stairs (5.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00A/R1001/Ceiling Structures/Linings/S4					Chrysotile (white asbestos)	
B00B - R1014 - Stairs (4.86 m2)						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Other - 1976 - Brick/Veneer (Brick/Veneer)

Exterior

In-fill-panel	Flat AC Sheeting 3342/B00A/In-fill-panel/S1	68m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting 3342/B00C/Gable Verge Lining/S22	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting 3342/B00C/Eaves Linings/S19	80m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting 3342/B00C/Eaves Linings/S19	80m2	East	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Void	AC Fragments/Debris 3342/B00C/Ceiling Void/S29	1m2	Variable positions	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
Underfloor Void	No Asbestos Found					

Interior

B00C - R0001 - General Storeroom (100.84 m2)

No Asbestos

B00C - R0002 - Staff Toilet (3.05 m2)

No Asbestos

B00C - R0003 - Movement (162.9 m2)

Ceiling Structures/Linings	Flat AC Sheeting 3342/B00C/R0003/Ceiling Structures/Linings/S12	163m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-------	------------	--------------------	---------	--

B00C - R0004 - Home Base (11.24 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3342/B00C/R0018/Floor Coverings Res/Textile/S30					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00C - R0005 - Clerical Office/Workroom (59 m2)

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3342/B00C/R0018/Floor Coverings Res/Textile/S30					No Asbestos Detected
-----------------------------	--	--	--	--	--	-----------------------------

B00C - R0006 - Movement (6.94 m2)

Floor Coverings Res/Textile	Vinyl Tiles 3342/B00A/R0025/Floor Coverings Res/Textile/S3	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	------------	--------------------	---------	--

B00C - R0007 - Distribution Board (0.9 m2)

Note: No inspection of live electrical installation.

Electrical Backing Board	Resinous Board 3342/B00C/R0007/Electrical Backing Board/S31	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
--------------------------	--	-------	-------	--------------------	---------	--

Wall Linings Internal	Flat AC Sheeting 3342/B00J/R0005/Wall Linings Internal/S9 No Asbestos Detected					
-----------------------	---	--	--	--	--	--

Ceiling Structures/Linings	Flat AC Sheeting 3342/B00C/R0007/Ceiling Structures/Linings/S15	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	-----	------------	--------------------	---------	--

Floor Coverings Res/Textile	Vinyl Tiles 3342/B00A/R0025/Floor Coverings Res/Textile/S3	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------------	---	-----	------------	--------------------	---------	--

Ceiling Structures/Linings	AC Fragments/Debris 3342/B00C/R0007/Ceiling Structures/Linings/S26	1m2	Floor throughout	Poor Condition - Extensive Damage (4)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos)
----------------------------	---	-----	------------------	---------------------------------------	---------	---

3342 Walgett Community College - Public School

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0008 - Distribution Board (0.87 m2)				Note: No inspection of live electrical installation.		
Wall Linings Internal	Flat AC Sheeting 3342/B00J/R0005/Wall Linings Internal/S9					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles 3342/B00A/R0025/Floor Coverings Res/Textile/S3	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0009 - General Storeroom (4.11 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 3342/B00C/R0018/Floor Coverings Res/Textile/S30					No Asbestos Detected
B00C - R0010 - Other-Community Use (56.48 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 3342/B00A/R0025/Floor Coverings Res/Textile/S3	57m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0011 - Home Base (85.32 m2)				No Asbestos		
B00C - R0012 - Toilets-Unisex (3.89 m2)				No Asbestos		
B00C - R0013 - Home Base Store (2.28 m2)				No Asbestos		
B00C - R0014 - Personal Effects Storage (6.98 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 3342/B00A/R0025/Floor Coverings Res/Textile/S3	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
B00C - R0015 - Home Base (85.48 m2)						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3342/B00C/R0018/Floor Coverings Res/Textile/S30					No Asbestos Detected
B00C - R0016 - Toilets-Unisex (3.2 m2)				No Asbestos		
B00C - R0017 - Home Base Store (3.59 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 3342/B00C/R0018/Floor Coverings Res/Textile/S30					No Asbestos Detected
B00C - R0018 - Distribution Board (0.67 m2)				Note: No inspection of live electrical installation.		
Door Linings	Flat AC Sheeting 3342/B00C/R0018/Door Linings/S27	4m2	South	Minimal Damage (2)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 3342/B00C/R0018/Floor Coverings Res/Textile/S30					No Asbestos Detected
B00C - R0019 - Personal Effects Storage (11.82 m2)						
Manhole in Ceiling	Flat AC Sheeting 3342/B00C/R0019/Manhole in Ceiling/S28	1m2	Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 3342/B00C/R0018/Floor Coverings Res/Textile/S30					No Asbestos Detected
B00C - R0020 - General Storeroom (6.97 m2)						
Floor Coverings Res/Textile	Vinyl Tiles 3342/B00C/R0018/Floor Coverings Res/Textile/S30					No Asbestos Detected
B00C - R0021 - Home Base (56.89 m2)				No Asbestos		
B00C - R0022 - Movement (103.55 m2)						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	104m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00C/R0003/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Building Services - 1950 - Brick/Block (Brick/Block)**Exterior**

In-fill-panel	Flat AC Sheeting 3342/B00A/In-fill-panel/S1	20m2	North, South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting 3342/B00D/Gable Verge Lining/S23	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior**B00D - R0001 - Movement (49.7 m2)**

No Asbestos

B00D - R0002 - Movement (7.64 m2)

No Asbestos

B00D - R0003 - Cleaning Supplies (13.57 m2)

No Asbestos

B00D - R0004 - General Storeroom (2.41 m2)

No Asbestos

B00D - R0005 - Toilets - Boys (37.3 m2)

Ceiling Structures/Linings	Vermiculite 3342/B00A/R0025/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

Partition Walls (Cubicles)	Compressed AC Sheet 3342/B00J/R0002/Partition Walls (Cubicles)/S8	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	------------	--------------------	---------	--

B00D - R0006 - Toilets - Girls (46.66 m2)

Ceiling Structures/Linings	Vermiculite 3342/B00A/R0025/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

Partition Walls (Cubicles)	Compressed AC Sheet 3342/B00J/R0002/Partition Walls (Cubicles)/S8	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
----------------------------	--	------	------------	--------------------	---------	--

B00D - R0007 - General Assistant/Bulk Store (35.88 m2)

Ceiling Structures/Linings	Vermiculite 3342/B00A/R0025/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

B00D - R0008 - Movement (10.74 m2)

No Asbestos

B00D - R0009 - Craft Store (13.32 m2)

No Asbestos

B00D - R0010 - Sports Store (28.48 m2)

Ceiling Structures/Linings	Vermiculite 3342/B00A/R0025/Ceiling Structures/Linings/S2					Limited Samples Taken Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works
----------------------------	--	--	--	--	--	---

Wall Linings Internal	Flat AC Sheeting 3342/B00D/R0010/Wall Linings Internal/S11					No Asbestos Detected
-----------------------	---	--	--	--	--	-----------------------------

B00D - R0011 - Stairs (4.52 m2)

No Asbestos

B00D - R0012 - Stairs (4.52 m2)

No Asbestos

B00D - R1001 - Movement (80.01 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00J/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
B00D - R1002 - Special Programs Room (7.82 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00J/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
B00D - R1003 - Home Base (59.2 m2)						
No Asbestos						
B00D - R1004 - Home Base Store (7.36 m2)						
No Asbestos						
B00D - R1005 - Personal Effects Storage (14 m2)						
No Asbestos						
B00D - R1006 - Home Base Store (7.36 m2)						
No Asbestos						
B00D - R1007 - Home Base (59.27 m2)						
No Asbestos						
B00D - R1008 - General Storeroom (6.9 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00J/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
B00D - R1009 - Distribution Board (0.66 m2)				Note: No inspection of live electrical installation.		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00J/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
B00D - R1010 - Stairs (5.75 m2)						
No Asbestos						
B00D - R1011 - Stairs (5.64 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00J/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Other-Regional Use - 1976 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00E - R0001 - General Storeroom (52.59 m2)

No Asbestos

B00E - R0002 - General Storeroom (6.89 m2)

No Asbestos

B00E - R0003 - General Storeroom (52.52 m2)

No Asbestos

B00E - R0004 - Movement (26.48 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Shed - 1976 - Steel (Steel)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior

B00F - R0002 - Movement (109.91 m2)

No Asbestos

B00F - R0003 - Communal Space (357.54 m2)

No Asbestos

B00F - R0004 - General Storeroom (89.14 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1976 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00G/Eaves Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00G/Eaves Linings/S20				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00G - R0001 - General Storeroom (53.33 m2)

No Asbestos

B00G - R0002 - Communal Space (53.51 m2)

No Asbestos

B00G - R0003 - Practical Activities (10.82 m2)

No Asbestos

B00G - R0004 - Practical Activities (11.19 m2)

No Asbestos

B00G - R0005 - Movement (38.33 m2)

Ceiling Structures/Linings	Flat AC Sheeting	39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00G/R0005/Ceiling Structures/Linings/S10				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	3342/B00J/R0005/Wall Linings Internal/S9					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00J - Pupil Facilities - 1976 - Brick/Block (Brick/Block)						
Exterior						
Eaves Linings	Flat AC Sheeting	80m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00C/Eaves Linings/S19					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					
Interior						
B00J - R0001 - Movement (83.28 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	84m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00J/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
B00J - R0002 - Toilets - Boys (49.91 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00J/R0002/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	50m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00J/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
B00J - R0003 - Cleaning Distributed Store (2.16 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00J/R0003/Ceiling Structures/Linings/S24					Chrysotile (white asbestos)
B00J - R0004 - Shower/Change (24.09 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00J/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
B00J - R0005 - Toilets-Unisex (6.01 m2)						
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	3342/B00J/R0005/Wall Linings Internal/S9					
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00J/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
B00J - R0006 - General Storeroom (5.69 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00J/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
B00J - R0007 - Cleaning Distributed Store (1.55 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00J/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
B00J - R0008 - Distribution Board (0.69 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00J/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
B00J - R0009 - Shower/Change (35.71 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00J/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
B00J - R0010 - Toilets - Girls (44.49 m2)						
Partition Walls (Cubicles)	Compressed AC Sheet	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3342/B00J/R0002/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00J/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
B00J - R0011 - Cleaning Distributed Store (2.2 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00J/R0003/Ceiling Structures/Linings/S24					Chrysotile (white asbestos)	
B00J - R0012 - Movement (72.86 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00J/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)	
B00J - R0013 - Staff Toilet (5.45 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00J/R0013/Ceiling Structures/Linings/S25					Chrysotile (white asbestos)	
B00J - R0014 - Canteen Office/Store (3 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00J/R0013/Ceiling Structures/Linings/S25					Chrysotile (white asbestos)	
B00J - R0015 - Canteen (24.92 m2)						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3342/B00J/R0013/Ceiling Structures/Linings/S25					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pre-School Facilities - 1999 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00K - R0001 - Movement (13.14 m2)

No Asbestos

B00K - R0002 - Toilets-Unisex (12.18 m2)

No Asbestos

B00K - R0003 - Home Base Store - P (8.78 m2)

No Asbestos

B00K - R0004 - Staff Toilet (3.99 m2)

No Asbestos

B00K - R0005 - Home Base - Pre (67.92 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0006 - Covered Outdoor Learning Area (55.57 m2)

No Asbestos

B00K - R0008 - Kitchen - Pre (8.28 m2)

No Asbestos

B00K - R0009 - Clerical Office - Pre (10.23 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0010 - Staff Room - Pre (9.14 m2)

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00K - R0012 - Laundry - Pre (6.54 m2)

No Asbestos

B00K - R0013 - Movement (3.16 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Building Services - 2007 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00L - R0001 - General Assistant/Bulk Store (28.68 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B0K1 - Pre-School Facilities - 1999 - Brick Shed (Brick Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 3342/B0K1/Eaves Linings/S21					No Asbestos Detected

Interior

B0K1 - R0001 - Home Base Store (15.92 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 523 - D16795 - Staff Study With Toilets : Placement Date - 8/12/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Entry

No Asbestos Found.

R2 - Staff Room

No Asbestos Found.

R3 - Staff Toilet

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017