


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Wallacia Public School (3346)  
**Region :** Western Sydney  
**State Electorate :** Mulgoa  
**Local Government Area :** Penrith

**Initial Survey :** Noel Arnold & Associates : 12 - Jun - 2008  
**Reviewed By :** Parsons Brinckerhoff : 21 - Nov - 2016

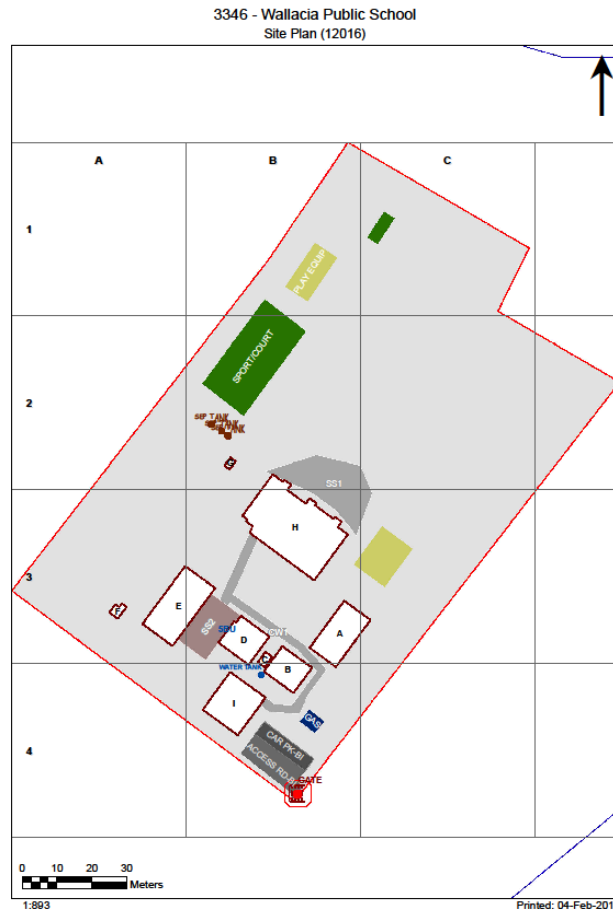

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Staff Facilities - 1980 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	6m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3346/B00A/Eaves Linings/S7					<b>Chrysotile (white asbestos)</b>
Ceiling Void	No Asbestos Found					

**Interior**

**B00A - R0001 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles					
	3346/B00A/R0001/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>

**B00A - R0002 - Entry Vestibule**

Floor Coverings Res/Textile	Vinyl Tiles					
	3346/B00A/R0001/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>

**B00A - R0003 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3346/B00A/R0015/Ceiling Structures/Linings/S1					<b>Chrysotile (White asbestos) , Amosite (Brown asbestos)</b>

**B00A - R0004 - Clerical Office**

No Asbestos

**B00A - R0005 - Staff Room**

Floor Coverings Res/Textile	Vinyl Tiles					
	3346/B00A/R0001/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>

**B00A - R0006 - Duplicating Workroom**

No Asbestos

**B00A - R0007 - Cleaning Distributed Store**

No Asbestos

**B00A - R0008 - Staff Toilet**

No Asbestos

**B00A - R0009 - Staff Toilet**

No Asbestos

**B00A - R0010 - Clerical Office**

Floor Coverings Res/Textile	Vinyl Tiles					
	3346/B00A/R0001/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>

**B00A - R0011 - Movement**

Floor Coverings Res/Textile	Vinyl Tiles					
	3346/B00A/R0001/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>

**B00A - R0012 - Movement**

Floor Coverings Res/Textile	Vinyl Tiles					
	3346/B00A/R0001/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>

**B00A - R0013 - Principal**

No Asbestos

**B00A - R0014 - Main Switch Board**

Ceiling Structures/Linings	Flat AC Sheeting					
	3346/B00A/R0014/Ceiling Structures/Linings/S12					<b>No Asbestos Detected</b>
Electrical Backing Board	Resinous Board	2Unit	South	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3346/B00A/R0014/Electrical Backing Board/S16					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0015 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3346/B00A/R0015/Ceiling Structures/Linings/S1				<b>Chrysotile (White asbestos) , Amosite (Brown asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1928 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting 3346/B00B/Eaves Linings/S8	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Underfloor Voids	Flat AC Sheeting 3346/B00B/Underfloor Voids/S11	1m2	Throughout	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Ceiling Void	No Asbestos Found					

**Interior**

**B00B - R0001 - Movement**

No Asbestos

**B00B - R0002 - Withdrawal Space - 1hb**

No Asbestos

**B00B - R0003 - Home Base**

No Asbestos

**B00B - R0004 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Building Services - 1975 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

**Interior**

**B00C - R0001 - Garden Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1950 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3346/B00B/Eaves Linings/S8					<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00D - R0001 - Community Clinic**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3346/B00A/R0015/Ceiling Structures/Linings/S1					<b>Chrysotile (White asbestos) , Amosite (Brown asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles					<b>No Asbestos Detected</b>
	3346/B00A/R0001/Floor Coverings Res/Textile/S3					

**B00D - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3346/B00A/R0015/Ceiling Structures/Linings/S1					<b>Chrysotile (White asbestos) , Amosite (Brown asbestos)</b>

**B00D - R0003 - Withdrawal Space - 1hb**

No Asbestos

**B00D - R0004 - Home Base Store**

No Asbestos

**B00D - R0005 - Home Base**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning/Pupil Facilities - 1965 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting	12m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3346/B00E/Eaves Linings/S9					<b>Chrysotile (white asbestos)</b>
In-fill-panel	Compressed AC Sheet					<b>No Asbestos Detected</b>
	3346/B00E/In-fill-panel/S4					
Ceiling Void	No Asbestos Found					
Underfloor Voids	Paper to concrete ceiling					<b>No Asbestos Detected</b>
	3346/B00E/Underfloor Voids/S17					

**Interior****B00E - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3346/B00E/R0001/Ceiling Structures/Linings/S5					<b>Chrysotile (White asbestos)</b>

**B00E - R0002 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3346/B00E/R0002/Partition Walls (Cubicles)/S2					<b>Chrysotile (White asbestos)</b>

**B00E - R0003 - Toilets - Girls**

Partition Walls (Cubicles)	Compressed AC Sheet	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3346/B00E/R0002/Partition Walls (Cubicles)/S2					<b>Chrysotile (White asbestos)</b>

**B00E - R0004 - Home Base**

No Asbestos

**B00E - R0005 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3346/B00E/R0005/Floor Coverings Res/Textile/S6					<b>Chrysotile (White asbestos)</b>

**B00E - R0006 - Toilets - Boys/Girls**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Pupil Facilities - 1965 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Void	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	1m2	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3346/B00F/Eaves Linings/S10			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Infill Panel	Flat AC Sheeting	1m2	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3346/B00F/Infill Panel/S15			<b>Chrysotile (white asbestos)</b>		

**Interior**

**B00F - R0001 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3346/B00F/R0001/Ceiling Structures/Linings/S13			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Building Services - 1988 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00G - R0001 - General Assistant/Bulk Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning/Pupil Facilities - 1980 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

**Interior**

**B00H - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3346/B00A/R0015/Ceiling Structures/Linings/S1				<b>Chrysotile (White asbestos) , Amosite (Brown asbestos)</b>		

**B00H - R0002 - Home Base**

No Asbestos

**B00H - R0004 - Home Base Store**

No Asbestos

**B00H - R0005 - Withdrawal Space - 1hb**

No Asbestos

**B00H - R0006 - Home Base Store**

No Asbestos

**B00H - R0007 - Home Base**

No Asbestos

**B00H - R0008 - Sports Store**

No Asbestos

**B00H - R0009 - Canteen**

No Asbestos

**B00H - R0010 - Canteen Office/Store**

No Asbestos

**B00H - R0013 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3346/B00A/R0015/Ceiling Structures/Linings/S1				<b>Chrysotile (White asbestos) , Amosite (Brown asbestos)</b>		

**B00H - R0014 - Home Base**

No Asbestos

**B00H - R0016 - Home Base Store**

No Asbestos

**B00H - R0017 - Withdrawal Space - 1hb**

No Asbestos

**B00H - R0018 - Practical Activities - 1hb**

No Asbestos

**B00H - R0019 - Craft Store**

No Asbestos

**B00H - R0020 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	30m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
3346/B00H/R0020/Ceiling Structures/Linings/S14				<b>Chrysotile (white asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Library - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00I - R0001 - External Movement**

No Asbestos

**B00I - R0002 - Reading Area**

No Asbestos

**B00I - R0003 - K.L.A. Store**

No Asbestos

**B00I - R0004 - Library Office/Workroom**

No Asbestos

**B00I - R0005 - Communications Room**

No Asbestos

**B00I - R0006 - Toilets-Unisex**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017