


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Walla Walla Public School (3352)  
**Region :** Riverina  
**State Electorate :** Albury  
**Local Government Area :** Greater Hume

**Initial Survey :** Noel Arnold & Associates : 23 - Feb - 2008  
**Reviewed By :** Grencap-NAA : 07 - Jul - 2016

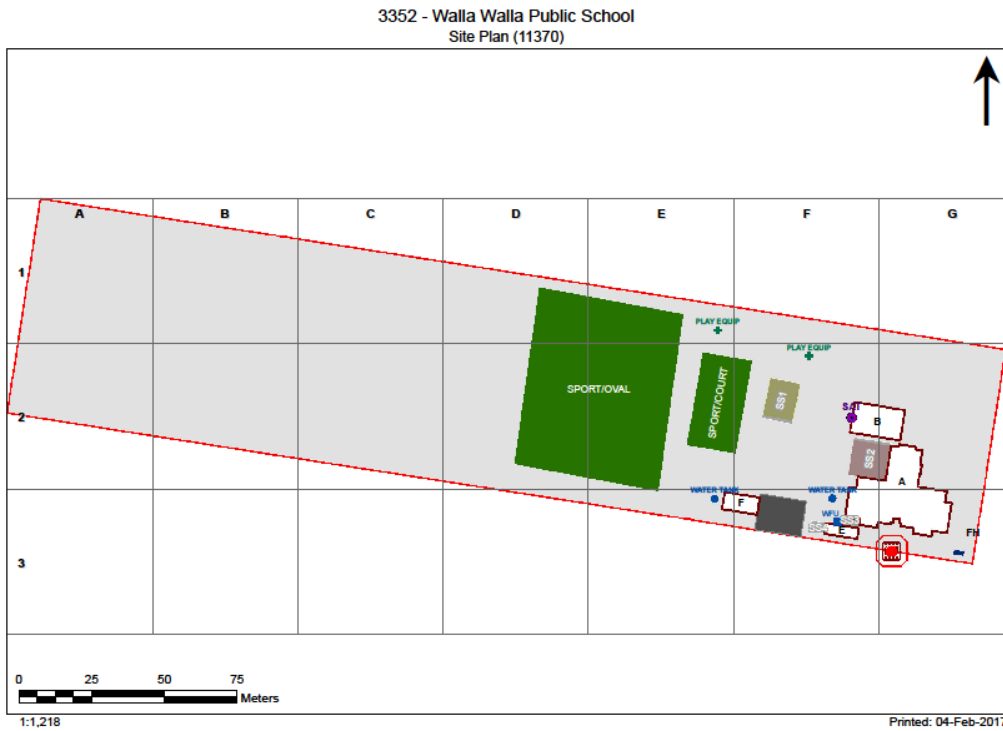

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/General Learning - 1985 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids	No Asbestos Found					
Columns	Fibre Cement Pipe 3352/B00A/Columns/S12	36m	West	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior**

**B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 3352/B00A/R0029/Ceiling Structures/Linings/S1					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

**B00A - R0002 - Clerical Office**

No Asbestos

**B00A - R0003 - Entry Vestibule**

No Asbestos

**B00A - R0004 - Distribution Board**

Note: No inspection of live electrical installation.

Ceiling Structures/Linings	Flat AC Sheeting 3352/B00A/R0029/Ceiling Structures/Linings/S1					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

Electrical Backing Board	Resinous Board	1Unit	North	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-------	-------	--------------------	---------	--------------------

**Assumed Asbestos - Electrical Hazard**

**B00A - R0005 - Cleaning Supplies**

No Asbestos

**B00A - R0006 - Principal**

No Asbestos

**B00A - R0007 - Movement**

No Asbestos

**B00A - R0008 - Personal Effects Storage**

No Asbestos

**B00A - R0009 - Practical Activities - 1hb**

No Asbestos

**B00A - R0010 - Home Base**

No Asbestos

**B00A - R0011 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 3352/B00A/R0029/Ceiling Structures/Linings/S1					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

**B00A - R0012 - Home Base Store**

No Asbestos

**B00A - R0013 - Withdrawal Space - 1hb**

No Asbestos

**B00A - R0014 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 3352/B00A/R0029/Ceiling Structures/Linings/S1					<b>No Asbestos Detected</b>
----------------------------	---	--	--	--	--	-----------------------------

**B00A - R0015 - Home Base**

No Asbestos

**B00A - R0016 - General Storeroom**

No Asbestos

**B00A - R0017 - Home Base Store**

No Asbestos

**B00A - R0018 - Craft Store**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R0019 - Security Store</b>						
No Asbestos						
<b>B00A - R0020 - Personal Effects Storage</b>						
No Asbestos						
<b>B00A - R0021 - General Storeroom</b>						
No Asbestos						
<b>B00A - R0022 - Home Base Store</b>						
No Asbestos						
<b>B00A - R0023 - Home Base</b>						
No Asbestos						
<b>B00A - R0024 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
		3352/B00A/R0029/Ceiling Structures/Linings/S1				<b>No Asbestos Detected</b>
<b>B00A - R0025 - Withdrawal Space - 1hb</b>						
No Asbestos						
<b>B00A - R0026 - Home Base Store</b>						
No Asbestos						
<b>B00A - R0027 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
		3352/B00A/R0029/Ceiling Structures/Linings/S1				<b>No Asbestos Detected</b>
<b>B00A - R0028 - Home Base</b>						
No Asbestos						
<b>B00A - R0029 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
		3352/B00A/R0029/Ceiling Structures/Linings/S1				<b>No Asbestos Detected</b>
<b>B00A - R0030 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00A - R0031 - Toilets - Boys</b>						
No Asbestos						
<b>B00A - R0033 - Toilets - Girls</b>						
No Asbestos						
<b>B00A - R0034 - Movement</b>						
No Asbestos						
<b>B00A - R0035 - Cleaning Distributed Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
		3352/B00A/R0029/Ceiling Structures/Linings/S1				<b>No Asbestos Detected</b>
<b>B00A - R0036 - Sick Bay</b>						
No Asbestos						
<b>B00A - R0037 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
		3352/B00A/R0029/Ceiling Structures/Linings/S1				<b>No Asbestos Detected</b>
<b>B00A - R0038 - Toilet - Lobby</b>						
No Asbestos						
<b>B00A - R0039 - Staff Toilet</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Library/Staff Facilities - 1967 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Eaves Linings	Fibre Cement Casting (Monocrete) 3352/B00B/R0002/Ceiling Structures/Linings/S11	10m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Infill panel to windows	Flat AC Sheeting 3352/B00B/Infill panel to windows/S10	22m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable verge lining	Flat AC Sheeting 3352/B00B/Gable verge lining/S9					<b>No Asbestos Detected</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00B - R0001 - Staff Room**

No Asbestos

**B00B - R0002 - Movement**

Ceiling Structures/Linings	Fibre Cement Casting (Monocrete) 3352/B00B/R0002/Ceiling Structures/Linings/S11	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00B - R0003 - Music Store**

No Asbestos

**B00B - R0004 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting 3352/B00B/R0004/Wall Linings Internal/S6	35m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
				<b>Chrysotile (white asbestos)</b>		

**B00B - R0005 - Library Office/Workroom**

No Asbestos

**B00B - R0006 - Reading Area**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities/General Learning - 1920 - Timber (Timber)**

**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no access point					
Awnings	Flat AC Sheeting	12m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3352/B00E/R0001/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>
Underfloor Voids	Flat AC Sheeting 3352/B00E/Underfloor Voids/S8					
						<b>No Asbestos Detected</b>

**Interior**

**B00E - R0001 - Canteen**

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3352/B00E/R0001/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>

**B00E - R0002 - Canteen Office/Store**

Floor Coverings Res/Textile	Vinyl Tiles					
	3352/B00E/R0002/Floor Coverings Res/Textile/S2					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting 3352/B00E/R0002/Ceiling Structures/Linings/S3					
						<b>No Asbestos Detected</b>

**B00E - R0003 - Withdrawal Space - 1hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Communal Facilities/Building Services - 2009 - Steel (Steel)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00F - R0001 - Sports Store**

No Asbestos

**B00F - R0002 - General Assistant/Bulk Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017