


# Asbestos Register

(Hazardous Materials and Risk Assessment)



**School :** West Wallsend Public School (3358)  
**Region :** Hunter/Central Coast  
**State Electorate :** Cessnock  
**Local Government Area :** Lake Macquarie

**Initial Survey :** Noel Arnold & Associates : 24 - Apr - 2008  
**Reviewed By :** AECOM : 17 - Jun - 2016

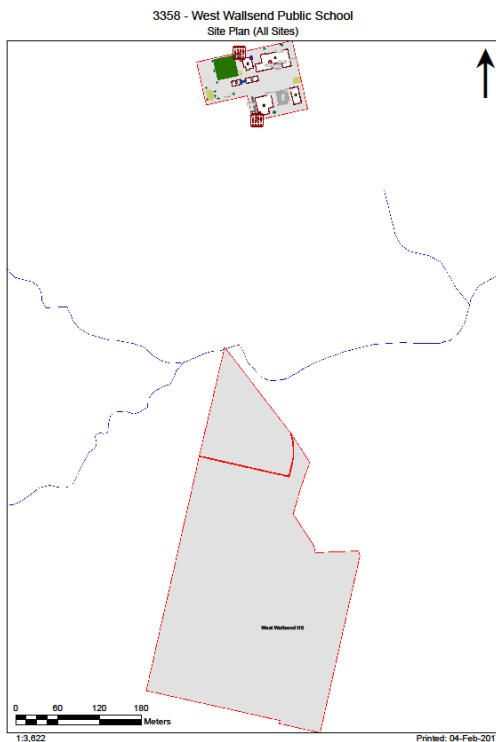

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### B00A - General Learning/Administration - 1889 - Brick/Block (Brick/Block)

#### Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction manhole located in AR00032. Too high to safely access 4.6m.

#### Interior

##### B00A - R0001 - Home Base

No Asbestos

##### B00A - R0002 - Movement

No Asbestos

##### B00A - R0003 - Home Base

No Asbestos

##### B00A - R0004 - Home Base

No Asbestos

##### B00A - R0005 - General Storeroom

No Asbestos

##### B00A - R0006 - General Storeroom

No Asbestos

##### B00A - R0008 - Movement

No Asbestos

##### B00A - R0012 - Movement

No Asbestos

##### B00A - R0013 - Interview

No Asbestos

##### B00A - R0014 - Movement

No Asbestos

##### B00A - R0015 - Staff Toilet

No Asbestos

##### B00A - R0016 - Staff Toilet

No Asbestos

##### B00A - R0017 - Home Base

No Asbestos

##### B00A - R0018 - Clerical Office

No Asbestos

##### B00A - R0019 - Home Base

No Asbestos

##### B00A - R0020 - Deputy Principal

No Asbestos

##### B00A - R0021 - Movement

No Asbestos

##### B00A - R0022 - Movement

No Asbestos

##### B00A - R0023 - Movement

No Asbestos

##### B00A - R0024 - Principal

No Asbestos

##### B00A - R0025 - Sick Bay

No Asbestos

##### B00A - R0026 - Clerical Office

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R0027 - Clerical Office</b>						
No Asbestos						
<b>B00A - R0028 - Entry Vestibule</b>						
No Asbestos						
<b>B00A - R0029 - Movement</b>						
No Asbestos						
<b>B00A - R0030 - Stairs</b>						
No Asbestos						
<b>B00A - R0031 - Home Base</b>						
No Asbestos						
<b>B00A - R0032 - Home Base</b>						
No Asbestos						
<b>B00A - R9001 - Raised Platform</b>						
No Asbestos						
<b>B00A - R9002 - Communal Space</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
3358/B00A/R9002/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>	
<b>B00A - R9003 - Canteen</b>						
No Asbestos						
<b>B00A - R9004 - General Storeroom</b>						
No Asbestos						
<b>B00A - R9005 - Staff Toilet</b>						
No Asbestos						
<b>B00A - R9006 - Staff Toilet</b>						
No Asbestos						
<b>B00A - R9007 - Movement</b>						
No Asbestos						
<b>B00A - R9008 - Canteen Office/Store</b>						
No Asbestos						
<b>B00A - R9009 - Movement</b>						
No Asbestos						
<b>B00A - R9010 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00A - R9011 - Movement</b>						
No Asbestos						
<b>B00A - R9012 - General Storeroom</b>						
No Asbestos						
<b>B00A - R9013 - Stairs</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### B00B - General Learning/Communal Facilities - 1889 - Brick/Block (Brick/Block)

#### Exterior

Underfloor Voids - Packing to Floor Joists	Non Accessible Area					
	- Area inaccessible no void entrance located.					
Ceiling Voids - Flat Roof	Non Accessible Area					
	- Height Restriction too high to safely access 4.97m.					

#### Interior

##### B00B - R0004 - Staff Toilet

No Asbestos

##### B00B - R0005 - Craft Store

No Asbestos

##### B00B - R0006 - General Storeroom

No Asbestos

##### B00B - R0007 - Movement

No Asbestos

##### B00B - R0008 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	11m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3358/B00B/R0017/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	

##### B00B - R0009 - Staff Room Annexe

No Asbestos

##### B00B - R0010 - Staff Toilet

No Asbestos

##### B00B - R0011 - Communal Space

Floor Coverings Res/Textile	Vinyl Tiles	90m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3358/B00B/R0017/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	

##### B00B - R0012 - Cleaning Distributed Store

No Asbestos

##### B00B - R0017 - Movement

Floor Coverings Res/Textile	Vinyl Tiles	10m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3358/B00B/R0017/Floor Coverings Res/Textile/S2				Chrysotile (white asbestos)	

##### B00B - R0018 - General Storeroom

No Asbestos

##### B00B - R0019 - General Assistant/Bulk Store

No Asbestos

##### B00B - R0021 - Home Base

No Asbestos

##### B00B - R0022 - Practical Activities - 1hb

No Asbestos

##### B00B - R0023 - Home Base

No Asbestos

##### B00B - R0024 - Practical Activities - 1hb

No Asbestos

##### B00B - R0025 - Home Base

No Asbestos

##### B00B - R0026 - Special Programs Room

No Asbestos

##### B00B - R0027 - Home Base

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - R0028 - Practical Activities - 1hb**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities - 1889 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof    Non Accessible Area  
 - Area inaccessible no void entrance found.

Underfloor Voids - Slab on Ground    Non Accessible Area  
 - Area inaccessible no void entrance found.

**Interior****B00C - R0001 - Toilets - Girls**

No Asbestos

**B00C - R0002 - Movement**

No Asbestos

**B00C - R0003 - Toilets - Boys**

No Asbestos

**B00C - R0004 - Cleaning Distributed Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities - 1977 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible no void entrance found.

Ceiling Voids - Flat Roof      Non Accessible Area  
 - Area inaccessible no void entrance found.

**Interior**

**B00D - R0001 - Toilets - Girls**

No Asbestos

**B00D - R0002 - Movement**

No Asbestos

**B00D - R0003 - Toilets - Boys**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning/Administration - 1889 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible no void entrance found.
Underfloor Voids - Packing to Floor Joists	Non Accessible Area - Area inaccessible void area too low to safely access.

**Interior****B00E - R0001 - Withdrawal Space - 1hb**

No Asbestos

**B00E - R0002 - Movement**

No Asbestos

**B00E - R0003 - Interview**

No Asbestos

**B00E - R0004 - Interview**

No Asbestos

**B00E - R0005 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3358/B00E/R0014/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>	

**B00E - R0006 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3358/B00E/R0014/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>	

**B00E - R0007 - Staff Kitchen**

No Asbestos

**B00E - R0008 - General Storeroom**

No Asbestos

**B00E - R0009 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3358/B00E/R0014/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>	

**B00E - R0010 - Staff Room**

No Asbestos

**B00E - R0011 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3358/B00E/R0014/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>	

Wall Linings Internal	Flat AC Sheeting	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
3358/B00E/R0011/Wall Linings Internal/S4					<b>Chrysotile (white asbestos)</b>	

**B00E - R0012 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3358/B00E/R0014/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>	

Wall Linings Internal	Flat AC Sheeting	12m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
3358/B00E/R0011/Wall Linings Internal/S4					<b>Chrysotile (white asbestos)</b>	

**B00E - R0013 - Staff Room Annexe**

No Asbestos

**B00E - R0014 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	22m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3358/B00E/R0014/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>	

**B00E - R0015 - Staff Toilet**



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Administration - 1889 - Timber Shed (Timber Shed)**

**Exterior**

Underfloor Voids - Slab on Ground      Non Accessible Area  
 - Area inaccessible

Ceiling Voids - Raked Ceiling      No Asbestos Found

**Interior**

**B00F - R0001 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Library/Other - 2011 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Packing to Floor Joists      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior****B00G - R0001 - External Movement**

No Asbestos

**B00G - R0002 - Toilet - Lobby**

No Asbestos

**B00G - R0003 - Staff Toilet**

No Asbestos

**B00G - R0004 - Cleaning Distributed Store**

No Asbestos

**B00G - R0005 - Main Switch Board**

No Asbestos

**B00G - R0006 - Reading Area**

No Asbestos

**B00G - R0007 - K.L.A. Store**

No Asbestos

**B00G - R0008 - Communications Room**

No Asbestos

**B00G - R0009 - Library Office/Workroom**

No Asbestos

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017