


Asbestos Register

(Hazardous Materials and Risk Assessment)



School : Wanaaring Public School (3365)
Region : Western NSW
State Electorate : Barwon
Local Government Area : Bourke

Initial Survey : Noel Arnold & Associates : 03 - May - 2008
Register Issue Date : 22 - Mar - 2017

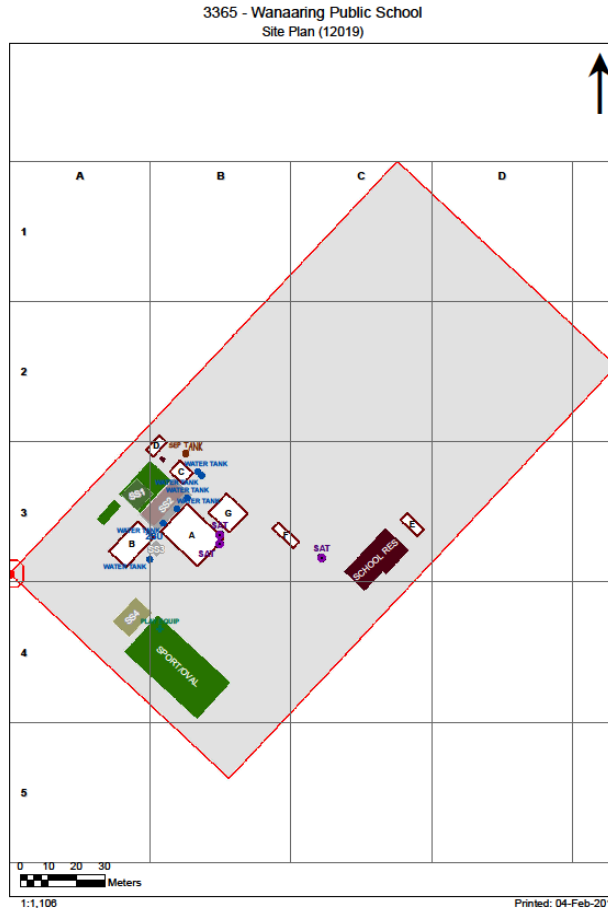

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Staff Facilities/General Learning - 1976 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	50m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3365/B00A/Eaves Linings/S1					Chrysotile (white asbestos)
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00A - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3365/B00A/R0003/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00A - R0002 - Home Base

No Asbestos

B00A - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3365/B00A/R0003/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00A - R0004 - Principal

No Asbestos

B00A - R0005 - Duplicating Workroom

No Asbestos

B00A - R0006 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					
	3365/B00A/R0006/Floor Coverings Res/Textile/S3					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1976 - Timber (Timber)

Exterior

Ceiling Voids	Requires Inspection
Underfloor Voids	Requires Inspection

Interior

B00B - R0001 - Sports Store

Wall Linings Internal	Flat AC Sheeting	
	3365/B00B/R0001/Wall Linings Internal/S4	No Asbestos Detected

B00B - R0002 - Reading Area

No Asbestos

B00B - R0003 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities/Staff Facilities - 1898 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos					
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior**B00C - R0001 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3365/B00C/R0002/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3365/B00C/R0004/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	3365/B00C/R0002/Wall Linings Internal/S6					

B00C - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3365/B00C/R0002/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	3365/B00C/R0002/Wall Linings Internal/S6					

B00C - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3365/B00C/R0002/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	3365/B00C/R0002/Wall Linings Internal/S6					

B00C - R0004 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3365/B00C/R0002/Ceiling Structures/Linings/S5					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3365/B00C/R0004/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	3365/B00C/R0002/Wall Linings Internal/S6					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Communal Facilities - 2008 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00D - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Staff Facilities - 2008 - Timber (Timber)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00E - R0001 - Garage/Carport

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 2008 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00F - R0001 - Garage/Carport

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00G - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00G - R0001 - Reading Area

No Asbestos

B00G - R0002 - Library Office/Workroom

No Asbestos

B00G - R0003 - Practical Activities

No Asbestos

B00G - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017