


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wangi Wangi Public School (3373)
Region : Hunter/Central Coast
State Electorate : Lake Macquarie
Local Government Area : Lake Macquarie

Initial Survey : Noel Arnold & Associates : 22 - Apr - 2008
Reviewed By : AECOM : 25 - Jun - 2015

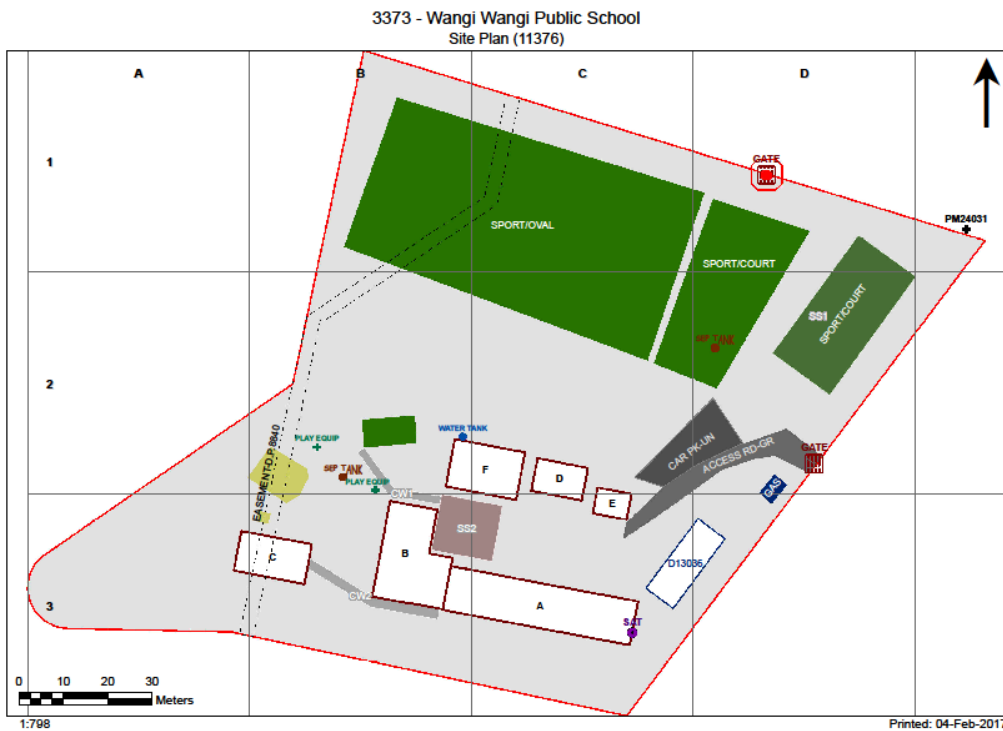

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Staff Facilities - 1952 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	32m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00A/R0006/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction, access point in AR0007.					
Underfloor Voids	AC Fragments/Debris 3373/B00A/Underfloor Voids/S9				No Asbestos Detected	
Underfloor Voids	Compressed AC Sheet	4m2	East	Some Damage - Unsealed (3)	Medium (2)	Medium Priority (4-5)
	3373/B00D/R0001/Partition Walls (Cubicles)/S2				Chrysotile (white asbestos)	
Underfloor Voids	Infill panels to top of floor supports throughout floorspace.	24m	Upper portion	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3373/B00B/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

Interior**B00A - R0001 - Cleaning Distributed Store (0.33 m2)**

No Asbestos

B00A - R0002 - Staff Toilet (3.2 m2)

No Asbestos

B00A - R0003 - Staff Toilet (3.42 m2)

No Asbestos

B00A - R0004 - Movement (3.9 m2)

No Asbestos

B00A - R0005 - Staff Room (23.7 m2)

No Asbestos

B00A - R0006 - External Movement (88.74 m2)

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3373/B00A/R0006/Ceiling Structures/Linings/S3					
Ceiling Structures/Linings	Flat AC Sheeting	44m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00A/R0006/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	

B00A - R0007 - General Storeroom (10.96 m2)

No Asbestos

B00A - R0008 - Duplicating Workroom (11.2 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3373/B00A/R0008/Floor Coverings Res/Textile/S4					

B00A - R0009 - Home Base (53.51 m2)

No Asbestos

B00A - R0010 - Home Base (53.44 m2)

Wall Linings Internal	Flat AC Sheeting	1m2	South, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00A/R0010/Wall Linings Internal/S5				Chrysotile (white asbestos)	

B00A - R0011 - General Storeroom (10.95 m2)

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3373/B00A/R0008/Floor Coverings Res/Textile/S4					

B00A - R0012 - Staff Room Annexe (11.04 m2)

No Asbestos

B00A - R0013 - Home Base (53.58 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Wall Linings Internal	Flat AC Sheeting	1m2	South, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3373/B00A/R0010/Wall Linings Internal/S5					Chrysotile (white asbestos)	
B00A - R0014 - Home Base (53.59 m2)						
Wall Linings Internal	Flat AC Sheeting	1m2	South, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3373/B00A/R0010/Wall Linings Internal/S5					Chrysotile (white asbestos)	
B00A - R0015 - General Storeroom (22.47 m2)						
No Asbestos						
B00A - R0016 - Communal/Performance Store (7.57 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
3373/B00A/R0016/Ceiling Structures/Linings/S7					No Asbestos Detected	
B00A - R9001 - External Movement (10.72 m2)						
No Asbestos						
B00A - R9002 - Garden Store (6.57 m2)						
No Asbestos						
B00A - R9003 - General Assistant/Bulk Store (12.07 m2)						
No Asbestos						
B00A - R9004 - General Storeroom (27.36 m2)						
No Asbestos						
B00A - R9005 - General Storeroom (13.24 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
3373/B00A/R0006/Ceiling Structures/Linings/S3					No Asbestos Detected	
B00A - R9006 - General Storeroom (4.47 m2)						
No Asbestos						
B00A - R9007 - Sports Store (30.3 m2)						
No Asbestos						
B00A - R9008 - General Storeroom (11.33 m2)						
Ceiling Structures/Linings	Flat AC Sheeting					
3373/B00A/R0006/Ceiling Structures/Linings/S3					No Asbestos Detected	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning/Pupil Facilities - 1967 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	33m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00B/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible, no access point.					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - External Movement (40.99 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00B/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B00B - R0002 - Personal Effects Storage (6.58 m2)

Ceiling Structures/Linings	Vermiculite	7m2	Throughout	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	3373/B00D/R0001/Partition Walls (Cubicles)/S2				Chrysotile (white asbestos)	

B00B - R0003 - Home Base Store (3.45 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00B/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

Wall Linings Internal	Vermiculite	3373/B00B/R0008/Decorative Coating/S10				Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00B - R0004 - Home Base (57.02 m2)

Ceiling Structures/Linings	Vermiculite	3373/B00B/R0008/Decorative Coating/S10				Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00B - R0005 - Home Base (85.22 m2)

Ceiling Structures/Linings	Vermiculite	3373/B00B/R0008/Decorative Coating/S10				Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00B - R0006 - Home Base Store (3.71 m2)

Wall Linings Internal	Vermiculite	3373/B00B/R0008/Decorative Coating/S10				Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00B/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B00B - R0007 - Practical Activities - 1hb (8.15 m2)

Ceiling Structures/Linings	Vermiculite	3373/B00B/R0008/Decorative Coating/S10				Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

Wall Linings Internal	Vermiculite	3373/B00B/R0008/Decorative Coating/S10				Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00B - R0008 - Toilets - Boys/Girls (3.3 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00B/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

Decorative Coating	Vermiculite	3373/B00B/R0008/Decorative Coating/S10				Limited Samples Taken
	Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works					

B00B - R0009 - External Movement (3.2 m2)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3373/B00B/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00B - R0010 - External Movement (62.49 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Communal Facilities - 1922 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction					
Underfloor Voids - Packing to Floor Joists	AC Fragments/Debris 3373/B00C/Underfloor Voids - Packing to Floor Joists/S11					No Asbestos Detected
Underfloor Voids	AC Fragments/Debris 3373/B00C/Underfloor Voids/S12					No Asbestos Detected

Interior

B00C - R0001 - External Movement (43.65 m2)

No Asbestos

B00C - R0002 - General Storeroom (7.91 m2)

No Asbestos

B00C - R0003 - Communal Space (70.93 m2)

No Asbestos

B00C - R0004 - Raised Platform (15.45 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1965 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	5m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00B/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible, slab on ground.					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible, no access hatch.					

Interior**B00D - R0001 - Toilets - Boys (24.82 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	25m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00B/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Partition Walls (Cubicles)	Compressed AC Sheet	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00D/R0001/Partition Walls (Cubicles)/S2				Chrysotile (white asbestos)	

B00D - R0002 - Toilets - Boys (2.69 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00B/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B00D - R0003 - External Movement (4.25 m2)

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00B/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B00D - R0004 - Cleaning Supplies (8.21 m2)

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00B/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B00D - R0005 - Toilets - Girls (25.75 m2)

Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00B/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B00D - R0006 - Toilets - Girls (2.85 m2)

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00B/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

B00D - R0007 - External Movement (4.45 m2)

Ceiling Structures/Linings	Flat AC Sheeting	4.45m2	Throughout	Good Condition (1)	Medium (2)	Low Priority (2-3)
	3373/B00B/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1977 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	12m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3373/B00B/R0001/Ceiling Structures/Linings/S6				Chrysotile (white asbestos)	
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible, no access hatch, flat roof.					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible, no floor access hatch.					

Interior**B00E - R0001 - Canteen (12.26 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	3373/B00E/R0001/Floor Coverings Res/Textile/S1				No Asbestos Detected	

B00E - R0002 - Canteen Office/Store (1.8 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3373/B00E/R0001/Floor Coverings Res/Textile/S1				No Asbestos Detected	

B00E - R0003 - Staff Toilet (4.23 m2)

No Asbestos

B00E - R0004 - Movement (2.27 m2)

Floor Coverings Res/Textile	Vinyl Tiles					
	3373/B00E/R0001/Floor Coverings Res/Textile/S1				No Asbestos Detected	

B00E - R0005 - External Movement (16.91 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)**Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

Interior**B00F - R0001 - External Movement (34.78 m2)**

No Asbestos

B00F - R0002 - Reading Area (91.95 m2)

No Asbestos

B00F - R0003 - Library Office/Workroom (20.52 m2)

No Asbestos

B00F - R0004 - Communications Cupboard (8.47 m2)

No Asbestos

B00F - R0005 - General Storeroom (9.91 m2)

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 502 - D13036 - Admin Staff/Principal/Clerk/Dup/Clinic : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos				1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				23.04 m2

Interior

R1 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2

R10 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
---------	---------------	------------------	--	--	--	-------

R2 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos				1 m2
---------	---------------	------------------	--	--	--	------

R3 - Duplicating Wookroom

Ceiling	Flat AC Sheet	Assumed Asbestos				12 m2
---------	---------------	------------------	--	--	--	-------

R4 - Clinic-Waiting

Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
---------	---------------	------------------	--	--	--	-------

R5 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
---------	---------------	------------------	--	--	--	-------

R6 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
---------	---------------	------------------	--	--	--	-------

R7 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

R8 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos				2 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2

R9 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				27 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017