


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Waratah Public School (3377)
Region : Hunter/Central Coast
State Electorate : Wallsend
Local Government Area : Newcastle

Initial Survey : Noel Arnold & Associates : 11 - Mar - 2008
Reviewed By : AECOM : 25 - Jun - 2015

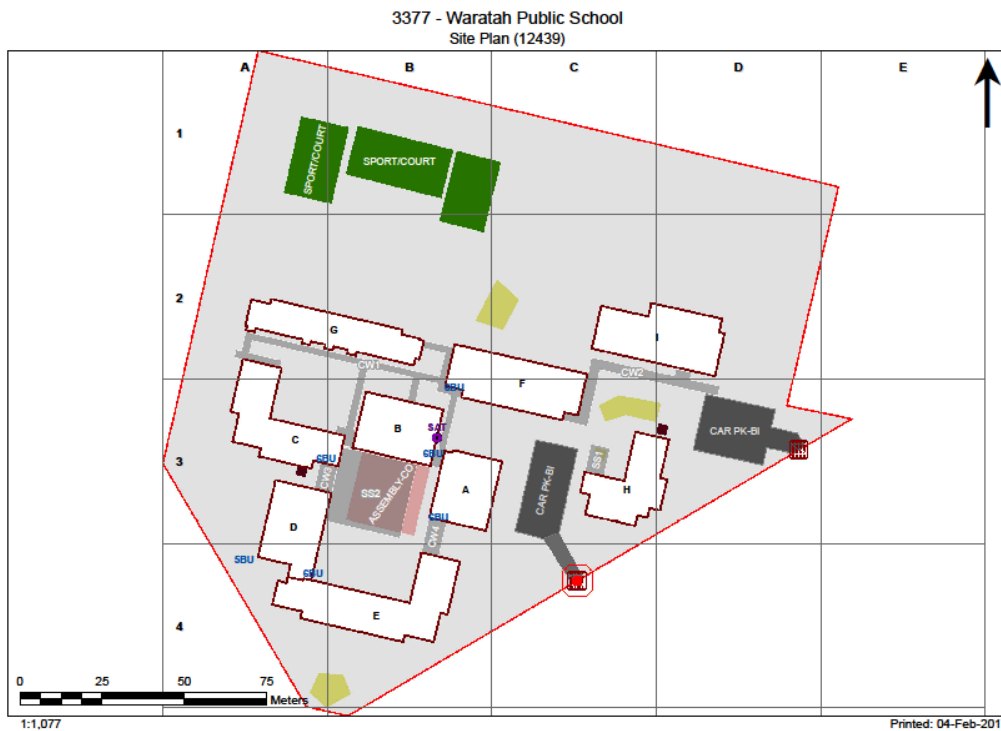

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Staff Facilities - 1977 - Brick/Block (Brick/Block)

Exterior

Gable Verge Lining	Flat AC Sheeting	25m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00A/Gable Verge Lining/S18					Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Area inaccessible no manhole located					
Underfloor Voids	Non Accessible Area - Area inaccessible no void entrance found					
Eaves Linings	Flat AC Sheeting	40m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00A/R0019/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)	

Interior

B00A - R0001 - Movement

No Asbestos

B00A - R0002 - Clerical Office

Ceiling Structures/Linings No Asbestos Found

B00A - R0003 - Sick Bay

Floor Coverings Res/Textile Vinyl Tiles
3377/B00A/R0009/Floor Coverings Res/Textile/S17

No Asbestos Detected

B00A - R0004 - Entry Vestibule

No Asbestos

B00A - R0005 - Clerical Office

No Asbestos

B00A - R0006 - Duplicating Workroom

No Asbestos

B00A - R0007 - Movement

No Asbestos

B00A - R0008 - Principal

No Asbestos

B00A - R0009 - Distribution Board

Note: No inspection of live electrical installation.

Floor Coverings Res/Textile Vinyl Tiles
3377/B00A/R0009/Floor Coverings Res/Textile/S17

No Asbestos Detected

Electrical Mounting Board	Resinous Board	1Unit	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	----------------	-------	-------------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

B00A - R0010 - General Storeroom

No Asbestos

B00A - R0011 - Staff Toilet

No Asbestos

B00A - R0012 - Staff Room Annexe

No Asbestos

B00A - R0013 - Staff Room

No Asbestos

B00A - R0014 - Cleaning Distributed Store

Ceiling Structures/Linings No Asbestos Found

B00A - R0015 - Staff Toilet

No Asbestos

B00A - R0016 - Movement

No Asbestos

B00A - R0017 - Deputy Principal

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0018 - Interview

No Asbestos

B00A - R0019 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	38m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	------	--------------	--------------------	---------	--------------------

3377/B00A/R0019/Ceiling Structures/Linings/S16

Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1977 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00A/Gable Verge Lining/S18					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B00B - R0004 - Entry Vestibule**

No Asbestos

B00B - R0005 - Staff Toilet

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00B/R0007/Partition Walls (Cubicles)/S14					Chrysotile (white asbestos)

B00B - R0006 - Cleaning Distributed Store

No Asbestos

B00B - R0007 - Staff Toilet

Partition Walls (Cubicles)	Compressed AC Sheet	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00B/R0007/Partition Walls (Cubicles)/S14					Chrysotile (white asbestos)

B00B - R0008 - Library Office/Workroom

Floor Coverings Res/Textile	Vinyl Tiles	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00B/R0010/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B00B - R0010 - Communications Room

Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00B/R0010/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)

B00B - R0011 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00B - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	47m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00B/R0012/Ceiling Structures/Linings/S15					Chrysotile (white asbestos)

B00B - R0014 - Special Programs Room

No Asbestos

B00B - R0016 - Reading Area

Ceiling Structures/Linings No Asbestos Found

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Pupil Facilities - 1977 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m	North facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00A/Gable Verge Lining/S18					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible manhole unable to be accessed due to height design					

Interior**B00C - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	90m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00A/R0019/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

B00C - R0002 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00C/R0002/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00C - R0003 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00C/R0002/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00C - R0004 - Home Base

No Asbestos

B00C - R0005 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00C/R0002/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00C - R0006 - Home Base

No Asbestos

B00C - R0007 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00C/R0002/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00C - R0008 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00C/R0010/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00C/R0010/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00C - R0009 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	2.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00E/R0022/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)

B00C - R0010 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00C/R0010/Partition Walls (Cubicles)/S8					Chrysotile (white asbestos)

Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00C/R0010/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00C - R0011 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00C/R0002/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)

B00C - R0012 - Home Base

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00C - R0013 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00C/R0002/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00C - R0014 - Home Base						
No Asbestos						
B00C - R0015 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00C/R0002/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)	
B00C - R0016 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00A/R0019/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Pupil Facilities - 1977 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	25m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00A/Gable Verge Lining/S18					Chrysotile (white asbestos)
Ceiling Voids	Non Accessible Area - Area inaccessible no manhole found					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B00D - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00A/R0019/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

B00D - R0002 - Toilets - Boys/Girls

No Asbestos

B00D - R0003 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00D/R0003/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00D - R0004 - Home Base

No Asbestos

B00D - R0005 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00D/R0003/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00D - R0006 - Toilets - Boys/Girls

No Asbestos

B00D - R0007 - Home Base

No Asbestos

B00D - R0008 - Toilets - Boys/Girls

No Asbestos

B00D - R0009 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00D/R0003/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)

B00D - R0010 - Home Base

No Asbestos

B00D - R0011 - General Storeroom

No Asbestos

B00D - R0012 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	44m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00A/R0019/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Support Unit - 1977 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00A/Gable Verge Lining/S18					Chrysotile (white asbestos)	
Underfloor Voids - Slab on Ground	Non Accessible Area					
- Area inaccessible						
Ceiling Voids - Raked Ceiling	Non Accessible Area					
- Height Restriction						

Interior**B00E - R0001 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0007/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

B00E - R0002 - Home Base

No Asbestos

B00E - R0003 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0007/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

B00E - R0004 - Home Base

No Asbestos

B00E - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	128m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0022/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00E - R0006 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0022/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0022/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00E - R0007 - Sports Store

Floor Coverings Res/Textile	Vinyl Tiles	20m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0007/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

B00E - R0008 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0022/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00E - R0009 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0022/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0022/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

B00E - R0010 - Home Base

No Asbestos

B00E - R0011 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0007/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	

B00E - R0012 - Home Base

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00E - R0013 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0007/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00E - R0014 - Home Base						
No Asbestos						
B00E - R0015 - Practical Activities - 1hb						
Floor Coverings Res/Textile	Vinyl Tiles	22m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0007/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00E - R0016 - Home Base - E						
No Asbestos						
B00E - R0017 - Practical Activities - E						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0007/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00E - R0018 - Toilet - E						
Wall Linings Internal	Flat AC Sheeting					
3377/B00E/R0018/Wall Linings Internal/S4					No Asbestos Detected	
B00E - R0019 - Toilets - Girls						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0022/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	19m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0022/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00E - R0020 - Cleaning Distributed Store						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0022/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	
B00E - R0021 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0007/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
B00E - R0022 - Toilets - Boys						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0022/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	18m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00E/R0022/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Communal Facilities/Pupil Facilities - 1976 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00A/Gable Verge Lining/S18					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B00F - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	58m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00A/R0019/Ceiling Structures/Linings/S16					Chrysotile (white asbestos)

B00F - R0003 - Raised Platform

No Asbestos

B00F - R0004 - Hall Chair Store

No Asbestos

B00F - R0005 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0006 - Hall Chair Store

No Asbestos

B00F - R0007 - Uniform Shop

No Asbestos

B00F - R0008 - General Assistant/Bulk Store

No Asbestos

B00F - R0009 - Garden Store

No Asbestos

B00F - R0010 - Movement

No Asbestos

B00F - R0011 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00F/R0019/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)

B00F - R0012 - Canteen Office/Store

No Asbestos

B00F - R0013 - Staff Toilet

No Asbestos

B00F - R0014 - Canteen Office/Store

No Asbestos

B00F - R0015 - Canteen

No Asbestos

B00F - R0016 - P.E. Store

No Asbestos

B00F - R0017 - Cleaning Supplies

No Asbestos

B00F - R0018 - Staff Toilet

No Asbestos

B00F - R0019 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00F/R0019/Partition Walls (Cubicles)/S10					Chrysotile (white asbestos)

B00F - R0020 - Special Programs Room

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - R0021 - Special Programs Room

No Asbestos

B00F - R0022 - Special Programs Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning/Music - 1933 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	Non Accessible Area - Area inaccessible, no ceiling void access hatch sighted.

Interior

B00G - R0001 - Movement

No Asbestos

B00G - R0002 - Drinking Facilities

No Asbestos

B00G - R0003 - Movement

No Asbestos

B00G - R0004 - General Storeroom

No Asbestos

B00G - R0005 - Drinking Facilities

No Asbestos

B00G - R0006 - Movement

No Asbestos

B00G - R0007 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00G/R0025/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	

B00G - R0008 - Practical Activities - 1hb

No Asbestos

B00G - R0009 - Home Base

No Asbestos

B00G - R0010 - Practical Activities - 1hb

No Asbestos

B00G - R0011 - Home Base

No Asbestos

B00G - R0012 - Movement

No Asbestos

B00G - R0013 - Movement

No Asbestos

B00G - R0014 - Staff Room Annexe

No Asbestos

B00G - R0015 - Movement

No Asbestos

B00G - R0016 - P.E. Store

No Asbestos

B00G - R0017 - Practical Activities - 1hb

No Asbestos

B00G - R0018 - Home Base

No Asbestos

B00G - R0019 - Movement

No Asbestos

B00G - R0020 - Movement

No Asbestos

B00G - R0021 - Practical Activities - 1hb

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00G - R0022 - Home Base						
No Asbestos						
B00G - R0023 - Movement						
No Asbestos						
B00G - R0024 - Craft Store						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00G/R0025/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00G - R0025 - Craft Store						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00G/R0025/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00G - R0026 - Movement						
No Asbestos						
B00G - R0027 - Cleaning Distributed Store						
Floor Coverings Res/Textile	Vinyl Tiles	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00G/R0025/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00G - R0028 - Stairs						
No Asbestos						
B00G - R0029 - Stairs						
No Asbestos						
B00G - R0030 - Stairs						
No Asbestos						
B00G - R1001 - Movement						
No Asbestos						
B00G - R1002 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00G/R0025/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00G - R1003 - Practical Activities - 1hb						
No Asbestos						
B00G - R1004 - Home Base						
No Asbestos						
B00G - R1005 - Practical Activities - 1hb						
No Asbestos						
B00G - R1006 - Home Base						
No Asbestos						
B00G - R1007 - Withdrawal Space - 1hb						
No Asbestos						
B00G - R1008 - Movement						
No Asbestos						
B00G - R1009 - Practical Activities - 1hb						
No Asbestos						
B00G - R1010 - Home Base						
No Asbestos						
B00G - R1011 - Practical Activities - 1hb						
No Asbestos						
B00G - R1012 - Home Base						
No Asbestos						
B00G - R1013 - Withdrawal Space - 1hb						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R1014 - Sports Store						
Floor Coverings Res/Textile	Vinyl Tiles	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3377/B00G/R0025/Floor Coverings Res/Textile/S9					Chrysotile (white asbestos)	
B00G - R1015 - Stairs						
No Asbestos						
B00G - R1016 - Stairs						
No Asbestos						
B00G - R1017 - Stairs						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Pre-School Facilities - 1976 - Brick/Block (Brick/Block)**Exterior**

Gable Verge Lining	Flat AC Sheeting	50m	North facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00A/Gable Verge Lining/S18					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B00H - R0001 - General Storeroom - Pre**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00H/R0013/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00H - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	85m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00H/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)

B00H - R0003 - Toilets - Boys/Girls - Pre

No Asbestos

B00H - R0004 - Home Base - Pre

No Asbestos

B00H - R0005 - General Storeroom - Pre

Ceiling Structures/Linings	Flat AC Sheeting	4m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00H/R0013/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00H - R0006 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00H - R0007 - Staff Toilet - Pre

Ceiling Structures/Linings	Flat AC Sheeting	2m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00H/R0013/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00H - R0008 - Kitchen - Pre

Ceiling Structures/Linings	Flat AC Sheeting	6m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00H/R0013/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00H - R0009 - Personal Effects - Pre

No Asbestos

B00H - R0010 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00H/R0002/Ceiling Structures/Linings/S12					Chrysotile (white asbestos)

B00H - R0011 - Clerical Office - Pre

No Asbestos

B00H - R0012 - Clerical Office - Pre

Ceiling Structures/Linings	Flat AC Sheeting	8m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00H/R0013/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00H - R0013 - General Storeroom - Pre

Ceiling Structures/Linings	Flat AC Sheeting	4m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3377/B00H/R0013/Ceiling Structures/Linings/S11					Chrysotile (white asbestos)

B00H - R0014 - Home Base - Pre

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - R0015 - Toilets - Boys/Girls - Pre

No Asbestos

B00H - R0016 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00I - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior**B00I - R0001 - Covered Outdoor Learning Area**

No Asbestos

B00I - R0002 - External Movement

No Asbestos

B00I - R0003 - Access Shower/Toilet

No Asbestos

B00I - R0004 - Main Switch Board

No Asbestos

B00I - R0005 - Communal Space

No Asbestos

B00I - R0006 - Cleaning Distributed Store

No Asbestos

B00I - R0007 - General Storeroom

No Asbestos

B00I - R0008 - Toilet - Lobby

No Asbestos

B00I - R0009 - Toilets - Boys

No Asbestos

B00I - R0010 - Sound Cupboard

No Asbestos

B00I - R0011 - Toilet - Lobby

No Asbestos

B00I - R0012 - Toilets - Girls

No Asbestos

B00I - R0013 - P.E. Store

No Asbestos

B00I - R0014 - Communal/Performance Store

No Asbestos

B00I - R0015 - Hall Chair Store

No Asbestos

B00I - R0016 - Movement

No Asbestos

B00I - R0017 - Movement

No Asbestos

B00I - R0018 - Raised Platform

No Asbestos

B00I - R0019 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017