


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wardell Public School (3378)
Region : North Coast
State Electorate : Ballina
Local Government Area : Ballina

Initial Survey : Noel Arnold & Associates : 11 - Jun - 2008
Reviewed By : Greencap-NAA : 04 - May - 2016

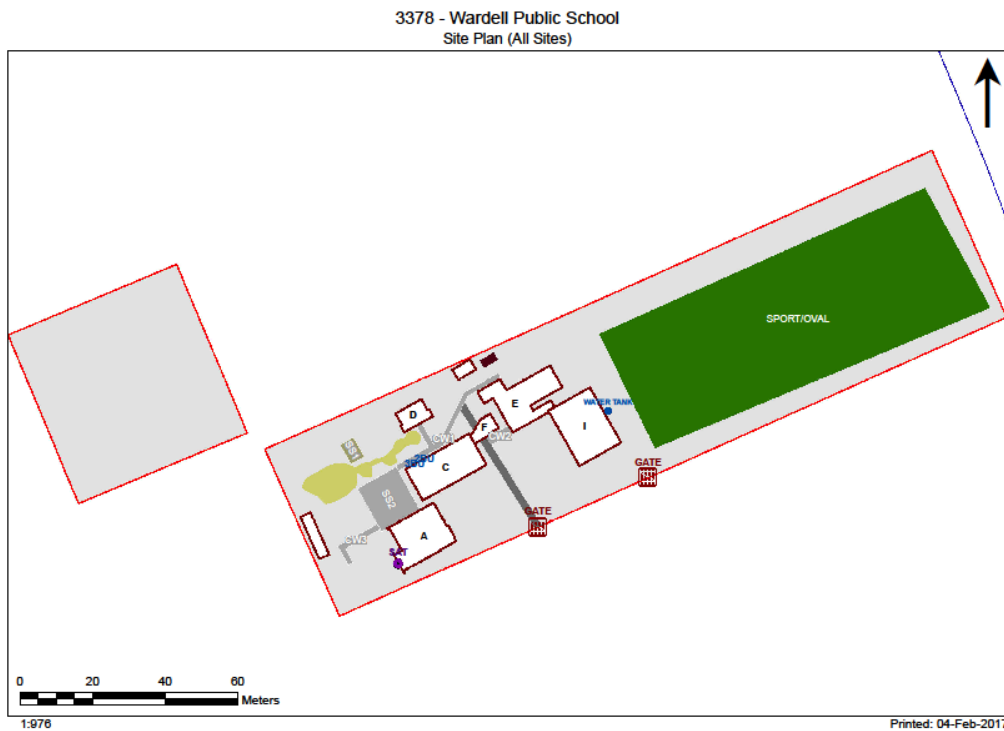

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1995 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	26m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3378/B00A/R0007/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Eaves Linings	Flat AC Sheeting	26m2	Throughout, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3378/B00A/R0007/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					

Interior**B00A - R0006 - Home Base**

No Asbestos

B00A - R0007 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3378/B00A/R0007/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00A - R0008 - Sports Store

No Asbestos

B00A - R0009 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3378/B00A/R0007/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00A - R0010 - External Movement

No Asbestos

B00A - R0012 - Special Programs Room

No Asbestos

B00A - R0013 - Home Base Store

Electrical Backing Board	Compressed AC Sheet	1Unit	East	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	---------------------	-------	------	--------------------	---------	--------------------

Assumed Asbestos - Electrical Hazard

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Library - 1922 - Timber (Timber)**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	Non Accessible Area - Height Restricted grearer 4m

Interior**B00C - R0001 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3378/B00C/R0004/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3378/B00C/R0001/Wall Linings Internal/S9					Chrysotile (white asbestos)	

B00C - R0002 - Home Base

Wall Linings Internal	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3378/B00C/R0001/Wall Linings Internal/S9					Chrysotile (white asbestos)	

B00C - R0003 - Reading Area

Wall Linings Internal	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3378/B00C/R0001/Wall Linings Internal/S9					Chrysotile (white asbestos)	

B00C - R0004 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3378/B00C/R0004/Floor Coverings Res/Textile/S3					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
3378/B00C/R0001/Wall Linings Internal/S9					Chrysotile (white asbestos)	

B00C - R0005 - Duplicating Workroom

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3378/B00C/R0001/Wall Linings Internal/S9					Chrysotile (white asbestos)	

B00C - R0006 - Movement

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3378/B00C/R0001/Wall Linings Internal/S9					Chrysotile (white asbestos)	

B00C - R0007 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1952 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Downpipes	Fibre Cement Pipe	6m	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3378/B00D/Downpipes/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Eaves Linings	Flat AC Sheeting 3378/B00D/Eaves Linings/S13					No Asbestos Detected
Ceiling Voids	No Asbestos Found					

Interior

B00D - R0004 - Movement

No Asbestos

B00D - R0005 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 3378/B00D/R0005/Ceiling Structures/Linings/S12					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00D - R0006 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 3378/B00D/R0005/Ceiling Structures/Linings/S12					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning/Staff Facilities - 1972 - Timber (Timber)**Exterior**

Wall Cladding	Flat AC Sheeting	8m2	East and West Facia	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - not accessible-Height restricted						
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

Interior**B00E - R0001 - Music Store**

No Asbestos

B00E - R0002 - Withdrawal Space - 1hb

No Asbestos

B00E - R0007 - Practical Activities - 1hb

No Asbestos

B00E - R0009 - Staff Room

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
3378/B00E/R0009/Floor Coverings Res/Textile/S5						
Wall Linings Internal	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3378/B00E/R0009/Wall Linings Internal/S6		Chrysotile (white asbestos) , Amosite (brown asbestos)				

B00E - R0010 - Staff Toilet

No Asbestos

B00E - R0011 - Movement

No Asbestos

B00E - R0012 - General Storeroom

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
3378/B00E/R0012/Wall Linings Internal/S7						

B00E - R0013 - External Movement

No Asbestos

B00E - R0015 - Principal

No Asbestos

B00E - R0016 - Entry Vestibule

No Asbestos

B00E - R0017 - Sick Bay

No Asbestos

B00E - R0018 - Security Store

No Asbestos

B00E - R0019 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	4m2	adjacent entrance	Good Condition (1)	Low (1)	Low Priority (2-3)
3378/B00E/R0019/Ceiling Structures/Linings/S8		Chrysotile (white asbestos)				

B00E - R0020 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1972 - Steel (Steel)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00F - R0001 - Canteen

Floor Coverings Res/Textile Vinyl Tiles
 3378/B00E/R0009/Floor Coverings Res/Textile/S5 **No Asbestos Detected**

Wall Linings Internal Flat AC Sheeting
 3378/B00F/R0001/Wall Linings Internal/S11 **No Asbestos Detected**

B00F - R0002 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Building Services - 1999 - Timber Shed (Timber Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00G - R0001 - General Assistant/Bulk Store

Wall Linings Internal Flat AC Sheeting
 3378/B00G/R0001/Wall Linings Internal/S4

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services - 2006 - Steel (Steel)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00H - R0001 - Movement

No Asbestos

B00H - R0002 - Special Programs Room

Wall Linings Internal	Flat AC Sheeting					
	3378/B00H/R0002/Wall Linings Internal/S10					No Asbestos Detected

B00H - R0003 - Cleaning Distributed Store

No Asbestos

B00H - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00I - R0001 - External Movement

No Asbestos

B00I - R0002 - Practical Activities - 1hb

No Asbestos

B00I - R0003 - Home Base Store

No Asbestos

B00I - R0004 - Home Base

No Asbestos

B00I - R0005 - Withdrawal Space - 2hb

No Asbestos

B00I - R0006 - Home Base

No Asbestos

B00I - R0007 - Home Base Store

No Asbestos

B00I - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017