


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Warialda Public School (3382)
Region : New England
State Electorate : Northern Tablelands
Local Government Area : Gwydir

Initial Survey : Noel Arnold & Associates : 21 - May - 2008
Reviewed By : Grencap-NAA : 04 - May - 2016

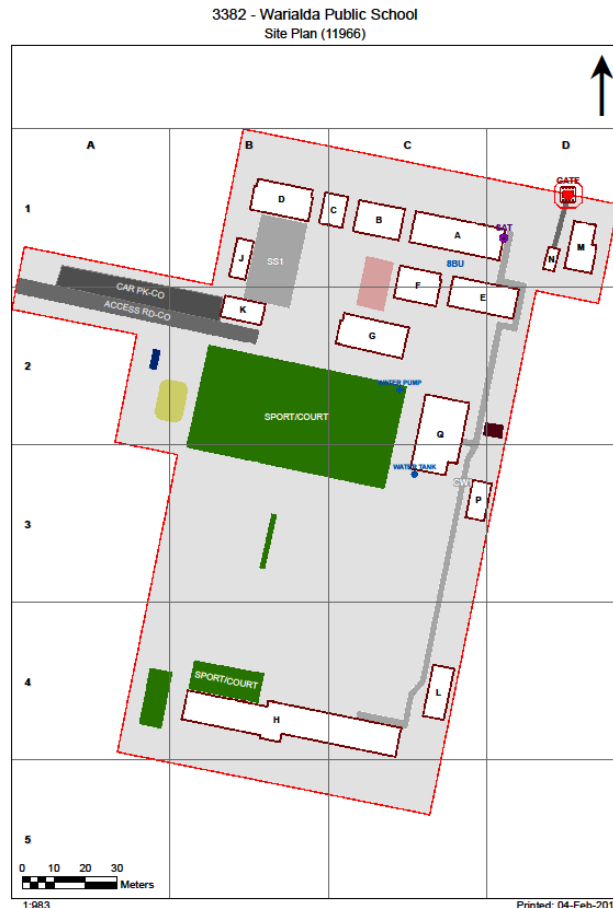

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Library/General Learning - 1962 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	20m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00A/Eaves Linings/S15				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- height - 3.6 meters					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

Interior**B00A - R0001 - Library Office/Workroom**

No Asbestos

B00A - R0002 - K.L.A. Store

No Asbestos

B00A - R0003 - Reading Area

No Asbestos

B00A - R0004 - Staff Room Annexe

No Asbestos

B00A - R0005 - General Storeroom

No Asbestos

B00A - R0006 - Reading Area

No Asbestos

B00A - R0007 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	4m2	East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00A/R0007/Wall Linings Internal/S16				Chrysotile (white asbestos)	
Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00D/R0004/Electrical Backing Board/S10				Chrysotile (white asbestos)	

B00A - R0008 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00A - R0009 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1910 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids - Raked Ceiling	Non Accessible Area - height - 3.6 meters

Interior

B00B - R0001 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3382/B00B/R0003/Floor Coverings Res/Textile/S17	No Asbestos Detected
-----------------------------	---	---	-----------------------------

B00B - R0002 - Practical Activities - 1hb

No Asbestos

B00B - R0003 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3382/B00B/R0003/Floor Coverings Res/Textile/S17	No Asbestos Detected
-----------------------------	---	---	-----------------------------

B00B - R0004 - Practical Activities - 1hb

No Asbestos

B00B - R0005 - External Movement

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
3382/B00D/R0004/Electrical Backing Board/S10					Chrysotile (white asbestos)	

B00B - R0006 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1910 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

Interior

B00C - R0001 - Home Base

Floor Coverings Res/Textile Vinyl Tiles (Under Floor Covering/Carpet)
 3382/B00C/R0001/Floor Coverings Res/Textile/S18 **No Asbestos Detected**

B00C - R0002 - Practical Activities - 1hb

No Asbestos

B00C - R0003 - External Movement

Electrical Backing Board Resinous Board 1m2 South Good Condition (1) Low (1) Low Priority (2-3)
 3382/B00D/R0004/Electrical Backing Board/S10 **Chrysotile (white asbestos)**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1953 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00D/Eaves Linings/S20					Chrysotile (white asbestos)
Underfloor Voids	Packing					No Asbestos Detected
	3382/B00D/Underfloor Voids/S19					
Ceiling Voids - Raked Ceiling	No Asbestos Found					

Interior**B00D - R0001 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3382/B00D/R0001/Floor Coverings Res/Textile/S21					No Asbestos Detected

B00D - R0002 - Practical Activities - 1hb

No Asbestos

B00D - R0004 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00D/R0004/Electrical Backing Board/S10					Chrysotile (white asbestos)

B00D - R0005 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	3382/B00D/R0005/Wall Linings Internal/S9					

B00D - R0006 - General Storeroom

Floor Coverings Res/Textile	Vinyl Sheet					
	3382/B00D/R0006/Floor Coverings Res/Textile/S22					No Asbestos Detected

B00D - R0007 - General Storeroom

No Asbestos

B00D - R0008 - Communal/Performance Store

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	3382/B00D/R0005/Wall Linings Internal/S9					

B00D - R0009 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3382/B00D/R0001/Floor Coverings Res/Textile/S21					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Administration - 1880 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Packing to Floor Joists
No Asbestos Found

Ceiling Voids - Raked Ceiling
Non Accessible Area
- height - 4 meters

Interior**B00E - R0002 - General Storeroom**

Floor Coverings Res/Textile
Vinyl Tiles (Under Floor Covering/Carpet)
3382/B00E/R0002/Floor Coverings Res/Textile/S23
No Asbestos Detected

B00E - R0003 - External Movement

Ceiling Structures/Linings
Flat AC Sheeting
1m2 West
Good Condition (1) Low (1) Low Priority (2-3)
3382/B00H/R0019/Ceiling Structures/Linings/S1
Chrysotile (white asbestos) , Amosite (brown asbestos)

Electrical Backing Board
Resinous Board
1m2 South
Good Condition (1) Low (1) Low Priority (2-3)
3382/B00D/R0004/Electrical Backing Board/S10
Chrysotile (white asbestos)

B00E - R0004 - Sick Bay

Wall Linings Internal
Flat AC Sheeting
3382/B00D/R0005/Wall Linings Internal/S9
No Asbestos Detected

B00E - R0005 - Sick Bay - Shower/Toilet

Ceiling Structures/Linings
Flat AC Sheeting
4m2 Throughout
Good Condition (1) Low (1) Low Priority (2-3)
3382/B00H/R0019/Ceiling Structures/Linings/S1
Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal
Flat AC Sheeting
3382/B00D/R0005/Wall Linings Internal/S9
No Asbestos Detected

B00E - R0006 - Clerical Office

Floor Coverings Res/Textile
Vinyl Tiles
3m2 South, West
Minimal Damage (2) Low (1) Low Priority (2-3)
3382/B00F/R0005/Floor Coverings Res/Textile/S11
Chrysotile (white asbestos)

B00E - R0007 - Principal

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1972 - Brick/Veneer (Brick/Veneer)

Exterior

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00F/Gable Verge Lining/S24					Chrysotile (white asbestos) , Amosite (brown asbestos)
Eaves Linings	Flat AC Sheeting	15m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
In-fill-panel	Flat AC Sheeting	10m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00F/R0006/Panels Under Windows/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

Interior

B00F - R0001 - Toilets - Boys/Girls

No Asbestos

B00F - R0002 - Home Base Store

No Asbestos

B00F - R0003 - Home Base

No Asbestos

B00F - R0004 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	5m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3382/B00F/R0005/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00F - R0005 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3382/B00F/R0005/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00F - R0006 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	24m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
In-fill-panel	Flat AC Sheeting	8m	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00F/R0006/Panels Under Windows/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1953 - Timber (Timber)**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00G/Eaves Linings/S25					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- height - 3.6 meters					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

Interior**B00G - R0002 - Practical Activities - 1hb**

No Asbestos

B00G - R0003 - General Storeroom

No Asbestos

B00G - R0004 - Withdrawal Space - 1hb

No Asbestos

B00G - R0005 - Home Base

Heater Surround	Flat AC Sheeting	1Unit(s)	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00G/R0005/Panels Behind Heater/S13					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3382/B00G/R0008/Floor Coverings Res/Textile/S26					No Asbestos Detected

B00G - R0006 - Practical Activities - 1hb

No Asbestos

B00G - R0007 - Cleaning Supplies

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3382/B00F/R0005/Floor Coverings Res/Textile/S11					Chrysotile (white asbestos)

B00G - R0008 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3382/B00G/R0008/Floor Coverings Res/Textile/S26					No Asbestos Detected

B00G - R0010 - Home Base

Ceiling Structures/Linings	Flat AC Sheeting	15m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

Wall Linings Internal	Flat AC Sheeting					
	3382/B00D/R0005/Wall Linings Internal/S9					No Asbestos Detected

B00G - R0011 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	31m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - 1962 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	120m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/Eaves Linings/S27				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids - Raked Ceiling	Non Accessible Area - height - 3.6 meters					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					

Interior

B00H - R0001 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3382/B00H/R0001/Floor Coverings Res/Textile/S28				No Asbestos Detected	

B00H - R0002 - Home Base Store

No Asbestos

B00H - R0003 - Raised Platform

No Asbestos

B00H - R0004 - Communal Space

No Asbestos

B00H - R0006 - Movement

No Asbestos

B00H - R0007 - Movement

No Asbestos

B00H - R0008 - Staff Room Annexe

No Asbestos

B00H - R0009 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0009/Wall Linings Internal/S2				Chrysotile (white asbestos)	

B00H - R0010 - Staff Room Annexe

No Asbestos

B00H - R0011 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles					
	3382/B00H/R0017/Floor Coverings Res/Textile/S31				No Asbestos Detected	
Floor Coverings Res/Textile	Vinyl Tiles	60.39m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0011/Floor Coverings Res/Textile/S30				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
	3382/B00H/R0011/Floor Coverings Res/Textile/S43				No Asbestos Detected	

B00H - R0012 - Home Base Store

No Asbestos

B00H - R0013 - Home Base Store

No Asbestos

B00H - R0014 - Cleaning Distributed Store

Floor Coverings Res/Textile	Vinyl Sheet					
	3382/B00H/R0014/Floor Coverings Res/Textile/S3				No Asbestos Detected	

B00H - R0015 - Practical Activities - 1hb

No Asbestos

B00H - R0016 - Home Base Store

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3382/B00H/R0017/Floor Coverings Res/Textile/S31					No Asbestos Detected
B00H - R0017 - Withdrawal Space - 1hb						
Fume Cupboard	Flat AC Sheeting	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0017/Fume Cupboard/S4					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3382/B00H/R0017/Floor Coverings Res/Textile/S31					No Asbestos Detected
B00H - R0018 - Home Base						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3382/B00H/R0017/Floor Coverings Res/Textile/S31					No Asbestos Detected
B00H - R0019 - External Movement						
Ceiling Structures/Linings	Flat AC Sheeting	106m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	3m2	Upper portion, Middle portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0009/Wall Linings Internal/S2					Chrysotile (white asbestos)
Electrical Backing Board	Resinous Board	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Electrical Backing Board/S29					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00H - R0020 - Sick Bay						
No Asbestos						
B00H - R0021 - Disabled Toilet						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1963 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00J/Eaves Linings/S32					Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00J - R0001 - Canteen**

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00J/R0001/Wall Linings Internal/S34					Chrysotile (white asbestos)

B00J - R0002 - Movement

No Asbestos

B00J - R0003 - Canteen Office/Store

No Asbestos

B00J - R0004 - Staff Toilet

Rope Lining To Incinrette	Rope Lining	1Unit(s)	East	Friable Asbestos (5)	Medium (2)	Medium Priority (4-5)
	3382/B00K/R0005/Rope Lining To Incinrette/S6					Chrysotile (white asbestos)

B00J - R0005 - Uniform Shop

No Asbestos

B00J - R0006 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	9.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00J/R0006/Ceiling Structures/Linings/S33					Chrysotile (white asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00K - Pupil Facilities - 1963 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00K/Eaves Linings/S35					Chrysotile (white asbestos)
Ceiling Voids - Flat Roof	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior**B00K - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00K/R0002/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)

B00K - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	27m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00K/R0002/Partition Walls (Cubicles)/S7					Chrysotile (white asbestos)
Rope Lining To Incinrette	Rope Lining	1Unit(s)	South	Friable Asbestos (5)	Medium (2)	Low Priority (2-3)
	3382/B00K/R0005/Rope Lining To Incinrette/S6					Chrysotile (white asbestos)

B00K - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Rope Lining To Incinrette	Rope Lining	1Unit(s)	East	Friable Asbestos (5)	Medium (2)	Medium Priority (4-5)
	3382/B00K/R0005/Rope Lining To Incinrette/S6					Chrysotile (white asbestos)

B00K - R0004 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	14m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00K - R0005 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
Rope Lining To Incinrette	Rope Lining	1Unit(s)	East	Friable Asbestos (5)	Medium (2)	Medium Priority (4-5)
	3382/B00K/R0005/Rope Lining To Incinrette/S6					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Pupil Facilities - 1963 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00L/Eaves Linings/S36			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00L - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00L/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00L - R0002 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00L/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00L - R0003 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting	43m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00L/R0001/Ceiling Structures/Linings/S5			Chrysotile (white asbestos) , Amosite (brown asbestos)		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00M - Administration - 1962 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00M/Eaves Linings/S37				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Underfloor Voids - Packing to Floor Joists	No Asbestos Found				No Asbestos Detected	
Ceiling Voids - Raked Ceiling	Loose Fill				No Asbestos Detected	
	3382/B00M/Ceiling Voids - Raked Ceiling/S41				No Asbestos Detected	
Electrical Backing Board	Resinous Board	1m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00M/Electrical Backing Board/S42				Chrysotile (white asbestos)	

Interior

B00M - R0001 - Laundry - Type 2

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Wall Linings Internal	Flat AC Sheeting				No Asbestos Detected	
	3382/B00D/R0005/Wall Linings Internal/S9				No Asbestos Detected	

B00M - R0002 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Wall Linings Internal	Flat AC Sheeting				No Asbestos Detected	
	3382/B00D/R0005/Wall Linings Internal/S9				No Asbestos Detected	

B00M - R0003 - Interview

No Asbestos

B00M - R0004 - No Access

No Asbestos

B00M - R0005 - Clerical Office

No Asbestos

B00M - R0006 - Interview

No Asbestos

B00M - R0007 - Staff Shower/Change

Wall Linings Internal	Flat AC Sheeting				No Asbestos Detected	
	3382/B00D/R0005/Wall Linings Internal/S9				No Asbestos Detected	

B00M - R0008 - Movement

No Asbestos

B00M - R0009 - Special Programs Room

Heater Surround	Flat AC Sheeting				No Asbestos Detected	
	3382/B00M/R0009/In-fill Panel Behind Heater/S14				No Asbestos Detected	

B00M - R0010 - Staff Kitchen

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Wall Linings Internal	Flat AC Sheeting				No Asbestos Detected	
	3382/B00D/R0005/Wall Linings Internal/S9				No Asbestos Detected	

B00M - R0011 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00N - Building Services - 1962 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3382/B00N/Eaves Linings/S40					Chrysotile (white asbestos)
Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					

Interior

B00N - R0001 - General Assistant/Bulk Store

Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Poor Condition (4)	Medium (2)	Low Priority (2-3)
	3382/B00H/R0019/Ceiling Structures/Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Building Services - 2002 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00P - R0001 - Sports Store

No Asbestos

B00P - R0002 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Q - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

Interior

B00Q - R0001 - Communal Space

No Asbestos

B00Q - R0002 - Communal/Performance Store

No Asbestos

B00Q - R0003 - External Movement

No Asbestos

B00Q - R0004 - Covered Outdoor Learning Area

No Asbestos

B00Q - R0005 - No Access

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017