


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Warrawee Public School (3390)  
**Region :** Northern Sydney  
**State Electorate :** Ku-ring-gai  
**Local Government Area :** Ku-Ring-Gai

**Initial Survey :** Noel Arnold & Associates : 18 - Jan - 2008  
**Reviewed By :** Grencap-NAA : 13 - Aug - 2014

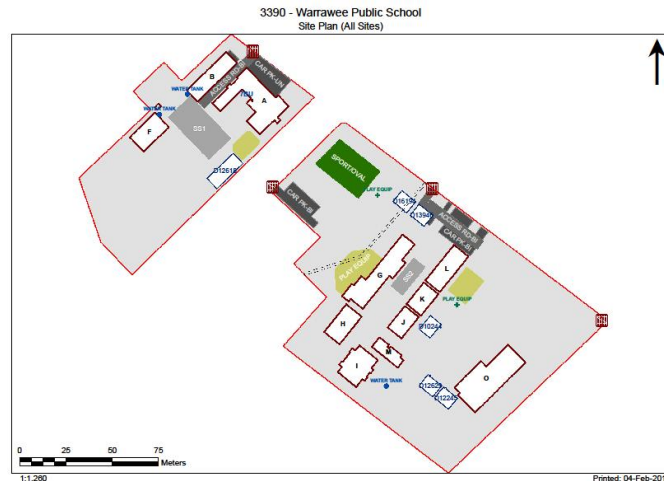

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Administration - 1967 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00A/Eaves Linings/S3					Chrysotile (white asbestos)	

**Interior****B00A - R0001 - Home Base (66.19 m2)**

No Asbestos

**B00A - R0002 - Home Base Store (8.71 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00A/R1012/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	

**B00A - R0003 - Cleaning Supplies (2.5 m2)**

No Asbestos

**B00A - R0004 - External Movement (3.4 m2)**

No Asbestos

**B00A - R0005 - Movement (37.01 m2)**

No Asbestos

**B00A - R0006 - Special Programs Room (59.56 m2)**

No Asbestos

**B00A - R0007 - Staff Room (42.28 m2)**

No Asbestos

**B00A - R0008 - Staff Toilet (7.92 m2)**

Wall Linings Internal	Flat AC Sheeting	28m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00A/R0008/Wall Linings Internal/S1					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00A/R0008/Wall Linings Internal/S1					Chrysotile (white asbestos)	

**B00A - R0009 - Cleaning Distributed Store (2.53 m2)**

Infill Panel	Flat AC Sheeting	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00A/R0008/Wall Linings Internal/S1					Chrysotile (white asbestos)	

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00A/R0024/Ceiling Structures/Linings/S2					Chrysotile (white asbestos)	

**B00A - R0010 - Movement (11.32 m2)**

No Asbestos

**B00A - R0011 - External Movement (1.49 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00A/Eaves Linings/S3					Chrysotile (white asbestos)	

**B00A - R0012 - Movement (29.16 m2)**

No Asbestos

**B00A - R0013 - Movement (2.05 m2)**

No Asbestos

**B00A - R0014 - Clerical Office (11.29 m2)**

No Asbestos

**B00A - R0015 - Principal (25.85 m2)**

No Asbestos

**B00A - R0016 - Movement (3.66 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00A/R0024/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0017 - General Storeroom (4.14 m2)</b>						
No Asbestos						
<b>B00A - R0018 - Clerical Office (47.41 m2)</b>						
No Asbestos						
<b>B00A - R0019 - Canteen Office/Store (2.74 m2)</b>						
No Asbestos						
<b>B00A - R0020 - Movement (0.75 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00A/R0024/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0021 - Movement (1.22 m2)</b>						
No Asbestos						
<b>B00A - R0022 - Staff Toilet (4.28 m2)</b>						
No Asbestos						
<b>B00A - R0023 - Canteen (20.65 m2)</b>						
No Asbestos						
<b>B00A - R0024 - Movement (24.9 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00A/R0024/Ceiling Structures/Linings/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0025 - Cleaning Supplies (3.21 m2)</b>						
No Asbestos						
<b>B00A - R0026 - Cleaning Supplies (2.91 m2)</b>						
No Asbestos						
<b>B00A - R0027 - Movement (2.55 m2)</b>						
No Asbestos						
<b>B00A - R0028 - External Movement (1.16 m2)</b>						
No Asbestos						
<b>B00A - R0029 - Security Store (11.02 m2)</b>						
No Asbestos						
<b>B00A - R0030 - Stairs (5.01 m2)</b>						
No Asbestos						
<b>B00A - R0031 - Stairs (4.37 m2)</b>						
No Asbestos						
<b>B00A - R1001 - Movement (8.83 m2)</b>						
No Asbestos						
<b>B00A - R1002 - General Storeroom (7.41 m2)</b>						
No Asbestos						
<b>B00A - R1003 - General Storeroom (7.97 m2)</b>						
No Asbestos						
<b>B00A - R1004 - Withdrawal Space - 1hb (48.12 m2)</b>						
No Asbestos						
<b>B00A - R1005 - Home Base (48.33 m2)</b>						
No Asbestos						
<b>B00A - R1006 - Home Base (42.99 m2)</b>						
No Asbestos						
<b>B00A - R1007 - Home Base (60.32 m2)</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00A - R1008 - Movement (20.67 m2)**

No Asbestos

**B00A - R1009 - Personal Effects Storage (11.7 m2)**

No Asbestos

**B00A - R1010 - Movement (25.37 m2)**

No Asbestos

**B00A - R1011 - Personal Effects Storage (7.52 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00A/R1012/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

**B00A - R1012 - Security Store (9.1 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00A/R1012/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

**B00A - R1013 - Home Base (66.84 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	67m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00A/R1012/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>	

**B00A - R1014 - Stairs (11.7 m2)**

No Asbestos

**B00A - R1015 - Stairs (12.42 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning - 1952 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	50m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00B/R0015/Ceiling Structures/Linings/S15			<b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>		
Gable Verge Linings	Flat AC Sheeting	30m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00B/R0015/Ceiling Structures/Linings/S15			<b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>		

**Interior****B00B - R0001 - Home Base (56.77 m2)**

No Asbestos

**B00B - R0002 - Home Base Store (4.59 m2)**

No Asbestos

**B00B - R0003 - Cleaning Distributed Store (0.54 m2)**

No Asbestos

**B00B - R0004 - Movement (5.46 m2)**

No Asbestos

**B00B - R0005 - Toilets - Boys/Girls (5.66 m2)**

No Asbestos

**B00B - R0006 - Personal Effects Storage (2.84 m2)**

No Asbestos

**B00B - R0007 - External Movement (1.47 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00B/R0015/Ceiling Structures/Linings/S15			<b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>		

**B00B - R0008 - General Storeroom (0.55 m2)**

No Asbestos

**B00B - R0009 - Home Base Store (4.59 m2)**

No Asbestos

**B00B - R0010 - Home Base (56.61 m2)**

No Asbestos

**B00B - R0011 - Home Base (55.98 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	56m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00B/R0012/Floor Coverings Res/Textile/S16			<b>Chrysotile (white asbestos)</b>		
Vinyl tile adhesive	Adhesive					<b>No Asbestos Detected</b>
	3390/B00B/R0011/Vinyl tile adhesive/S18					

**B00B - R0012 - Interview (19.53 m2)**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00B/R0012/Floor Coverings Res/Textile/S16			<b>Chrysotile (white asbestos)</b>		
Vinyl tile adhesive	Adhesive					<b>No Asbestos Detected</b>
	3390/B00B/R0011/Vinyl tile adhesive/S18					

**B00B - R0013 - Movement (5.62 m2)**

No Asbestos

**B00B - R0014 - Cleaning Distributed Store (0.46 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00B/R0015/Ceiling Structures/Linings/S15			<b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>		

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R0015 - External Movement (1.43 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00B/R0015/Ceiling Structures/Linings/S15				<b>Chrysotile (white asbestos) , Crocidolite (blue asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning - 1906 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	25m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00A/R0024/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	
Infill Panel Below Window	Flat AC Sheeting	8m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00F/R0007/infill panels below windows/S5				<b>Chrysotile (white asbestos)</b>	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00F - R0001 - Home Base (56.86 m2)**

No Asbestos

**B00F - R0002 - Personal Effects Storage (15.38 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	3390/B00F/R0002/Floor Coverings Res/Textile/S4				<b>No Asbestos Detected</b>	

**B00F - R0003 - Cleaning Distributed Store (0.82 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	3390/B00F/R0002/Floor Coverings Res/Textile/S4				<b>No Asbestos Detected</b>	

**B00F - R0004 - Home Base (56.71 m2)**

No Asbestos

**B00F - R0005 - Home Base Store (6.02 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	3390/B00F/R0002/Floor Coverings Res/Textile/S4				<b>No Asbestos Detected</b>	

**B00F - R0006 - Home Base Store (4.99 m2)**

Floor Coverings Res/Textile	Vinyl Sheet					
	3390/B00F/R0002/Floor Coverings Res/Textile/S4				<b>No Asbestos Detected</b>	

**B00F - R0007 - External Movement (34.04 m2)**

Infill Panels Below Windows	Flat AC Sheeting	8m2	South facing, East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00F/R0007/infill panels below windows/S5				<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00A/R0024/Ceiling Structures/Linings/S2				<b>Chrysotile (white asbestos)</b>	

**B00F - R9001 - Toilets - Girls (31.04 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet					
	3390/B00M/R0005/Partition Walls (Cubicles)/S7				<b>No Asbestos Detected</b>	
Ceiling Structures/Linings	Vermiculite	32m2	Throughout	Friable Asbestos (5)	Medium (2)	High Priority (6-8)
	3390/B00F/R9002/Ceiling Structures/Linings/S17				<b>Chrysotile (white asbestos)</b>	

**B00F - R9002 - Movement (4.26 m2)**

Ceiling Structures/Linings	Vermiculite	5m2	Throughout	Friable Asbestos (5)	Medium (2)	High Priority (6-8)
	3390/B00F/R9002/Ceiling Structures/Linings/S17				<b>Chrysotile (white asbestos)</b>	

**B00F - R9003 - External Movement (17.26 m2)**

No Asbestos

**B00F - R9004 - Movement (3.41 m2)**

Ceiling Structures/Linings	Vermiculite	4m2	Throughout	Friable Asbestos (5)	Medium (2)	High Priority (6-8)
	3390/B00F/R9002/Ceiling Structures/Linings/S17				<b>Chrysotile (white asbestos)</b>	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R9005 - Toilets - Boys (28.2 m2)</b>						
Partition Walls (Cubicles)	Compressed AC Sheet					
	3390/B00M/R0005/Partition Walls (Cubicles)/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Vermiculite	29m2	Throughout	Friable Asbestos (5)	Medium (2)	High Priority (6-8)
	3390/B00F/R9002/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos)</b>
<b>B00F - R9006 - Sports Store (16.71 m2)</b>						
No Asbestos						

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning/Administration - 1967 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00G/R0006/Ceiling Structures/Linings/S12			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Verge Linings	Flat AC Sheeting	30m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00G/R0006/Ceiling Structures/Linings/S12			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Above Window Panels	Flat AC Sheeting	1m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00G/R0006/Ceiling Structures/Linings/S12			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00G - R0001 - Home Base (85.63 m2)**

No Asbestos

**B00G - R0002 - Toilets - Boys/Girls (2.64 m2)**

Wall Linings Internal	Flat AC Sheeting	6m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00A/R0008/Wall Linings Internal/S1			<b>Chrysotile (white asbestos)</b>		

**B00G - R0003 - Home Base Store (2.84 m2)**

No Asbestos

**B00G - R0004 - Personal Effects Storage (5.66 m2)**

No Asbestos

**B00G - R0005 - Movement (2.08 m2)**

No Asbestos

**B00G - R0006 - External Movement (24.04 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00G/R0006/Ceiling Structures/Linings/S12			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Infill Panel Above Door	Flat AC Sheeting	1m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00G/R0006/Ceiling Structures/Linings/S12			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00G - R0007 - Staff Toilet (2.94 m2)**

No Asbestos

**B00G - R0008 - Interview (10.89 m2)**

No Asbestos

**B00G - R0009 - Sick Bay (7.53 m2)**

No Asbestos

**B00G - R0010 - Entry Vestibule (7.3 m2)**

No Asbestos

**B00G - R0011 - Clerical Office (11.78 m2)**

No Asbestos

**B00G - R0012 - Movement (14.93 m2)**

No Asbestos

**B00G - R0013 - Duplicating Workroom (16.57 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00G - R0014 - Security Store (11.03 m2)</b>						
No Asbestos						
<b>B00G - R0015 - Principal (11.09 m2)</b>						
No Asbestos						
<b>B00G - R0016 - Staff Room (56.74 m2)</b>						
No Asbestos						
<b>B00G - R0017 - Staff Toilet (2.42 m2)</b>						
No Asbestos						
<b>B00G - R0018 - General Storeroom (6.65 m2)</b>						
No Asbestos						
<b>B00G - R0019 - Movement (5.13 m2)</b>						
No Asbestos						
<b>B00G - R0020 - Cleaning Distributed Store (0.57 m2)</b>						
No Asbestos						
<b>B00G - R0021 - External Movement (1.51 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00G/R0006/Ceiling Structures/Linings/S12			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
panel above door	Flat AC Sheeting	1m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00G/R0006/Ceiling Structures/Linings/S12			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
<b>B00G - R0022 - Cleaning Distributed Store (0.57 m2)</b>						
No Asbestos						
<b>B00G - R0023 - Personal Effects Storage (6.3 m2)</b>						
No Asbestos						
<b>B00G - R0024 - Home Base Store (2.65 m2)</b>						
No Asbestos						
<b>B00G - R0025 - Home Base (56.9 m2)</b>						
No Asbestos						
<b>B00G - R9001 - Out Of School Hours Care Centre (52.91 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	53m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00G/Room+1/Ceiling Structures/Linings/S6			<b>Chrysotile (white asbestos)</b>		
<b>B00G - R9003 - General Storeroom (128.45 m2)</b>						
No Asbestos						
<b>B00G - R9004 - Garden Store (16.43 m2)</b>						
No Asbestos						
<b>B00G - R9005 - Toilets-Unisex (17.53 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00G/Room+1/Ceiling Structures/Linings/S6			<b>Chrysotile (white asbestos)</b>		
<b>B00G - R9006 - External Movement (39.19 m2)</b>						
No Asbestos						
<b>B00G - R9007 - Other-After School Care (33.99 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	34m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00G/Room+1/Ceiling Structures/Linings/S6			<b>Chrysotile (white asbestos)</b>		
<b>B00G - R9008 - Staff Kitchen (10.5 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00G/Room+1/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
<b>B00G - R9009 - Clerical Office (9.72 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00G/Room+1/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
<b>B00G - Room+1 - GR9009</b>						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00G/Room+1/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
<b>B00G - Room+2 - GR9005</b>						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00G/Room+1/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
<b>B00G - Room+3 - GR9006</b>						
Ceiling Structures/Linings	Flat AC Sheeting	24m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00G/Room+1/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	
<b>B00G - Room+4 - GR9008</b>						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00G/Room+1/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00H - General Learning - 1967 - Brick/Veneer (Brick/Veneer)****Exterior**

Eaves Linings	Flat AC Sheeting 3390/B00G/R0006/Ceiling Structures/Linings/S12	20m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Gable Verge Linings	Flat AC Sheeting 3390/B00G/R0006/Ceiling Structures/Linings/S12	30m	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior****B00H - R0001 - Home Base (57.67 m2)**

No Asbestos

**B00H - R0002 - Home Base Store (4.52 m2)**

No Asbestos

**B00H - R0003 - Home Base Store (0.55 m2)**

No Asbestos

**B00H - R0004 - External Movement (1.91 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3390/B00G/Room+1/Ceiling Structures/Linings/S6	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>

**B00H - R0005 - Movement (4.19 m2)**

No Asbestos

**B00H - R0006 - Personal Effects Storage (10.38 m2)**

Infill Panel Behind Sink	Flat AC Sheeting 3390/B00H/R0006/panel behind sink/S11					<b>No Asbestos Detected</b>
Wall Linings Internal	Flat AC Sheeting 3390/B00G/R0006/Ceiling Structures/Linings/S12	12m2	North facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00H - R0007 - Home Base Store (0.37 m2)**

No Asbestos

**B00H - R0008 - Home Base Store (4.68 m2)**

No Asbestos

**B00H - R0009 - Home Base (57.52 m2)**

No Asbestos

**B00H - R9001 - General Assistant/Bulk Store (57.54 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3390/B00G/Room+1/Ceiling Structures/Linings/S6	58m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>

**B00H - R9002 - Cleaning Supplies (39.79 m2)**

No Asbestos

**B00H - R9003 - Special Programs Room (86.23 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3390/B00G/Room+1/Ceiling Structures/Linings/S6	87m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - General Learning - 1952 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting 3390/B00I/Eaves Linings/S9	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00I - R0001 - External Movement (7.92 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3390/B00I/Eaves Linings/S9	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	-----	--------------	--------------------	---------	--

**B00I - R0002 - Home Base (61.4 m2)**

No Asbestos

**B00I - R0003 - Home Base Store (4.98 m2)**

No Asbestos

**B00I - R0004 - Withdrawal Space - 1hb (11.29 m2)**

No Asbestos

**B00I - R0005 - Home Base Store (5.04 m2)**

No Asbestos

**B00I - R0006 - External Movement (7.69 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3390/B00I/Eaves Linings/S9	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	-----	--------------	--------------------	---------	--

**B00I - R0007 - Home Base (61.39 m2)**

No Asbestos

**B00I - R0008 - External Movement (10.69 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3390/B00I/Eaves Linings/S9	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	------	--------------	--------------------	---------	--

**B00I - R0009 - Distribution Board (0.43 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00I - R0010 - Personal Effects Storage (3.33 m2)**

No Asbestos

**B00I - R0011 - Security Store (3.26 m2)**

No Asbestos

**B00I - R0012 - Practical Activities - 1hb (35.69 m2)**

No Asbestos

**B00I - R0013 - Cleaning Distributed Store (3.24 m2)**

No Asbestos

**B00I - R0014 - Personal Effects Storage (3.74 m2)**

No Asbestos

**B00I - R0015 - Movement (11.05 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3390/B00I/Eaves Linings/S9	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	--	------	--------------	--------------------	---------	--

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Special Purpose - 1952 - Steel (Steel)**

**Exterior**

Gable Ends	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Height restricted no access</b>						
Wall Cladding	Flat AC Sheeting	3m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00J/R0003/Wall Linings Internal/S10					<b>Chrysotile (white asbestos)</b>	

**Interior**

**B00J - R0001 - Home Base (53.15 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00J/R0003/Wall Linings Internal/S10					<b>Chrysotile (white asbestos)</b>	

**B00J - R0002 - Home Base (53.15 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00J/R0003/Wall Linings Internal/S10					<b>Chrysotile (white asbestos)</b>	

**B00J - R0003 - General Storeroom (9.65 m2)**

Wall Linings Internal	Flat AC Sheeting	200m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00J/R0003/Wall Linings Internal/S14					<b>Chrysotile (white asbestos)</b>	

**B00J - R0004 - External Movement (19.33 m2)**

Wall Linings Internal	Flat AC Sheeting	20m2	North facing, South facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
3390/B00J/R0003/Wall Linings Internal/S10					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - General Learning/Support Unit - 1952 - Steel (Steel)**

**Exterior**

Gable Ends	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
------------	------------------	------	-------------------------------	--------------------	---------	--------------------

**Assumed Asbestos - Height restricted no access**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00K - R0001 - Home Base Store - M (5.76 m2)**

No Asbestos

**B00K - R0002 - Home Base - M (53.66 m2)**

No Asbestos

**B00K - R0003 - Withdrawal Space - 1hb (53.8 m2)**

No Asbestos

**B00K - R0004 - Home Base Store (5.76 m2)**

No Asbestos

**B00K - R0005 - External Movement (23.01 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Communal Facilities - 1960 - Steel (Steel)**

**Exterior**

Gable Ends	Flat AC Sheeting	30m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00J/R0003/Wall Linings Internal/S14				Chrysotile (white asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00L - R0001 - External Movement (45.93 m2)**

No Asbestos

**B00L - R0005 - Uniform Shop (5.55 m2)**

No Asbestos

**B00L - R0006 - Uniform Shop (10.95 m2)**

No Asbestos

**B00L - R0007 - Uniform Shop (5.8 m2)**

No Asbestos

**B00L - R0008 - Home Base (66.19 m2)**

No Asbestos

**B00L - R0009 - Withdrawal Space - 2hb (14.63 m2)**

No Asbestos

**B00L - R0010 - Practical Activities - 2hb (16.46 m2)**

No Asbestos

**B00L - R0011 - Home Base (54.12 m2)**

No Asbestos

**B00L - R0012 - Home Base Store - M (6.64 m2)**

No Asbestos

**B00L - R0013 - Toilet - Lobby (3.42 m2)**

No Asbestos

**B00L - R0014 - Staff Toilet (2.2 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Pupil Facilities - 1960 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00M/R0002/Ceiling Structures/Linings/S13			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00M - R0001 - Toilets - Boys (35.73 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
	3390/B00M/R0005/Partition Walls (Cubicles)/S7					

**B00M - R0002 - Drinking Facilities (8.61 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00M/R0002/Ceiling Structures/Linings/S13			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00M - R0003 - Disabled Toilet (7.69 m2)**

No Asbestos

**B00M - R0004 - No Access (7.08 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3390/B00M/R0002/Ceiling Structures/Linings/S13			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00M - R0005 - Toilets - Girls (32.94 m2)**

Partition Walls (Cubicles)	Compressed AC Sheet					<b>No Asbestos Detected</b>
	3390/B00M/R0005/Partition Walls (Cubicles)/S7					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B000 - Communal Facilities - 2010 - Brick/Veneer (Brick/Veneer)****Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids - Slab on Ground No Asbestos Found

**Interior****B000 - R0001 - Covered Outdoor Learning Area (194.42 m2)**

No Asbestos

**B000 - R0002 - Communal Space (199.9 m2)**

No Asbestos

**B000 - R0003 - Raised Platform (56.64 m2)**

No Asbestos

**B000 - R0004 - Hall Chair Store (11.13 m2)**

No Asbestos

**B000 - R0005 - Communal/Performance Store (10.98 m2)**

No Asbestos

**B000 - R0006 - P.E. Store (16.28 m2)**

No Asbestos

**B000 - R0007 - Toilet - Lobby (2.49 m2)**

No Asbestos

**B000 - R0008 - Toilets - Girls (7.44 m2)**

No Asbestos

**B000 - R0009 - Sound Cupboard (2.06 m2)**

No Asbestos

**B000 - R0010 - Toilets - Boys (5.74 m2)**

No Asbestos

**B000 - R0011 - Toilet - Lobby (3.44 m2)**

No Asbestos

**B000 - R0012 - Cleaning Distributed Store (2.61 m2)**

No Asbestos

**B000 - R0013 - Main Switch Board (4.36 m2)**

No Asbestos

**B000 - R0014 - Toilet - P (7.03 m2)**

No Asbestos

**B000 - R0015 - Plant (1.62 m2)**

No Asbestos

**B000 - R0016 - Movement (6.3 m2)**

No Asbestos

**B000 - R0017 - Movement (16.77 m2)**

No Asbestos

**B000 - R0018 - Movement (12.91 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B0D2 - Building Services - 1906 - Brick/Block (Brick/Block)**

**Exterior**

No Asbestos

**Interior**

**B0D2 - R0001 - Garden Store (4.45 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D10244 - Learning Unit - Standard With P.A.A. : Placement Date - 21/01/2014**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

**Interior**

**R1 - Learning space/withdrawal/entry**

Ceiling	Flat AC Sheet	Assumed Asbestos	70 m2
---------	---------------	------------------	-------

**R2 - Home Base Store**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	3 m2

**OS 602 - D11709 - Learning Unit - Standard With P.A.A. : Placement Date - 22/01/2011**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D12245 - Learning Unit - Standard With P.A.A. : Placement Date - 13/03/2009**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.


**R2 - Home Base Store**

No Asbestos Found.

**OS 534 - D12618 - Library/Group Study/Office/A V Store : Placement Date - 30/06/1995**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	23.04 m2

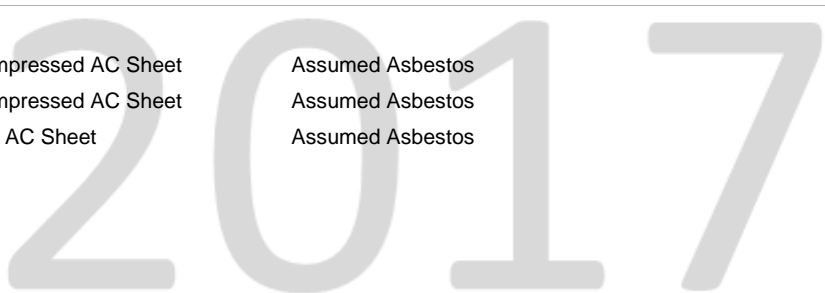

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>Interior</b>						
<b>R1 - Clerical Office</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - Staff Room</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				36 m2
<b>R3 - Security Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R4 - Principal</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				16 m2
<b>R5 - Staff Toilet</b>						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2
<b>R6 - Staff Toilet</b>						
Toilet partitions	Compressed AC Sheet	Assumed Asbestos				4 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				5 m2
<b>R7 - Reading Area</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				54 m2
<b>R8 - Entry</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				14 m2
<b>OS 602 - D12629 - Learning Unit - Standard With P.A.A. : Placement Date - 13/03/2009</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 602 - D13946 - Learning Unit - Standard With P.A.A. : Placement Date - 3/01/2012</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 602 - D16194 - Learning Unit - Standard With P.A.A. : Placement Date - 3/01/2012</b>						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017