


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Waterfall Public School (3396)
Region : Sydney
State Electorate : Heathcote
Local Government Area : Sutherland

Initial Survey : Noel Arnold & Associates : 26 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 01 - Nov - 2016

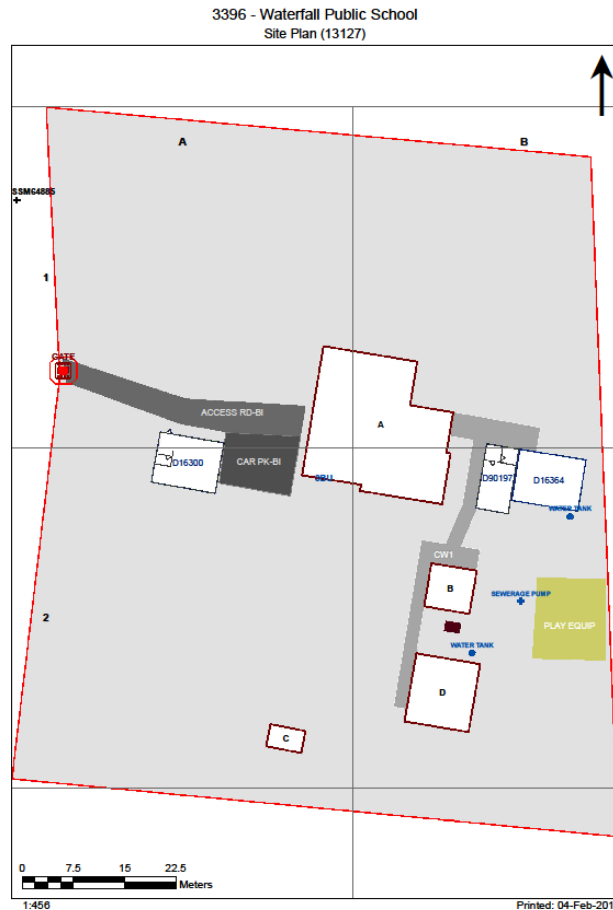

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning/Administration - 1884 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00A/Eaves Linings/S3				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00A - R0002 - Home Base

Wall Linings Internal	Flat AC Sheeting	5m2	North facing, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00A/R0002/Wall Linings Internal/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	10m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00A/R0002/Ceiling Structures/Linings/S6				Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)	

B00A - R0003 - Home Base Store

No Asbestos

B00A - R0004 - Clerical Office/Workroom

No Asbestos

B00A - R0005 - Reading Area

No Asbestos

B00A - R0006 - Library Office/Workroom

Ceiling Structures/Linings	Flat AC Sheeting	7m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00A/R0006/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0007 - K.L.A. Store

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00A/R0006/Ceiling Structures/Linings/S5				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0008 - Covered Outdoor Learning Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities/Staff Facilities - 1955 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	5m2	East facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00B/Eaves Linings/S4					Chrysotile (white asbestos)
Underfloor Void	No Asbestos Found					

Interior**B00B - R0005 - Toilets - Boys**

Wall Linings Internal	Flat AC Sheeting	15m2	South facing, East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00B/R0005/Wall Linings Internal/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00B/R0005/Wall Linings Internal/S1					Chrysotile (white asbestos)

B00B - R0007 - Toilets - Boys/Girls

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00B/R0013/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	25m2	North, East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00B/R0012/Wall Linings Internal/S8					Chrysotile (white asbestos)
Partition Walls (Cubicles)	Compressed AC Sheet					No Asbestos Detected
	3396/B00B/R0007/Partition Walls (Cubicles)/S9					

B00B - R0008 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00B/R0013/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	South, East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00B/R0012/Wall Linings Internal/S8					Chrysotile (white asbestos)

B00B - R0009 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00B/R0013/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00B/R0012/Wall Linings Internal/S8					Chrysotile (white asbestos)

B00B - R0012 - Toilet - Lobby

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00B/R0013/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00B/R0012/Wall Linings Internal/S8					Chrysotile (white asbestos)

B00B - R0013 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00B/R0013/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting	8m2	North, East & West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3396/B00B/R0012/Wall Linings Internal/S8					Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Other - 1955 - Timber (Timber)

Exterior

Ceiling Void	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00C - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Void	No Asbestos Found

Interior

B00D - R0001 - Reading Area

No Asbestos

B00D - R0002 - Practical Activities

No Asbestos

B00D - R0003 - K.L.A. Store

No Asbestos

B00D - R0004 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D16300 - Learning Unit - Standard With P.A.A. : Placement Date - 9/10/2014

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 601 - D16364 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

R2 - General Learning Space

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

R3 - Store

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

NS 020 - D90197 - Staff Study/Store : Placement Date - 30/06/1995

Exterior

No Asbestos Found.

Interior

R1 - Staff Room

No Asbestos Found.

R2 - Store

No Asbestos Found.

R3 - Entry

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017