


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Wee Waa Public School (3416)  
**Region :** New England  
**State Electorate :** Barwon  
**Local Government Area :** Narrabri

**Initial Survey :** Noel Arnold & Associates : 20 - May - 2008  
**Reviewed By :** Greencap-NAA : 01 - Apr - 2015

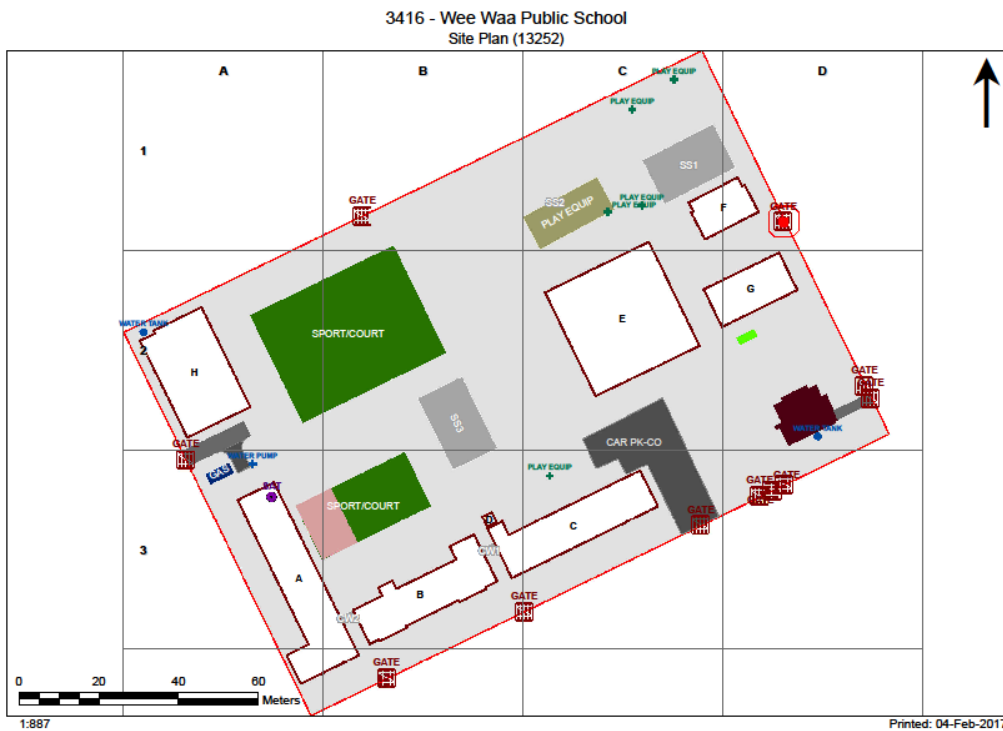

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Library - 1967 - Brick/Block (Brick/Block)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting 3416/B00A/Gable Verge Lining/S31					<b>No Asbestos Detected</b>
Eaves Linings	Flat AC Sheeting 3416/B00A/Eaves Linings/S29	150m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>
Ceiling Voids	No Asbestos Found					
Underfloor Voids - Slab on Ground						

**Interior**

**B00A - R0001 - Shower/Change**

No Asbestos

**B00A - R0002 - Shower/Change**

Partition Walls (Cubicles)	Compressed AC Sheet	30m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
	3416/B00A/R0002/Partition Walls (Cubicles)/S28					

**B00A - R0003 - Movement**

No Asbestos

**B00A - R0004 - Cleaning Supplies**

No Asbestos

**B00A - R0005 - Movement**

No Asbestos

**B00A - R0006 - Toilets - Girls**

No Asbestos

**B00A - R0007 - Staff Toilet**

No Asbestos

**B00A - R0008 - Staff Toilet**

No Asbestos

**B00A - R0009 - Cleaning Distributed Store**

No Asbestos

**B00A - R0010 - Toilets - Boys**

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
	3416/B00E/R0025/Partition Walls (Cubicles)/S8					

**B00A - R0011 - Sports Store**

No Asbestos

**B00A - R0012 - Plant**

No Asbestos

**B00A - R1001 - Staff Room Annexe**

No Asbestos

**B00A - R1002 - Staff Room Annexe**

No Asbestos

**B00A - R1003 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3416/B00A/R1003/Floor Coverings Res/Textile/S26	89.37m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
-----------------------------	--	---------	------------	--------------------	---------	--

**B00A - R1004 - Movement**

No Asbestos

**B00A - R1005 - Movement**

No Asbestos

**B00A - R1006 - Home Base Store**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00A - R1007 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3416/B00A/R1007/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>	

**B00A - R1008 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles	66.78m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3416/B00A/R1007/Floor Coverings Res/Textile/S13					<b>Chrysotile (white asbestos)</b>	

**B00A - R1009 - Reading Area**

No Asbestos

**B00A - R1010 - Library Office/Workroom**

Floor Coverings Res/Textile	Vinyl Tiles					
3416/B00A/R1010/Floor Coverings Res/Textile/S14					<b>No Asbestos Detected</b>	

**B00A - R1011 - K.L.A. Store**

Manhole	Flat AC Sheeting					
3416/B00A/R1011/Manhole/S27					<b>No Asbestos Detected</b>	

**B00A - R1012 - Main Switch Board**

Electrical Backing Board	Resinous Board	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						

**B00A - R1013 - Cleaning Distributed Store**

No Asbestos

**B00A - R1014 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning/Communal Facilities - 1936 - Timber (Timber)****Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	Non Accessible Area - Height Restriction

**Interior****B00B - R0001 - Movement**

No Asbestos

**B00B - R0002 - Special Programs Room**

Ceiling Structures/Linings	Flat AC Sheeting	83m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3416/B00B/R0002/Ceiling Structures/Linings/S10					<b>Chrysotile (white asbestos)</b>	

**B00B - R0003 - General Storeroom**

No Asbestos

**B00B - R0004 - General Storeroom**

No Asbestos

**B00B - R0005 - Movement**

No Asbestos

**B00B - R1001 - Music Store**

No Asbestos

**B00B - R1002 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3416/B00B/R1005/Floor Coverings Res/Textile/S25				<b>No Asbestos Detected</b>
-----------------------------	---	---	--	--	--	-----------------------------

**B00B - R1003 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3416/B00B/R1005/Floor Coverings Res/Textile/S25				<b>No Asbestos Detected</b>
-----------------------------	---	---	--	--	--	-----------------------------

**B00B - R1004 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3416/B00B/R1005/Floor Coverings Res/Textile/S25				<b>No Asbestos Detected</b>
-----------------------------	---	---	--	--	--	-----------------------------

**B00B - R1005 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	3416/B00B/R1005/Floor Coverings Res/Textile/S25				<b>No Asbestos Detected</b>
-----------------------------	---	---	--	--	--	-----------------------------

**B00B - R1006 - Cleaning Supplies**

Wall Linings Internal	Flat AC Sheeting	12m2	North, Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3416/B00B/R1007/Wall Linings Internal/S12					<b>Chrysotile (white asbestos)</b>	

**B00B - R1007 - Distribution Board**

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3416/B00B/R1007/Wall Linings Internal/S12					<b>Chrysotile (white asbestos)</b>	

Electrical Backing Board	Resinous Membrane	1m2	Northwest	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						

**B00B - R1008 - Movement**

Wall Linings Internal	Flat AC Sheeting	6m2	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
3416/B00B/R1007/Wall Linings Internal/S12					<b>Chrysotile (white asbestos)</b>	

Flooring	Compressed AC Sheet	3416/B00B/R1008/Flooring/S24				<b>No Asbestos Detected</b>
----------	---------------------	------------------------------	--	--	--	-----------------------------

**B00B - R1009 - General Storeroom**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R1010 - General Storeroom</b>						
No Asbestos						
<b>B00B - R1011 - Movement</b>						
No Asbestos						
<b>B00B - Room+1 - Stairs</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
3416/B00B/Room+1/Floor Coverings Res/Textile/S11					<b>No Asbestos Detected</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning/Communal Facilities - 1967 - Brick/Block (Brick/Block)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00C/Gable Verge Lining/S32				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00C/Eaves Linings/S30				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	
Underfloor Voids - Slab on Ground						
Ceiling Voids	No Asbestos Found					

**Interior**

**B00C - R0001 - Movement**

No Asbestos

**B00C - R0002 - Movement**

No Asbestos

**B00C - R0003 - General Assistant/Bulk Store**

No Asbestos

**B00C - R0004 - Duplicating Workroom**

No Asbestos

**B00C - R1001 - Movement**

No Asbestos

**B00C - R1002 - General Storeroom**

No Asbestos

**B00C - R1003 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	53m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00C/R1013/Floor Coverings Res/Textile/S23				<b>Chrysotile (white asbestos)</b>	

**B00C - R1004 - Home Base Store**

No Asbestos

**B00C - R1005 - Movement**

No Asbestos

**B00C - R1006 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.92m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00C/R1013/Floor Coverings Res/Textile/S23				<b>Chrysotile (white asbestos)</b>	

**B00C - R1007 - Home Base Store**

No Asbestos

**B00C - R1008 - Home Base - M**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00C/R1013/Floor Coverings Res/Textile/S23				<b>Chrysotile (white asbestos)</b>	

**B00C - R1009 - Home Base Store**

No Asbestos

**B00C - R1010 - Movement**

Manhole	Flat AC Sheeting	0.2m2	Central	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00C/R1010/Manhole/S22				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>	

**B00C - R1011 - Distribution Board**

Note: No inspection of live electrical installation.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3416/B00C/R1011/Ceiling Structures/Linings/S21				<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
Electrical Backing Board	Resinous Board	2m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						

**B00C - R1012 - Home Base Store**

No Asbestos

**B00C - R1013 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	52.7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3416/B00C/R1013/Floor Coverings Res/Textile/S23				<b>Chrysotile (white asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Shed - 1967 - Brick/Block (Brick/Block)**

**Exterior**

In-fill-panel	Flat AC Sheeting 3416/B00D/In-fill-panel/S9					<b>No Asbestos Detected</b>
Ceiling Voids	Non Accessible Area - Area inaccessible					
Underfloor Voids	Non Accessible Area - Area inaccessible					

**Interior**

**B00D - R0001 - Garden Store**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - General Learning/Administration - 1975 - Brick/Block (Brick/Block)****Exterior**Underfloor Voids - Slab  
on Ground

Ceiling Voids No Asbestos Found

**Interior****B00E - R0001 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles					
		3416/B00E/R0001/Floor Coverings Res/Textile/S6				No Asbestos Detected

**B00E - R0002 - Principal**

Floor Coverings Res/Textile	Vinyl Tiles					
		3416/B00E/R0001/Floor Coverings Res/Textile/S6				No Asbestos Detected

**B00E - R0003 - Clerical Office**

Floor Coverings Res/Textile	Vinyl Tiles					
		3416/B00E/R0001/Floor Coverings Res/Textile/S6				No Asbestos Detected

**B00E - R0004 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles					
		3416/B00E/R0001/Floor Coverings Res/Textile/S6				No Asbestos Detected

**B00E - R0005 - Entry Vestibule**

Floor Coverings Res/Textile	Vinyl Tiles					
		3416/B00E/R0001/Floor Coverings Res/Textile/S6				No Asbestos Detected

**B00E - R0006 - Sick Bay**

Floor Coverings Res/Textile	Vinyl Tiles					
		3416/B00E/R0001/Floor Coverings Res/Textile/S6				No Asbestos Detected

**B00E - R0008 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles					
		3416/B00E/R0001/Floor Coverings Res/Textile/S6				No Asbestos Detected

**B00E - R0009 - Movement**

Floor Coverings Res/Textile	Vinyl Tiles					
		3416/B00E/R0001/Floor Coverings Res/Textile/S6				No Asbestos Detected

**B00E - R0010 - Movement**

No Asbestos

**B00E - R0011 - Movement**

No Asbestos

**B00E - R0012 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles					
		3416/B00E/R0001/Floor Coverings Res/Textile/S6				No Asbestos Detected

**B00E - R0013 - Canteen Office/Store**

Floor Coverings Res/Textile	Vinyl Tiles					
		3416/B00E/R0001/Floor Coverings Res/Textile/S6				No Asbestos Detected

**B00E - R0014 - Canteen Office/Store**

Floor Coverings Res/Textile	Vinyl Tiles					
		3416/B00E/R0001/Floor Coverings Res/Textile/S6				No Asbestos Detected

**B00E - R0016 - Staff Toilet**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Incinerette	Encapsulated Insulation material within unit	1Unit(s)	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Area inaccessible</b>						
<b>B00E - R0017 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00E - R0018 - Distribution Board</b>					Note: No inspection of live electrical installation.	
Electrical Mounting Board	Resinous Board	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
3416/B00E/R0018/Electrical Mounting Board/S15					<b>Chrysotile (white asbestos)</b>	
Wall Linings Internal	Flat AC Sheeting	4m2	Back of doors	Good Condition (1)	Low (1)	Low Priority (2-3)
3416/B00E/R0018/Wall Linings Internal/S7					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3416/B00E/R0007/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>	
<b>B00E - R0019 - Staff Room</b>						
No Asbestos						
<b>B00E - R0020 - Staff Toilet</b>						
No Asbestos						
<b>B00E - R0021 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
3416/B00E/R0001/Floor Coverings Res/Textile/S6					<b>No Asbestos Detected</b>	
<b>B00E - R0022 - Toilets - Boys/Girls</b>						
No Asbestos						
<b>B00E - R0023 - Home Base</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
3416/B00E/R0001/Floor Coverings Res/Textile/S6					<b>No Asbestos Detected</b>	
<b>B00E - R0024 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	15m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3416/B00E/R0025/Partition Walls (Cubicles)/S8					<b>Chrysotile (white asbestos)</b>	
<b>B00E - R0025 - Toilets - Boys</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3416/B00E/R0025/Partition Walls (Cubicles)/S8					<b>Chrysotile (white asbestos)</b>	
<b>B00E - R0026 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00E - R0027 - Home Base</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
3416/B00E/R0001/Floor Coverings Res/Textile/S6					<b>No Asbestos Detected</b>	
<b>B00E - R0028 - Staff Room Annexe</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
3416/B00E/R0001/Floor Coverings Res/Textile/S6					<b>No Asbestos Detected</b>	
<b>B00E - R0029 - Staff Room Annexe</b>						
No Asbestos						
<b>B00E - R0030 - Staff Toilet</b>						
No Asbestos						
<b>B00E - R0031 - Movement</b>						
No Asbestos						
<b>B00E - R0032 - Canteen</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning - 1940 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00F/Eaves Linings/S20					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Underfloor Voids	No Asbestos Found					
Ceiling Voids	No Asbestos Found					

**Interior**

**B00F - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	32m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00F/R0001/Ceiling Structures/Linings/S1					<b>Chrysotile (white asbestos)</b>

**B00F - R0002 - Home Base**

In-fill-panel	Flat AC Sheeting	2m	Southwest behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00F/R0002/In-fill-panel/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00F - R0003 - Home Base**

In-fill-panel	Flat AC Sheeting	2m	Southwest behind heater	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00F/R0002/In-fill-panel/S2					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - General Learning - 1972 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Gable Verge Lining	Flat AC Sheeting	20m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00G/Gable Verge Lining/S16			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Eaves Linings	Flat AC Sheeting	25m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00G/Eaves Linings/S17			<b>Chrysotile (white asbestos) , Amosite (brown asbestos) , Crocidolite (blue asbestos)</b>		
In-fill-panel	Flat AC Sheeting	12m2	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00G/In-fill-panel/S3			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00G - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00G/R0001/Ceiling Structures/Linings/S4			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
In-fill-panel	Flat AC Sheeting	12m	South, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00G/In-fill-panel/S3			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
In-fill-panel	Flat AC Sheeting	5m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3416/B00G/R0001/Ceiling Structures/Linings/S4			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00G - R0002 - Personal Effects Storage**

Manhole	Flat AC Sheeting					<b>No Asbestos Detected</b>
	3416/B00G/R0002/Manhole/S18					

**B00G - R0003 - Home Base**

No Asbestos

**B00G - R0004 - Home Base Store**

No Asbestos

**B00G - R0005 - Home Base**

No Asbestos

**B00G - R0006 - Movement**

No Asbestos

**B00G - R0007 - Home Base Store**

No Asbestos

**B00G - R0008 - Toilets - Boys/Girls**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00H - Communal Facilities - 2011 - Brick/Veneer (Brick/Veneer)**

**Exterior**

No Asbestos

**Interior**

**B00H - R0001 - Communal Space**

No Asbestos

**B00H - R0002 - Raised Platform**

No Asbestos

**B00H - R0003 - Hall Chair Store**

No Asbestos

**B00H - R0004 - Communal/Performance Store**

No Asbestos

**B00H - R0005 - P.E. Store**

No Asbestos

**B00H - R0006 - Toilet - Lobby**

No Asbestos

**B00H - R0007 - Toilets - Girls**

No Asbestos

**B00H - R0008 - Sound Cupboard**

No Asbestos

**B00H - R0009 - Toilet - Lobby**

No Asbestos

**B00H - R0010 - Toilets - Boys**

No Asbestos

**B00H - R0011 - Cleaning Distributed Store**

No Asbestos

**B00H - R0012 - General Storeroom**

No Asbestos

**B00H - R0013 - Main Switch Board**

No Asbestos

**B00H - R0014 - Disabled Toilet**

No Asbestos

**B00H - R0015 - Covered Outdoor Learning Area**

No Asbestos

**B00H - R0016 - Movement**

No Asbestos

**B00H - R0017 - Ramp**

No Asbestos

**B00H - R0018 - Movement**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017