


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wentworth Falls Public School (3422)
Region : Western Sydney
State Electorate : Blue Mountains
Local Government Area : Blue Mountains

Initial Survey : Noel Arnold & Associates : 23 - May - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

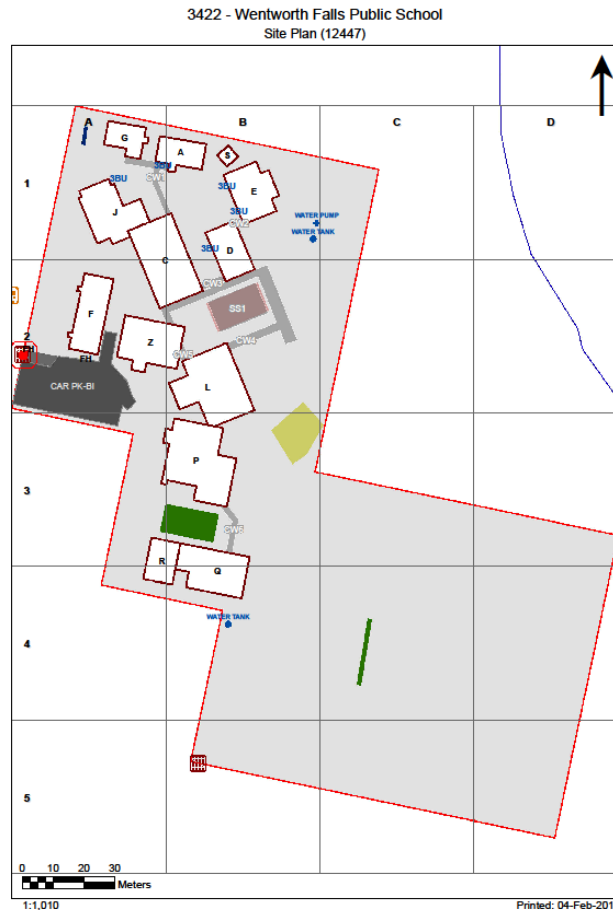

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1953 - Brick/Veneer (Brick/Veneer)

Exterior

Eaves Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3422/B00A/Eaves Linings/S5				Chrysotile (white asbestos) , Crocidolite (blue asbestos)	
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00A - R0001 - Home Base

No Asbestos

B00A - R0002 - Practical Activities - 1hb

No Asbestos

B00A - R0003 - Personal Effects Storage

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3422/B00A/R0003/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00A - R0004 - Movement

No Asbestos

B00A - R0005 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3422/B00A/R0005/Wall Linings Internal/S2					
Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
	3422/B00A/R0005/Wall Linings Internal/S2					

B00A - R0006 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3422/B00A/R0003/Floor Coverings Res/Textile/S1				Chrysotile (white asbestos)	

B00A - R0007 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting	8m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3422/B00A/R0008/Wall Linings Internal/S3				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0008 - Security Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Administration/Staff Facilities - 1991 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00C - R0001 - Principal**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0002 - Movement

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0003 - Interview

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0004 - Clerical Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0005 - Sick Bay

No Asbestos

B00C - R0006 - Community Clinic

No Asbestos

B00C - R0007 - Movement

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0008 - Staff Toilet

No Asbestos

B00C - R0009 - Staff Toilet

No Asbestos

B00C - R0010 - Staff Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0011 - Disabled Toilet

No Asbestos

B00C - R0012 - Security Store

No Asbestos

B00C - R0013 - Duplicating Workroom

No Asbestos

B00C - R0014 - Clerical Office

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0015 - Entry Vestibule

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0016 - Distribution Board

No Asbestos

Note: No inspection of live electrical installation.

B00C - R0017 - Interview

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00C - R0018 - General Storeroom

No Asbestos

B00C - R0019 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning/Pupil Facilities - 1991 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00D - R0001 - External Movement

No Asbestos

B00D - R0002 - Toilets - Boys

No Asbestos

B00D - R0003 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00D - R0004 - Cleaning Distributed Store

No Asbestos

B00D - R0005 - Toilets - Girls

No Asbestos

B00D - R0007 - Home Base

No Asbestos

B00D - R0008 - Practical Activities - 1hb

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1980 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - No Manhole in building					

Interior

B00E - R0001 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	29m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3422/B00E/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00E - R0002 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00E - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3422/B00E/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

B00E - R0004 - Distribution Board Note: No inspection of live electrical installation.

No Asbestos						
-------------	--	--	--	--	--	--

B00E - R0005 - Practical Activities - 1hb

No Asbestos						
-------------	--	--	--	--	--	--

B00E - R0006 - Movement

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00E - R0007 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found					
---	-------------------	--	--	--	--	--

B00E - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3422/B00E/R0001/Ceiling Structures/Linings/S6					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1912 - Timber (Timber)

Exterior

Underfloor Voids	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00F - R0001 - Home Base

No Asbestos

B00F - R0002 - Withdrawal Space - 1hb

No Asbestos

B00F - R0003 - Home Base Store

No Asbestos

B00F - R0004 - External Movement

No Asbestos

B00F - R0005 - Practical Activities - 1hb

No Asbestos

B00F - R0006 - Home Base

No Asbestos

B00F - R0007 - Home Base Store

No Asbestos

B00F - R0008 - Withdrawal Space - 1hb

No Asbestos

B00F - R0009 - Withdrawal Space - 1hb

No Asbestos

B00F - R0010 - Cleaning Distributed Store

No Asbestos

B00F - R0011 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1980 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- No Manhole in building					
Underfloor Voids	No Asbestos Found					

Interior

B00G - R0001 - Home Base Store

No Asbestos

B00G - R0002 - Home Base

No Asbestos

B00G - R0003 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3422/B00G/R0003/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0004 - External Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3422/B00G/R0003/Ceiling Structures/Linings/S4				Chrysotile (white asbestos) , Amosite (brown asbestos)		

B00G - R0005 - External Movement

No Asbestos

B00G - R0006 - Home Base Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - Pupil Facilities - 1991 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00J - R0001 - External Movement**

No Asbestos

B00J - R0002 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0003 - Practical Activities - 1hb

No Asbestos

B00J - R0004 - Practical Activities - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0005 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00J - R0006 - Personal Effects Storage

No Asbestos

B00J - R0007 - Toilets - Girls

No Asbestos

B00J - R0008 - General Storeroom

No Asbestos

B00J - R0009 - Toilets - Boys

No Asbestos

B00J - R0010 - Main Switch Board

No Asbestos

B00J - R0011 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00L - Library/Pupil Facilities - 1991 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00L - R0001 - External Movement

No Asbestos

B00L - R0002 - Canteen

No Asbestos

B00L - R0003 - Canteen Office/Store

No Asbestos

B00L - R0004 - K.L.A. Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0005 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0006 - Reading Area

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0007 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00L - R0008 - Movement

No Asbestos

B00L - R0009 - Cleaning Distributed Store

No Asbestos

B00L - R0010 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0011 - K.L.A. Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00L - R0012 - Plant

No Asbestos

B00L - R0013 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00P - Communal Facilities/Pupil Facilities - 1991 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00P - R0002 - Toilets - Girls**

No Asbestos

B00P - R0003 - Toilets - Boys

No Asbestos

B00P - R0004 - External Movement

No Asbestos

B00P - R0005 - External Movement

No Asbestos

B00P - R0006 - External Movement

No Asbestos

B00P - R0007 - Sports Store

No Asbestos

B00P - R0008 - Plant

No Asbestos

B00P - R0009 - Canteen Office/Store

No Asbestos

B00P - R0010 - Hall Chair Store

No Asbestos

B00P - R0011 - Communal Space

No Asbestos

B00P - R0012 - Raised Platform

No Asbestos

B00P - R0013 - Movement

No Asbestos

B00P - R0014 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00P - R0015 - Movement

No Asbestos

B00P - R0016 - Garden Store

No Asbestos

B00P - R0017 - No Access

No Asbestos

B00P - R0018 - Cleaning Distributed Store

No Asbestos

B00P - R0019 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00Q - General Learning - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00Q - R0001 - Practical Activities - 1hb**

No Asbestos

B00Q - R0002 - Home Base Store

No Asbestos

B00Q - R0003 - Home Base

No Asbestos

B00Q - R0004 - Withdrawal Space - 2hb

No Asbestos

B00Q - R0005 - Home Base

No Asbestos

B00Q - R0006 - Home Base Store

No Asbestos

B00Q - R0007 - Practical Activities - 1hb

No Asbestos

B00Q - R0008 - Plant

No Asbestos

B00Q - R0009 - General Storeroom

No Asbestos

B00Q - R0010 - External Movement

No Asbestos

B00Q - R0011 - Stairs

No Asbestos

B00Q - R1001 - Practical Activities - 1hb

No Asbestos

B00Q - R1002 - Home Base Store

No Asbestos

B00Q - R1003 - Home Base

No Asbestos

B00Q - R1004 - Withdrawal Space - 2hb

No Asbestos

B00Q - R1005 - Home Base

No Asbestos

B00Q - R1006 - Home Base Store

No Asbestos

B00Q - R1007 - Practical Activities - 1hb

No Asbestos

B00Q - R1008 - Plant

No Asbestos

B00Q - R1009 - External Stairs

No Asbestos

B00Q - R1010 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00R - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00R - R0001 - Withdrawal Space - 1hb

No Asbestos

B00R - R0002 - Home Base Store

No Asbestos

B00R - R0003 - Home Base

No Asbestos

B00R - R0004 - Practical Activities - 1hb

No Asbestos

B00R - R0005 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00S - General Learning - 2009 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00S - R0001 - Special Programs Room

No Asbestos

B00S - R0002 - Special Programs Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00Z - General Learning/Pupil Facilities - 1991 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00Z - R0001 - External Movement

No Asbestos

B00Z - R0002 - Practical Activities - 1hb

No Asbestos

B00Z - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00Z - R0004 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00Z - R0005 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00Z - R0006 - Kiln Room

No Asbestos

B00Z - R0007 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00Z - R0008 - Practical Activities - 1hb

No Asbestos

B00Z - R0009 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00Z - R0010 - Distribution Board

Note: No inspection of live electrical installation.

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00Z - R0011 - Cleaning Distributed Store

No Asbestos

B00Z - R0012 - Disabled Toilet

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3422_ASB_231112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017