


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wentworthville Public School (3423)
Region : Western Sydney
State Electorate : Granville
Local Government Area : Holroyd

Initial Survey : Noel Arnold & Associates : 17 - Mar - 2008
Reviewed By : Greencap-NAA : 22 - Jun - 2015

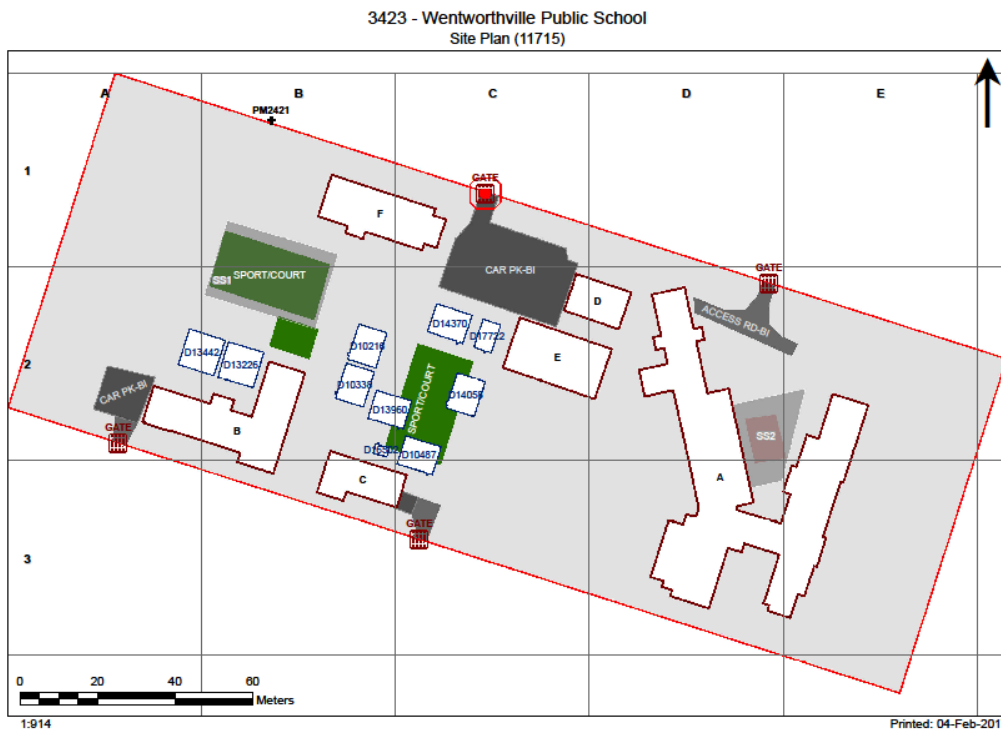

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

B00A - General Learning/Pupil Facilities - 1954 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	300m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3423/B00A/Eaves Linings/S1				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Window beading	Caulking					
	3423/B00A/Window beading/S22					No Asbestos Detected

Interior

B00A - R0001 - Home Base

No Asbestos

B00A - R0002 - Home Base

No Asbestos

B00A - R0003 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0004 - Movement

No Asbestos

B00A - R0005 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0006 - Movement

No Asbestos

B00A - R0007 - Withdrawal Space - 2hb

No Asbestos

B00A - R0008 - Home Base

Chalk Board	Flat AC Sheeting	5m2	Southwest	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0009/Chalk Board/S15				Chrysotile (white asbestos)	

B00A - R0009 - Home Base

Chalk Board	Flat AC Sheeting	2m2	Southwest	Good Condition (1)	Medium (2)	Low Priority (2-3)
	3423/B00A/R0009/Chalk Board/S15				Chrysotile (white asbestos)	

B00A - R0010 - Home Base

No Asbestos

B00A - R0011 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0012 - Staff Room Annexe

Ceiling Structures/Linings	Flat AC Sheeting	1m2	SW corner of room ceiling of cupboard	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2				Chrysotile (white asbestos) , Amosite (brown asbestos)	

Floor Coverings Res/Textile	Olive-green vinyl sheet under carpet					
	3423/B00A/R0012/Floor Coverings Res/Textile/S13					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Adhesive pertains to S13 located undee carpet					
	3423/B00A/R0012/Floor Coverings Res/Textile/S14					No Asbestos Detected
B00A - R0013 - Staff Toilet						
No Asbestos						
B00A - R0014 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	10m2	West adjacent & north of AR0042	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0015 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0016 - Raised Platform						
No Asbestos						
B00A - R0017 - Communal Space						
No Asbestos						
B00A - R0018 - Movement						
No Asbestos						
B00A - R0019 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0020 - Movement						
Wall Linings Internal	Flat AC Sheeting	2m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0021/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0021 - No Access						
Ceiling Structures/Linings	Flat AC Sheeting	1m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Wall Linings Internal	Flat AC Sheeting	1m2	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0021/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0022 - Movement						
No Asbestos						
B00A - R0024 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0025 - Staff Toilet						
No Asbestos						
B00A - R0026 - Movement						
No Asbestos						
B00A - R0027 - Canteen Office/Store						
No Asbestos						
B00A - R0028 - Canteen						
No Asbestos						
B00A - R0029 - Toilets - Boys						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Infill Panel	Flat AC Sheeting					No Asbestos Detected
	3423/B00A/R0029/Infill Panel/S10					
B00A - R0030 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0031 - Toilets - Girls						
Ceiling Structures/Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Infill Panel	Flat AC Sheeting					No Asbestos Detected
	3423/B00A/R0029/Infill Panel/S10					
B00A - R0032 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	20m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/Eaves Linings/S1					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0033 - Home Base						
No Asbestos						
B00A - R0034 - Home Base						
No Asbestos						
B00A - R0035 - Home Base						
No Asbestos						
B00A - R0036 - Sports Store						
No Asbestos						
B00A - R0037 - Cleaning Distributed Store						
No Asbestos						
B00A - R0038 - Home Base Store						
No Asbestos						
B00A - R0039 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0040 - Staff Toilet						
No Asbestos						
B00A - R0041 - Withdrawal Space - 1hb						
Floor Coverings Res/Textile	Blue-white mottled vinyl sheet under carpet					No Asbestos Detected
	3423/B00A/R0041/Floor Coverings Res/Textile/S11					
Floor Coverings Res/Textile	Adhesive pertains to S11 - Under carpet					No Asbestos Detected
	3423/B00A/R0041/Floor Coverings Res/Textile/S12					
B00A - R0042 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R0043 - General Storeroom						
No Asbestos						
B00A - R0044 - Withdrawal Space - 2hb						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

B00A - R0045 - Movement

No Asbestos

B00A - R0046 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles	6.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3423/B00A/R0046/Floor Coverings Res/Textile/S20					Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Adhesive pertain to S20					
3423/B00A/R0046/Floor Coverings Res/Textile/S21					No Asbestos Detected	

B00A - R0047 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	6m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3423/B00A/R0031/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0048 - Movement

No Asbestos

B00A - R0049 - Staff Toilet

No Asbestos

B00A - R0050 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3423/B00A/R0031/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)	

B00A - R0051 - Stairs

No Asbestos

B00A - R0052 - Cleaning Distributed Store

No Asbestos

B00A - R0053 - Plant

No Asbestos

B00A - R0054 - Main Switch Board

No Asbestos

B00A - R0055 - Movement

No Asbestos

B00A - R0056 - Chair Storeroom

No Asbestos

B00A - R0057 - P.E. Store

No Asbestos

B00A - R0058 - Toilet - Lobby

No Asbestos

B00A - R0059 - Toilets - Girls

No Asbestos

B00A - R0060 - Sound Cupboard

No Asbestos

B00A - R0061 - Toilet - Lobby

No Asbestos

B00A - R0062 - Toilets - Boys

No Asbestos

B00A - R0063 - Access Shower/Toilet/Change

No Asbestos

B00A - R0064 - Movement

No Asbestos

B00A - R0065 - Disabled Shower/Toilet

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
B00A - R0066 - External Movement						
No Asbestos						
B00A - R1001 - Home Base						
No Asbestos						
B00A - R1005 - Staff Toilet						
No Asbestos						
B00A - R1006 - Staff Toilet						
No Asbestos						
B00A - R1007 - Movement						
Floor Coverings Res/Textile	Vinyl Sheet					
	3423/B00A/R1007/Floor Coverings Res/Textile/S16					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive pertains to S16					
	3423/B00A/R1007/Floor Coverings Res/Textile/S17					No Asbestos Detected
Wall Linings Internal	Flat AC Sheeting	10m2	East	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5)
	3423/B00A/R0021/Wall Linings Internal/S3					Chrysotile (white asbestos) , Amosite (brown asbestos)
B00A - R1008 - Movement						
No Asbestos						
B00A - R1009 - Stairs						
No Asbestos						
B00A - R1010 - Home Base						
No Asbestos						
B00A - R9001 - Movement						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Greenish blue vinyl sheet					
	3423/B00A/R9001/Floor Coverings Res/Textile/S18					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive pertains S18					
	3423/B00A/R9001/Floor Coverings Res/Textile/S19					No Asbestos Detected
B00A - R9002 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	48m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Adhesive pertains S18					
	3423/B00A/R9001/Floor Coverings Res/Textile/S19					No Asbestos Detected
Floor Coverings Res/Textile	Greenish blue vinyl sheet					
	3423/B00A/R9001/Floor Coverings Res/Textile/S18					No Asbestos Detected
B00A - R9003 - General Storeroom						
Ceiling Structures/Linings	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3423/B00A/R0031/Ceiling Structures/Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)
Floor Coverings Res/Textile	Adhesive pertains S18					
	3423/B00A/R9001/Floor Coverings Res/Textile/S19					No Asbestos Detected

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings
Res/Textile

Greenish blue vinyl sheet

3423/B00A/R9001/Floor Coverings Res/Textile/S18

No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Other-Commercial/General Learning - 1924 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	Non Accessible Area - Height restricted					
Underfloor Voids	No Asbestos Found					
Window beading	Caulking 3423/B00A/Window beading/S22					No Asbestos Detected

Interior

B00B - R0001 - Home Base Store	No Asbestos					
B00B - R0002 - Home Base	No Asbestos					
B00B - R0003 - Withdrawal Space - 2hb	No Asbestos					
B00B - R0004 - Home Base	No Asbestos					
B00B - R0005 - Movement	No Asbestos					
B00B - R0006 - General Storeroom	No Asbestos					
B00B - R0007 - Home Base Store	No Asbestos					
B00B - R0008 - Other-Community Use	No Asbestos					
B00B - R0009 - Other-Community Use	No Asbestos					
B00B - R0010 - Other-Community Use	No Asbestos					
B00B - R0011 - Movement	No Asbestos					
B00B - R0012 - Movement	No Asbestos					
B00B - R0013 - Toilets - Boys/Girls	No Asbestos					
B00B - R0014 - Staff Room	No Asbestos					
B00B - R0015 - Movement	No Asbestos					
B00B - R0016 - Movement	No Asbestos					



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning/Various - 1891 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	50m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Could not sample - restricted access.						
Ceiling Voids	Non Accessible Area - Height restricted					
Underfloor Voids	No Asbestos Found					
Window beading	Caulking 3423/B00A/Window beading/S22					No Asbestos Detected

Interior

B00C - R0001 - General Assistant/Bulk Store

Wall Linings Internal	Flat AC Sheeting 3423/B00C/R0005/Wall Linings Internal/S5					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00C - R0002 - General Storeroom

No Asbestos

B00C - R0003 - Home Base

No Asbestos

B00C - R0004 - Home Base

No Asbestos

B00C - R0005 - Movement

Wall Linings Internal	Flat AC Sheeting 3423/B00C/R0005/Wall Linings Internal/S5					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00C - R0006 - Other-Community Use

Wall Linings Internal	Flat AC Sheeting 3423/B00C/R0005/Wall Linings Internal/S5					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00C - R0007 - General Storeroom

Wall Linings Internal	Flat AC Sheeting 3423/B00C/R0005/Wall Linings Internal/S5					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Other-After School Care - 1952 - Steel (Steel)

Exterior

Wall Cladding	Flat AC Sheeting 3423/B00D/Wall Cladding/S7					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 3423/B00A/Eaves Linings/S1	30m2	All surfaces	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids - Flat Roof	Non Accessible Area - Height restricted.					
Underfloor Voids	No Asbestos Found					
Window beading	Caulking 3423/B00A/Window beading/S22					No Asbestos Detected

Interior

B00D - R0001 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 3423/B00D/R0001/Wall Linings Internal/S8	6m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	--	-----	----------------------------	--------------------	---------	--

B00D - R0002 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting 3423/B00D/R0001/Wall Linings Internal/S8	6m2	North facing, South facing	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	--	-----	----------------------------	--------------------	---------	--

B00D - R0003 - Special Programs Room

No Asbestos

B00D - R0004 - Out Of School Hours Care Centre

No Asbestos

B00D - R0005 - Movement

Wall Linings Internal	Flat AC Sheeting 3423/B00D/R0005/Wall Linings Internal/S9	15m2	East, west & south walls	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
-----------------------	--	------	--------------------------	--------------------	---------	--

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 2004 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0001 - Reading Area

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00E - R0002 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00E - R0003 - Communications Cupboard

No Asbestos

B00E - R0004 - K.L.A. Store

No Asbestos

B00E - R0005 - Main Switch Board

No Asbestos

B00E - R0006 - Staff Toilet

No Asbestos

B00E - R0007 - Cleaning Distributed Store

No Asbestos

B00E - R0008 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00F - Administration - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids - Slab
on Ground**Interior****B00F - R0001 - Entry Vestibule**

No Asbestos

B00F - R0002 - Movement

No Asbestos

B00F - R0003 - Clerical Office

No Asbestos

B00F - R0004 - Duplicating Workroom

No Asbestos

B00F - R0005 - Sick Bay

No Asbestos

B00F - R0006 - Access Shower/Toilet

No Asbestos

B00F - R0007 - Staff Toilet

No Asbestos

B00F - R0008 - Cleaning Distributed Store

No Asbestos

B00F - R0009 - Interview

No Asbestos

B00F - R0010 - Security Store

No Asbestos

B00F - R0011 - Staff Room Annexe

No Asbestos

B00F - R0012 - Staff Room

No Asbestos

B00F - R0013 - Staff Kitchen

No Asbestos

B00F - R0014 - Staff Toilet

No Asbestos

B00F - R0015 - Staff Toilet

No Asbestos

B00F - R0016 - Deputy Principal

No Asbestos

B00F - R0017 - Principal

No Asbestos

B00F - R0018 - Interview

No Asbestos

B00F - R0019 - Main Switch Board

No Asbestos

B00F - R0020 - External Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 602 - D10216 - Learning Unit - Standard With P.A.A. : Placement Date - 9/05/2013

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D10338 - Learning Unit - Standard With P.A.A. : Placement Date - 20/02/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D10487 - Learning Unit - Standard With P.A.A. : Placement Date - 9/12/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

NS 100 - D13226 - Learning Unit - Single Primary/PAA : Placement Date - 7/02/2011

Exterior

No Asbestos Found.

Interior

R1 - Home Base

No Asbestos Found.

R2 - Practical Activity Area

No Asbestos Found.

R3 - Home Base Store

No Asbestos Found.

R4 - Entry

No Asbestos Found.

NS 100 - D13442 - Learning Unit - Single Primary/PAA : Placement Date - 11/07/2011

Exterior

No Asbestos Found.



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

Interior

R1 - Home Base

No Asbestos Found.

R2 - Practical Activity Area

No Asbestos Found.

R3 - Home Base Store

No Asbestos Found.

R4 - Entry

No Asbestos Found.

OS 602 - D13960 - Learning Unit - Standard With P.A.A. : Placement Date - 9/12/2015

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 602 - D14058 - Learning Unit - Standard With P.A.A. : Placement Date - 16/12/2014

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 603 - D14370 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 18/05/2012

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Learning space/withdrawal/entry

No Asbestos Found.

R2 - Home Base Store

No Asbestos Found.

OS 837 - D16502 - Hcap Shower/Change/Toilet : Placement Date - 9/05/2011

Exterior

No Asbestos Found.

Interior

R1 - Disabled Shower/Toilet

No Asbestos Found.

OS 750 - D17722 - Learning Unit - ESL : Placement Date - 20/02/2014

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Esl						
No Asbestos Found.						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3423_ASB_010313_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017