


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Whitton Public School (3438)
Region : Riverina
State Electorate : Murray
Local Government Area : Leeton

Initial Survey : Noel Arnold & Associates : 07 - May - 2008
Reviewed By : Parsons Brinckerhoff : 12 - Jul - 2016

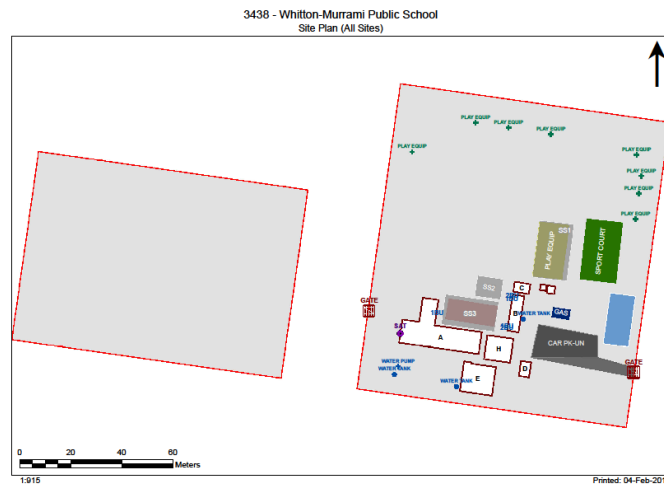

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1967 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 3438/B00A/Eaves Linings/S2					No Asbestos Detected
Ceiling Void	No Asbestos Found					
underfloor Void	No Asbestos Found					

Interior**B00A - R0001 - Principal**

No Asbestos

B00A - R0002 - Cleaning Supplies

Wall Linings Internal	Flat AC Sheeting 3438/B00A/R0002/Wall Linings Internal/S5	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 3438/B00A/R0002/Wall Linings Internal/S5	3m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00A - R0003 - Movement

No Asbestos

B00A - R0004 - Distribution Board

Note: No inspection of live electrical installation.

Electrical Mounting Board	Resinous Board 3438/B00A/R0004/Electrical Mounting Board/S9	1Unit	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Wall Linings Internal	Flat AC Sheeting 3438/B00A/R0004/Wall Linings Internal/S4	4m2	South facing, East facing, West facing	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 3438/B00A/R0004/Wall Linings Internal/S4	1m2	All surfaces	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00A - R0005 - Reading Area

No Asbestos

B00A - R0006 - Home Base

No Asbestos

B00A - R0007 - Movement

In-fill-panel above Door	Flat AC Sheeting 3438/B00A/R0007/In-fill-panel above Door/S8	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00A - R0008 - Personal Effects Storage

No Asbestos

B00A - R0009 - Home Base Store

Wall Linings Internal	Flat AC Sheeting 3438/B00A/R0017/Ceiling Structures/Linings/S3	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 3438/B00A/R0017/Floor Coverings Res/Textile/S1	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting 3438/B00A/R0017/Ceiling Structures/Linings/S3	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

B00A - R0010 - General Storeroom

Wall Linings Internal	Flat AC Sheeting 3438/B00A/R0017/Ceiling Structures/Linings/S3	10m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles 3438/B00A/R0017/Floor Coverings Res/Textile/S1	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3438/B00A/R0017/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00A - R0011 - Staff Room						
No Asbestos						
B00A - R0012 - Home Base Store						
Wall Linings Internal	Flat AC Sheeting	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3438/B00A/R0017/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3438/B00A/R0017/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	5m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3438/B00A/R0017/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
B00A - R0013 - Home Base						
No Asbestos						
B00A - R0014 - Movement						
No Asbestos						
B00A - R0015 - Entry Vestibule						
No Asbestos						
B00A - R0016 - Clerical Office						
No Asbestos						
B00A - R0017 - General Storeroom						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3438/B00A/R0017/Floor Coverings Res/Textile/S1					Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3438/B00A/R0017/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
Ceiling Structures/Linings	Flat AC Sheeting	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3438/B00A/R0017/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Pupil Facilities - 1967 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00B - R0001 - Toilets - Boys

No Asbestos

B00B - R0002 - Staff Toilet

No Asbestos

B00B - R0003 - Movement

Wall Linings Internal	Flat AC Sheeting					
	3438/B00B/R0003/Wall Linings Internal/S7					No Asbestos Detected

B00B - R0006 - Toilets - Girls

No Asbestos

B00B - R0007 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting					
	3438/B00B/R0007/Wall Linings Internal/S6					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Shed - 1967 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Void No Asbestos Found

Interior

B00C - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Shed - 1967 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Void	No Asbestos Found

Interior

B00D - R0001 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Library - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00E - R0001 - Reading Area

No Asbestos

B00E - R0002 - Library Office/Workroom

No Asbestos

B00E - R0003 - K.L.A. Store

No Asbestos

B00E - R0004 - Communications Room

No Asbestos

B00E - R0005 - Main Switch Board

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Storage - - Metal Shed (Metal Shed)

Exterior

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior

B00F - R0001 - General Storeroom

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Storage - - Metal Shed (Metal Shed)

Exterior

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior

B00G - R0001 - Garden Store

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning - - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Void	Requires Inspection
Underfloor Void	Requires Inspection

Interior

B00H - R0001 - External Movement

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0002 - Home Base

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0003 - Practical Activities

Recently Modified Space	Requires Inspection
-------------------------	---------------------

B00H - R0004 - Home Base Store

Recently Modified Space	Requires Inspection
-------------------------	---------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3438_ASB_100913_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017