


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wilberforce Public School (3441)
Region : Western Sydney
State Electorate : Hawkesbury
Local Government Area : Hawkesbury

Initial Survey : Noel Arnold & Associates : 22 - Apr - 2008
Reviewed By : Parsons Brinckerhoff : 25 - Nov - 2016

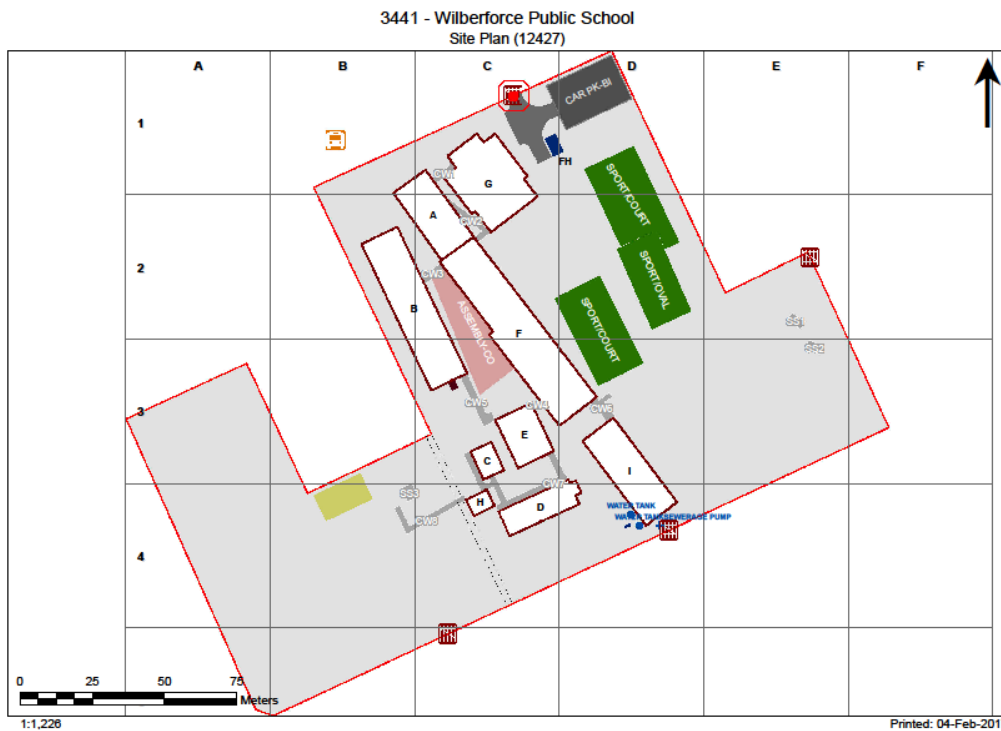

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/Staff Facilities - 1994 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00A - R0001 - Movement**

No Asbestos

B00A - R0002 - Staff Room Annexe

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0003 - Staff Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0004 - Cleaning Distributed Store

No Asbestos

B00A - R0005 - Deputy Principal

No Asbestos

B00A - R0006 - Deputy Principal

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0007 - Interview

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0008 - Sick Bay - Shower/Toilet

No Asbestos

B00A - R0009 - Sick Bay

No Asbestos

B00A - R0010 - Clerical Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0011 - Entry Vestibule

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0012 - Duplicating Workroom

No Asbestos

B00A - R0013 - Principal

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0014 - General Storeroom

No Asbestos

B00A - R0015 - Staff Toilet

No Asbestos

B00A - R0016 - Staff Toilet

No Asbestos

B00A - R0017 - Staff Toilet

No Asbestos

B00A - R0018 - Movement

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00A - R0019 - Main Switch Board

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1994 - Brick/Veneer (Brick/Veneer)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00B - R0001 - Movement

No Asbestos

B00B - R0002 - Practical Activities - 1hb

No Asbestos

B00B - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0004 - Movement

No Asbestos

B00B - R0005 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0006 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0007 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0008 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0009 - Practical Activities - 1hb

No Asbestos

B00B - R0010 - Movement

No Asbestos

B00B - R0011 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0012 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0013 - Practical Activities - 1hb

No Asbestos

B00B - R0014 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0015 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0016 - Practical Activities - 1hb

No Asbestos

B00B - R0017 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet)	No Asbestos Found
---	-------------------

B00B - R0018 - Movement

No Asbestos

B00B - R0019 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00B - R0020 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet)		No Asbestos Found				
B00B - R0021 - Home Base Store						
Vinyl Tiles (Under Floor Covering/Carpet)		No Asbestos Found				
B00B - R0022 - Practical Activities - 1hb						
No Asbestos						
B00B - R0023 - Withdrawal Space - 1hb						
Vinyl Tiles (Under Floor Covering/Carpet)		No Asbestos Found				
B00B - R0024 - Home Base						
Vinyl Tiles (Under Floor Covering/Carpet)		No Asbestos Found				
B00B - R0025 - Home Base Store						
Vinyl Tiles (Under Floor Covering/Carpet)		No Asbestos Found				
B00B - R0026 - Practical Activities - 1hb						
No Asbestos						
B00B - R0027 - Movement						
No Asbestos						
B00B - R0028 - Distribution Board					Note: No inspection of live electrical installation.	
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1970 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting	8m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3441/B00C/Eaves Linings/S4					Chrysotile (white asbestos)
Gable Verge Lining	Flat AC Sheeting	15m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3441/B00C/Gable Verge Lining/S6					Chrysotile (white asbestos)
Ceiling Void	No Asbestos Found					
Underfloor Void	No Asbestos Found					

Interior

B00C - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3441/B00C/R0001/Ceiling Structures/Linings/S7					Chrysotile (white asbestos)

B00C - R0002 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3441/B00C/R0002/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)

B00C - R0003 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3441/B00C/R0002/Partition Walls (Cubicles)/S1					Chrysotile (white asbestos)

Incinerette	Encapsulated Insulation material within unit	1Unit(s)	North	Friable Asbestos (5)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Encapsulated material within unit					

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - General Learning - 1933 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting 3441/B00D/Eaves Linings/S5					No Asbestos Detected
Ceiling Void	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00D - R0001 - Security Store

No Asbestos

B00D - R0002 - Movement

No Asbestos

B00D - R0003 - Staff Toilet

No Asbestos

B00D - R0004 - Staff Toilet

No Asbestos

B00D - R0005 - K.L.A. Store

In-fill-panel	Flat AC Sheeting	2m	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3441/B00D/R0009/In-fill-panel/S2					Chrysotile (white asbestos)

B00D - R0006 - General Storeroom

No Asbestos

B00D - R0007 - Movement

No Asbestos

B00D - R0008 - Personal Effects Storage

No Asbestos

B00D - R0009 - Practical Activities - 1hb

In-fill-panel	Flat AC Sheeting	2m	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3441/B00D/R0009/In-fill-panel/S2					Chrysotile (white asbestos)

B00D - R0010 - Home Base

In-fill-panel	Flat AC Sheeting	2m	South, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3441/B00D/R0009/In-fill-panel/S2					Chrysotile (white asbestos)

B00D - R0011 - Home Base Store

No Asbestos

B00D - R0012 - Home Base Store


No Asbestos

B00D - R0013 - Personal Effects Storage

Electrical Backing Board	Resinous Board 3441/B00D/R0013/Electrical Backing Board/S8					No Asbestos Detected
--------------------------	---	--	--	--	--	-----------------------------

B00D - R0014 - Movement

No Asbestos

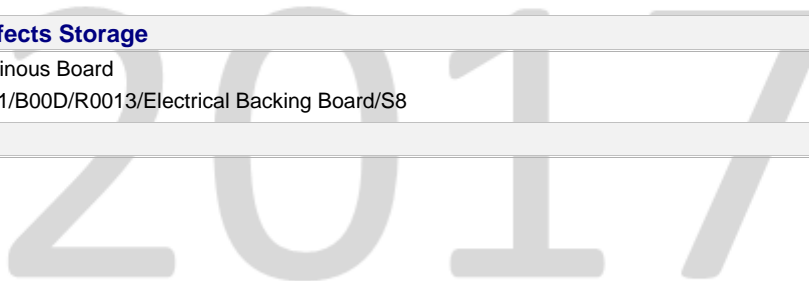

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1994 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0001 - Movement

No Asbestos

B00E - R0002 - Practical Activities - 1hb

No Asbestos

B00E - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0004 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0005 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0007 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0008 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00E - R0009 - Practical Activities - 1hb

No Asbestos

B00E - R0010 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library/Tiered Learning - 1994 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00F - R0001 - Movement

No Asbestos

B00F - R0002 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0003 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0004 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0005 - Practical Activities - 1hb

No Asbestos

B00F - R0006 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0007 - Movement

No Asbestos

B00F - R0008 - Practical Activities - 1hb

No Asbestos

B00F - R0009 - Home Base Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0010 - Withdrawal Space - 1hb

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0011 - Home Base

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0012 - Reading Area

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0013 - Communications Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0014 - Library Office/Workroom

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0015 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00F - R0016 - Special Programs Room

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0017 - Special Programs Store

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

B00F - R0018 - Toilets - Boys

No Asbestos

B00F - R0019 - Toilets - Girls

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00F - R0020 - Kiln Room						
No Asbestos						
B00F - R0021 - Cleaning Supplies						
No Asbestos						
B00F - R0022 - Plant						
No Asbestos						
B00F - R0023 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Communal Facilities - 1994 - Brick/Block (Brick/Block)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00G - R0002 - Movement

No Asbestos

B00G - R0003 - Disabled Toilet

No Asbestos

B00G - R0004 - Cleaning Distributed Store

No Asbestos

B00G - R0005 - Hall Chair Store

No Asbestos

B00G - R0006 - Uniform Shop

No Asbestos

B00G - R0007 - Cleaning Supplies

No Asbestos

B00G - R0008 - Garden Store

No Asbestos

B00G - R0009 - Toilets - Girls

No Asbestos

B00G - R0010 - Shower/Change

No Asbestos

B00G - R0012 - Movement

No Asbestos

B00G - R0013 - Staff Toilet

No Asbestos

B00G - R0014 - Community Clinic

No Asbestos

B00G - R0016 - Toilets - Boys

No Asbestos

B00G - R0017 - General Assistant/Bulk Store

No Asbestos

B00G - R0018 - P.E. Store

No Asbestos

B00G - R0020 - Distribution Board

Note: No inspection of live electrical installation.

No Asbestos

B00G - R0027 - P.E. Store

No Asbestos

B00G - R0028 - Sound Cupboard

No Asbestos

B00G - R0029 - Canteen Office/Store

No Asbestos

B00G - R0030 - Canteen

No Asbestos

B00G - R0031 - Movement

No Asbestos

B00G - R0032 - Communal Space

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
B00G - R0033 - Raised Platform						
No Asbestos						
B00G - R0034 - Movement						
No Asbestos						
B00G - R0035 - Movement						
No Asbestos						
B00G - R0036 - Other-Not Used						
No Asbestos						
B00G - R0037 - Movement						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Building Services - 1994 - Timber (Timber)

Exterior

Wall Cladding	Flat AC Sheeting 3441/B00H/Wall Cladding/S3					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00H - R0001 - Movement

No Asbestos

B00H - R0002 - General Storeroom

No Asbestos

B00H - R0003 - Cleaning Supplies

No Asbestos

B00H - R0004 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00I - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00I - R0001 - Home Base

No Asbestos

B00I - R0002 - Home Base Store

No Asbestos

B00I - R0003 - Practical Activities - 1hb

No Asbestos

B00I - R0004 - Withdrawal Space - 2hb

No Asbestos

B00I - R0005 - Home Base

No Asbestos

B00I - R0006 - Home Base Store

No Asbestos

B00I - R0007 - Practical Activities - 1hb

No Asbestos

B00I - R0008 - Home Base

No Asbestos

B00I - R0009 - Home Base Store

No Asbestos

B00I - R0010 - Practical Activities - 1hb

No Asbestos

B00I - R0011 - Withdrawal Space - 2hb

No Asbestos

B00I - R0012 - Home Base

No Asbestos

B00I - R0013 - Home Base Store

No Asbestos

B00I - R0014 - Practical Activities - 1hb

No Asbestos

B00I - R0015 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017