


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Willawarrin Public School (3445)
Region : North Coast
State Electorate : Oxley
Local Government Area : Kempsey

Initial Survey : Noel Arnold & Associates : 24 - Apr - 2008
Reviewed By : Grencap-NAA : 14 - Apr - 2016

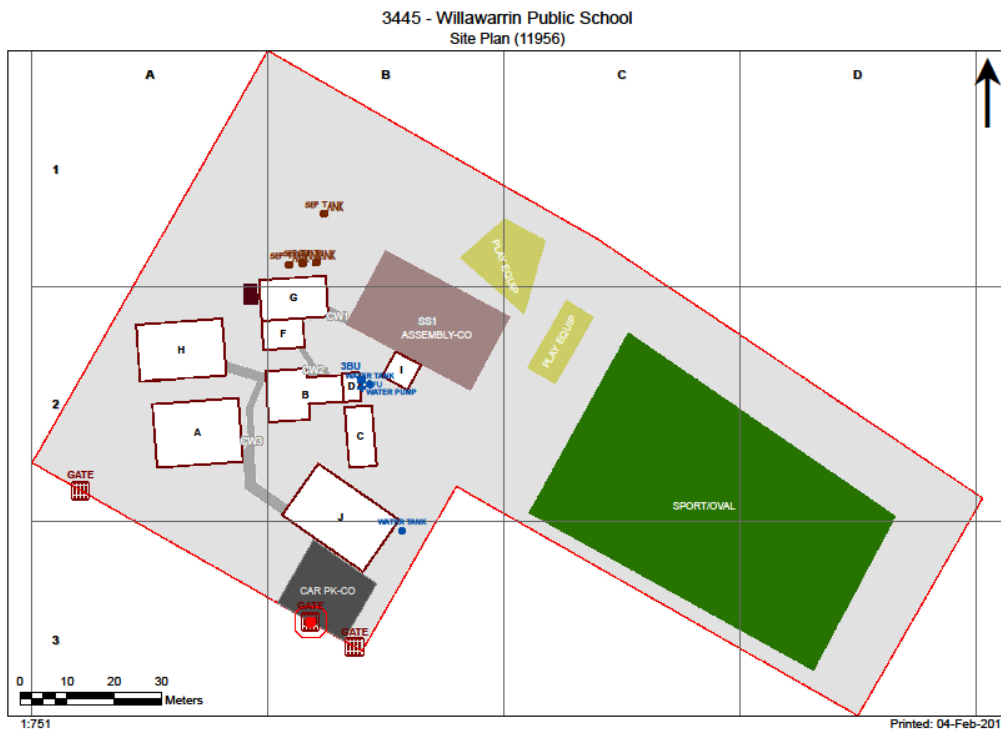

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1920 - Timber (Timber)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area inaccessible. Limited view of underfloor on Northern side, no safe access					
Wall Cladding	Flat AC Sheeting					
	3445/B00A/Wall Cladding/S7					No Asbestos Detected
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Area inaccessible. Ceiling space visible from hatch, no access within					

Interior**B00A - R0001 - Home Base**

No Asbestos

B00A - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	3445/B00A/R0007/Ceiling Structures/Linings/S8					No Asbestos Detected
Wall Cladding	Flat AC Sheeting					
	3445/B00A/Wall Cladding/S7					No Asbestos Detected

B00A - R0003 - Staff Room Annexe

No Asbestos

B00A - R0004 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	3445/B00A/R0007/Ceiling Structures/Linings/S8					No Asbestos Detected
Wall Cladding	Flat AC Sheeting					
	3445/B00A/Wall Cladding/S7					No Asbestos Detected

B00A - R0005 - Home Base

No Asbestos

B00A - R0006 - Practical Activities - 1hb

No Asbestos

B00A - R0007 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	3445/B00A/R0007/Ceiling Structures/Linings/S8					No Asbestos Detected
Wall Cladding	Flat AC Sheeting					
	3445/B00A/Wall Cladding/S7					No Asbestos Detected

B00A - R0008 - Home Base Store

No Asbestos

B00A - R0009 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting					
	3445/B00A/R0009/Wall Linings Internal/S13					No Asbestos Detected

B00A - R0010 - Home Base Store

No Asbestos

B00A - R0011 - Practical Activities - 1hb

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Library - 1929 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction. Ceiling space visible from hatch, no access within (3.5m)					
Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3445/B00C/Eaves Linings/S11					Chrysotile (white asbestos)	

Interior

B00B - R0002 - Craft Store

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
3445/B00B/R0001/Wall Linings Internal/S9						

B00B - R0003 - K.L.A. Store

Wall Linings Internal	Flat AC Sheeting					No Asbestos Detected
3445/B00B/R0001/Wall Linings Internal/S9						
Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3445/B00B/R0003/Ceiling Structures/Linings/S10					Chrysotile (white asbestos)	

B00B - R0005 - External Movement

No Asbestos

B00B - R0006 - Canteen

No Asbestos

B00B - R0007 - External Movement

No Asbestos

B00B - R0008 - Seminar/Study

No Asbestos

B00B - R0009 - Reading Area

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	38m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3445/B00B/R0009/Floor Coverings Res/Textile/S18					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
3445/B00B/R0009/Floor Coverings Res/Textile/S19						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - General Learning - 1920 - Timber (Timber)

Exterior

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	40m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3445/B00C/Eaves Linings/S11				Chrysotile (white asbestos)	
Eaves Linings	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3445/B00C/Eaves Linings/S17				Chrysotile (white asbestos)	
Ceiling Voids - Raked Ceiling	Non Accessible Area					
	- Height Restriction. Access hatch not safely accessible due to items\cupboard below					

Interior

B00C - R0001 - Home Base

No Asbestos

B00C - R0002 - Practical Activities - 1hb

Floor Coverings Res/Textile	Vinyl Tiles					
	3445/B00C/R0002/Floor Coverings Res/Textile/S12				No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
	3445/B00C/R0002/Floor Coverings Res/Textile/S16				No Asbestos Detected	

B00C - R0003 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1920 - Timber (Timber)

Exterior

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	Non Accessible Area					
	- Area partially visible on East and North sides, no access due to low clearance					
Wall Cladding	Corrugated AC Sheeting					
	3445/B00D/Wall Cladding/S14					No Asbestos Detected

Interior

B00D - R0001 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Pupil Facilities - 1971 - Brick/Block (Brick/Block)**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible. No access without damaging ceiling					
Flue	Fibre Cement Pipe	5m	West	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3445/B00F/Air Vent Pipe/S4					Chrysotile (white asbestos)
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior**B00F - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3445/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00F - R0002 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3445/B00F/R0002/Partition Walls (Cubicles)/S2					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	23m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3445/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00F - R0003 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3445/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00F - R0004 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3445/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00F - R0005 - Staff Toilet

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3445/B00F/R0001/Ceiling Structures/Linings/S1					Chrysotile (white asbestos)

B00F - R0006 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - Pupil Facilities - 1920 - Brick/Block (Brick/Block)**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Eaves Linings	Flat AC Sheeting 3445/B00G/R0001/Ceiling Structures/Linings/S6					No Asbestos Detected
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible. No access to roof space without damaging ceiling.					

Interior**B00G - R0001 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting 3445/B00G/R0001/Ceiling Structures/Linings/S6					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00G - R0002 - Cleaning Supplies

Ceiling Structures/Linings	Flat AC Sheeting 3445/B00G/R0001/Ceiling Structures/Linings/S6					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00G - R0003 - P.E. Store

Ceiling Structures/Linings	Flat AC Sheeting 3445/B00G/R0001/Ceiling Structures/Linings/S6					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00G - R0004 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 3445/B00G/R0001/Ceiling Structures/Linings/S6					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00G - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3445/B00G/R0005/Ceiling Structures/Linings/S5					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Multi Purpose Facilities - 2008 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00H - R0001 - Communal Space

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Multi Purpose Facilities - 2009 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof Non Accessible Area
 - Area inaccessible. Area between ceiling cover and roof inaccessible without damage to ceiling

Interior

B001 - R0001 - Raised Platform

Wall Linings Internal	Flat AC Sheeting 3445/B001/R0001/Wall Linings Internal/S15					No Asbestos Detected
Ceiling Structures/Linings	Flat AC Sheeting 3445/B001/R0001/Wall Linings Internal/S15					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00J - Administration/Library - 2010 - Brick/Veneer (Brick/Veneer)**Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

Interior**B00J - R0001 - External Movement**

No Asbestos

B00J - R0002 - Clerical Office

No Asbestos

B00J - R0004 - Staff Toilet

No Asbestos

B00J - R0005 - Sick Bay

No Asbestos

B00J - R0006 - Security Store

No Asbestos

B00J - R0007 - Access Shower/Toilet

No Asbestos

B00J - R0008 - Movement

No Asbestos

B00J - R0009 - Staff Room

No Asbestos

B00J - R0010 - Staff Kitchen

No Asbestos

B00J - R0011 - Cleaning Distributed Store

No Asbestos

B00J - R0012 - Principal

No Asbestos

B00J - R0013 - Reading Area

No Asbestos

B00J - R0014 - Communications Room

No Asbestos

B00J - R0015 - K.L.A. Store

No Asbestos

B00J - R0016 - Library Office/Workroom

No Asbestos

B00J - R0017 - Main Switch Board Cupboard

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017