


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Willoughby Public School (3449)  
**Region :** Northern Sydney  
**State Electorate :** Willoughby  
**Local Government Area :** Willoughby

**Initial Survey :** Noel Arnold & Associates : 26 - Mar - 2008  
**Reviewed By :** Greencap-NAA : 24 - Jun - 2015

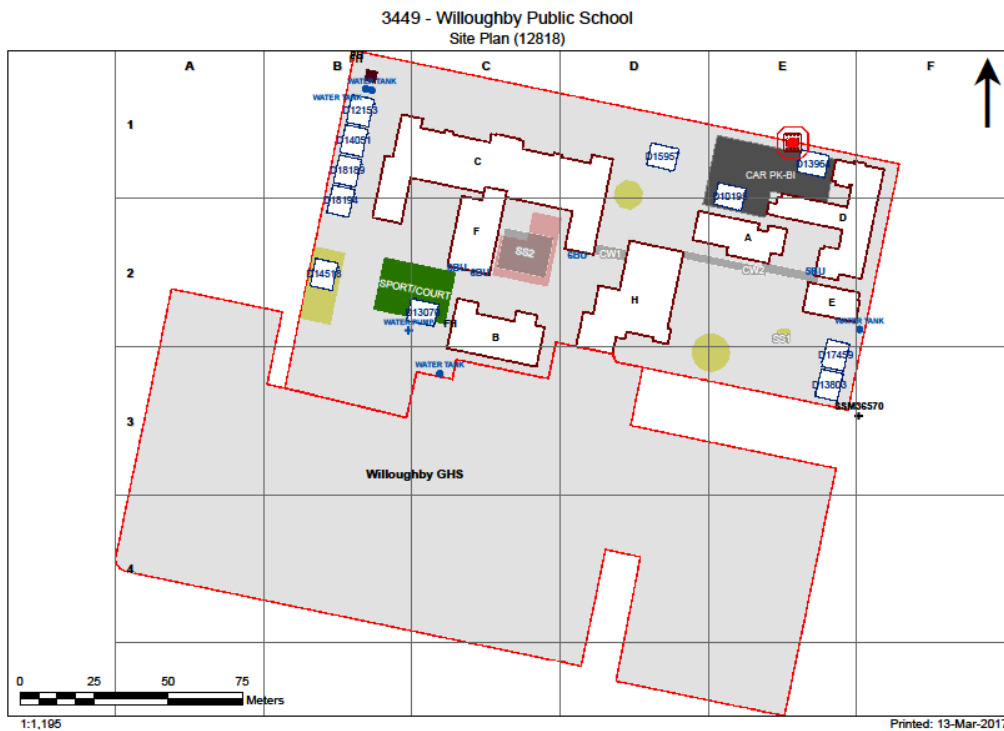

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration - 1978 - Brick/Block (Brick/Block)****Exterior**

Eaves Linings	Flat AC Sheeting	40m2	Perimeter of building	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	3449/B00A/Eaves Linings/S2			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Gable Ends	Flat AC Sheeting	10m	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3449/B00H/R0017/Gable Ends - packer/S16			<b>Chrysotile (white asbestos)</b>		
Underfloor Voids - Slab on Ground	No Asbestos Found					
Ceiling Voids	No Asbestos Found					
Electrical \ PA Ground pits	Moulded Fibre cement	2Unit	South	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
	3449/B00A/Electrical \ PA Ground pits/S27			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior****B00A - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00A/R0001/Ceiling Structures/Linings/S3			<b>Chrysotile (white asbestos)</b>		

**B00A - R0002 - Principal**

No Asbestos

**B00A - R0003 - Entry Vestibule**

No Asbestos

**B00A - R0004 - Interview**

No Asbestos

**B00A - R0005 - Sick Bay**

Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00A/R0019/Floor Coverings Res/Textile/S15			<b>No Asbestos Detected</b>		

**B00A - R0006 - Clerical Office**

No Asbestos

**B00A - R0007 - Staff Toilet**

No Asbestos

**B00A - R0008 - Staff Toilet**

No Asbestos

**B00A - R0009 - Staff Room Annexe**

No Asbestos

**B00A - R0010 - Staff Room Annexe**

No Asbestos

**B00A - R0011 - Cleaning Distributed Store**

No Asbestos

**B00A - R0012 - Duplicating Workroom**

Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00A/R0019/Floor Coverings Res/Textile/S15			<b>No Asbestos Detected</b>		

**B00A - R0013 - Main Switch Board**

No Asbestos

**B00A - R0014 - General Storeroom**

No Asbestos

**B00A - R0015 - Movement**

No Asbestos

**B00A - R0016 - Movement**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	8m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00A/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
<b>B00A - R0017 - Cleaning Supplies</b>						
No Asbestos						
<b>B00A - R0018 - Movement</b>						
Roof void Access hatch	Flat AC Sheeting	1m2	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3449/B00A/R0018/Roof void Access hatch/S1					Chrysotile (white asbestos)	
<b>B00A - R0019 - Community Clinic</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
3449/B00A/R0019/Floor Coverings Res/Textile/S15					No Asbestos Detected	
<b>B00A - R0020 - Staff Toilet</b>						
No Asbestos						
<b>B00A - R0021 - Movement</b>						
No Asbestos						
<b>B00A - R0022 - Stairs</b>						
No Asbestos						
<b>B00A - R0023 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	250m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3449/B00A/R0001/Ceiling Structures/Linings/S3					Chrysotile (white asbestos)	
Gable ends - packer	Flat AC Sheeting	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00H/R0017/Gable Ends - packer/S16					Chrysotile (white asbestos)	
<b>B00A - R1001 - Movement</b>						
No Asbestos						
<b>B00A - R1002 - Staff Room</b>						
No Asbestos						
<b>B00A - R1003 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00A/Eaves Linings/S2					Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00A - R1004 - Stairs</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

**B00B - Library/General Learning - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00B - R0001 - Reading Area**

No Asbestos

**B00B - R0002 - K.L.A. Store**

No Asbestos

**B00B - R0003 - Library Office/Workroom**

No Asbestos

**B00B - R0004 - Communications Room**

No Asbestos

**B00B - R0005 - Cleaning Distributed Store**

No Asbestos

**B00B - R0006 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00B - R0007 - Toilet - Lobby**

No Asbestos

**B00B - R0008 - Staff Toilet**

No Asbestos

**B00B - R0009 - External Movement**

No Asbestos

**B00B - R0010 - General Storeroom**

No Asbestos

**B00B - R0011 - General Storeroom**

No Asbestos

**B00B - R0012 - External Stairs**

No Asbestos

**B00B - R0013 - External Stairs**

No Asbestos

**B00B - R1001 - Home Base**

No Asbestos

**B00B - R1002 - Home Base**

No Asbestos

**B00B - R1003 - Home Base**

No Asbestos

**B00B - R1004 - Practical Activities - 1hb**

No Asbestos

**B00B - R1005 - Withdrawal Space - 1hb**

No Asbestos

**B00B - R1006 - Home Base Store**

No Asbestos

**B00B - R1007 - Home Base Store**

No Asbestos

**B00B - R1008 - Practical Activities - 1hb**

No Asbestos

**B00B - R1009 - Withdrawal Space - 2hb**

No Asbestos

**B00B - R1010 - Practical Activities - 1hb**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	<b>Sample No</b>					<b>Test Result</b>

No Asbestos

**B00B - R1011 - Home Base Store**

No Asbestos

**B00B - R1012 - External Movement**

No Asbestos

**B00B - R1013 - External Stairs**

No Asbestos

**B00B - R1014 - External Stairs**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - General Learning/Library - 1925 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids	Non Accessible Area - Area inaccessible - small crawl space					

**Interior**

**B00C - R0001 - Movement**

No Asbestos

**B00C - R0002 - Home Base**

Chalk Board	Compressed AC Sheet	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00D/R0006/Chalk Board/S9					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3449/B00C/R0030/Floor Coverings Res/Textile/S26					

**B00C - R0003 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3449/B00C/R0030/Floor Coverings Res/Textile/S26					

**B00C - R0004 - Home Base**

Chalk Board	Compressed AC Sheet	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00D/R0006/Chalk Board/S9					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3449/B00C/R0030/Floor Coverings Res/Textile/S26					

**B00C - R0005 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3449/B00C/R0030/Floor Coverings Res/Textile/S26					

**B00C - R0006 - Movement**

No Asbestos

**B00C - R0007 - Kiln Room**

No Asbestos

**B00C - R0009 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00C/R0024/Floor Coverings Res/Textile/S25					<b>No Asbestos Detected</b>

**B00C - R0010 - Withdrawal Space - 1hb**

Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00C/R0024/Floor Coverings Res/Textile/S25					<b>No Asbestos Detected</b>

**B00C - R0011 - Home Base**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Chalk Board	Compressed AC Sheet	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00D/R0006/Chalk Board/S9					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3449/B00C/R0030/Floor Coverings Res/Textile/S26					
<b>B00C - R0012 - Home Base</b>						
Chalk Board	Compressed AC Sheet	47m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00D/R0006/Chalk Board/S9					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3449/B00C/R0030/Floor Coverings Res/Textile/S26					
<b>B00C - R0017 - Staff Toilet</b>						
Cistern bracets - Packer	Flat AC Sheeting					<b>No Asbestos Detected</b>
	3449/B00C/R0017/Cistern bracets - Packer/S24					
<b>B00C - R0018 - Communications Room</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	13m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>
<b>B00C - R0019 - Library Office/Workroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>
<b>B00C - R0020 - Library Office/Workroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>
<b>B00C - R0021 - Staff Toilet</b>						
No Asbestos						
<b>B00C - R0023 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
	3449/B00C/R0024/Floor Coverings Res/Textile/S25					
<b>B00C - R0024 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
	3449/B00C/R0024/Floor Coverings Res/Textile/S25					
<b>B00C - R0025 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00C - R0026 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00C - R0027 - General Storeroom</b>						
No Asbestos						
<b>B00C - R0029 - Seminar/Study</b>						
Floor Coverings Res/Textile	Vinyl Sheet					<b>No Asbestos Detected</b>
	3449/B00C/R0024/Floor Coverings Res/Textile/S25					
<b>B00C - R0030 - Distribution Board</b>						
				Note: No inspection of live electrical installation.		
Floor Coverings Res/Textile	Vinyl Tiles	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4					<b>Chrysotile (white asbestos)</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	3449/B00C/R0030/Floor Coverings Res/Textile/S26					No Asbestos Detected
<b>B00C - R0031 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00C/R0024/Floor Coverings Res/Textile/S25					No Asbestos Detected
<b>B00C - R0032 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3449/B00C/R0030/Floor Coverings Res/Textile/S26					No Asbestos Detected
<b>B00C - R0033 - Home Base</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					
	3449/B00C/R0030/Floor Coverings Res/Textile/S26					No Asbestos Detected
Floor Coverings Res/Textile	Adhesive					
	3449/B00C/R0030/Floor Coverings Res/Textile/S26					No Asbestos Detected
<b>B00C - R0034 - Withdrawal Space - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00C/R0024/Floor Coverings Res/Textile/S25					No Asbestos Detected
<b>B00C - R0035 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00C/R0024/Floor Coverings Res/Textile/S25					No Asbestos Detected
<b>B00C - R0036 - Home Base</b>						
Chalk Board	Compressed AC Sheet	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00D/R0006/Chalk Board/S9					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	3449/B00C/R0030/Floor Coverings Res/Textile/S26					No Asbestos Detected
<b>B00C - R0037 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00C/R0024/Floor Coverings Res/Textile/S25					No Asbestos Detected
<b>B00C - R0038 - Kiln Room</b>						
No Asbestos						
<b>B00C - R0039 - Home Base</b>						
Chalk Board	Compressed AC Sheet	4m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00D/R0006/Chalk Board/S9					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					
	3449/B00C/R0030/Floor Coverings Res/Textile/S26					No Asbestos Detected
<b>B00C - R0040 - Home Base</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Adhesive					
	3449/B00C/R0030/Floor Coverings Res/Textile/S26				<b>No Asbestos Detected</b>	
<b>B00C - R0041 - Movement</b>						
No Asbestos						
<b>B00C - R0042 - Personal Effects Storage</b>						
No Asbestos						
<b>B00C - R0043 - Home Base</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
	3449/B00C/R0030/Floor Coverings Res/Textile/S26				<b>No Asbestos Detected</b>	
<b>B00C - R0044 - Home Base</b>						
Chalk Board	Compressed AC Sheet	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00D/R0006/Chalk Board/S9				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00C/R1003/Floor Coverings Res/Textile/S4				<b>Chrysotile (white asbestos)</b>	
Floor Coverings Res/Textile	Adhesive					
	3449/B00C/R0030/Floor Coverings Res/Textile/S26				<b>No Asbestos Detected</b>	
<b>B00C - R0045 - Movement</b>						
No Asbestos						
<b>B00C - R0046 - Personal Effects Storage</b>						
No Asbestos						
<b>B00C - R0047 - Movement</b>						
No Asbestos						
<b>B00C - R0066 - Movement</b>						
No Asbestos						
<b>B00C - R0067 - Movement</b>						
No Asbestos						
<b>B00C - R0068 - Movement</b>						
No Asbestos						
<b>B00C - R0069 - Movement</b>						
No Asbestos						
<b>B00C - R0070 - Stairs</b>						
No Asbestos						
<b>B00C - R0071 - Stairs</b>						
No Asbestos						
<b>B00C - R0072 - Resource/Toy Space</b>						
No Asbestos						
<b>B00C - R0073 - Resource/Toy Space</b>						
No Asbestos						
<b>B00C - R0074 - Movement</b>						
No Asbestos						
<b>B00C - R0075 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00C/R0024/Floor Coverings Res/Textile/S25				<b>No Asbestos Detected</b>	
<b>B00C - R0076 - Home Base</b>						



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	64m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00C/R1003/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive					
3449/B00C/R0030/Floor Coverings Res/Textile/S26					No Asbestos Detected	
<b>B00C - R0077 - Special Programs Room</b>						
No Asbestos						
<b>B00C - R0078 - Personal Effects Storage</b>						
No Asbestos						
<b>B00C - R0079 - Practical Activities</b>						
No Asbestos						
<b>B00C - R0080 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
3449/B00C/R0024/Floor Coverings Res/Textile/S25					No Asbestos Detected	
<b>B00C - R0081 - Home Base</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00C/R1003/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
<b>B00C - R1001 - Special Programs Room</b>						
Fume Cupboard	Vinyl Tiles (Under Floor Covering/Carpet)	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00C/R1003/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
<b>B00C - R1002 - Special Programs Room</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	28m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00C/R1003/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
<b>B00C - R1003 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00C/R1003/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
<b>B00C - R1004 - Home Base</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00C/R1003/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
Chalk Board	Compressed AC Sheet	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00D/R0006/Chalk Board/S9					Chrysotile (white asbestos)	
<b>B00C - R1005 - General Storeroom</b>						
No Asbestos						
<b>B00C - R1006 - Home Base</b>						
Chalk Board	Compressed AC Sheet	4m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00D/R0006/Chalk Board/S9					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00C/R1003/Floor Coverings Res/Textile/S4					Chrysotile (white asbestos)	
<b>B00C - R1007 - Movement</b>						
No Asbestos						
<b>B00C - R1008 - Stairs</b>						
No Asbestos						
<b>B00C - R1009 - Stairs</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - General Learning - 1936 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction
Underfloor Voids	Non Accessible Area - Area inaccessible - no access sighted

**Interior****B00D - R0001 - Cleaning Distributed Store**

Floor Coverings Res/Textile	Vinyl Tiles	4m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00D/R0001/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					
	3449/B00E/R0003/Wall linings around heater/S12					<b>No Asbestos Detected</b>

**B00D - R0002 - Staff Toilet**

No Asbestos

**B00D - R0003 - Movement**

No Asbestos

**B00D - R0004 - Movement**

No Asbestos

**B00D - R0005 - Practical Activities - 1hb**

Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00D/R0005/Floor Coverings Res/Textile/S22					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive					
	3449/B00D/R0005/Floor Coverings Res/Textile/S23					<b>No Asbestos Detected</b>

**B00D - R0006 - Home Base**

Chalk Board	Compressed AC Sheet	20m2	to surrounding masonry walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3449/B00D/R0006/Chalk Board/S9					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00D/R0001/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>

**B00D - R0007 - Home Base**

Chalk Board	Compressed AC Sheet	20m2	to surrounding masonry walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3449/B00D/R0006/Chalk Board/S9					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00D/R0001/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>

**B00D - R0008 - Movement**

Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00D/R0005/Floor Coverings Res/Textile/S22					<b>No Asbestos Detected</b>

**B00D - R0009 - Home Base**

Chalk Board	Compressed AC Sheet	20m2	to surrounding masonry walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3449/B00D/R0006/Chalk Board/S9					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	47m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00D/R0001/Floor Coverings Res/Textile/S8					<b>Chrysotile (white asbestos)</b>

**B00D - R0010 - Movement**

Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00D/R0005/Floor Coverings Res/Textile/S22					<b>No Asbestos Detected</b>

**B00D - R0011 - Home Base**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Chalk Board	Compressed AC Sheet	20m2	to surrounding masonry walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3449/B00D/R0006/Chalk Board/S9					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	61m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00D/R0001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
<b>B00D - R0012 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00D - R0013 - Movement</b>						
No Asbestos						
<b>B00D - R0014 - Drinking Facilities</b>						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00E/R0001/Ceiling Structures/Linings/S11					Chrysotile (white asbestos) , Amosite (brown asbestos)	
<b>B00D - R0017 - Home Base</b>						
Chalk Board	Compressed AC Sheet	20m2	To surrounding masonry	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3449/B00D/R0006/Chalk Board/S9					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	46m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00D/R0001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
<b>B00D - R0018 - General Storeroom</b>						
No Asbestos						
<b>B00D - R0019 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00D/R0001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
<b>B00D - R0020 - Staff Room Annexe</b>						
Chalk Board	Compressed AC Sheet	10m2	All surfaces	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3449/B00D/R0006/Chalk Board/S9					Chrysotile (white asbestos)	
<b>B00D - R0021 - Movement</b>						
No Asbestos						
<b>B00D - R0022 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
3449/B00D/R0005/Floor Coverings Res/Textile/S22					No Asbestos Detected	
<b>B00D - R0023 - Cleaning Distributed Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00D/R0001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
<b>B00D - R0024 - Staff Toilet</b>						
No Asbestos						
<b>B00D - R0025 - Movement</b>						
No Asbestos						
<b>B00D - R0026 - Movement</b>						
No Asbestos						
<b>B00D - R0027 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
3449/B00D/R0005/Floor Coverings Res/Textile/S22					No Asbestos Detected	
<b>B00D - R0028 - Movement</b>						
No Asbestos						
<b>B00D - R0029 - Stairs</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00D - R0030 - Stairs</b>						
No Asbestos						
<b>B00D - R0031 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00A/R0001/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R0032 - Disabled Shower/Toilet</b>						
No Asbestos						
<b>B00D - R0033 - Sports Store</b>						
Ceiling Structures/Linings	Flat AC Sheeting	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00E/R0001/Ceiling Structures/Linings/S11					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00D - R0034 - Sports Store</b>						
No Asbestos						
<b>B00D - R0035 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00F/R0016/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00E/R0001/Ceiling Structures/Linings/S11					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00D - R0036 - Toilets - Boys</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	6m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00F/R0016/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>	
Ceiling Structures/Linings	Flat AC Sheeting	26m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00E/R0001/Ceiling Structures/Linings/S11					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00D - R1001 - Cleaning Distributed Store</b>						
No Asbestos						
<b>B00D - R1002 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Tiles	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00D/R1002/Floor Coverings Res/Textile/S10					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R1003 - Home Base</b>						
Chalk Board	Compressed AC Sheet	20m2	to surrounding masonry walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3449/B00D/R0006/Chalk Board/S9					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R1004 - Home Base</b>						
Chalk Board	Compressed AC Sheet	20m2	to surrounding masonry walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3449/B00D/R0006/Chalk Board/S9					<b>Chrysotile (white asbestos)</b>	
<b>B00D - R1005 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
3449/B00D/R0005/Floor Coverings Res/Textile/S22					<b>No Asbestos Detected</b>	
<b>B00D - R1006 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
3449/B00D/R0005/Floor Coverings Res/Textile/S22					<b>No Asbestos Detected</b>	
Floor Coverings Res/Textile	Adhesive					
3449/B00D/R0005/Floor Coverings Res/Textile/S23					<b>No Asbestos Detected</b>	
<b>B00D - R1007 - Home Base</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Chalk Board	Compressed AC Sheet	20m2	to surrounding masonry walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3449/B00D/R0006/Chalk Board/S9					Chrysotile (white asbestos)	
<b>B00D - R1008 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
3449/B00D/R0005/Floor Coverings Res/Textile/S22					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
3449/B00D/R0005/Floor Coverings Res/Textile/S23					No Asbestos Detected	
<b>B00D - R1009 - Home Base</b>						
Chalk Board	Compressed AC Sheet	20m2	to surrounding masonry wall	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3449/B00D/R0006/Chalk Board/S9					Chrysotile (white asbestos)	
<b>B00D - R1010 - Home Base</b>						
Chalk Board	Compressed AC Sheet	20m2	to surrounding masonry walls	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3449/B00D/R0006/Chalk Board/S9					Chrysotile (white asbestos)	
<b>B00D - R1011 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
3449/B00D/R0005/Floor Coverings Res/Textile/S22					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
3449/B00D/R0005/Floor Coverings Res/Textile/S23					No Asbestos Detected	
<b>B00D - R1012 - Craft Store</b>						
Floor Coverings Res/Textile	Vinyl Tiles	15m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00D/R0001/Floor Coverings Res/Textile/S8					Chrysotile (white asbestos)	
Floor Coverings Res/Textile	adhesive					
3449/B00E/R0002/Floor Coverings Res/Textile/S20					No Asbestos Detected	
<b>B00D - R1013 - Movement</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
3449/B00D/R0005/Floor Coverings Res/Textile/S22					No Asbestos Detected	
Floor Coverings Res/Textile	Adhesive					
3449/B00D/R0005/Floor Coverings Res/Textile/S23					No Asbestos Detected	
<b>B00D - R1014 - Stairs</b>						
No Asbestos						
<b>B00D - R1015 - Stairs</b>						
No Asbestos						

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00E - General Learning - 1975 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting 3449/B00E/Eaves Linings/S13	20m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Wall Cladding	Flat AC Sheeting 3449/B00E/Wall Cladding/S14	10m2	North east corner	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Non Accessible Area - Height Restriction					
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting <b>Assumed Asbestos - Area inaccessible</b>	1m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)

**Interior**

**B00E - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 3449/B00E/R0001/Ceiling Structures/Linings/S11	30m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00E - R0002 - Uniform Shop**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3449/B00E/R0002/Floor Coverings Res/Textile/S19					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive 3449/B00E/R0002/Floor Coverings Res/Textile/S20					<b>No Asbestos Detected</b>

**B00E - R0003 - Home Base**

Wall linings around heater	Flat AC Sheeting 3449/B00E/R0003/Wall linings around heater/S12					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3449/B00E/R0002/Floor Coverings Res/Textile/S19					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive 3449/B00E/R0002/Floor Coverings Res/Textile/S20					<b>No Asbestos Detected</b>

**B00E - R0004 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3449/B00E/R0002/Floor Coverings Res/Textile/S19					<b>No Asbestos Detected</b>
Floor Coverings Res/Textile	Adhesive 3449/B00E/R0002/Floor Coverings Res/Textile/S20					<b>No Asbestos Detected</b>

**B00E - R0005 - P.E. Store**

Ceiling Structures/Linings	Flat AC Sheeting 3449/B00E/R0001/Ceiling Structures/Linings/S11	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Wall Linings Internal	Flat AC Sheeting 3449/B00E/R0005/Wall Linings Internal/S21	4m2	northwest	Good Condition (1)	Low (1)	Low Priority (2-3)
						<b>Chrysotile (white asbestos)</b>



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning - 1978 - Brick/Block (Brick/Block)**

**Exterior**

Eaves Linings	Flat AC Sheeting	100m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3449/B00F/Eaves Linings/S7				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Voids - Raked Ceiling	Non Accessible Area - Area inaccessible					
Gable Ends	Flat AC Sheeting	10m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
	3449/B00H/R0017/Gable Ends - packer/S16				<b>Chrysotile (white asbestos)</b>	
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00F - M1001 - Withdrawal Space - 1hb**

No Asbestos

**B00F - M1002 - Stairs**

No Asbestos

**B00F - R0001 - Movement**

Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00C/R0024/Floor Coverings Res/Textile/S25				<b>No Asbestos Detected</b>	

**B00F - R0002 - Movement**

No Asbestos

**B00F - R0003 - Sports Store**

Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00C/R0024/Floor Coverings Res/Textile/S25				<b>No Asbestos Detected</b>	

**B00F - R0004 - Sports Store**

Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00C/R0024/Floor Coverings Res/Textile/S25				<b>No Asbestos Detected</b>	

**B00F - R0005 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00C/R0024/Floor Coverings Res/Textile/S25				<b>No Asbestos Detected</b>	

**B00F - R0006 - Staff Toilet**

No Asbestos

**B00F - R0007 - Staff Toilet**

No Asbestos

**B00F - R0010 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00C/R0024/Floor Coverings Res/Textile/S25				<b>No Asbestos Detected</b>	

**B00F - R0011 - Cleaning Distributed Store**

No Asbestos

**B00F - R0012 - Distribution Board**

Note: No inspection of live electrical installation.

No Asbestos

**B00F - R0013 - Movement**

No Asbestos

**B00F - R0014 - General Storeroom**

No Asbestos

**B00F - R0015 - Cleaning Supplies**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00F - R0016 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	21m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00F/R0016/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R0017 - Toilets - Boys</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00F/R0016/Partition Walls (Cubicles)/S5					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R0018 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	120m2	To sloped surfaces only.	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00F/R0018/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos)</b>	
Gable ends- packer	Flat AC Sheeting	5m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00H/R0017/Gable Ends - packer/S16					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R0019 - Stairs</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
3449/B00C/R0024/Floor Coverings Res/Textile/S25					<b>No Asbestos Detected</b>	
<b>B00F - R0020 - Practical Activities - 1hb</b>						
No Asbestos						
<b>B00F - R0021 - Home Base</b>						
No Asbestos						
<b>B00F - R1001 - Home Base Store</b>						
No Asbestos						
<b>B00F - R1002 - Home Base</b>						
No Asbestos						
<b>B00F - R1003 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	To sloped surfaces only.	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00F/R0018/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R1004 - Practical Activities - 1hb</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
3449/B00C/R0024/Floor Coverings Res/Textile/S25					<b>No Asbestos Detected</b>	
<b>B00F - R1005 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
3449/B00C/R0024/Floor Coverings Res/Textile/S25					<b>No Asbestos Detected</b>	
<b>B00F - R1006 - General Storeroom</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
3449/B00C/R0024/Floor Coverings Res/Textile/S25					<b>No Asbestos Detected</b>	
<b>B00F - R1007 - Distribution Board</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00F - R1008 - Personal Effects Storage</b>						
Floor Coverings Res/Textile	Vinyl Sheet					
3449/B00C/R0024/Floor Coverings Res/Textile/S25					<b>No Asbestos Detected</b>	
<b>B00F - R1009 - Home Base</b>						
No Asbestos						
<b>B00F - R1010 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	9m2	To sloped surfaces only.	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00F/R0018/Ceiling Structures/Linings/S6					<b>Chrysotile (white asbestos)</b>	
<b>B00F - R1011 - Stairs</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Floor Coverings Res/Textile	Vinyl Sheet					
	3449/B00C/R0024/Floor Coverings Res/Textile/S25					<b>No Asbestos Detected</b>

**B00F - R1012 - Stairs**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Communal Facilities - 1978 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids - Raked Ceiling	Non Accessible Area - Restricted Access - Raked Ceilings					
Eaves Linings	Flat AC Sheeting 3449/B00A/Eaves Linings/S2	40m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Gable Ends	Flat AC Sheeting 3449/B00H/R0017/Gable Ends - packer/S16	10m	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Voids - Raked Ceiling	Non Accessible Area - Height Restriction - Restricted Access - Raked Ceilings					
Underfloor Voids - Slab on Ground	No Asbestos Found					

**Interior**

**B00H - R0001 - Adjoining School**

No Asbestos

**B00H - R0002 - Adjoining School**

No Asbestos

**B00H - R0003 - Adjoining School**

No Asbestos

**B00H - R0004 - Adjoining School**

No Asbestos

**B00H - R0005 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 3449/B00A/R0001/Ceiling Structures/Linings/S3	11m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	---	------	--------------	--------------------	---------	--

**B00H - R0006 - General Assistant/Bulk Store**

No Asbestos

**B00H - R0007 - Main Switch Board**

Electrical Mounting Board	Resinous Board <b>Assumed Asbestos - Electrical Hazard - metal encased</b>	1Unit	West	Good Condition (1)	Low (1)	Low Priority (2-3)
---------------------------	---	-------	------	--------------------	---------	--------------------

Electrical Backing Board	Resinous Board 3449/B00H/R0007/Electrical Backing Board/S17	1m2	North	Minimal Damage (2)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
--------------------------	--	-----	-------	--------------------	---------	--

Cable Conduits	Fibre Cement Pipe <b>Assumed Asbestos - Electrical Hazard</b>	5m2	In electrical floor pit	Some Damage - Unsealed (3)	Low (1)	Low Priority (2-3)
----------------	--	-----	-------------------------	----------------------------	---------	--------------------

**B00H - R0008 - Music Store**

No Asbestos

**B00H - R0009 - Cleaning Distributed Store**

No Asbestos

**B00H - R0010 - Hall Chair Store**

No Asbestos

**B00H - R0012 - Canteen Office/Store**

No Asbestos

**B00H - R0013 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 3449/B00A/R0001/Ceiling Structures/Linings/S3	80m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
----------------------------	---	------	--------------	--------------------	---------	--

**B00H - R0014 - Movement**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Ceiling Structures/Linings	Flat AC Sheeting	44m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00A/R0001/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos)</b>		
<b>B00H - R0015 - Communal Space</b>						
No Asbestos						
<b>B00H - R0016 - Raised Platform</b>						
No Asbestos						
<b>B00H - R0017 - Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	120m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00A/R0001/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos)</b>		
Gable Ends - packer	Flat AC Sheeting	10m2	Variable positions	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3449/B00H/R0017/Gable Ends - packer/S16				<b>Chrysotile (white asbestos)</b>		
<b>B00H - R0018 - Toilets - Boys</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00F/R0016/Partition Walls (Cubicles)/S5				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00H/R0019/Wall Linings Internal/S18				<b>Chrysotile (white asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00H/R0019/Wall Linings Internal/S18				<b>Chrysotile (white asbestos)</b>		
<b>B00H - R0019 - Toilets - Girls</b>						
Partition Walls (Cubicles)	Compressed AC Sheet	12m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00F/R0016/Partition Walls (Cubicles)/S5				<b>Chrysotile (white asbestos)</b>		
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00H/R0019/Wall Linings Internal/S18				<b>Chrysotile (white asbestos)</b>		
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3449/B00H/R0019/Wall Linings Internal/S18				<b>Chrysotile (white asbestos)</b>		
<b>B00H - R0020 - Canteen</b>						
No Asbestos						
<b>B00H - R0021 - Canteen Office/Store</b>						
No Asbestos						
<b>B00H - R0022 - External Movement</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
3449/B00A/R0001/Ceiling Structures/Linings/S3				<b>Chrysotile (white asbestos)</b>		

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 602 - D10195 - Learning Unit - Standard With P.A.A. : Placement Date - 19/12/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D12153 - Learning Unit - Standard With P.A.A. : Placement Date - 30/12/2009**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 602 - D13070 - Learning Unit - Standard With P.A.A. : Placement Date - 11/02/2015**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 601 - D13803 - Learning Unit - Standard/Withdrawal : Placement Date - 6/02/2008**

**Exterior**

Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2

**Interior**

**R1 - Entry**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

**R2 - General Learning Space**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

**R3 - Store**

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 601 - D13964 - Learning Unit - Standard/Withdrawal : Placement Date - 1/02/2006**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
-------------	---------------------	------------------	---------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Landing	Compressed AC Sheet	Assumed Asbestos				1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos				11.52 m2
<b>Interior</b>						
<b>R1 - Entry</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
<b>R2 - General Learning Space</b>						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
<b>R3 - Store</b>						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2
<b>OS 602 - D14051 - Learning Unit - Standard With P.A.A. : Placement Date - 31/12/2009</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 602 - D14518 - Learning Unit - Standard With P.A.A. : Placement Date - 29/01/2016</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 603 - D15957 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 21/01/2015</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						
<b>OS 603 - D17459 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 23/04/2007</b>						
Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.						
<b>Exterior</b>						
No Asbestos Found.						
<b>Interior</b>						
<b>R1 - Learning space/withdrawal/entry</b>						
No Asbestos Found.						
<b>R2 - Home Base Store</b>						
No Asbestos Found.						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**OS 602 - D18055 - Learning Unit - Standard With P.A.A. : Placement Date - 31/01/2017**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 603 - D18189 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 14/11/2005**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

**OS 603 - D18194 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 5/01/2006**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Learning space/withdrawal/entry**

No Asbestos Found.

**R2 - Home Base Store**

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

3449\_ASB\_030113\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017