


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Wilsons Creek Public School (3454)  
**Region :** North Coast  
**State Electorate :** Ballina  
**Local Government Area :** Byron

**Initial Survey :** Noel Arnold & Associates : 27 - May - 2008  
**Reviewed By :** Greencap-NAA : 04 - May - 2016

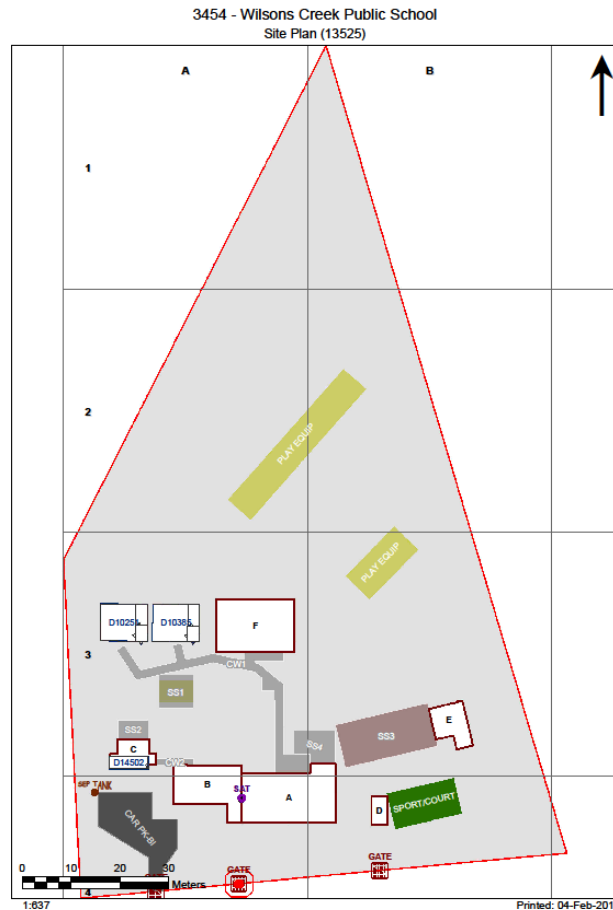

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Administration/Library - 1981 - Timber (Timber)**

**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids	Packing	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3454/B00A/Underfloor Voids/S11					Chrysotile (white asbestos)	

**Interior**

**B00A - R0001 - Clerical Office**

No Asbestos

**B00A - R0002 - Principal**

No Asbestos

**B00A - R0003 - General Storeroom**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3454/B00A/R0003/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Adhesive					
3454/B00A/R0003/Floor Coverings Res/Textile/S6					No Asbestos Detected	

**B00A - R0004 - Entry Vestibule**

No Asbestos

**B00A - R0005 - Home Base Store**

Floor Coverings Res/Textile	Vinyl Tiles	3m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3454/B00A/R0003/Floor Coverings Res/Textile/S5					Chrysotile (white asbestos)	

Floor Coverings Res/Textile	Adhesive					
3454/B00A/R0003/Floor Coverings Res/Textile/S6					No Asbestos Detected	

**B00A - R0006 - Home Base**

No Asbestos

**B00A - R0009 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting					
3454/B00A/R0009/Ceiling Structures/Linings/S2					No Asbestos Detected	

**B00A - R0010 - Principal**

Recently Modified Space Requires Inspection

**B00A - R0011 - Withdrawal Space - 1hb**

Recently Modified Space Requires Inspection

**B00A - R0012 - Canteen**

Recently Modified Space Requires Inspection

**B00A - R9001 - Garden Store**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Staff Facilities/Pupil Facilities - 1908 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	100m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3454/B00B/R0004/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>

**Interior****B00B - R0001 - Canteen**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	3454/B00B/R0001/Wall Linings Internal/S8					
Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3454/B00A/R0003/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3454/B00A/R0003/Floor Coverings Res/Textile/S6					

**B00B - R0002 - General Storeroom**

Wall Linings Internal	Flat AC Sheeting					<b>No Asbestos Detected</b>
	3454/B00B/R0001/Wall Linings Internal/S8					
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3454/B00A/R0003/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3454/B00A/R0003/Floor Coverings Res/Textile/S6					

**B00B - R0003 - Staff Room**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3454/B00A/R0003/Floor Coverings Res/Textile/S5					<b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					<b>No Asbestos Detected</b>
	3454/B00B/R0002/Floor Coverings Res/Textile/S4					
Floor Coverings Res/Textile	Adhesive					<b>No Asbestos Detected</b>
	3454/B00A/R0003/Floor Coverings Res/Textile/S6					

**B00B - R0004 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3454/B00B/R0004/Ceiling Structures/Linings/S7					<b>Chrysotile (white asbestos)</b>

**B00B - R0005 - Drinking Facilities**

No Asbestos

**B00B - R0006 - External Stairs**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Pupil Facilities - 1955 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Raked Ceiling No Asbestos Found

**Interior****B00C - R0001 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3454/B00C/R0004/Ceiling Structures/Linings/S10					<b>Chrysotile (white asbestos)</b>	

**B00C - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3454/B00C/R0004/Ceiling Structures/Linings/S10					<b>Chrysotile (white asbestos)</b>	

**B00C - R0003 - Cleaning Distributed Store**

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3454/B00C/R0004/Ceiling Structures/Linings/S10					<b>Chrysotile (white asbestos)</b>	

**B00C - R0004 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3454/B00C/R0004/Ceiling Structures/Linings/S10					<b>Chrysotile (white asbestos)</b>	

**B00C - R0005 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3454/B00C/R0004/Ceiling Structures/Linings/S10					<b>Chrysotile (white asbestos)</b>	

**B00C - R0006 - External Movement**

Ceiling Structures/Linings	Flat AC Sheeting	13m2	Throughout	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)
3454/B00C/R0006/Ceiling Structures/Linings/S9					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Building Services - 1955 - Timber Shed (Timber Shed)**

**Exterior**

Ceiling Voids - Raked Ceiling	No Asbestos Found					
Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 3454/B00D/Eaves Linings/S12					<b>No Asbestos Detected</b>

**Interior**

**B00D - R0001 - Sports Store**

Wall Linings Internal	Flat AC Sheeting	8m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3454/B00D/R0001/Wall Linings Internal/S13					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities - 1975 - Timber (Timber)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	Non Accessible Area - no manhole					
Eaves Linings	Flat AC Sheeting 3454/B00E/Eaves Linings/S14					<b>No Asbestos Detected</b>

**Interior**

**B00E - R0002 - Special Programs Room**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Library - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00F - R0001 - External Movement**

No Asbestos

**B00F - R0002 - Reading Area**

No Asbestos

**B00F - R0003 - Library Office/Workroom**

No Asbestos

**B00F - R0004 - Communications Room**

No Asbestos

**B00F - R0005 - K.L.A. Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**Demountables**

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 601 - D10251 - Learning Unit - Standard/Withdrawal : Placement Date - 23/08/1996**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

**Interior**

**R1 - Entry**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

**R2 - General Learning Space**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

**R3 - Store**

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 601 - D10385 - Learning Unit - Standard/Withdrawal : Placement Date - 23/08/1996**

**Exterior**

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	11.52 m2

**Interior**

**R1 - Entry**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	8 m2

**R2 - General Learning Space**

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	55 m2

**R3 - Store**

Ceiling	Flat AC Sheet	Assumed Asbestos	10 m2
---------	---------------	------------------	-------

**OS 840 - D14502 - Girls Toilet : Placement Date - 16/11/2012**

**Exterior**

No Asbestos Found.

**Interior**

**R1 - Toilets-Girls**

No Asbestos Found.

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017