


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Windsor Public School (3459)
Region : Western Sydney
State Electorate : Hawkesbury
Local Government Area : Hawkesbury

Initial Survey : Noel Arnold & Associates : 30 - Mar - 2008
Reviewed By : Parsons Brinckerhoff : 17 - Jun - 2015

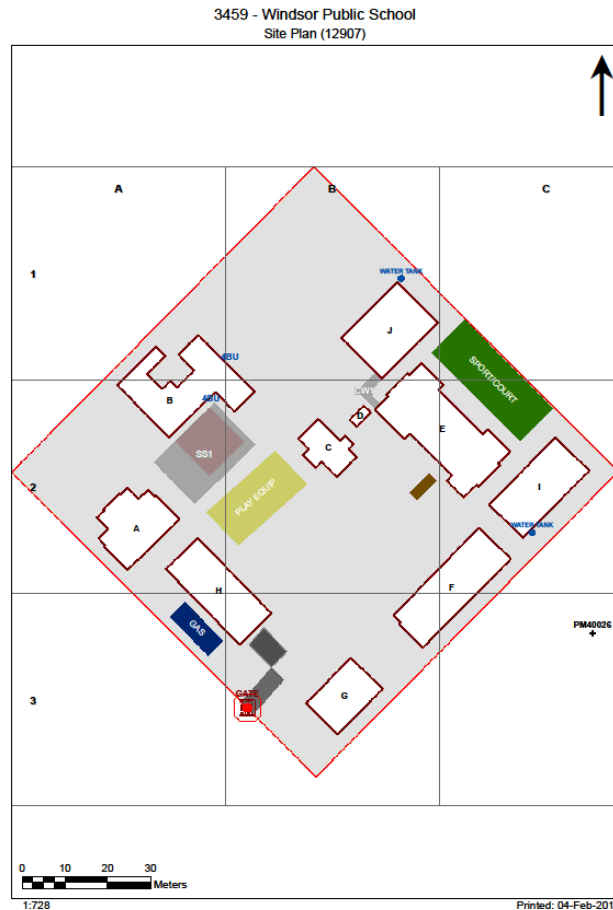

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Administration/General Learning - 1869 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 3459/B00A/Eaves Linings/S7					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00A - R0003 - Movement**

Floor Coverings Res/Textile	Vinyl Tiles 3459/B00A/R0003/Floor Coverings Res/Textile/S8					No Asbestos Detected
--------------------------------	---	--	--	--	--	----------------------

B00A - R0004 - Staff Room

No Asbestos

B00A - R0005 - Duplicating Workroom

Floor Coverings Res/Textile	Vinyl Tiles 3459/B00A/R0005/Floor Coverings Res/Textile/S1	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------------	---	-----	------------	--------------------	---------	--------------------

Chrysotile (white asbestos)

Manhole Infill Panel	Flat AC Sheeting 3459/B00A/R0005/Manhole Infill Panel/S17					No Asbestos Detected
----------------------	--	--	--	--	--	----------------------

B00A - R0006 - Duplicating Workroom

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3459/B00A/R0015/Floor Coverings Res/Textile/S20	10m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
--------------------------------	---	------	------------	--------------------	---------	--------------------

Chrysotile (white asbestos)

B00A - R0007 - Clerical Office

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3459/B00A/R0015/Floor Coverings Res/Textile/S20	12m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
--------------------------------	---	------	------------	--------------------	---------	--------------------

Chrysotile (white asbestos)

B00A - R0010 - Movement

No Asbestos

B00A - R0011 - Sick Bay

No Asbestos

B00A - R0013 - Principal

Floor Coverings Res/Textile	Vinyl Floor Sheeting (under carpet) 3459/B00A/R0013/Floor Coverings Res/Textile/S19					No Asbestos Detected
--------------------------------	---	--	--	--	--	----------------------

B00A - R0014 - Movement

Floor Coverings Res/Textile	Vinyl Floor Sheeting (under carpet) 3459/B00A/R0013/Floor Coverings Res/Textile/S19					No Asbestos Detected
--------------------------------	---	--	--	--	--	----------------------

No Asbestos Detected

B00A - R0015 - Entry Vestibule

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3459/B00A/R0015/Floor Coverings Res/Textile/S20	11m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
--------------------------------	---	------	------------	--------------------	---------	--------------------

Chrysotile (white asbestos)

B00A - R0016 - Clerical Office

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3459/B00A/R0015/Floor Coverings Res/Textile/S20	13m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
--------------------------------	---	------	------------	--------------------	---------	--------------------

Chrysotile (white asbestos)

B00A - R0017 - Staff Toilet

No Asbestos

B00A - R0018 - Toilet - Lobby

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Communal Facilities/Pupil Facilities - 1884 - Brick/Block (Brick/Block)**Exterior**

Eaves Linings	Flat AC Sheeting 3459/B00B/Eaves Linings/S13					No Asbestos Detected
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior**B00B - R0001 - Kiln Room**

No Asbestos

B00B - R0002 - Sports Store

No Asbestos

B00B - R0003 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	20m2	West	Minimal Damage (2)	Low (1)	Low Priority (2-3)
	3459/B00B/R0003/Wall Linings Internal/S18					Chrysotile (white asbestos)

B00B - R0004 - Canteen

Wall Linings Internal	Flat AC Sheeting	6m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
	3459/B00B/R0004/Wall Linings Internal/S5					Chrysotile (white asbestos)

B00B - R0005 - Movement

Wall Linings Internal	Flat AC Sheeting	6m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3459/B00B/R0004/Wall Linings Internal/S5					Chrysotile (white asbestos)

B00B - R0006 - Movement

No Asbestos

B00B - R0007 - Communal Space

No Asbestos

B00B - R0008 - Raised Platform

No Asbestos

B00B - R0009 - Movement

No Asbestos

B00B - R0010 - Movement

No Asbestos

B00B - R0011 - Uniform Shop

No Asbestos

B00B - R0012 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Pupil Facilities - 1937 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00C - R0001 - Movement

No Asbestos

B00C - R0002 - Toilets - Boys

No Asbestos

B00C - R0003 - Movement

No Asbestos

B00C - R0004 - Toilets - Girls

No Asbestos

B00C - R0005 - Handwashing Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Building Services - 1937 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00D - R0001 - General Assistant/Bulk Store

No Asbestos

B00D - R0002 - Garden Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - General Learning - 1937 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00E - R0003 - Movement

No Asbestos

B00E - R0004 - Home Base

No Asbestos

B00E - R0005 - Home Base

No Asbestos

B00E - R0006 - Home Base

No Asbestos

B00E - R0007 - Home Base

No Asbestos

B00E - R0009 - Movement

No Asbestos

B00E - R0010 - General Storeroom

No Asbestos

B00E - R0011 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting					
		3459/B00E/R0013/Ceiling Structures/Linings/S16				No Asbestos Detected

B00E - R0012 - External Movement

No Asbestos

B00E - R0013 - Home Base Store

Ceiling Structures/Linings	Flat AC Sheeting					
		3459/B00E/R0013/Ceiling Structures/Linings/S16				No Asbestos Detected

B00E - R0014 - Practical Activities - 1hb

No Asbestos

B00E - R0015 - Home Base Store

No Asbestos

B00E - R0016 - Withdrawal Space - 2hb

No Asbestos

B00E - R0017 - Practical Activities - 1hb

No Asbestos

B00E - R0018 - Withdrawal Space - 1hb

No Asbestos

B00E - R0019 - Sound Cupboard

No Asbestos

B00E - R0020 - Withdrawal Space - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - General Learning - 1912 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	12m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3459/B00G/Eaves Linings/S11					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00F - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	58m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3459/B00G/Eaves Linings/S11					Chrysotile (white asbestos)

B00F - R0002 - Home Base

Wall Linings Internal	Flat AC Sheeting	40m2	North, South, East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3459/B00G/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0003 - Home Base

Wall Linings Internal	Flat AC Sheeting	40m2	North, South, East, West, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3459/B00G/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0004 - General Storeroom

Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3459/B00G/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00F - R0005 - Home Base

No Asbestos

B00F - R0006 - General Storeroom

No Asbestos

B00F - R0007 - Staff Room Annexe

No Asbestos

B00F - R0008 - General Storeroom

Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
	3459/B00H/R0001/Ceiling Structures/Linings/S2					
Wall Linings Internal	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3459/B00G/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 1912 - Timber (Timber)

Exterior

Eaves Linings	Flat AC Sheeting	10m2	East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3459/B00G/Eaves Linings/S11					Chrysotile (white asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00G - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3459/B00G/Eaves Linings/S11					Chrysotile (white asbestos)

B00G - R0002 - Home Base

Wall Linings Internal	Flat AC Sheeting	30m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3459/B00G/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

B00G - R0003 - Home Base

Wall Linings Internal	Flat AC Sheeting	50m2	North, East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3459/B00G/R0002/Wall Linings Internal/S12					Chrysotile (white asbestos) , Amosite (brown asbestos)

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - General Learning/Pupil Facilities - 1972 - Brick/Block (Brick/Block)

Exterior

Eaves Linings	Flat AC Sheeting 3459/B00H/Eaves Linings/S14	30m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)
Gable Verge Lining	Fibrous Membrane 3459/B00H/Gable Verge Lining/S15					No Asbestos Detected
Wall Cladding	Flat AC Sheeting 3459/B00H/Wall Cladding/S10	30m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					

Interior

B00H - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3459/B00H/R0001/Ceiling Structures/Linings/S2					No Asbestos Detected
Wall panel	Compressed AC Sheet 3459/B00H/R0001/Wall panel/S3	4m2	South	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos)

B00H - R0002 - Toilets - Girls

Partition Walls (Cubicles)	Compressed AC Sheet 3459/B00H/R0005/Partition Walls (Cubicles)/S4					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00H - R0003 - Cleaning Distributed Store

No Asbestos

B00H - R0004 - Staff Toilet

No Asbestos

B00H - R0005 - Toilets - Boys

Partition Walls (Cubicles)	Compressed AC Sheet 3459/B00H/R0005/Partition Walls (Cubicles)/S4					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00H - R0006 - General Storeroom

No Asbestos

B00H - R0007 - Withdrawal Space - 1hb

No Asbestos

B00H - R0008 - Community Clinic

No Asbestos

B00H - R0009 - Personal Effects Storage

No Asbestos

B00H - R0010 - Home Base Store

No Asbestos

B00H - R0011 - Toilets - Boys/Girls

No Asbestos

B00H - R0012 - Home Base

No Asbestos

B00H - R0013 - Practical Activities - 1hb

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B001 - Library - 2009 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B001 - R0001 - Reading Area

No Asbestos

B001 - R0002 - Library Office/Workroom

No Asbestos

B001 - R0003 - Duplicating Workroom

No Asbestos

B001 - R0004 - General Storeroom

No Asbestos

B001 - R0005 - Disabled Shower/Toilet

No Asbestos

B001 - R0006 - Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00J - General Learning - 2010 - Brick/Veneer (Brick/Veneer)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

Interior

B00J - R0001 - Home Base

No Asbestos

B00J - R0002 - Home Base Store

No Asbestos

B00J - R0003 - Practical Activities - 1hb

No Asbestos

B00J - R0004 - Withdrawal Space - 2hb

No Asbestos

B00J - R0005 - Home Base

No Asbestos

B00J - R0006 - Home Base Store

No Asbestos

B00J - R0007 - Practical Activities - 1hb

No Asbestos

B00J - R0008 - External Movement

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017