


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wingello Public School (3461)
Region : Illawarra and South East
State Electorate : Goulburn
Local Government Area : Wingecarribee

Initial Survey : Noel Arnold & Associates : 07 - May - 2008
Register Issue Date : 23 - Mar - 2017

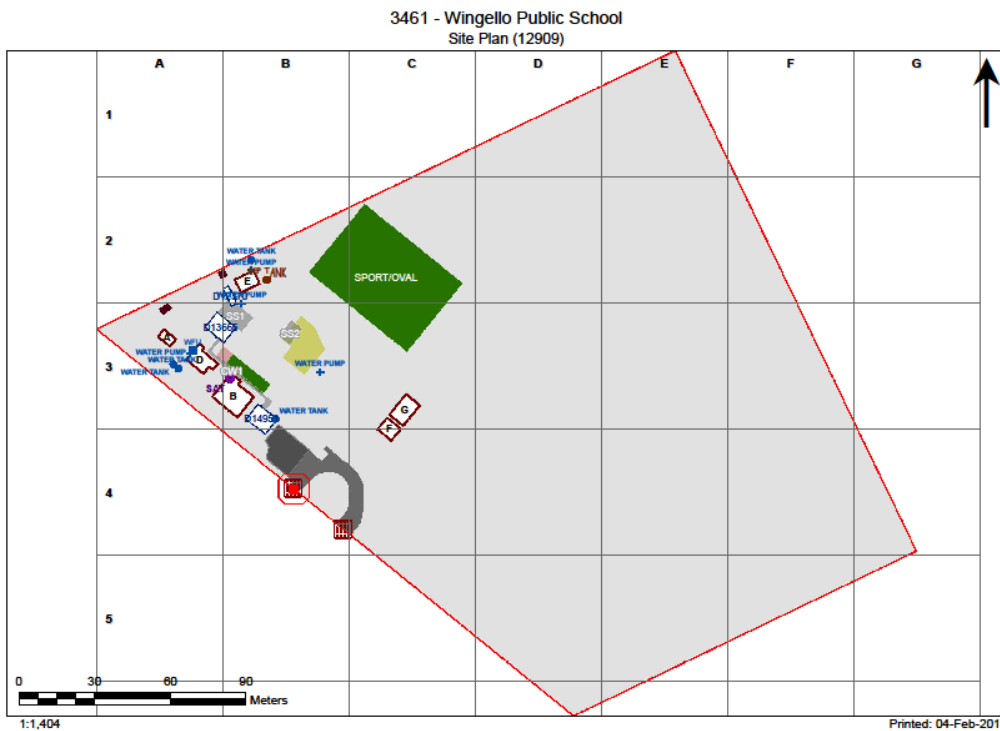

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - Building Services - 1913 - Timber (Timber)

Exterior

Wall Cladding	Flat AC Sheeting 3461/B00A/Wall Cladding/S6					No Asbestos Detected
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00A - R0001 - Sports Store

No Asbestos

B00A - R0002 - Movement

No Asbestos

B00A - R0003 - Kiln Room

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - General Learning - 1967 - Brick/Veneer (Brick/Veneer)

Exterior

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	Assumed Asbestos - Electrical Hazard					
Eaves Linings	Flat AC Sheeting	30m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3461/B00E/Eaves Linings/S2			Chrysotile (white asbestos) , Amosite (brown asbestos)		
Gable Verge Lining	Flat AC Sheeting					
	3461/B00E/Gable Verge Lining/S1					No Asbestos Detected
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00B - R0001 - Music Store

No Asbestos

B00B - R0002 - Movement

No Asbestos

B00B - R0003 - Withdrawal Space - 1hb

No Asbestos

B00B - R0004 - General Storeroom

No Asbestos

B00B - R0005 - Home Base Store

No Asbestos

B00B - R0006 - Home Base

No Asbestos

B00B - R0007 - Withdrawal Space - 1hb

No Asbestos

B00B - R0008 - Movement

Ceiling Structures/Linings	Flat AC Sheeting					
	3461/B00B/R0008/Ceiling Structures/Linings/S3					No Asbestos Detected

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Library - 1913 - Timber (Timber)

Exterior

Electrical Backing Board	Resinous Board	1m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
Assumed Asbestos - Electrical Hazard						
Eaves Linings	Flat AC Sheeting 3461/B00D/R0005/Ceiling Structures/Linings/S4					No Asbestos Detected
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00D - R0001 - Movement

No Asbestos

B00D - R0002 - K.L.A. Store

No Asbestos

B00D - R0003 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles	4m2	Throughout	Minimal Damage (2)	Low (1)	Low Priority (2-3)
						Chrysotile (white asbestos)
3461/B00D/R0003/Floor Coverings Res/Textile/S5						

B00D - R0004 - Reading Area

No Asbestos

B00D - R0005 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3461/B00D/R0005/Ceiling Structures/Linings/S4					No Asbestos Detected
----------------------------	---	--	--	--	--	-----------------------------

B00D - R0006 - Drinking Facilities

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Pupil Facilities - 1967 - Brick/Block (Brick/Block)

Exterior

Gable Verge Lining	Flat AC Sheeting 3461/B00E/Gable Verge Lining/S1					No Asbestos Detected
Eaves Linings	Flat AC Sheeting 3461/B00E/Eaves Linings/S2	12m2	North, South, East, West	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
Ceiling Voids	Requires Inspection					
Underfloor Voids	Requires Inspection					

Interior

B00E - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 3461/B00E/R0001/Ceiling Structures/Linings/S7	21m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	------	------------	--------------------	---------	---

B00E - R0002 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 3461/B00E/R0001/Ceiling Structures/Linings/S7	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) Chrysotile (white asbestos) , Amosite (brown asbestos)
----------------------------	---	------	------------	--------------------	---------	---

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Building Services - 2009 - Metal Shed (Metal Shed)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00F - R0001 - Sports Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	Sample No					Test Result

B00G - General Learning - 2009 - Steel (Steel)

Exterior

Ceiling Voids	No Asbestos Found
Underfloor Voids	Requires Inspection

Interior

B00G - R0001 - Special Programs Room

No Asbestos

B00G - R0002 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 842 - D12370 - Country Toilet - Relta - Boys/Girls : Placement Date - 8/01/1997

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		2.88 m2

Interior

R1 - Toilets-Girls

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		4 m2
End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		5 m2

R2 - Staff Toilet

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		4 m2

R3 - Toilets-Boys

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		6 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		5 m2

R4 - Staff Toilet

Ceiling	Flat AC Sheet	Assumed Asbestos		4 m2
---------	---------------	------------------	--	------

OS 505 - D13666 - Admin Staff/Principal/Secure Store : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Interior

R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		10 m2

R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos		16 m2
---------	---------------	------------------	--	-------

R3 - Staff Room

Ceiling	Flat AC Sheet	Assumed Asbestos		20 m2
---------	---------------	------------------	--	-------

R4 - Security Store

Ceiling	Flat AC Sheet	Assumed Asbestos		8 m2
---------	---------------	------------------	--	------

R5 - Clerical Office

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		18 m2

OS 601 - D14951 - Learning Unit - Standard/Withdrawal : Placement Date - 30/06/1995

Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		11.52 m2

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Interior						
R1 - Entry						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				8 m2
R2 - General Learning Space						
End wall panel	Flat AC Sheet	Assumed Asbestos				18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos				55 m2
R3 - Store						
Ceiling	Flat AC Sheet	Assumed Asbestos				10 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

There are no asbestos related file attachment(s) for this school.

2017