


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Wisemans Ferry Public School (3470)  
**Region :** Western Sydney  
**State Electorate :** Hawkesbury  
**Local Government Area :** The Hills

**Initial Survey :** Noel Arnold & Associates : 12 - Jun - 2008  
**Reviewed By :** Parsons Brinckerhoff : 01 - Nov - 2016

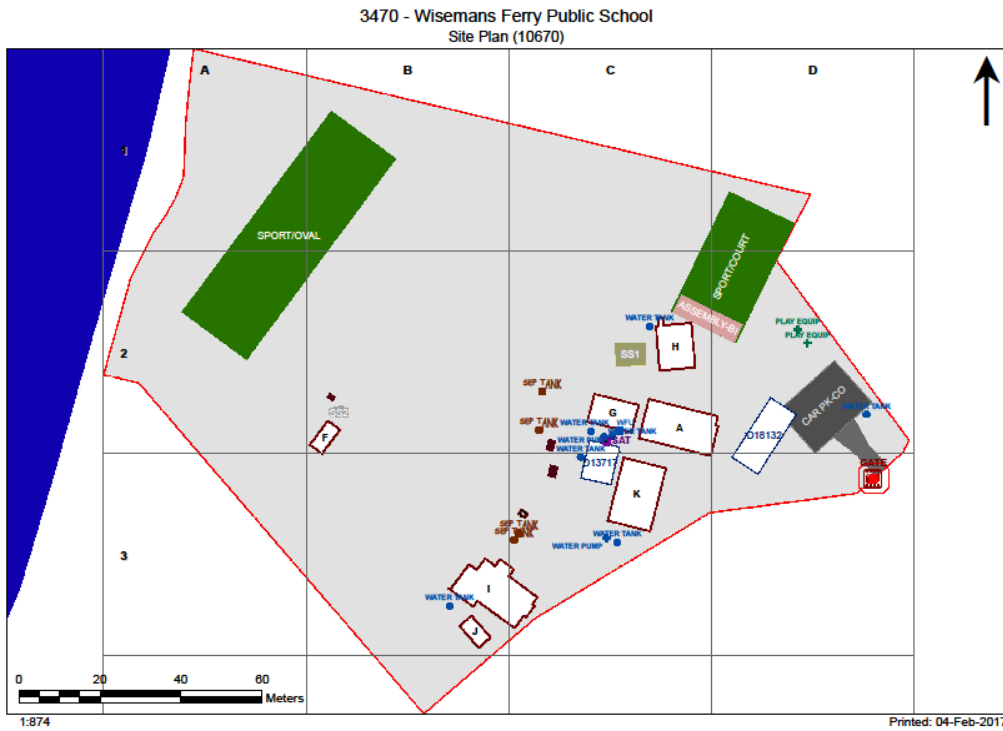

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Administration - 1962 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	10m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3470/B00A/Eaves Linings/S5				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
Ceiling Void	No Asbestos Found					
Underfloor Voids	Compressed AC Sheet					
	3470/B00A/Underfloor Voids/S8				<b>No Asbestos Detected</b>	

**Interior**

**B00A - R0001 - General Storeroom**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3470/B00A/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00A - R0002 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3470/B00A/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00A - R0003 - Home Base**

Wall Linings Internal	Compressed AC Sheet	3m2	South, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3470/B00A/R0003/Wall Linings Internal/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00A - R0004 - Home Base**

Wall Linings Internal	Compressed AC Sheet	3m2	South, West, Lower portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3470/B00A/R0003/Wall Linings Internal/S2				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00A - R0005 - Clerical Office**

Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3470/B00A/R0001/Ceiling Structures/Linings/S1				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	

**B00A - R0006 - Staff Room**

No Asbestos

**B00A - R0007 - Principal**

No Asbestos

**B00A - R9001 - P.E. Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Other-Vacant - 1962 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Voids - Slab on Ground	No Asbestos Found

**Interior**

**B00D - R0001 - Other-Vacant**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Shed - 1962 - Timber Shed (Timber Shed)**

**Exterior**

Eaves Linings	Flat AC Sheeting 3470/B00F/Eaves Linings/S6	6m2	West	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Wall Cladding	Flat AC Sheeting 3470/B00F/Wall Cladding/S3	20m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Facia Lining	Flat AC Sheeting 3470/B00F/FACIA LINING/S4	4m2	North, South	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Ceiling Voids - Flat Roof	Non Accessible Area - No Mnahole to Building					
Underfloor Voids	Compressed AC Sheet 3470/B00F/Underfloor Voids/S7	12m2	Ceiling to Underfloor	Some Damage - Unsealed (3)	Low (1)	Medium Priority (4-5) <b>Chrysotile (white asbestos)</b>

**Interior**

**B00F - R0001 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Pupil Facilities - 2006 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00G - R0001 - Toilets - Girls**

No Asbestos

**B00G - R0002 - Toilets - Boys**

No Asbestos

**B00G - R0003 - Toilets-Disabled**

No Asbestos

**B00G - R0004 - Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - General Learning - 2008 - Steel (Steel)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00H - R0001 - Home Base**

No Asbestos

**B00H - R0002 - External Stairs**

No Asbestos

**B00H - R0003 - External Movement**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00I - Pupil Facilities/Staff Facilities - 1940 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Void	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00I - R0001 - Other-Community Use**

No Asbestos

**B00I - R0002 - Staff Shower/Change**

No Asbestos

**B00I - R0003 - Other-Community Use**

No Asbestos

**B00I - R0004 - External Movement**

No Asbestos

**B00I - R0005 - General Storeroom**

No Asbestos

**B00I - R0006 - Interview**

No Asbestos

**B00I - R0007 - Staff Toilet**

No Asbestos

**B00I - R0008 - General Storeroom**

No Asbestos

**B00I - R0009 - Movement**

No Asbestos

**B00I - R0010 - Home Base/Practical Activities**

No Asbestos

**B00I - R0011 - Movement**

No Asbestos

**B00I - R0012 - Home Base/Practical Activities**

No Asbestos

**B00I - R0013 - General Storeroom**

No Asbestos

**B00I - R0014 - External Movement**

No Asbestos

**B00I - R0015 - Cleaning Distributed Store**

No Asbestos

**B00I - R0016 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - Building Services - 2008 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00J - R0001 - General Assistant/Bulk Store**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Library - 2011 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00K - R0001 - External Movement**

No Asbestos

**B00K - R0002 - K.L.A. Store**

No Asbestos

**B00K - R0003 - Communications Room**

No Asbestos

**B00K - R0004 - Library Office/Workroom**

No Asbestos

**B00K - R0005 - Reading Area**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

**Demountable details as per the AMS records as of 15 Feb 2017.**

**OS 603 - D13717 - Learning Unit - Standard With P.A.A. A/C : Placement Date - 29/01/2003**

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

### Exterior

No Asbestos Found.

### Interior

#### R1 - Learning space/withdrawal/entry

No Asbestos Found.

#### R2 - Home Base Store

No Asbestos Found.

**OS 500 - D18132 - Admin - Library : Placement Date - 12/06/2002**

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos	1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos	1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos	20.16 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	13 m2

#### R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2
---------	---------------	------------------	-------

#### R3 - Staff Room/Kitchen

Ceiling	Flat AC Sheet	Assumed Asbestos	19 m2
---------	---------------	------------------	-------

#### R4 - Clerical Office

Ceiling	Flat AC Sheet	Assumed Asbestos	18 m2
---------	---------------	------------------	-------

#### R5 - Library

Ceiling	Flat AC Sheet	Assumed Asbestos	54 m2
---------	---------------	------------------	-------

#### R6 - Storeroom

Ceiling	Flat AC Sheet	Assumed Asbestos	0 m2
---------	---------------	------------------	------

#### R7 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos	6 m2
End wall panel	Flat AC Sheet	Assumed Asbestos	18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos	4 m2

#### R8 - Entry to toilet

Ceiling	Flat AC Sheet	Assumed Asbestos	0 m2
---------	---------------	------------------	------

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Listing of Electronic Attachments as of 22/03/2017***

**Available Asbestos Related Electronic Files**

3470\_ASB\_231112\_AMP.pdf

\* Note : Refer to AMS for details of the attachment(s).

2017