


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Wollongong West Public School (3477)  
**Region :** Illawarra and South East  
**State Electorate :** Wollongong  
**Local Government Area :** Wollongong

**Initial Survey :** Noel Arnold & Associates : 21 - Mar - 2008  
**Reviewed By :** Parsons Brinckerhoff : 15 - Feb - 2017

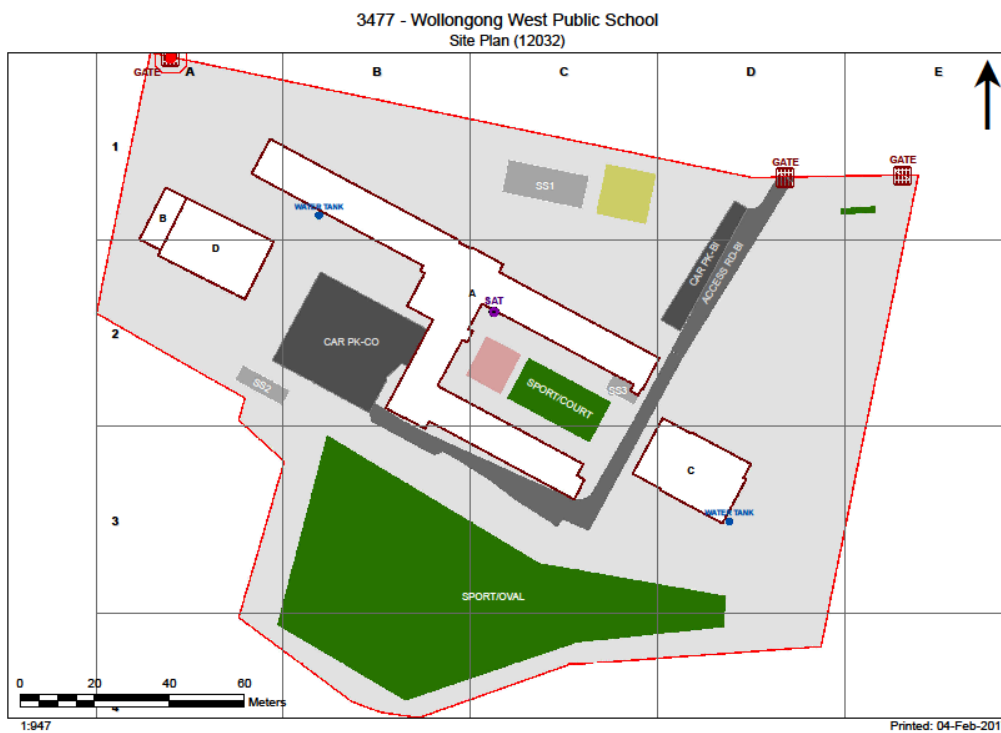

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Administration - 1952 - Brick/Block (Brick/Block)**

**Exterior**

Underfloor Voids - Slab on Ground	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 3477/B00A/Eaves Linings/S12					<b>No Asbestos Detected</b>
In-fill-panel	Flat AC Sheeting 3477/B00A/R9001/In-fill-panel/S9					<b>No Asbestos Detected</b>
Ceiling Voids - Raked Ceiling	Flat AC Sheeting 3477/B00A/Ceiling Voids - Raked Ceiling/S11					<b>No Asbestos Detected</b>
Eaves Linings	Flat AC Sheeting 3477/B00A/Eaves Linings/S13	50m2	Variable positions	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Eaves Linings	Flat AC Sheeting 3477/B00A/Eaves Linings/S14	10m2	South wing eaves	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior**

**B00A - R0001 - Movement (75.84 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 3477/B00A/R0001/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00A - R0002 - Movement (4.46 m2)**

No Asbestos

**B00A - R0003 - Out Of School Hours Care Centre (89.85 m2)**

Floor Coverings Res/Textile	Vinyl Tiles 3477/B00A/R0003/Floor Coverings Res/Textile/S2					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

Floor Coverings Res/Textile	Vinyl Tiles 3477/B00A/R0003/Floor Coverings Res/Textile/S3					<b>No Asbestos Detected</b>
-----------------------------	---	--	--	--	--	-----------------------------

**B00A - R0004 - Kiln Room (1.84 m2)**

No Asbestos

**B00A - R0005 - General Storeroom (3.36 m2)**

No Asbestos

**B00A - R0007 - K.L.A. Store (6.31 m2)**

No Asbestos

**B00A - R0010 - Movement (3.27 m2)**

No Asbestos

**B00A - R0011 - Security Store (6.92 m2)**

No Asbestos

**B00A - R0012 - Special Programs Room (30.21 m2)**

No Asbestos

**B00A - R0013 - Movement (23.35 m2)**

No Asbestos

**B00A - R0015 - Deputy Principal (15.93 m2)**

No Asbestos

**B00A - R0016 - General Storeroom (1.07 m2)**

No Asbestos

**B00A - R0017 - Cleaning Distributed Store (1.76 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00A - R0018 - Personal Effects Storage (7.24 m2)</b>						
No Asbestos						
<b>B00A - R0019 - Home Base (56.65 m2)</b>						
No Asbestos						
<b>B00A - R0020 - Home Base Store (6.35 m2)</b>						
No Asbestos						
<b>B00A - R0021 - Movement (26.17 m2)</b>						
No Asbestos						
<b>B00A - R0022 - Movement (1.94 m2)</b>						
Ceiling Structures/Linings	No Asbestos Found					
<b>B00A - R0023 - Movement (7.04 m2)</b>						
No Asbestos						
<b>B00A - R0024 - Home Base (57.2 m2)</b>						
No Asbestos						
<b>B00A - R0025 - Home Base Store (6.16 m2)</b>						
No Asbestos						
<b>B00A - R0026 - Movement (6.44 m2)</b>						
No Asbestos						
<b>B00A - R0027 - Movement (86.31 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3477/B00A/R0027/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0028 - Movement (3.57 m2)</b>						
No Asbestos						
<b>B00A - R0029 - Craft Store (9.44 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3477/B00A/R0027/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3477/B00A/R0029/Floor Coverings Res/Textile/S6					Chrysotile (white asbestos)
<b>B00A - R0030 - Interview (9.28 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3477/B00A/R0027/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0031 - Cleaning Distributed Store (3.21 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3477/B00A/R0027/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0032 - Home Base (56.8 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3477/B00A/R0027/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0033 - General Storeroom (5.73 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3477/B00A/R0027/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3477/B00A/R0033/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
<b>B00A - R0034 - Personal Effects Storage (7.52 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Vermiculite					
	3477/B00A/R0027/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0035 - Home Base (56.86 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3477/B00A/R0027/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0036 - Home Base Store (6.17 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3477/B00A/R0027/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3477/B00A/R0033/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
<b>B00A - R0037 - Personal Effects Storage (7.53 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3477/B00A/R0027/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0038 - Home Base (57.09 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3477/B00A/R0027/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0039 - Home Base Store (6.12 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3477/B00A/R0027/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
Floor Coverings Res/Textile	Vinyl Tiles	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3477/B00A/R0033/Floor Coverings Res/Textile/S7					Chrysotile (white asbestos)
<b>B00A - R0040 - Movement (15.63 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3477/B00A/R0027/Ceiling Structures/Linings/S5					Limited Samples Taken
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0041 - Distribution Board (0.68 m2)</b>					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00A - R0042 - General Storeroom (16.07 m2)</b>						
No Asbestos						
<b>B00A - R0043 - General Storeroom (6.37 m2)</b>						
No Asbestos						
<b>B00A - R0044 - Home Base (47.55 m2)</b>						
No Asbestos						
<b>B00A - R0045 - Home Base (47.75 m2)</b>						
No Asbestos						
<b>B00A - R0046 - General Storeroom (16 m2)</b>						
No Asbestos						
<b>B00A - R0047 - General Storeroom (6.46 m2)</b>						
No Asbestos						
<b>B00A - R0050 - Home Base (47.6 m2)</b>						
No Asbestos						
<b>B00A - R0051 - Home Base (47.73 m2)</b>						
No Asbestos						
<b>B00A - R0052 - Movement (103.48 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Floor Coverings Res/Textile	Vinyl Tiles					
	3477/B00A/R0001/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
<b>B00A - R0053 - Movement (4.04 m2)</b>						
No Asbestos						
<b>B00A - R0054 - Reading Area (123.63 m2)</b>						
No Asbestos						
<b>B00A - R0055 - Library Office/Workroom (22.15 m2)</b>						
No Asbestos						
<b>B00A - R0056 - Stairs (12.61 m2)</b>						
No Asbestos						
<b>B00A - R0057 - Stairs (17.68 m2)</b>						
No Asbestos						
<b>B00A - R0058 - Stairs (15.35 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3477/B00A/R0027/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0059 - Stairs (14.15 m2)</b>						
Ceiling Structures/Linings	Vermiculite					
	3477/B00A/R0027/Ceiling Structures/Linings/S5					<b>Limited Samples Taken</b>
<i>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</i>						
<b>B00A - R0060 - Access Shower/Toilet (10.34 m2)</b>						
No Asbestos						
<b>B00A - R0061 - Home Base (47.52 m2)</b>						
No Asbestos						
<b>B00A - R1001 - Movement (4.16 m2)</b>						
No Asbestos						
<b>B00A - R1002 - Movement (100.79 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	3477/B00A/R1002/Floor Coverings Res/Textile/S1					<b>No Asbestos Detected</b>
<b>B00A - R1003 - Home Base (44.69 m2)</b>						
No Asbestos						
<b>B00A - R1004 - Practical Activities - 1hb (2.99 m2)</b>						
No Asbestos						
<b>B00A - R1006 - Practical Activities - 1hb (2.93 m2)</b>						
No Asbestos						
<b>B00A - R1008 - Home Base Store (6.43 m2)</b>						
No Asbestos						
<b>B00A - R1014 - Movement (62.57 m2)</b>						
No Asbestos						
<b>B00A - R1015 - Movement (5.28 m2)</b>						
No Asbestos						
<b>B00A - R1016 - Principal (16.78 m2)</b>						
No Asbestos						
<b>B00A - R1017 - General Storeroom (0.8 m2)</b>						
No Asbestos						
<b>B00A - R1018 - General Storeroom (7.9 m2)</b>						
No Asbestos						
<b>B00A - R1019 - Staff Toilet (4.5 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
No Asbestos						
<b>B00A - R1020 - General Storeroom (4.06 m2)</b>						
No Asbestos						
<b>B00A - R1021 - General Storeroom (2.07 m2)</b>						
No Asbestos						
<b>B00A - R1022 - Clerical Office (21.98 m2)</b>						
No Asbestos						
<b>B00A - R1023 - Staff Room (19.79 m2)</b>						
No Asbestos						
<b>B00A - R1024 - Staff Room (29.34 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles					
	3477/B00A/R0001/Floor Coverings Res/Textile/S4					<b>No Asbestos Detected</b>
<b>B00A - R1025 - Staff Toilet (3.14 m2)</b>						
No Asbestos						
<b>B00A - R1026 - Movement (3.27 m2)</b>						
No Asbestos						
<b>B00A - R1027 - Movement (3.14 m2)</b>						
No Asbestos						
<b>B00A - R1028 - Staff Toilet (6.26 m2)</b>						
No Asbestos						
<b>B00A - R1029 - Cleaning Distributed Store (4.13 m2)</b>						
No Asbestos						
<b>B00A - R1030 - Stairs (17.12 m2)</b>						
No Asbestos						
<b>B00A - R1031 - Duplicating Workroom (15.87 m2)</b>						
No Asbestos						
<b>B00A - R1032 - Home Base Store (7.01 m2)</b>						
No Asbestos						
<b>B00A - R1033 - Home Base Store (6.56 m2)</b>						
No Asbestos						
<b>B00A - R1034 - Home Base (62.05 m2)</b>						
No Asbestos						
<b>B00A - R1035 - Communal Space (64.95 m2)</b>						
No Asbestos						
<b>B00A - R1036 - Communal Space (64.46 m2)</b>						
No Asbestos						
<b>B00A - R9001 - Toilets - Boys (53.84 m2)</b>						
In-fill-panel	Flat AC Sheeting					
	3477/B00A/R9001/In-fill-panel/S9					<b>No Asbestos Detected</b>
<b>B00A - R9002 - Movement (78.2 m2)</b>						
No Asbestos						
<b>B00A - R9003 - Movement (66.38 m2)</b>						
No Asbestos						
<b>B00A - R9004 - Movement (3.9 m2)</b>						
No Asbestos						
<b>B00A - R9005 - Staff Toilet (3.5 m2)</b>						
No Asbestos						
<b>B00A - R9006 - Canteen Office/Store (5.39 m2)</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

**B00A - R9007 - Canteen (37.82 m2)**

No Asbestos

**B00A - R9008 - Movement (17.61 m2)**

No Asbestos

**B00A - R9009 - Movement (50.51 m2)**

No Asbestos

**B00A - R9010 - Other-Vacant (3.01 m2)**

No Asbestos

**B00A - R9011 - Toilets - Girls (42.22 m2)**

No Asbestos

**B00A - R9012 - Movement (6.28 m2)**

No Asbestos

**B00A - R9013 - Movement (3.44 m2)**

No Asbestos

**B00A - R9014 - Movement (5.55 m2)**

No Asbestos

**B00A - R9015 - General Storeroom (6.53 m2)**

No Asbestos

**B00A - R9016 - General Storeroom (5.09 m2)**

No Asbestos

**B00A - R9017 - Cleaning Supplies (37.46 m2)**

No Asbestos

**B00A - R9018 - Garden Store (18.24 m2)**

No Asbestos

**B00A - R9019 - General Assistant/Bulk Store (6.28 m2)**

No Asbestos

**B00A - R9020 - Garden Store (6.92 m2)**

No Asbestos

**B00A - R9021 - Garden Store (5.1 m2)**

No Asbestos

**B00A - R9022 - Sports Store (16.12 m2)**

No Asbestos

**B00A - R9026 - General Storeroom (21.09 m2)**

No Asbestos

**B00A - R9027 - Movement (10.99 m2)**

No Asbestos

**B00A - R9028 - General Storeroom (73.66 m2)**

No Asbestos

**B00A - R9029 - Movement (3.35 m2)**

No Asbestos

**B00A - R9030 - Toilets - Boys (11.98 m2)**

Partition Walls (Cubicles) Compressed AC Sheet 3m2 Throughout Good Condition (1) Low (1) Low Priority (2-3)

3477/B00A/R9030/Partition Walls (Cubicles)/S8

**Chrysotile (white asbestos) , Amosite (brown asbestos)**

**B00A - R9032 - Movement (3.44 m2)**

No Asbestos

**B00A - R9033 - Toilets - Girls (12.09 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Partition Walls (Cubicles)	Compressed AC Sheet	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3477/B00A/R9030/Partition Walls (Cubicles)/S8				<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00A - R9034 - Movement (11 m2)**

No Asbestos

**B00A - R9035 - Main Switch Board (8.04 m2)**

Electrical Backing Board	Resinous Board	1m2	North	Good Condition (1)	Low (1)	Low Priority (2-3)
--------------------------	----------------	-----	-------	--------------------	---------	--------------------

**Assumed Asbestos - Not sampled due to live electrical**

**B00A - R9036 - Stairs (6.49 m2)**

No Asbestos

**B00A - R9037 - Stairs (4.7 m2)**

No Asbestos

**B00A - R9038 - Stairs (0.61 m2)**

No Asbestos

**B00A - R9039 - Movement (8.42 m2)**

No Asbestos

**B00A - R9040 - Movement (17.75 m2)**

No Asbestos

**B00A - R9041 - Covered Outdoor Learning Area (141.2 m2)**

No Asbestos

**B00A - R9042 - Covered Outdoor Learning Area (182.21 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Pupil Facilities - 1961 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids - Flat Roof No Asbestos Found

**Interior****B00B - R0001 - General Storeroom (6.85 m2)**

In-fill-panel	Flat AC Sheeting	1m	South, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3477/B00B/R0002/In-fill-panel/S10					Chrysotile (white asbestos)	

**B00B - R0002 - Movement (37.67 m2)**

In-fill-panel	Flat AC Sheeting	1m	Above Door to BR0001 & BR0004	Good Condition (1)	Low (1)	Low Priority (2-3)
3477/B00B/R0002/In-fill-panel/S10					Chrysotile (white asbestos)	

**B00B - R0003 - Toilets - Boys (19.11 m2)**

No Asbestos

**B00B - R0004 - Plant (6.96 m2)**

In-fill-panel	Flat AC Sheeting	1m	East, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
3477/B00B/R0002/In-fill-panel/S10					Chrysotile (white asbestos)	

**B00B - R0005 - Toilets - Girls (18.81 m2)**

No Asbestos

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Communal Facilities/Pupil Facilities - 2011 - Brick/Veneer (Brick/Veneer)****Exterior**

Underfloor Voids - Slab on Ground No Asbestos Found

Ceiling Voids No Asbestos Found

**Interior****B00C - R0001 - Communal Space (143.53 m2)**

No Asbestos

**B00C - R0002 - Raised Platform (55.84 m2)**

No Asbestos

**B00C - R0003 - Chair Storeroom (9.53 m2)**

No Asbestos

**B00C - R0004 - Communal/Performance Store (9.08 m2)**

No Asbestos

**B00C - R0005 - P.E. Store (12.63 m2)**

No Asbestos

**B00C - R0006 - Movement (2.39 m2)**

No Asbestos

**B00C - R0007 - Toilets - Girls (7.3 m2)**

No Asbestos

**B00C - R0008 - Sound Cupboard (1.65 m2)**

No Asbestos

**B00C - R0009 - Movement (3.25 m2)**

No Asbestos

**B00C - R0010 - Toilets - Boys (5.76 m2)**

No Asbestos

**B00C - R0011 - Cleaning Distributed Store (3.22 m2)**

No Asbestos

**B00C - R0012 - Plant (1.59 m2)**

No Asbestos

**B00C - R0013 - Distribution Board (3.38 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00C - R0014 - Access Shower/Toilet (6.88 m2)**

No Asbestos

**B00C - R0015 - Covered Outdoor Learning Area (143.64 m2)**

No Asbestos

**B00C - R0016 - Movement (6.08 m2)**

No Asbestos

**B00C - R0017 - Movement (11.95 m2)**

No Asbestos

**B00C - R0018 - Ramp (11.33 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Other/Pupil Facilities - 2009 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Underfloor Voids - Slab on Ground      No Asbestos Found

Ceiling Voids      No Asbestos Found

**Interior**

**B00D - R0001 - Other-Community Use (407.38 m2)**

No Asbestos

**B00D - R0002 - Kitchen - Pre (10.91 m2)**

No Asbestos

**B00D - R0003 - Clerical Office/Workroom (14.67 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

***Demountables***

**There are no Demountable(s) located at this school as per the AMS records as of 15 Feb 2017.**

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017