


Asbestos Register

(Hazardous Materials and Risk Assessment)

School : Wolumla Public School (3479)
Region : Illawarra and South East
State Electorate : Bega
Local Government Area : Bega Valley

Initial Survey : Noel Arnold & Associates : 08 - May - 2008
Reviewed By : Greencap-NAA : 17 - Jun - 2016

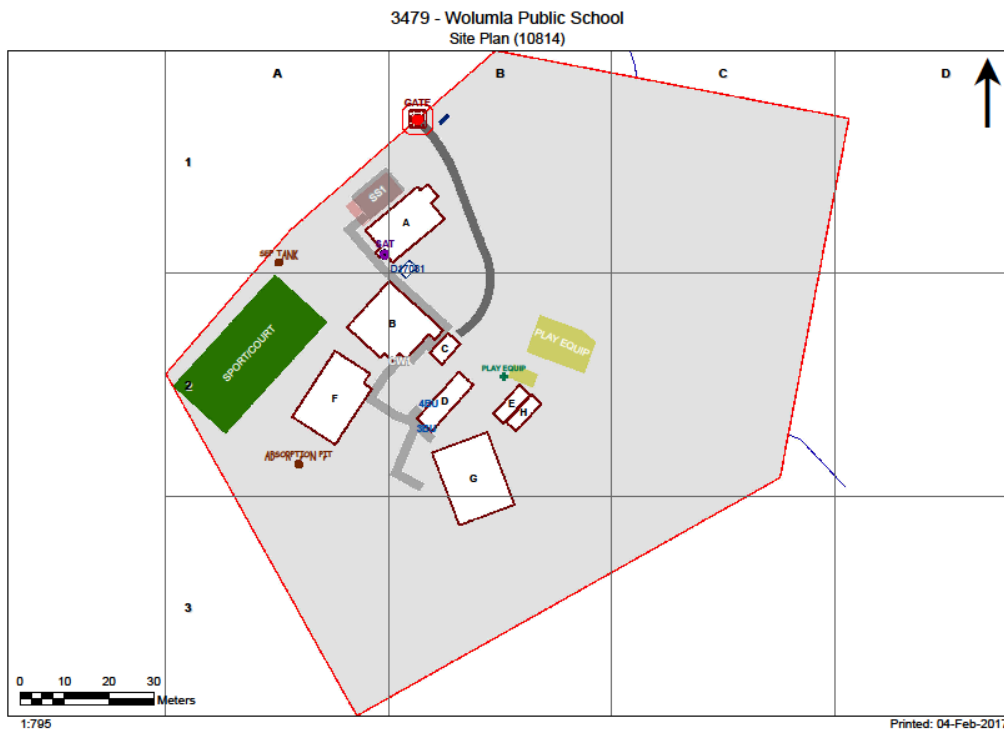

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00A - General Learning - 1882 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Height Restriction					
Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	60m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3479/B00A/Eaves Linings/S16					Chrysotile (white asbestos)

Interior

B00A - R0001 - Interview

Splashback lining	Flat AC Sheeting	1.5m2	Southeast	Good Condition (1)	Low (1)	Low Priority (2-3)
	3479/B00A/R0001/Splashback lining/S15					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	7.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3479/B00A/R0001/Floor Coverings Res/Textile/S13					Chrysotile (white asbestos)
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	3479/B00A/R0001/Floor Coverings Res/Textile/S14					

B00A - R0002 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	13.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3479/B00A/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)
Electrical Backing Board	Resinous Board	0.5m2	Southeast	Good Condition (1)	Low (1)	Low Priority (2-3)
	3479/B00A/R0002/Electrical Backing Board/S11					Chrysotile (white asbestos)
Splashback lining	Flat AC Sheeting					No Asbestos Detected
	3479/B00A/R0002/Splashback lining/S10					

B00A - R0003 - Movement

Ceiling Structures/Linings	Flat AC Sheeting	7.5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3479/B00A/R0002/Ceiling Structures/Linings/S9					Chrysotile (white asbestos)

B00A - R0004 - General Storeroom

Floor Coverings Res/Textile	Vinyl Tiles					No Asbestos Detected
	3479/B00A/R0004/Floor Coverings Res/Textile/S12					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	3479/B00A/R0004/Floor Coverings Res/Textile/S20					

B00A - R0005 - Home Base

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	3479/B00A/R0006/Floor Coverings Res/Textile/S7					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	3479/B00A/R0006/Floor Coverings Res/Textile/S8					

B00A - R0006 - Special Programs Room

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)					No Asbestos Detected
	3479/B00A/R0006/Floor Coverings Res/Textile/S7					
Floor Coverings Res/Textile	Adhesive					No Asbestos Detected
	3479/B00A/R0006/Floor Coverings Res/Textile/S8					

B00A - R0007 - Sports Store

No Asbestos

B00A - R0008 - External Movement

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00B - Administration/Staff Facilities - 1910 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Packing to Floor Joists	No Asbestos Found

Interior

B00B - R0001 - Movement

Wall Linings Internal	Flat AC Sheeting					
	3479/B00B/R0001/Wall Linings Internal/S2					No Asbestos Detected

B00B - R0002 - Staff Room

Wall Linings Internal	Flat AC Sheeting					
	3479/B00B/R0002/Wall Linings Internal/S6					No Asbestos Detected

B00B - R0003 - Principal

No Asbestos

B00B - R0004 - Clerical Office

No Asbestos

B00B - R0005 - Resources Store

No Asbestos

B00B - R0006 - Sick Bay

No Asbestos

B00B - R0007 - Movement

No Asbestos

B00B - R0008 - General Storeroom

No Asbestos

B00B - R0009 - Entry Vestibule

No Asbestos

B00B - R0010 - Movement

No Asbestos

B00B - R0011 - Movement

No Asbestos

B00B - R0012 - Staff Toilet

Wall Linings Internal	Flat AC Sheeting	15m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3479/B00B/R0013/Wall Linings Internal/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3479/B00B/R0013/Wall Linings Internal/S1					Chrysotile (white asbestos)

B00B - R0013 - Communications Room

Wall Linings Internal	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3479/B00B/R0013/Wall Linings Internal/S1					Chrysotile (white asbestos)
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3479/B00B/R0013/Wall Linings Internal/S1					Chrysotile (white asbestos)

B00B - R0014 - Canteen

No Asbestos

B00B - R0015 - Movement

No Asbestos

B00B - R0016 - Movement

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00C - Storage - 1980 - Timber (Timber)

Exterior

Ceiling Voids - Flat Roof	No Asbestos Found
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible

Interior

B00C - R0001 - Cleaning Supplies

No Asbestos

B00C - R0002 - General Assistant/Bulk Store

Wall Linings Internal	Flat AC Sheeting 3479/B00C/R0002/Wall Linings Internal/S3	No Asbestos Detected
-----------------------	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00D - Pupil Facilities - 1882 - Brick/Block (Brick/Block)

Exterior

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					

Interior

B00D - R0001 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 3479/B00D/R0001/Ceiling Structures/Linings/S17					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00D - R0003 - Toilets - Boys

Ceiling Structures/Linings	Flat AC Sheeting 3479/B00D/R0001/Ceiling Structures/Linings/S17					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00D - R0004 - Disabled Toilet

Ceiling Structures/Linings	Flat AC Sheeting 3479/B00D/R0001/Ceiling Structures/Linings/S17					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00D - R0005 - Toilets - Girls

Ceiling Structures/Linings	Flat AC Sheeting 3479/B00D/R0001/Ceiling Structures/Linings/S17					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00D - R0006 - Cleaning Distributed Store

Ceiling Structures/Linings	Flat AC Sheeting 3479/B00D/R0001/Ceiling Structures/Linings/S17					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00E - Shed - 1882 - Timber Shed (Timber Shed)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Ceiling Voids - Flat Roof	No Asbestos Found					
Wall Cladding	Fibre-cement sheeting					
	3479/B00E/Wall Cladding/S19					No Asbestos Detected

Interior

B00E - R0001 - General Storeroom

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00F - Library - 2003 - Timber (Timber)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 3479/B00F/R0001/Ceiling Structures/Linings/S18					No Asbestos Detected
Ceiling Voids	No Asbestos Found					

Interior

B00F - R0001 - Movement

Ceiling Structures/Linings	Flat AC Sheeting 3479/B00F/R0001/Ceiling Structures/Linings/S18					No Asbestos Detected
----------------------------	--	--	--	--	--	-----------------------------

B00F - R0002 - Reading Area

No Asbestos

B00F - R0003 - K.L.A. Store

No Asbestos

B00F - R0004 - Distribution Board

Note: No inspection of live electrical installation.

Wall Linings Internal	Flat AC Sheeting 3479/B00F/R0004/Wall Linings Internal/S5					No Asbestos Detected
-----------------------	--	--	--	--	--	-----------------------------

B00F - R0005 - Library Office/Workroom

No Asbestos

B00F - R0006 - Communications Room

No Asbestos

B00F - R0007 - Library Office/Workroom

No Asbestos

B00F - R0008 - Reading Area

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00G - General Learning - 2010 - Fibre Cement Clad (Fibre Cement Clad)

Exterior

Underfloor Voids - Packing to Floor Joists	No Asbestos Found
Ceiling Voids	No Asbestos Found

Interior

B00G - R0001 - Movement

No Asbestos

B00G - R0002 - Practical Activities - 1hb

No Asbestos

B00G - R0003 - Home Base Store

No Asbestos

B00G - R0004 - Home Base

No Asbestos

B00G - R0005 - Withdrawal Space - 2hb

No Asbestos

B00G - R0006 - Home Base

No Asbestos

B00G - R0007 - Home Base Store

No Asbestos

B00G - R0008 - Practical Activities - 1hb

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

B00H - Storage - 2010 - Metal Shed (Metal Shed)

Exterior

Underfloor Voids - Packing to Floor Joists No Asbestos Found

Ceiling Voids No Asbestos Found

Interior

B00H - R0001 - General Assistant/Bulk Store

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 837 - D17081 - Hcap Shower/Change/Toilet : Placement Date - 5/02/2016

Note: This refurbished demountable may have asbestos present in remnant mastic in window frames.

Exterior

No Asbestos Found.

Interior

R1 - Disabled Shower/Toilet

No Asbestos Found.

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

Listing of Electronic Attachments as of 22/03/2017

Available Asbestos Related Electronic Files

3479_ASB_221112_AMP.pdf

* Note : Refer to AMS for details of the attachment(s).

2017