


# Asbestos Register

(Hazardous Materials and Risk Assessment)



**School :** Wombat Public School (3482)  
**Region :** Riverina  
**State Electorate :** Cootamundra  
**Local Government Area :** Harden

**Initial Survey :** Noel Arnold & Associates : 08 - May - 2008  
**Reviewed By :** Greencap-NAA : 15 - Jun - 2016

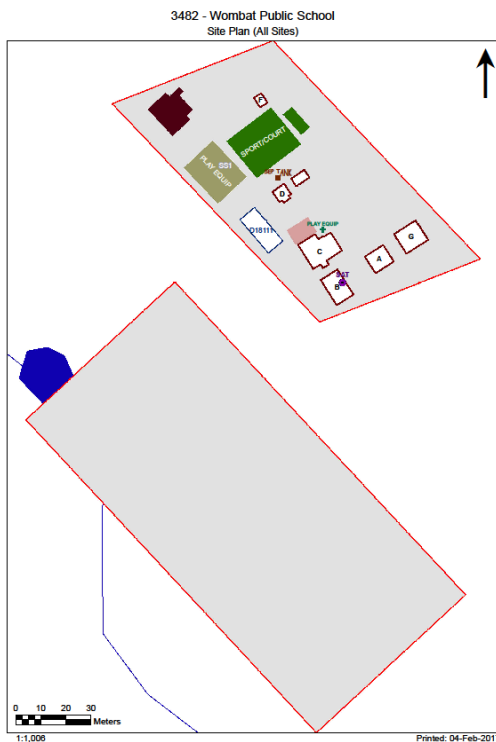

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - Library - 1930 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting	6m2	West facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00A/Eaves Linings/S15					<b>Chrysotile (white asbestos)</b>
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00A - R0001 - Staff Kitchen**

No Asbestos

**B00A - R0002 - Reading Area**

No Asbestos

**B00A - R0003 - Movement**

Flooring	Compressed AC Sheet					
	3482/B00A/R0003/Floor/S11					<b>No Asbestos Detected</b>

**B00A - R0004 - General Storeroom**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - General Learning/Staff Facilities - 1930 - Timber (Timber)****Exterior**

Eaves Linings	Flat AC Sheeting	30m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00B/R0001/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

**Interior****B00B - R0001 - Withdrawal Space - 1hb**

Ceiling Structures/Linings	Flat AC Sheeting	25m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00B/R0001/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	
Heater Surround	Flat AC Sheeting	3482/B00B/R0001/Infill panel behind heater/S9				No Asbestos Detected

**B00B - R0002 - Home Base**

Ceiling Structures/Linings	Flat AC Sheeting	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00B/R0001/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	
Heater Surround	Flat AC Sheeting	2m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00B/R0002/Heater Surround/S14				Chrysotile (white asbestos) , Amosite (brown asbestos)	
Wall Linings Internal	Flat AC Sheeting	90m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00B/R0003/Wall Linings Internal/S10				Chrysotile (white asbestos)	
Floor Coverings Res/Textile	Adhesive	3482/B00C/R0002/Floor Coverings Res/Textile/S13				No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet)	41m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00C/R0002/Floor Coverings Res/Textile/S12				Chrysotile (white asbestos)	

**B00B - R0003 - Staff Room Annexe**

Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00B/R0001/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	
Wall Linings Internal	Flat AC Sheeting	35m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00B/R0003/Wall Linings Internal/S10				Chrysotile (white asbestos)	

**B00B - R0004 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00B/R0001/Ceiling Structures/Linings/S8				Chrysotile (white asbestos)	

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Administration/General Learning - 1910 - Timber (Timber)**

**Exterior**

Eaves Linings	Flat AC Sheeting 3482/B00C/Eaves Linings/S2					No Asbestos Detected
Ceiling Voids	Non Accessible Area - Height Restriction 4m height					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00C - R0001 - Movement**

Ceiling Structures/Linings	Flat AC Sheeting 3482/B00C/R0001/Ceiling Structures/Linings/S1					No Asbestos Detected
----------------------------	-------------------------------------------------------------------	--	--	--	--	----------------------

**B00C - R0002 - Home Base**

Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3482/B00C/R0002/Floor Coverings Res/Textile/S12	45m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>
Floor Coverings Res/Textile	Adhesive 3482/B00C/R0002/Floor Coverings Res/Textile/S13					No Asbestos Detected

**B00C - R0003 - Withdrawal Space - 1hb**

Floor Coverings Res/Textile	Adhesive 3482/B00C/R0002/Floor Coverings Res/Textile/S13					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3482/B00C/R0002/Floor Coverings Res/Textile/S12	10m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00C - R0004 - Movement**

Electrical Mounting Board	Resinous Membrane	1Unit	North facing	Good Condition (1)	Low (1)	Low Priority (2-3)
<b>Assumed Asbestos - Electrical Hazard</b>						

**B00C - R0005 - Principal**

Floor Coverings Res/Textile	Adhesive 3482/B00C/R0002/Floor Coverings Res/Textile/S13					No Asbestos Detected
Floor Coverings Res/Textile	Vinyl Tiles (Under Floor Covering/Carpet) 3482/B00C/R0002/Floor Coverings Res/Textile/S12	9m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos)</b>

**B00C - R0006 - General Storeroom**

No Asbestos

**B00C - R0007 - Covered Outdoor Learning Area**

Wall Linings Internal	Flat AC Sheeting 3482/B00C/R0007/Wall Linings Internal/S3	2m2	East facing, West facing	Good Condition (1)	Low (1)	Low Priority (2-3) <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Splashback lining	Flat AC Sheeting 3482/B00C/R0007/Splashback/S4					No Asbestos Detected

**B00C - R0008 - Covered Outdoor Learning Area**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Pupil Facilities/Staff Facilities - 1968 - Brick/Block (Brick/Block)****Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible					
Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Ceiling Structures/Lining	Flat AC Sheeting	4m2	Porch	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00D/R0003/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

**Interior****B00D - R0002 - Toilets - Girls**

Ceiling Structures/Linings	Flat AC Sheeting	9m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00D/R0003/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>
In-fill-panel	Flat AC Sheeting	1m2	South facing	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00D/R0003/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>
In-fill-panel	Flat AC Sheeting	1m2	Above Toilet Door	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00D/R0003/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

**B00D - R0003 - Toilets - Boys**

Ceiling Structures/Linings	Flat AC Sheeting	12m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00D/R0003/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>
In-fill-panel	Flat AC Sheeting	1m2	South facing, Upper portion	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00D/R0003/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

**B00D - R0005 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00D/R0003/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

**B00D - R0006 - Staff Toilet**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	All surfaces	Good Condition (1)	Low (1)	Low Priority (2-3)
	3482/B00D/R0003/Ceiling Structures/Linings/S5					<b>Chrysotile (white asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Pupil Facilities - 1955 - Timber (Timber)**

**Exterior**

Ceiling Voids - Flat Roof	Non Accessible Area - Area inaccessible					
Underfloor Voids	No Asbestos Found					

**Interior**

**B00E - R0003 - Communal Space**

Ceiling Structures/Linings	Flat AC Sheeting 3482/B00E/R0003/Ceiling Structures/Linings/S6					<b>No Asbestos Detected</b>
----------------------------	-------------------------------------------------------------------	--	--	--	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - Pupil Facilities - 2008 - Metal Shed (Metal Shed)**

**Exterior**

Underfloor Voids - Slab on Ground	Non Accessible Area - Area inaccessible
Ceiling Voids	No Asbestos Found

**Interior**

**B00F - R0001 - Sports Store**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Multi Purpose Facilities - 2010 - Fibre Cement Clad (Fibre Cement Clad)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00G - R0001 - Communal Space**

No Asbestos

**B00G - R0002 - General Storeroom**

No Asbestos

**B00G - R0003 - Practical Activities**

No Asbestos

**B00G - R0004 - External Movement**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

## Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 500 - D18111 - Admin - Library : Placement Date - 10/09/2008

### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		20.16 m2

### Interior

#### R1 - Entry

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		13 m2

#### R2 - Principal

Ceiling	Flat AC Sheet	Assumed Asbestos		18 m2
---------	---------------	------------------	--	-------

#### R3 - Staff Room/Kitchen

Ceiling	Flat AC Sheet	Assumed Asbestos		19 m2
---------	---------------	------------------	--	-------

#### R4 - Clerical Office

Ceiling	Flat AC Sheet	Assumed Asbestos		18 m2
---------	---------------	------------------	--	-------

#### R5 - Library

Ceiling	Flat AC Sheet	Assumed Asbestos		54 m2
---------	---------------	------------------	--	-------

#### R6 - Storeroom

Ceiling	Flat AC Sheet	Assumed Asbestos		0 m2
---------	---------------	------------------	--	------

#### R7 - Staff Toilet

Toilet partitions	Compressed AC Sheet	Assumed Asbestos		6 m2
End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		4 m2

#### R8 - Entry to toilet

Ceiling	Flat AC Sheet	Assumed Asbestos		0 m2
---------	---------------	------------------	--	------

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017