


# Asbestos Register

(Hazardous Materials and Risk Assessment)

**School :** Woodenbong Central School (3491)  
**Region :** North Coast  
**State Electorate :** Lismore  
**Local Government Area :** Kyogle

**Initial Survey :** Noel Arnold & Associates : 11 - Jun - 2008  
**Reviewed By :** Parsons Brinckerhoff : 08 - Oct - 2015

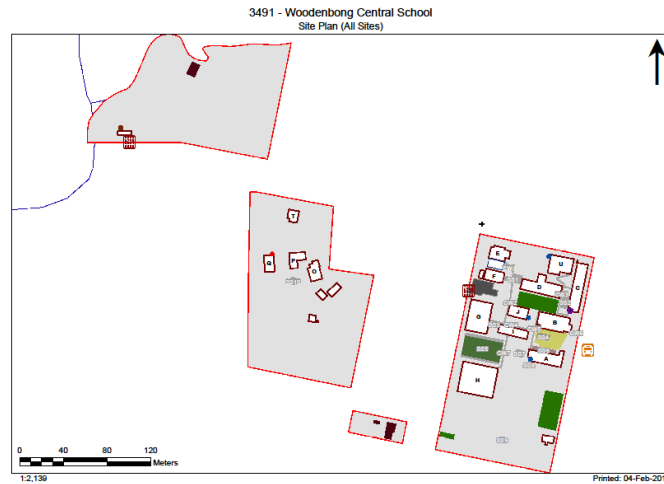

# 2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00A - General Learning/Pupil Facilities - 1978 - Brick/Block (Brick/Block)****Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	South	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00A/Eaves Linings/S37					<b>Chrysotile (white asbestos)</b>

**Interior****B00A - R0002 - External Movement (51.38 m2)**

No Asbestos

**B00A - R0003 - Home Base - S (51.32 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	3491/B00A/R0008/Ceiling Structures/Linings/S1					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0004 - Practical Activities - S - 1hb (17.94 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00A/R0009/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	3491/B00A/R0008/Ceiling Structures/Linings/S1					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0005 - Distribution Board (0.87 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00A - R0006 - Practical Activities - 1hb (18.16 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00A/R0009/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	3491/B00A/R0008/Ceiling Structures/Linings/S1					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0007 - Home Base (52.03 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	3491/B00A/R0008/Ceiling Structures/Linings/S1					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0008 - Home Base (56 m2)**

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	3491/B00A/R0008/Ceiling Structures/Linings/S1					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0009 - Practical Activities - 1hb (11.5 m2)**

Floor Coverings Res/Textile	Vinyl Tiles	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00A/R0009/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>

Ceiling Structures/Linings	Vermiculite					<b>Limited Samples Taken</b>
	3491/B00A/R0008/Ceiling Structures/Linings/S1					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0010 - Toilets - Boys/Girls (3.1 m2)**

Decorative Coating	Vermiculite					<b>Limited Samples Taken</b>
	3491/B00A/R0010/Decorative Coating/S48					
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00A - R0011 - Sports Store (5.03 m2)**

No Asbestos

**B00A - R0013 - External Stairs (11.4 m2)**

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3491/B00A/R0013/Ceiling Structures/Linings/S49					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R0014 - External Stairs (15.67 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3491/B00A/R0014/Ceiling Structures/Linings/S50					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1002 - External Movement (49.43 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3491/B00A/R0012/Ceiling Structures/Linings/S3					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>	
<b>B00A - R1003 - Home Base (51.34 m2)</b>						
No Asbestos						
<b>B00A - R1004 - Practical Activities - 1hb (17.9 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3491/B00A/R0009/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1005 - Distribution Board (0.87 m2)</b>						
					Note: No inspection of live electrical installation.	
No Asbestos						
<b>B00A - R1006 - Practical Activities - 1hb (18.12 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	18m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3491/B00A/R0009/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1007 - Home Base (52.05 m2)</b>						
No Asbestos						
<b>B00A - R1008 - Special Programs Room (51.58 m2)</b>						
No Asbestos						
<b>B00A - R1009 - Practical Activities - 1hb (18.7 m2)</b>						
Floor Coverings Res/Textile	Vinyl Tiles	19m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3491/B00A/R0009/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1010 - External Stairs (8.13 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	8m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3491/B00A/R1010/Ceiling Structures/Linings/S51					<b>Chrysotile (white asbestos)</b>	
<b>B00A - R1011 - External Stairs (15.67 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3491/B00A/R1011/Ceiling Structures/Linings/S52					<b>Chrysotile (white asbestos)</b>	

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00B - Administration/Library - 1978 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00B - R0001 - Movement (65.55 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	66m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3491/B00B/R0001/Ceiling Structures/Linings/S53					<b>Chrysotile (white asbestos)</b>	

**B00B - R0002 - Deputy Principal (13.67 m2)**

Ceiling Structures/Linings	Vermiculite	3491/B00B/R0017/Ceiling Structures/Linings/S10				<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00B - R0003 - Interview (13.37 m2)**

Ceiling Structures/Linings	Vermiculite	3491/B00B/R0017/Ceiling Structures/Linings/S10				<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00B - R0004 - Movement (5.04 m2)**

No Asbestos

**B00B - R0005 - Entry Vestibule (19.19 m2)**

Ceiling Structures/Linings	Vermiculite	3491/B00B/R0017/Ceiling Structures/Linings/S10				<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00B - R0006 - Movement (32.52 m2)**

Ceiling Structures/Linings	Vermiculite	3491/B00B/R0017/Ceiling Structures/Linings/S10				<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00B - R0007 - Principal (19.29 m2)**

Ceiling Structures/Linings	Vermiculite	3491/B00B/R0017/Ceiling Structures/Linings/S10				<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00B - R0008 - Clerical Office (16.88 m2)**

Ceiling Structures/Linings	Vermiculite	3491/B00B/R0017/Ceiling Structures/Linings/S10				<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

**B00B - R0009 - General Storeroom (16.45 m2)**

No Asbestos

**B00B - R0010 - Plant (0.72 m2)**

No Asbestos

**B00B - R0011 - Distribution Board (1.21 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00B - R0012 - Duplicating Workroom (16.73 m2)**

Ceiling Structures/Linings	Vermiculite	3491/B00B/R0017/Ceiling Structures/Linings/S10				<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Floor Coverings Res/Textile	Vinyl Tiles	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3491/B00A/R0009/Floor Coverings Res/Textile/S2					<b>Chrysotile (white asbestos)</b>	

**B00B - R0013 - Sick Bay (10.76 m2)**

Ceiling Structures/Linings	Vermiculite	3491/B00B/R0017/Ceiling Structures/Linings/S10				<b>Limited Samples Taken</b>
<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		
Floor Coverings Res/Textile	Vinyl Tiles	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3491/B00A/R0009/Floor Coverings Res/Textile/S2				<b>Chrysotile (white asbestos)</b>		
<b>B00B - R0014 - Staff Room Annexe (18.69 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
3491/B00B/R0017/Ceiling Structures/Linings/S10				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00B - R0017 - Staff Room (92.34 m2)</b>						
Ceiling Structures/Linings	Vermiculite					Limited Samples Taken
3491/B00B/R0017/Ceiling Structures/Linings/S10				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00B - R0018 - General Storeroom (5.09 m2)</b>						
No Asbestos						
<b>B00B - R0019 - Stairs (11.1 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	11m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3491/B00B/R0019/Ceiling Structures/Linings/S54				<b>Chrysotile (white asbestos)</b>		
<b>B00B - R0021 - Staff Toilet (4.12 m2)</b>						
Decorative Coating	Vermiculite					Limited Samples Taken
3491/B00B/R0021/Decorative Coating/S55				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00B - R0022 - Staff Toilet (3.85 m2)</b>						
Decorative Coating	Vermiculite					Limited Samples Taken
3491/B00B/R0022/Decorative Coating/S56				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00B - R0023 - Toilet - Lobby (4.14 m2)</b>						
Decorative Coating	Vermiculite					Limited Samples Taken
3491/B00B/R0023/Decorative Coating/S57				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00B - R0024 - Toilet - Lobby (3.85 m2)</b>						
Decorative Coating	Vermiculite					Limited Samples Taken
3491/B00B/R0024/Decorative Coating/S58				<b>Vermiculite Ceilings may contain asbestos. Asbestos testing MUST be conducted prior to any disturbance works</b>		
<b>B00B - R1001 - Movement (6.61 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	7m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3491/B00B/R1001/Ceiling Structures/Linings/S59				<b>Chrysotile (white asbestos)</b>		
<b>B00B - R1007 - Communications Room (14.07 m2)</b>						
No Asbestos						
<b>B00B - R1008 - Library Office/Workroom (18.17 m2)</b>						
No Asbestos						
<b>B00B - R1009 - Cleaning Distributed Store (1.67 m2)</b>						
No Asbestos						
<b>B00B - R1011 - Movement (10.38 m2)</b>						
No Asbestos						
<b>B00B - R1012 - Distribution Board (1.67 m2)</b>				Note: No inspection of live electrical installation.		
No Asbestos						
<b>B00B - R1015 - Stairs (16.97 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
3491/B00B/R1015/Ceiling Structures/Linings/S61				<b>Chrysotile (white asbestos)</b>		
<b>B00B - R1016 - K.L.A. Store (8.64 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					No Asbestos Detected
3491/B00B/R1021/Ceiling Structures/Linings/S68						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	
<b>B00B - R1017 - Movement (3.44 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	3491/B00B/R1021/Ceiling Structures/Linings/S68					<b>No Asbestos Detected</b>
<b>B00B - R1018 - Reading Area (206.26 m2)</b>						
No Asbestos						
<b>B00B - R1019 - Resource/Toy Space (20.16 m2)</b>						
No Asbestos						
<b>B00B - R1020 - Library Office/Workroom (21.54 m2)</b>						
No Asbestos						
<b>B00B - R1021 - Movement (3.72 m2)</b>						
Ceiling Structures/Linings	Flat AC Sheeting					
	3491/B00B/R1021/Ceiling Structures/Linings/S68					<b>No Asbestos Detected</b>
Wall Linings Internal	Flat AC Sheeting					
	3491/B00B/R1021/Ceiling Structures/Linings/S68					<b>No Asbestos Detected</b>
<b>B00B - R1022 - Toilets - Boys (1.4 m2)</b>						
No Asbestos						
<b>B00B - R1023 - Toilet - Lobby (1.4 m2)</b>						
No Asbestos						
<b>B00B - R1024 - Toilet - Lobby (1.45 m2)</b>						
No Asbestos						
<b>B00B - R1025 - Toilets - Girls (1.4 m2)</b>						
No Asbestos						
<b>B00B - Room+1 - Added Room</b>						
Wall Linings Internal	Flat AC Sheeting					
	3491/B00B/Room+1/Wall Linings Internal/S64					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00B/Room+1/Ceiling Structures/Linings/S62					<b>Chrysotile (white asbestos)</b>
<b>B00B - Room+10 - Added Room</b>						
No Asbestos						
<b>B00B - Room+11 - Added Room</b>						
No Asbestos						
<b>B00B - Room+2 - Added Room</b>						
Ceiling Structures/Linings	Flat AC Sheeting	4m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00B/Room+2/Ceiling Structures/Linings/S65					<b>Chrysotile (white asbestos)</b>
<b>B00B - Room+3 - Added Room</b>						
Ceiling Structures/Linings	Flat AC Sheeting	12m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00B/Room+3/Ceiling Structures/Linings/S66					<b>Chrysotile (white asbestos)</b>
<b>B00B - Room+4 - Added Room</b>						
No Asbestos						
<b>B00B - Room+5 - Added Room</b>						
No Asbestos						
<b>B00B - Room+6 - Added Room</b>						
No Asbestos						
<b>B00B - Room+7 - Added Room</b>						
No Asbestos						
<b>B00B - Room+8 - Added Room</b>						
No Asbestos						
<b>B00B - Room+9 - Added Room</b>						
No Asbestos						

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
	<b>Sample No</b>					<b>Test Result</b>

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00C - Science Learning - 1965 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	30m2	West	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00C/Eaves Linings/S38			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior**

**B00C - R0001 - Staff Room (16.63 m2)**

No Asbestos

**B00C - R0002 - Movement (4.21 m2)**

No Asbestos

**B00C - R0003 - General Storeroom (3.21 m2)**

No Asbestos

**B00C - R0004 - Movement (80.46 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00C/R0004/Ceiling Structures/Linings/S67			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00C - R0005 - Distribution Board (0.75 m2)** Note: No inspection of live electrical installation.

No Asbestos

**B00C - R0006 - Computer Learning Space (52.34 m2)**

No Asbestos

**B00C - R0008 - Preparation (9.54 m2)**

No Asbestos

**B00C - R0009 - Preparation (28.73 m2)**

No Asbestos

**B00C - R0013 - General Storeroom (6.17 m2)**

No Asbestos

**B00C - R0014 - Staff Room Annexe (6.34 m2)**

No Asbestos

**B00C - R0015 - Laboratory L.S. (91.84 m2)**

No Asbestos

**B00C - R0016 - Staff Room Annexe (26.86 m2)**

No Asbestos

**B00C - R0017 - Seminar (64.95 m2)**

No Asbestos

**B00C - R9001 - Darkroom Space (6.73 m2)**

No Asbestos

**B00C - R9002 - General Assistant/Bulk Store (46.16 m2)**

No Asbestos

**B00C - R9003 - General Storeroom (14.64 m2)**

No Asbestos

**B00C - R9004 - General Storeroom (68.32 m2)**

No Asbestos

**B00C - R9005 - L.P.G. Store (1.12 m2)**

No Asbestos



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00D - Technological & Applied Studies - 1920 - Timber (Timber)****Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Flat AC Sheeting Debris	1m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	3491/B00D/Underfloor Voids/S39			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior****B00D - R0002 - Seminar/Technology Space (30.62 m2)**

No Asbestos

**B00D - R0004 - Food Technology L.S. (58.05 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	3491/B00D/R0004/Floor Coverings Res/Textile/S8			<b>No Asbestos Detected</b>		

**B00D - R0005 - Pantry (7.23 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	3491/B00D/R0004/Floor Coverings Res/Textile/S8			<b>No Asbestos Detected</b>		

**B00D - R0006 - Materials Store (7.26 m2)**

Floor Coverings Res/Textile	Vinyl Tiles					
	3491/B00D/R0004/Floor Coverings Res/Textile/S8			<b>No Asbestos Detected</b>		

**B00D - R0007 - Movement (66.21 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	66m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3491/B00D/R0007/Ceiling Structures/Linings/S9			<b>Chrysotile (white asbestos)</b>		

**B00D - R0008 - General Learning Space (49.25 m2)**

No Asbestos

**B00D - R0009 - Staff Room (53.78 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	54m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00D/R0009/Ceiling Structures/Linings/S12			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00D - R0010 - General Learning Space (43.82 m2)**

No Asbestos

**B00D - R0011 - General Learning Space (43.82 m2)**

No Asbestos

**B00D - R0012 - General Storeroom (10.94 m2)**

No Asbestos

**B00D - R0013 - External Movement (23.7 m2)**

No Asbestos

**B00D - R0014 - Kitchen - Type 1 (15.34 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00E - Technological & Applied Studies - 1959 - Timber (Timber)****Exterior**

Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting 3491/B00E/Eaves Linings/S40					<b>No Asbestos Detected</b>
Underfloor Voids	Flat AC Sheeting Debris 3491/B00E/Underfloor Voids/S41	2m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)  <b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**Interior****B00E - R0001 - Materials Store (16.96 m2)**

Wall Linings Internal	Flat AC Sheeting 3491/B00E/R0003/Wall Linings Internal/S7					<b>No Asbestos Detected</b>
Ceiling Structures/Linings	Flat AC Sheeting 3491/B00E/R0001/Ceiling Structures/Linings/S13	17m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)  <b>Chrysotile (white asbestos)</b>

**B00E - R0004 - Metal Technology Bay (16.25 m2)**

No Asbestos

**B00E - R0006 - Materials Technology L.S. (78.82 m2)**

Wall Linings Internal	Flat AC Sheeting 3491/B00E/R0006/Wall Linings Internal/S14					<b>No Asbestos Detected</b>
-----------------------	---	--	--	--	--	-----------------------------

**B00E - R0007 - Welding Area (22.8 m2)**

Wall Linings Internal	Flat AC Sheeting 3491/B00E/R0007/Wall Linings Internal/S15					<b>No Asbestos Detected</b>
-----------------------	---	--	--	--	--	-----------------------------

**B00E - R0008 - External Movement (18.44 m2)**

No Asbestos

**B00E - R0009 - Project Store - Type 1 (33.91 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00F - General Learning - 1959 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	Flat AC Sheeting Debris	1m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	3491/B00F/Underfloor Voids/S42			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**Interior**

**B00F - R0001 - Movement (49.29 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	49m2	Throughout	Some Damage / Unsealed (3)	Low (1)	Low Priority (2-3)
	3491/B00F/R0001/Ceiling Structures/Linings/S6			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		

**B00F - R0002 - Interview (5.52 m2)**

Wall Linings Internal	Flat AC Sheeting	10m2	North, East, West, Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00F/R0002/Wall Linings Internal/S5			<b>Chrysotile (white asbestos)</b>		

**B00F - R0003 - General Learning Space (53.36 m2)**

No Asbestos

**B00F - R0004 - General Learning Space (53.15 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00G - Communal Facilities - 1977 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00G - R0001 - Main Switch Board (3.59 m2)**

No Asbestos

**B00G - R0002 - Shower/Change (15.37 m2)**

No Asbestos

**B00G - R0003 - Movement (33.66 m2)**

No Asbestos

**B00G - R0004 - Music Store (9.68 m2)**

No Asbestos

**B00G - R0005 - Distribution Board (0.47 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00G - R0006 - Resources Store (4.44 m2)**

No Asbestos

**B00G - R0007 - Communal Space (174.24 m2)**

No Asbestos

**B00G - R0008 - Hall Chair Store (4.44 m2)**

No Asbestos

**B00G - R0009 - Raised Platform (35.64 m2)**

No Asbestos

**B00G - R0010 - Cleaning Supplies (10.18 m2)**

No Asbestos

**B00G - R0011 - Shower/Change (15.46 m2)**

No Asbestos

**B00G - R0012 - Canteen (28.17 m2)**

No Asbestos

**B00G - R0013 - Canteen Office/Store (3.29 m2)**

No Asbestos

**B00G - R0014 - Canteen Office/Store (4.77 m2)**

No Asbestos

**B00G - R0016 - Cleaning Distributed Store (8.82 m2)**

No Asbestos

**B00G - R0017 - Movement (166.31 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	166m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
----------------------------	------------------	-------	------------	--------------------	---------	--------------------

3491/B00G/R0017/Ceiling Structures/Linings/S16

Chrysotile (white asbestos) , Amosite (brown asbestos)

**B00G - R0018 - Staff - Toilet (1.44 m2)**

No Asbestos

**B00G - R0019 - Toilet - Lobby (0.92 m2)**

No Asbestos

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00H - Physical Education - 1992 - Steel (Steel)**

**Exterior**

Underfloor Voids	No Asbestos Found
Ceiling Voids	No Asbestos Found

**Interior**

**B00H - R0001 - P.E. Store (35.82 m2)**

No Asbestos

**B00H - R0002 - Communal Space (680.99 m2)**

No Asbestos

**B00H - R0003 - Staff Room Annexe (18.96 m2)**

Vinyl Tiles (Under Floor Covering/Carpet) No Asbestos Found

**B00H - R0004 - Plant (0.99 m2)**

No Asbestos

**B00H - R0005 - Distribution Board (0.84 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00H - R0006 - Movement (18.83 m2)**

No Asbestos

**B00H - R0007 - Staff Shower/Change (6.97 m2)**

No Asbestos

**B00H - R0008 - Cleaning Distributed Store (2.93 m2)**

No Asbestos

**B00H - R0009 - Disabled Toilet (6.98 m2)**

No Asbestos

**B00H - R0010 - Shower/Change (47.4 m2)**

No Asbestos

**B00H - R0011 - Shower/Change (47.88 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B001 - Pupil Facilities - 1992 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Gable Ends	Flat AC Sheeting	20m2	East and West	Minimal Damage (2)	Medium (2)	Medium Priority (4-5)
	3491/B001/Gable Ends/S43					<b>Chrysotile (white asbestos)</b>

**Interior**

**B001 - R0001 - Movement (73.31 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	73m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B001/R0001/Ceiling Structures/Linings/S17					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B001 - R0002 - Shower/Change (4.7 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	3491/B001/R0002/Ceiling Structures/Linings/S18					<b>No Asbestos Detected</b>

**B001 - R0003 - Staff Toilet (5.31 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	3491/B001/R0003/Ceiling Structures/Linings/S19					<b>No Asbestos Detected</b>

**B001 - R0004 - Toilets - Boys (30.21 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	3491/B001/R0004/Ceiling Structures/Linings/S20					<b>No Asbestos Detected</b>

**B001 - R0005 - Cleaning Distributed Store (1.83 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	3491/B001/R0005/Ceiling Structures/Linings/S21					<b>No Asbestos Detected</b>

**B001 - R0006 - Toilets - Boys (14.89 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	3491/B001/R0006/Ceiling Structures/Linings/S22					<b>No Asbestos Detected</b>

**B001 - R0007 - Plant (0.72 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	3491/B001/R0007/Ceiling Structures/Linings/S23					<b>No Asbestos Detected</b>

**B001 - R0008 - Toilets - Girls (13.24 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	3491/B001/R0008/Ceiling Structures/Linings/S24					<b>No Asbestos Detected</b>

**B001 - R0009 - Toilets - Girls (30.02 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	3491/B001/R0009/Ceiling Structures/Linings/S25					<b>No Asbestos Detected</b>

**B001 - R0010 - Shower/Change (3.34 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	3491/B001/R0010/Ceiling Structures/Linings/S26					<b>No Asbestos Detected</b>

**B001 - R0011 - Staff Toilet (6.98 m2)**

Ceiling Structures/Linings	Flat AC Sheeting					
	3491/B001/R0011/Ceiling Structures/Linings/S27					<b>No Asbestos Detected</b>

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00J - General Learning - 1950 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	80m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00J/Eaves Linings/S44			<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>		
Underfloor Voids - Packing to Floor Joists	Flat AC Sheeting	1m2	Throughout	Poor Condition - Extensive Damage (4)	Medium (2)	High Priority (6-8)
	3491/B00J/Underfloor Voids - Packing to Floor Joists/S45			<b>Chrysotile (white asbestos)</b>		

**Interior**

**B00J - R0001 - Movement (36.74 m2)**

No Asbestos

**B00J - R0002 - Seminar/Study (11.77 m2)**

No Asbestos

**B00J - R0003 - Seminar/Study (14.1 m2)**

No Asbestos

**B00J - R0004 - General Learning Space (52.19 m2)**

No Asbestos

**B00J - R0005 - General Learning Space (50.45 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00K - Other-Museum - 1908 - Timber (Timber)**

**Exterior**

Ceiling Voids            No Asbestos Found

Underfloor Voids        No Asbestos Found

**Interior**

**B00K - R0001 - Resources Store (24.84 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00L - Communal Facilities - 1977 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00L - R0001 - Multi-Purpose Space (21.04 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3491/B00L/R0001/Ceiling Structures/Linings/S28	<b>No Asbestos Detected</b>
----------------------------	--	-----------------------------

**B00L - R0002 - External Movement (11.84 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3491/B00L/R0002/Ceiling Structures/Linings/S29	<b>No Asbestos Detected</b>
----------------------------	--	-----------------------------

**B00L - R0003 - External Movement (27.03 m2)**

No Asbestos

**B00L - R0004 - Staff - Toilet (3.55 m2)**

Ceiling Structures/Linings	Flat AC Sheeting 3491/B00L/R0004/Ceiling Structures/Linings/S30	<b>No Asbestos Detected</b>
----------------------------	--	-----------------------------

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00M - Agricultural Science - 1977 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00M - R0001 - Garden Store (66.12 m2)**

No Asbestos

**B00M - R0002 - General Storeroom (5.91 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00N - Agricultural Science - 1977 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00N - R0001 - Shower/Change (5.5 m2)**

No Asbestos

**B00N - R0002 - General Storeroom (34.1 m2)**

No Asbestos

**B00N - R0003 - Movement (8.35 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B000 - Agricultural Science - 1977 - Steel (Steel)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B000 - R0001 - Animal Space (27.1 m2)**

No Asbestos

**B000 - R0002 - Agriculture Covered Area (122.83 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00P - Agricultural Science - 1920 - Timber (Timber)**

**Exterior**

Ceiling Voids No Asbestos Found

Underfloor Voids No Asbestos Found

**Interior**

**B00P - R0001 - Animal Space (93.83 m2)**

No Asbestos

**B00P - R0002 - Animal Space (45.24 m2)**

No Asbestos

**B00P - R0003 - External Movement (13.5 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00Q - Agricultural Science - 1955 - Brick/Block (Brick/Block)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00Q - R0001 - Garden Store (125.8 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No				Test Result		

**B00R - Agricultural Science - 1977 - Timber (Timber)****Exterior**

Ceiling Voids	No Asbestos Found					
Underfloor Voids	No Asbestos Found					
Eaves Linings	Flat AC Sheeting	36m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00R/Eaves Linings/S46					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>
Electrical Backing Board	Resinous Board	1m2	East	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00R/Electrical Backing Board/S47					<b>Chrysotile (white asbestos)</b>

**Interior****B00R - R0001 - General Storeroom (5.45 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	5m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00R/R0001/Ceiling Structures/Linings/S31					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00R - R0002 - Animal Space (5.51 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00R/R0002/Ceiling Structures/Linings/S32					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00R - R0003 - Animal Space (16.43 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	16m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00R/R0003/Ceiling Structures/Linings/S33					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00R - R0004 - Toilets - Boys/Girls (1.69 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	2m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00R/R0004/Ceiling Structures/Linings/S34					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00R - R0005 - Shower/Change (6.13 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	6m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00R/R0005/Ceiling Structures/Linings/S35					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

**B00R - R0006 - Movement (1.28 m2)**

Ceiling Structures/Linings	Flat AC Sheeting	1m2	Throughout	Good Condition (1)	Low (1)	Low Priority (2-3)
	3491/B00R/R0006/Ceiling Structures/Linings/S36					<b>Chrysotile (white asbestos) , Amosite (brown asbestos)</b>

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00S - Agricultural Science - 1977 - Metal Shed (Metal Shed)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00S - R0001 - Animal Space (37.42 m2)**

No Asbestos

2017



Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00T - Agricultural Science - 1920 - Timber (Timber)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00T - R0001 - Staff Room (9.59 m2)**

No Asbestos

**B00T - R0002 - External Movement (19.77 m2)**

No Asbestos

**B00T - R0003 - Interview/Meeting (40.53 m2)**

No Asbestos

**B00T - R0004 - External Movement (21.58 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

**B00U - Science Learning - 2010 - Brick/Veneer (Brick/Veneer)**

**Exterior**

Ceiling Voids	No Asbestos Found
Underfloor Voids	No Asbestos Found

**Interior**

**B00U - R0001 - General Learning Space (59.93 m2)**

No Asbestos

**B00U - R0002 - Science Laboratory (59.85 m2)**

No Asbestos

**B00U - R0003 - Preparation - Science (30.29 m2)**

No Asbestos

**B00U - R0004 - Staff Room Annexe (20.97 m2)**

No Asbestos

**B00U - R0005 - Seminar (21.03 m2)**

No Asbestos

**B00U - R0006 - Chemical Store (12.05 m2)**

No Asbestos

**B00U - R0007 - Apparatus Store (13.91 m2)**

No Asbestos

**B00U - R0008 - Distribution Board (0.53 m2)**

Note: No inspection of live electrical installation.

No Asbestos

**B00U - R0009 - External Movement (79.19 m2)**

No Asbestos

**B00U - R0010 - Movement (6.18 m2)**

No Asbestos

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

### Demountables

Demountable details as per the AMS records as of 15 Feb 2017.

OS 780 - D10438 - Woodwork/Metalwork/Heat Area/Store : Placement Date - 30/06/1995

#### Exterior

Step Treads	Compressed AC Sheet	Assumed Asbestos		1.08 m2
Landing	Compressed AC Sheet	Assumed Asbestos		1.2 m2
Eave Lining	Flat AC Sheet	Assumed Asbestos		17.28 m2

#### Interior

##### R1 - Store

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		18 m2

##### R2 - Materials Technology L.S.

End wall panel	Flat AC Sheet	Assumed Asbestos		18 m2
Ceiling	Flat AC Sheet	Assumed Asbestos		91 m2

2017

Product	Material Description	Extent	Location Reference	Material Condition	Risk Status	Control Priority
Sample No					Test Result	

*Listing of Electronic Attachments as of 22/03/2017*

**There are no asbestos related file attachment(s) for this school.**

2017